

# INTERNATIONAL STANDARD

## NORME INTERNATIONALE



**Arc welding equipment –  
Part 1: Welding power sources**

**Matériel de soudage à l'arc –  
Partie 1: Sources de courant de soudage**



## THIS PUBLICATION IS COPYRIGHT PROTECTED

Copyright © 2019 IEC, Geneva, Switzerland

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either IEC or IEC's member National Committee in the country of the requester. If you have any questions about IEC copyright or have an enquiry about obtaining additional rights to this publication, please contact the address below or your local IEC member National Committee for further information.

Droits de reproduction réservés. Sauf indication contraire, aucune partie de cette publication ne peut être reproduite ni utilisée sous quelque forme que ce soit et par aucun procédé, électronique ou mécanique, y compris la photocopie et les microfilms, sans l'accord écrit de l'IEC ou du Comité national de l'IEC du pays du demandeur. Si vous avez des questions sur le copyright de l'IEC ou si vous désirez obtenir des droits supplémentaires sur cette publication, utilisez les coordonnées ci-après ou contactez le Comité national de l'IEC de votre pays de résidence.

IEC Central Office  
3, rue de Varembe  
CH-1211 Geneva 20  
Switzerland

Tel.: +41 22 919 02 11  
[info@iec.ch](mailto:info@iec.ch)  
[www.iec.ch](http://www.iec.ch)

### About the IEC

The International Electrotechnical Commission (IEC) is the leading global organization that prepares and publishes International Standards for all electrical, electronic and related technologies.

### About IEC publications

The technical content of IEC publications is kept under constant review by the IEC. Please make sure that you have the latest edition, a corrigendum or an amendment might have been published.

#### IEC publications search - [webstore.iec.ch/advsearchform](http://webstore.iec.ch/advsearchform)

The advanced search enables to find IEC publications by a variety of criteria (reference number, text, technical committee,...). It also gives information on projects, replaced and withdrawn publications.

#### IEC Just Published - [webstore.iec.ch/justpublished](http://webstore.iec.ch/justpublished)

Stay up to date on all new IEC publications. Just Published details all new publications released. Available online and once a month by email.

#### IEC Customer Service Centre - [webstore.iec.ch/csc](http://webstore.iec.ch/csc)

If you wish to give us your feedback on this publication or need further assistance, please contact the Customer Service Centre: [sales@iec.ch](mailto:sales@iec.ch).

#### Electropedia - [www.electropedia.org](http://www.electropedia.org)

The world's leading online dictionary on electrotechnology, containing more than 22 000 terminological entries in English and French, with equivalent terms in 16 additional languages. Also known as the International Electrotechnical Vocabulary (IEV) online.

#### IEC Glossary - [std.iec.ch/glossary](http://std.iec.ch/glossary)

67 000 electrotechnical terminology entries in English and French extracted from the Terms and Definitions clause of IEC publications issued since 2002. Some entries have been collected from earlier publications of IEC TC 37, 77, 86 and CISPR.

### A propos de l'IEC

La Commission Electrotechnique Internationale (IEC) est la première organisation mondiale qui élabore et publie des Normes internationales pour tout ce qui a trait à l'électricité, à l'électronique et aux technologies apparentées.

### A propos des publications IEC

Le contenu technique des publications IEC est constamment revu. Veuillez vous assurer que vous possédez l'édition la plus récente, un corrigendum ou amendement peut avoir été publié.

#### Recherche de publications IEC -

[webstore.iec.ch/advsearchform](http://webstore.iec.ch/advsearchform)

La recherche avancée permet de trouver des publications IEC en utilisant différents critères (numéro de référence, texte, comité d'études,...). Elle donne aussi des informations sur les projets et les publications remplacées ou retirées.

#### IEC Just Published - [webstore.iec.ch/justpublished](http://webstore.iec.ch/justpublished)

Restez informé sur les nouvelles publications IEC. Just Published détaille les nouvelles publications parues. Disponible en ligne et une fois par mois par email.

#### Service Clients - [webstore.iec.ch/csc](http://webstore.iec.ch/csc)

Si vous désirez nous donner des commentaires sur cette publication ou si vous avez des questions contactez-nous: [sales@iec.ch](mailto:sales@iec.ch).

#### Electropedia - [www.electropedia.org](http://www.electropedia.org)

Le premier dictionnaire d'électrotechnologie en ligne au monde, avec plus de 22 000 articles terminologiques en anglais et en français, ainsi que les termes équivalents dans 16 langues additionnelles. Egalement appelé Vocabulaire Electrotechnique International (IEV) en ligne.

#### Glossaire IEC - [std.iec.ch/glossary](http://std.iec.ch/glossary)

67 000 entrées terminologiques électrotechniques, en anglais et en français, extraites des articles Termes et Définitions des publications IEC parues depuis 2002. Plus certaines entrées antérieures extraites des publications des CE 37, 77, 86 et CISPR de l'IEC.

# INTERNATIONAL STANDARD

# NORME INTERNATIONALE



**Arc welding equipment –  
Part 1: Welding power sources**

**Matériel de soudage à l'arc –  
Partie 1: Sources de courant de soudage**

INTERNATIONAL  
ELECTROTECHNICAL  
COMMISSION

COMMISSION  
ELECTROTECHNIQUE  
INTERNATIONALE

ICS 25.160.30

ISBN 978-2-8322-6429-4

**Warning! Make sure that you obtained this publication from an authorized distributor.**  
**Attention! Veuillez vous assurer que vous avez obtenu cette publication via un distributeur agréé.**

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

# REDLINE VERSION

## VERSION REDLINE



**Arc welding equipment –  
Part 1: Welding power sources**

**Matériel de soudage à l'arc –  
Partie 1: Sources de courant de soudage**

## CONTENTS

|                                                                                             |    |
|---------------------------------------------------------------------------------------------|----|
| FOREWORD .....                                                                              | 9  |
| 1 Scope .....                                                                               | 11 |
| 2 Normative references .....                                                                | 11 |
| 3 Terms and definitions .....                                                               | 12 |
| 3.1 General terms .....                                                                     | 12 |
| 3.2 Terms related to battery systems .....                                                  | 21 |
| 4 Environmental conditions .....                                                            | 24 |
| 5 Tests .....                                                                               | 25 |
| 5.1 Test conditions .....                                                                   | 25 |
| 5.2 Measuring instruments .....                                                             | 25 |
| 5.3 Conformity of components .....                                                          | 25 |
| 5.4 Type tests .....                                                                        | 26 |
| 5.5 Routine tests .....                                                                     | 26 |
| 6 Protection against electric shock .....                                                   | 27 |
| 6.1 Insulation .....                                                                        | 27 |
| 6.1.1 General .....                                                                         | 27 |
| 6.1.2 Clearances .....                                                                      | 28 |
| 6.1.3 Creepage distances .....                                                              | 30 |
| 6.1.4 Insulation resistance .....                                                           | 32 |
| 6.1.5 Dielectric strength .....                                                             | 32 |
| 6.2 Protection against electric shock in normal service (direct contact) .....              | 34 |
| 6.2.1 Protection provided by the enclosure .....                                            | 34 |
| 6.2.2 Capacitors .....                                                                      | 34 |
| 6.2.3 Automatic discharge of supply circuit capacitors .....                                | 35 |
| 6.2.4 Isolation of the welding circuit .....                                                | 35 |
| 6.2.5 Welding circuit touch current .....                                                   | 35 |
| 6.2.6 Touch current in normal condition .....                                               | 36 |
| 6.3 Protection against electric shock in case of a fault condition (indirect contact) ..... | 37 |
| 6.3.1 Protective provisions .....                                                           | 37 |
| 6.3.2 Isolation between windings of the supply circuit and the welding circuit .....        | 37 |
| 6.3.3 Internal conductors and connections .....                                             | 37 |
| 6.3.4 Additional requirements for plasma cutting systems .....                              | 38 |
| 6.3.5 Movable coils and cores .....                                                         | 38 |
| 6.3.6 Touch current in fault condition .....                                                | 38 |
| 7 Thermal requirements .....                                                                | 39 |
| 7.1 Heating test .....                                                                      | 39 |
| 7.1.1 Test conditions .....                                                                 | 39 |
| 7.1.2 Tolerances of the test parameters .....                                               | 39 |
| 7.1.3 Duration of test .....                                                                | 40 |
| 7.2 Temperature measurement .....                                                           | 40 |
| 7.2.1 Measurement conditions .....                                                          | 40 |
| 7.2.2 Surface temperature sensor .....                                                      | 40 |
| 7.2.3 Resistance .....                                                                      | 40 |
| 7.2.4 Embedded temperature sensor .....                                                     | 41 |

|        |                                                                                                                   |    |
|--------|-------------------------------------------------------------------------------------------------------------------|----|
| 7.2.5  | Determination of the ambient air temperature .....                                                                | 41 |
| 7.2.6  | Recording of temperatures .....                                                                                   | 41 |
| 7.3    | Limits of temperature rise .....                                                                                  | 41 |
| 7.3.1  | Windings, commutators and slip-rings.....                                                                         | 41 |
| 7.3.2  | External surfaces.....                                                                                            | 42 |
| 7.3.3  | Other components .....                                                                                            | 43 |
| 7.4    | Loading test.....                                                                                                 | 43 |
| 7.5    | Commutators and slip-rings .....                                                                                  | 44 |
| 8      | Thermal protection.....                                                                                           | 44 |
| 8.1    | General requirements .....                                                                                        | 44 |
| 8.2    | Construction .....                                                                                                | 44 |
| 8.3    | Location.....                                                                                                     | 44 |
| 8.4    | Operating capacity.....                                                                                           | 44 |
| 8.5    | Operation.....                                                                                                    | 45 |
| 8.6    | Resetting .....                                                                                                   | 45 |
| 8.7    | Indication .....                                                                                                  | 45 |
| 9      | Abnormal operation .....                                                                                          | 45 |
| 9.1    | General requirements .....                                                                                        | 45 |
| 9.2    | Stalled fan test.....                                                                                             | 46 |
| 9.3    | Short circuit test.....                                                                                           | 46 |
| 9.4    | Overload test .....                                                                                               | 47 |
| 10     | Connection to the supply network .....                                                                            | 47 |
| 10.1   | Supply voltage .....                                                                                              | 47 |
| 10.2   | Multi-supply voltage .....                                                                                        | 47 |
| 10.3   | Means of connection to the supply circuit.....                                                                    | 47 |
| 10.4   | Marking of terminals .....                                                                                        | 48 |
| 10.5   | Protective circuit .....                                                                                          | 48 |
| 10.5.1 | Continuity requirement.....                                                                                       | 48 |
| 10.5.2 | Type test .....                                                                                                   | 49 |
| 10.5.3 | Routine test.....                                                                                                 | 49 |
| 10.6   | Cable anchorage.....                                                                                              | 50 |
| 10.7   | Inlet openings .....                                                                                              | 51 |
| 10.8   | Supply circuit on/off switching device.....                                                                       | 51 |
| 10.9   | Supply cables .....                                                                                               | 52 |
| 10.10  | Supply coupling device (attachment plug) .....                                                                    | 52 |
| 11     | Output .....                                                                                                      | 53 |
| 11.1   | Rated no-load voltage .....                                                                                       | 53 |
| 11.1.1 | Rated no-load voltage for use in environments with increased risk of electric shock .....                         | 53 |
| 11.1.2 | Rated no-load voltage for use in environments without increased risk of electric shock .....                      | 53 |
| 11.1.3 | Rated no-load voltage for the use with mechanically held torches with increased protection for the operator ..... | 53 |
| 11.1.4 | Rated no-load voltage for special processes for example plasma cutting .....                                      | 53 |
| 11.1.5 | Additional requirements .....                                                                                     | 54 |
| 11.1.6 | Measuring circuits .....                                                                                          | 55 |
| 11.2   | Type test values of the conventional load voltage .....                                                           | 56 |
| 11.2.1 | Manual metal arc welding with covered electrodes.....                                                             | 56 |
| 11.2.2 | Tungsten inert gas.....                                                                                           | 56 |

|        |                                                                         |    |
|--------|-------------------------------------------------------------------------|----|
| 11.2.3 | Metal inert/active gas and flux cored arc welding .....                 | 56 |
| 11.2.4 | Submerged arc welding .....                                             | 56 |
| 11.2.5 | Plasma cutting .....                                                    | 56 |
| 11.2.6 | Plasma welding .....                                                    | 56 |
| 11.2.7 | Plasma gouging .....                                                    | 56 |
| 11.2.8 | Additional requirements .....                                           | 56 |
| 11.3   | Mechanical switching devices used to adjust output .....                | 57 |
| 11.4   | Welding circuit connections .....                                       | 57 |
| 11.4.1 | Protection against unintentional contact .....                          | 57 |
| 11.4.2 | Location of coupling devices .....                                      | 57 |
| 11.4.3 | Outlet openings .....                                                   | 57 |
| 11.4.4 | Three-phase multi-operator welding transformer .....                    | 57 |
| 11.4.5 | Marking .....                                                           | 58 |
| 11.4.6 | Connections for plasma cutting torches .....                            | 58 |
| 11.5   | Power supply to external devices connected to the welding circuit ..... | 58 |
| 11.6   | Auxiliary power supply .....                                            | 58 |
| 11.7   | Welding cables .....                                                    | 59 |
| 12     | Control circuits .....                                                  | 59 |
| 12.1   | General requirement .....                                               | 59 |
| 12.2   | Isolation of control circuits .....                                     | 59 |
| 12.3   | Working voltages of remote control circuits .....                       | 59 |
| 13     | Hazard reducing device .....                                            | 60 |
| 13.1   | General requirements .....                                              | 60 |
| 13.2   | Types of hazard reducing devices .....                                  | 60 |
| 13.2.1 | Voltage reducing device .....                                           | 60 |
| 13.2.2 | Switching device for AC to DC .....                                     | 60 |
| 13.3   | Requirements for hazard reducing devices .....                          | 60 |
| 13.3.1 | Disabling the hazard reducing device .....                              | 60 |
| 13.3.2 | Interference with operation of a hazard reducing device .....           | 61 |
| 13.3.3 | Indication of satisfactory operation .....                              | 61 |
| 13.3.4 | Fail to a safe condition .....                                          | 61 |
| 14     | Mechanical provisions .....                                             | 61 |
| 14.1   | General requirements .....                                              | 61 |
| 14.2   | Enclosure .....                                                         | 61 |
| 14.2.1 | Enclosure materials .....                                               | 61 |
| 14.2.2 | Enclosure strength .....                                                | 62 |
| 14.3   | Handling means .....                                                    | 62 |
| 14.3.1 | Mechanised handling .....                                               | 62 |
| 14.3.2 | Manual handling .....                                                   | 62 |
| 14.4   | Drop withstand .....                                                    | 63 |
| 14.5   | Tilting stability .....                                                 | 63 |
| 15     | Rating plate .....                                                      | 63 |
| 15.1   | General requirements .....                                              | 63 |
| 15.2   | Description .....                                                       | 64 |
| 15.3   | Contents .....                                                          | 65 |
| 15.4   | Tolerances .....                                                        | 68 |
| 15.5   | Direction of rotation .....                                             | 68 |
| 16     | Adjustment of the output .....                                          | 68 |



|                       |                                                                                                        |     |
|-----------------------|--------------------------------------------------------------------------------------------------------|-----|
| 16.1                  | Type of adjustment .....                                                                               | 68  |
| 16.2                  | Marking of the adjusting device .....                                                                  | 69  |
| 16.3                  | Indication of current or voltage control .....                                                         | 69  |
| 17                    | Instructions and markings .....                                                                        | 70  |
| 17.1                  | Instructions .....                                                                                     | 70  |
| 17.2                  | Markings .....                                                                                         | 71  |
| Annex A (informative) | Nominal voltages of supply networks .....                                                              | 72  |
| Annex B (informative) | Example of a combined dielectric test .....                                                            | 73  |
| Annex C (normative)   | Unbalanced load in case of AC tungsten inert-gas welding power sources .....                           | 74  |
| C.1                   | General .....                                                                                          | 74  |
| C.2                   | Unbalanced load .....                                                                                  | 74  |
| C.3                   | Example for an unbalanced load .....                                                                   | 75  |
| Annex D (informative) | Extrapolation of temperature to time of shutdown .....                                                 | 76  |
| Annex E (normative)   | Construction of supply circuit terminals .....                                                         | 77  |
| E.1                   | Size of terminals .....                                                                                | 77  |
| E.2                   | Connections at the terminals .....                                                                     | 77  |
| E.3                   | Construction of the terminals .....                                                                    | 78  |
| E.4                   | Fixing of the terminals .....                                                                          | 78  |
| Annex F (informative) | Cross-reference to non-SI units .....                                                                  | 79  |
| Annex G (informative) | Suitability of supply network for the measurement of the true r.m.s. value of the supply current ..... | 80  |
| Annex H (informative) | Plotting of static characteristics .....                                                               | 81  |
| H.1                   | General .....                                                                                          | 81  |
| H.2                   | Method .....                                                                                           | 81  |
| H.3                   | Analysis of the results .....                                                                          | 81  |
| Annex I (normative)   | Test methods for a 10 Nm impact .....                                                                  | 82  |
| I.1                   | Pendulum impact hammer .....                                                                           | 82  |
| I.2                   | Free fall spherical steel weight .....                                                                 | 83  |
| Annex J (normative)   | Thickness of sheet metal for enclosures .....                                                          | 84  |
| Annex K (informative) | Examples of rating plates .....                                                                        | 87  |
| Annex L (informative) | Graphical symbols for arc welding equipment .....                                                      | 94  |
| L.1                   | General .....                                                                                          | 94  |
| L.2                   | Use of symbols .....                                                                                   | 94  |
| L.2.1                 | General .....                                                                                          | 94  |
| L.2.2                 | Selection of symbols .....                                                                             | 94  |
| L.2.3                 | Size of symbols .....                                                                                  | 94  |
| L.2.4                 | Use of colour .....                                                                                    | 94  |
| L.3                   | Symbols .....                                                                                          | 95  |
| L.3.1                 | General .....                                                                                          | 95  |
| L.3.2                 | Letter symbols .....                                                                                   | 95  |
| L.3.3                 | Graphical symbols .....                                                                                | 96  |
| L.4                   | Examples of combinations of symbols .....                                                              | 116 |
| L.5                   | Examples of control panels .....                                                                       | 118 |
| Annex M (informative) | Efficiency and idle state power measurement .....                                                      | 121 |
| M.1                   | Measuring efficiency .....                                                                             | 121 |
| M.2                   | Measuring idle state power .....                                                                       | 121 |

|                                                                        |     |
|------------------------------------------------------------------------|-----|
| Annex N (normative) Touch current measurement in fault condition ..... | 123 |
| Annex O (normative) Battery-powered welding power sources .....        | 128 |
| O.1 General.....                                                       | 128 |
| O.4 Environmental conditions .....                                     | 129 |
| O.5 Tests .....                                                        | 129 |
| O.5.1 Test conditions .....                                            | 129 |
| O.5.3 Conformity of components .....                                   | 130 |
| O.6 Protection against electric shock.....                             | 131 |
| O.6.1 Insulation.....                                                  | 131 |
| O.6.2 Protection against electric shock in normal service .....        | 132 |
| O.7 Thermal requirements .....                                         | 133 |
| O.7.1 Heating test .....                                               | 133 |
| O.7.2 Temperature measurement.....                                     | 134 |
| O.7.4 Loading test.....                                                | 134 |
| O.7.201 Normal charging of lithium-ion systems.....                    | 134 |
| O.8 Thermal protection.....                                            | 135 |
| O.8.1 General requirements .....                                       | 135 |
| O.8.4 Operating capacity.....                                          | 135 |
| O.9 Abnormal operation.....                                            | 135 |
| O.9.1 General requirements .....                                       | 135 |
| O.9.2 Stalled fan test .....                                           | 136 |
| O.9.3 Short circuit test .....                                         | 136 |
| O.9.4 Overload test.....                                               | 136 |
| O.9.201 Welding power source – abnormal conditions .....               | 136 |
| O.9.202 Welding circuit components – abnormal conditions .....         | 137 |
| O.9.203 Lithium-ion charging systems – abnormal conditions .....       | 137 |
| O.9.204 Lithium-ion battery short circuit.....                         | 138 |
| O.9.205 Batteries other than lithium-ion – overcharging .....          | 139 |
| O.9.206 Battery pack disconnection .....                               | 139 |
| O.9.207 General purpose batteries .....                                | 139 |
| O.10 Connection to the supply network .....                            | 139 |
| O.10.5 Protective circuit.....                                         | 140 |
| O.10.8 Supply circuit on/off switching device.....                     | 140 |
| O.14 Mechanical provisions.....                                        | 141 |
| O.14.1 General requirements .....                                      | 141 |
| O.14.2 Enclosure .....                                                 | 141 |
| O.14.4 Drop withstand .....                                            | 141 |
| O.15 Rating plate .....                                                | 142 |
| O.15.3 Contents.....                                                   | 142 |
| O.17 Instructions and markings .....                                   | 144 |
| O.17.1 Instructions.....                                               | 144 |
| O.17.2 Markings.....                                                   | 145 |
| Annex P (normative) Conformity of components.....                      | 146 |
| Bibliography.....                                                      | 148 |

Figure 1 – Example of insulation configuration for Class I equipment..... 28

Figure 2 – Measurement of welding circuit touch current..... 36

Figure 3 – Measurement of touch current in normal condition ..... 36

|                                                                                                                                                                             |     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----|
| Figure 4 – Measurement of r.m.s. values .....                                                                                                                               | 55  |
| Figure 5 – Measurement of peak values .....                                                                                                                                 | 55  |
| Figure 6 – Principle of the rating plate .....                                                                                                                              | 64  |
| Figure B.1 – Combined high-voltage transformers .....                                                                                                                       | 73  |
| Figure C.1 – Voltage and current during AC tungsten inert-gas welding .....                                                                                                 | 74  |
| Figure C.2 – Unbalanced voltage during AC tungsten inert-gas welding .....                                                                                                  | 75  |
| Figure C.3 – AC welding power source with unbalanced load .....                                                                                                             | 75  |
| Figure I.1 – Test set-up .....                                                                                                                                              | 82  |
| Figure K.1 – Single-phase transformer .....                                                                                                                                 | 87  |
| Figure K.2 – Three-phase rotating frequency converter .....                                                                                                                 | 88  |
| Figure K.3 – Subdivided rating plate: single-/three-phase transformer rectifier .....                                                                                       | 89  |
| Figure K.4 – Engine-generator-rectifier .....                                                                                                                               | 90  |
| Figure K.5 – Single-/three-phase inverter type .....                                                                                                                        | 91  |
| Figure K.6 – Battery powered welding power source with integral battery .....                                                                                               | 92  |
| Figure K.7 – Battery powered welding power source with detachable / separable battery .....                                                                                 | 93  |
| Figure L.1 – Input voltage power switch .....                                                                                                                               | 119 |
| Figure L.2 – Arc force control potentiometer .....                                                                                                                          | 119 |
| Figure L.3 – Remote receptacle and selector switches .....                                                                                                                  | 119 |
| Figure L.4 – Terminals with inductance selector for MIG/MAG welding .....                                                                                                   | 119 |
| Figure L.5 – Process switch (MMA, TIG, MIG) .....                                                                                                                           | 120 |
| Figure L.6 – Selector switch on AC/DC equipment .....                                                                                                                       | 120 |
| Figure L.7 – Panel indicator lights (overheat, fault, arc striking, output voltage) .....                                                                                   | 120 |
| Figure L.8 – Setting pulsing parameters using digital display .....                                                                                                         | 120 |
| Figure N.1 – Measuring network for weighted touch current .....                                                                                                             | 123 |
| Figure N.2 – Diagram for touch current measurement on fault condition at operating temperature for single-phase connection of appliances other than those of class II ..... | 125 |
| Figure N.3 – Diagram for touch current measurement on fault condition for three-phase four-wire system connection of appliances other than those of class II .....          | 127 |
| Figure O.1 – Marking of battery voltage class B electric components .....                                                                                                   | 145 |
| Figure P.1 – Flow chart for conformity methods of Annex P .....                                                                                                             | 147 |
| Table 1 – Minimum clearances for overvoltage category III .....                                                                                                             | 29  |
| Table 2 – Minimum creepage distances .....                                                                                                                                  | 31  |
| Table 3 – Insulation resistance .....                                                                                                                                       | 32  |
| Table 4 – Dielectric test voltages .....                                                                                                                                    | 33  |
| Table 5 – Minimum distance through insulation .....                                                                                                                         | 37  |
| Table 6 – Temperature limits for windings, commutators and slip-rings .....                                                                                                 | 42  |
| Table 7 – Temperature limits for external surfaces .....                                                                                                                    | 43  |
| Table 8 – Cross-section of the output short-circuit conductor .....                                                                                                         | 46  |
| Table 9 – Current and time requirements for protective circuits .....                                                                                                       | 49  |
| Table 10 – Minimum cross-sectional area of the external protective copper conductor .....                                                                                   | 49  |
| Table 11 – Verification of continuity of the protective circuit .....                                                                                                       | 50  |
| Table 12 – Pull .....                                                                                                                                                       | 51  |

|                                                                                                 |    |
|-------------------------------------------------------------------------------------------------|----|
| Table 13 – Summary of allowable rated no-load voltages.....                                     | 54 |
| Table 14 – Hazard reducing device requirements.....                                             | 60 |
| Table E.1 – Range of conductor dimensions to be accepted by the supply circuit terminals.....   | 77 |
| Table F.1 – Cross-reference for mm <sup>2</sup> to American wire gauge (AWG).....               | 79 |
| Table I.1 – Angle of rotation $\theta$ to obtain 10 Nm impact .....                             | 83 |
| Table I.2 – Mass of the free fall weight and height of the free fall .....                      | 84 |
| Table J.1 – Minimum thickness of sheet metal for steel enclosures.....                          | 86 |
| Table J.2 – Minimum thickness of sheet metal for enclosures of aluminium, brass or copper ..... | 87 |
| Table L.1 – Letters used as symbols .....                                                       | 96 |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## INTERNATIONAL ELECTROTECHNICAL COMMISSION

### ARC WELDING EQUIPMENT –

#### Part 1: Welding power sources

#### FOREWORD

- 1) The International Electrotechnical Commission (IEC) is a worldwide organization for standardization comprising all national electrotechnical committees (IEC National Committees). The object of IEC is to promote international co-operation on all questions concerning standardization in the electrical and electronic fields. To this end and in addition to other activities, IEC publishes International Standards, Technical Specifications, Technical Reports, Publicly Available Specifications (PAS) and Guides (hereafter referred to as "IEC Publication(s)"). Their preparation is entrusted to technical committees; any IEC National Committee interested in the subject dealt with may participate in this preparatory work. International, governmental and non-governmental organizations liaising with the IEC also participate in this preparation. IEC collaborates closely with the International Organization for Standardization (ISO) in accordance with conditions determined by agreement between the two organizations.
- 2) The formal decisions or agreements of IEC on technical matters express, as nearly as possible, an international consensus of opinion on the relevant subjects since each technical committee has representation from all interested IEC National Committees.
- 3) IEC Publications have the form of recommendations for international use and are accepted by IEC National Committees in that sense. While all reasonable efforts are made to ensure that the technical content of IEC Publications is accurate, IEC cannot be held responsible for the way in which they are used or for any misinterpretation by any end user.
- 4) In order to promote international uniformity, IEC National Committees undertake to apply IEC Publications transparently to the maximum extent possible in their national and regional publications. Any divergence between any IEC Publication and the corresponding national or regional publication shall be clearly indicated in the latter.
- 5) IEC itself does not provide any attestation of conformity. Independent certification bodies provide conformity assessment services and, in some areas, access to IEC marks of conformity. IEC is not responsible for any services carried out by independent certification bodies.
- 6) All users should ensure that they have the latest edition of this publication.
- 7) No liability shall attach to IEC or its directors, employees, servants or agents including individual experts and members of its technical committees and IEC National Committees for any personal injury, property damage or other damage of any nature whatsoever, whether direct or indirect, or for costs (including legal fees) and expenses arising out of the publication, use of, or reliance upon, this IEC Publication or any other IEC Publications.
- 8) Attention is drawn to the Normative references cited in this publication. Use of the referenced publications is indispensable for the correct application of this publication.
- 9) Attention is drawn to the possibility that some of the elements of this IEC Publication may be the subject of patent rights. IEC shall not be held responsible for identifying any or all such patent rights.

**This consolidated version of the official IEC Standard and its amendment has been prepared for user convenience.**

**IEC 60974-1 edition 5.1 contains the fifth edition (2017-02) [documents 26/610/FDIS and 26/613/RVD] and its amendment 1 (2019-01) [documents 26/653/CDV and 26/669/RVC].**

**In this Redline version, a vertical line in the margin shows where the technical content is modified by amendment 1. Additions are in green text, deletions are in strikethrough red text. A separate Final version with all changes accepted is available in this publication.**

International Standard IEC 60974-1 has been prepared by IEC technical committee 26: Electric welding.

This fifth edition constitutes a technical revision.

The significant changes with respect to the previous edition are the following:

- improvement of Figure 1 (6.1.1);
- modification of Table 3 (6.1.4);
- description of energy efficiency measurements in Annex M;
- inclusion of battery supplied welding power sources in the scope. Requirements therefore are described in Annex O.

This publication has been drafted in accordance with the ISO/IEC Directives, Part 2.

In this standard, the following print types are used:

- conformity statements: in *italic* type.
- terms defined in Clause 3: in **bold** type.

A list of all parts of the IEC 60974 series can be found, under the general title *Arc welding equipment*, on the IEC website.

The committee has decided that the contents of the base publication and its amendment will remain unchanged until the stability date indicated on the IEC web site under "<http://webstore.iec.ch>" in the data related to the specific publication. At this date, the publication will be

- reconfirmed,
- withdrawn,
- replaced by a revised edition, or
- amended.

**IMPORTANT – The 'colour inside' logo on the cover page of this publication indicates that it contains colours which are considered to be useful for the correct understanding of its contents. Users should therefore print this document using a colour printer.**

## ARC WELDING EQUIPMENT –

### Part 1: Welding power sources

#### 1 Scope

This part of IEC 60974 is applicable to power sources for arc welding and allied processes designed for **industrial and professional use**, and supplied by a voltage not exceeding 1 000 V, battery supplied or driven by mechanical means.

This document specifies safety and performance requirements of welding power sources and **plasma cutting systems**.

This document is not applicable to limited duty arc welding and cutting power sources which are designed mainly for use by laymen and designed in accordance with IEC 60974-6.

This document includes requirements for battery-powered welding power sources and battery packs, which are given in Annex O.

This document is not applicable to testing of power sources during periodic maintenance or after repair.

NOTE 1 Typical allied processes are electric arc cutting and arc spraying.

NOTE 2 AC systems having a nominal voltage between 100 V and 1 000 V are given in Table 1 of IEC 60038:2009.

NOTE 3 This document does not include electromagnetic compatibility (EMC) requirements.

#### 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

IEC 60050-151, *International Electrotechnical Vocabulary – Part 151: Electrical and magnetic devices* (available at: <http://www.electropedia.org>)

IEC 60050-851, *International Electrotechnical Vocabulary – Part 851: Electric welding* (available at: <http://www.electropedia.org>)

IEC 60245-6, *Rubber insulated cables – Rated voltages up to and including 450/750 V – Part 6: Arc welding electrode cables*

IEC 60417, *Graphical symbols for use on equipment* (available at: <http://www.graphical-symbols.info/equipment>)

IEC 60445, *Basic and safety principles for man-machine interface, marking and identification – Identification of equipment terminals, conductor terminations and conductors*

IEC 60529, *Degrees of protection provided by enclosures (IP Code)*

IEC 60664-1:2007, *Insulation coordination for equipment within low-voltage systems – Part 1: Principles, requirements and tests*

IEC 60664-3, *Insulation coordination for equipment within low-voltage systems – Part 3: Use of coating, potting or moulding for protection against pollution*

IEC 60695-11-10, *Fire hazard testing – Part 11-10: Test flames – 50 W horizontal and vertical flame test methods*

IEC 60974-7, *Arc welding equipment – Part 7: Torches*

IEC 61140, *Protection against electric shock – Common aspects for installation and equipment*

IEC 61558-2-4, *Safety of transformers, reactors, power supply units and similar products for supply voltages up to 1 100 V – Part 2-4: Particular requirements and tests for isolating transformers and power supply units incorporating isolating transformers*

IEC 61558-2-6, *Safety of transformers, reactors, power supply units and similar products for supply voltages up to 1 100 V – Part 2-6: Particular requirements and tests for safety isolating transformers and power supply units incorporating safety isolating transformers*

IEC 62133-1:— 1, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary cells, and for batteries made from them, for use in portable applications – Part 1: Nickel systems*

IEC 62133-2:— 2, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary cells, and for batteries made from them, for use in portable applications – Part 2: Lithium systems*

ISO 7010:2011, *Graphical symbols – Safety colours and safety signs – Registered safety signs*

### 3 Terms and definitions

For the purposes of this document, the terms and definitions given in IEC 60050-151, IEC 60050-851, IEC 60664-1 and the following apply.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- IEC Electropedia: available at <http://www.electropedia.org/>
- ISO Online browsing platform: available at <http://www.iso.org/obp>

#### 3.1 General terms

##### 3.1.1 welding power source arc welding power source

equipment for supplying current and voltage and having the required characteristics suitable for arc welding and allied processes

Note 1 to entry: A **welding power source** can also supply services to other equipment and auxiliaries for example auxiliary power, cooling liquid, consumable arc welding electrode and gas to shield the arc and the welding area.

Note 2 to entry: This entry revises IEC 851-13-01, which will be updated.

<sup>1</sup> Under preparation. Stage at the time of publication: IEC CDV 62133-1:2015.

<sup>2</sup> Under preparation. Stage at the time of publication: IEC CDV 62133-2:2015.



### 3.1.2

#### **industrial and professional use**

use intended only for **experts** or **instructed persons**

[SOURCE: IEC 60050-851:2008, 851-11-12]

### 3.1.3

#### **expert**

#### **competent person**

#### **skilled person**

person who can judge the work assigned and recognize possible hazards on the basis of professional training, knowledge, experience and knowledge of the relevant equipment

Note 1 to entry: Several years of practice in the relevant technical field can be taken into consideration in assessment of professional training.

[SOURCE: IEC 60050-851:2008, 851-11-10]

### 3.1.4

#### **instructed person**

person informed about the tasks assigned and about the possible hazards involved in neglectful behaviour

Note 1 to entry: If necessary, the person has undergone some training

[SOURCE: IEC 60050-851:2008, 851-11-13]

### 3.1.5

#### **type test**

test of one or more devices made to a given design to check if these devices comply with the requirements of the standard concerned

[SOURCE: IEC 60050-851:2008, 851-12-05]

### 3.1.6

#### **routine test**

test made on each individual device during or after manufacture to check if it complies with the requirements of the standard concerned or the criteria specified

[SOURCE: IEC 60050-851:2008, 851-12-06]

### 3.1.7

#### **visual inspection**

inspection by eye to verify that there are no apparent discrepancies with respect to provisions of the standard concerned

[SOURCE: IEC 60050-851:2008, 851-11-11]

### 3.1.8

#### **drooping characteristic**

external **static characteristic** of a welding power source which, in its normal welding range, is such that the negative slope is greater than or equal to 7 V/100 A

Note 1 to entry: This entry revises IEC 851-12-34, which will be updated.

### 3.1.9

#### **flat characteristic**

external **static characteristic** of a welding power source which, in its normal welding range, is such that, as the current increases, the voltage either decreases by less than 7 V/100 A or increases by less than 10 V/100 A

[SOURCE: IEC 60050-851:2008, 851-12-35]

### 3.1.10

#### **static characteristic**

relationship between the voltage and the current at the output terminals of a welding power source when connected to a **conventional load**

Note 1 to entry: This entry revises IEC 851-12-32, which will be updated.

### 3.1.11

#### **welding circuit**

conductive material through which the **welding current** is intended to flow

Note 1 to entry: In arc welding, the arc is a part of the **welding circuit**.

Note 2 to entry: In certain arc welding processes, the welding arc can be established between two electrodes. In such a case, the workpiece is not necessarily a part of the **welding circuit**.

[SOURCE: IEC 60050-851:2008, 851-14-10]

### 3.1.12

#### **control circuit**

internal or external circuit for the operational control of the equipment or for protection of the power circuits, or both

EXAMPLE 1 **Control circuits** intended for interface between the welding power source and external equipment designed by the manufacturer.

EXAMPLE 2 **Control circuits** intended for interface between the welding power source and other types of ancillary equipment.

Note 1 to entry: This entry revises IEC 851-14-11, which will be updated.

### 3.1.13

#### **welding current**

current delivered by a welding power source during welding

### 3.1.14

#### **load voltage**

voltage between the output terminals when the welding power source is delivering **welding current**

[SOURCE: IEC 60050-851:2008, 851-12-04]

### 3.1.15

#### **no-load voltage**

voltage, exclusive of any arc striking or arc stabilizing voltage, between the accessible output terminals of a welding power source when the **welding circuit** is open but energized

Note 1 to entry: This entry revises IEC 851-12-24, which will be updated.

### 3.1.16

#### **conventional value**

standardized value that is used as a measure of a parameter for the purposes of comparison, calibration, testing, etc.

Note 1 to entry: **Conventional values** do not necessarily apply during the actual welding process.

[SOURCE: IEC 60050-851:2008, 851-12-07]

### 3.1.17

#### **conventional welding condition**

condition of the welding power source in the energized and thermally stabilized state defined by a **conventional welding current** driven by the corresponding **conventional load voltage** through a **conventional load** at **rated supply voltage** and frequency or speed of rotation

[SOURCE: IEC 60050-851:2008, 851-12-26]

### 3.1.18

#### **conventional load**

practically non-inductive constant resistive load having a power factor not less than 0,99

[SOURCE: IEC 60050-851:2008, 851-12-27]

### 3.1.19

#### **conventional welding current**

$I_2$   
current delivered by a welding power source to a **conventional load** at the corresponding **conventional load voltage**

Note 1 to entry: The values of  $I_2$  are given as r.m.s. values for AC and arithmetic mean values for DC.

### 3.1.20

#### **conventional load voltage**

$U_2$   
**load voltage** of a welding power source having a specified linear relationship to the **conventional welding current**

Note 1 to entry: The values for  $U_2$  are given as r.m.s. values for AC and arithmetic mean values for DC.

Note 2 to entry: The specified linear relationship varies in accordance with the process (see 11.2).

Note 3 to entry: This entry revises IEC 851-12-30, which will be updated.

### 3.1.21

#### **rated value**

assigned value, generally by the manufacturer, for a specified operating condition of a component, device or equipment

### 3.1.22

#### **rating plate** **name plate**

plate permanently affixed on an electric device, which indelibly states the rating and other information as required by the relevant standard

[SOURCE: IEC 60050-151:2001, 151-16-12]

### 3.1.23

#### **rated output**

**rated values** of the output of the equipment

Note 1 to entry: This entry revises IEC 851-12-17, which will be updated.

### 3.1.24 rated maximum welding current

$I_{2\max}$   
maximum value of the **conventional welding current** that can be obtained at the **conventional welding condition** from a welding power source at its maximum setting

[SOURCE: IEC 60050-851:2008, 851-12-14]

### 3.1.25 rated minimum welding current

$I_{2\min}$   
minimum value of the **conventional welding current** that can be obtained at the **conventional welding condition** from a welding power source at its minimum setting

[SOURCE: IEC 60050-851:2008, 851-12-15]

### 3.1.26 rated no-load voltage

$U_0$   
**no-load voltage** at **rated supply voltage** and frequency or **rated no-load speed** of rotation

Note 1 to entry: If a welding power source is fitted with a **hazard reducing device**, this is the voltage measured before the **hazard reducing device** has performed its function.

### 3.1.27 rated reduced no-load voltage

$U_r$   
**no-load voltage** of a welding power source, fitted with a voltage reducing device immediately after the device acts to effect a reduction in the voltage

### 3.1.28 rated switched no-load voltage

$U_s$   
DC **no-load voltage** of a welding power source, fitted with an AC to DC switching device

### 3.1.29 rated supply voltage

$U_1$   
r.m.s. value of supply voltage for which the equipment is designed

### 3.1.30 rated supply current

$I_1$   
r.m.s. value of supply current to the welding power source at a rated **conventional welding condition**

### 3.1.31 rated no-load supply current

$I_0$   
r.m.s. value of supply current to the welding power source at **rated no-load voltage**

### 3.1.32 rated maximum supply current

$I_{1\max}$   
maximum value of the **rated supply current**

Note 1 to entry: This entry revises IEC 851-12-13, which will be updated.

### 3.1.33 maximum effective supply current

$I_{1\text{eff}}$   
maximum value of the effective supply current, calculated from the **rated supply current** ( $I_1$ ), the corresponding **duty cycle** ( $X$ ) and the supply current at no-load ( $I_0$ ) by the formula:

$$I_{1\text{eff}} = \sqrt{I_1^2 \times X + I_0^2 \times (1 - X)}$$

Note 1 to entry: The maximum effective supply current is not always at the duty cycle corresponding to the **rated maximum supply current**.

[SOURCE: IEC 60050-851:2008, 851-12-39]

### 3.1.34 rated load speed

$n$   
speed of rotation of an engine-driven welding power source when operating at **rated maximum welding current**

Note 1 to entry: This entry revises IEC 851-12-12, which will be updated.

### 3.1.35 rated no-load speed

$n_0$   
speed of rotation of an engine-driven welding power source when the external **welding circuit** is open

Note 1 to entry: If an engine is fitted with a device to reduce the speed when not welding,  $n_0$  will be measured before the speed reduction device has operated.

Note 2 to entry: This entry revises IEC 851-12-16, which will be updated.

### 3.1.36 rated idle speed

$n_i$   
reduced no-load speed of an engine-driven welding power source

[SOURCE: IEC 60050-851:2008, 851-12-18]

### 3.1.37 duty cycle

$X$   
**SUPERSEDED**: duty factor  
ratio, for a given time interval, of the uninterrupted on-load duration to the total time

Note 1 to entry: This ratio, lying between 0 and 1, is expressed as a percentage.

Note 2 to entry: For the purposes of this document, the time period of one complete cycle is 10 min. For example, in the case of a 60 % **duty cycle**, a continuous 6 min load period is followed by a no-load period of 4 min.

### 3.1.38 clearance

shortest distance in air between two conductive parts

[SOURCE: IEC 60664-1:2007, 3.2]

### 3.1.39 creepage distance

shortest distance along the surface of a solid insulating material between two conductive parts

[SOURCE: IEC 60664-1:2007, 3.3]

### 3.1.40

#### **pollution degree**

numeral characterizing the expected pollution of the **micro-environment**

Note 1 to entry: For the purpose of evaluating **creepage distances** and **clearances**, the following four **pollution degrees** in the **micro-environment** are established in 4.6.2 of IEC 60664-1:2007.

- a) **Pollution degree 1:** No pollution or only dry, non-conductive pollution occurs. The pollution has no influence.
- b) **Pollution degree 2:** Only non-conductive pollution occurs except that occasionally a temporary conductivity caused by condensation is to be expected.
- c) **Pollution degree 3:** Conductive pollution occurs, or dry, non-conductive pollution occurs which becomes conductive due to condensation which is to be expected.
- d) **Pollution degree 4:** The pollution generates persistent conductivity caused by conductive dust or by rain or snow.

[SOURCE: IEC 60664-1:2007, 3.13, modified – Modification of the Note to entry.]

### 3.1.41

#### **micro-environment**

immediate environment of the insulation which particularly influences the dimensioning of the **creepage distances**

[SOURCE: IEC 60664-1:2007, 3.12.2]

### 3.1.42

#### **material group**

materials separated into four groups by their comparative tracking index (CTI) values in accordance with IEC 60664-1

Note 1 to entry: The following four groups are defined in IEC 60664-1:

- Material group I  $600 \leq \text{CTI}$
- Material group II  $400 \leq \text{CTI} < 600$
- Material group IIIa  $175 \leq \text{CTI} < 400$
- Material group IIIb  $100 \leq \text{CTI} < 175$

### 3.1.43

#### **temperature rise**

difference between the temperature of a part of the equipment and that of the ambient air

### 3.1.44

#### **thermal equilibrium**

state reached when the observed **temperature rise** of any part of the equipment does not exceed 2 K/h

### 3.1.45

#### **thermal protection**

system intended to ensure the protection of a part, and hence the whole, of the equipment against excessive temperatures resulting from certain conditions of thermal overload

Note 1 to entry: It is capable of being reset (either manually or automatically) when the temperature falls to the reset value.

Note 2 to entry: This entry revises IEC 851-15-03, which will be updated.

### 3.1.46

#### **environment with increased risk of electric shock**

environment where the probability of electric shock by arc welding is increased in relation to normal arc welding conditions

Note 1 to entry: Such environments are found, for example:

- a) in locations in which freedom of movement is restricted, so that the operator is forced to perform the welding in a cramped (for example kneeling, sitting, lying) position with physical contact with conductive parts;
- b) in locations which are fully or partially limited by conductive elements, and in which there is a high probability of unavoidable or accidental contact by the operator;
- c) in wet or damp or hot locations where humidity or perspiration considerably reduces the skin resistance of the human body and the insulating properties of accessories.

### 3.1.47

#### **hazard reducing device**

device designed to reduce the hazard of electric shock that may originate from the **no-load voltage**

[SOURCE: IEC 60050-851:2008, 851-15-01]

### 3.1.48

#### **class I equipment**

equipment with **basic insulation** as provision for basic protection and protective bonding as provision for fault protection

[SOURCE: IEC 60050-851:2008, 851-15-10]

### 3.1.49

#### **class II equipment**

equipment with **basic insulation** as provision for basic protection, and **supplementary insulation** as provision for fault protection, or in which basic and fault protection are provided by **reinforced insulation**

[SOURCE: IEC 60050-851:2008, 851-15-11]

### 3.1.50

#### **basic insulation**

insulation of hazardous-live-parts which provides basic protection

[SOURCE: IEC 60050-851:2008, 851-15-04]

### 3.1.51

#### **supplementary insulation**

independent insulation applied in addition to **basic insulation** for fault protection

[SOURCE: IEC 60050-851:2008, 851-15-05]

### 3.1.52

#### **double insulation**

insulation comprising both **basic insulation** and **supplementary insulation**

[SOURCE: IEC 60050-851:2008, 851-15-06]

### 3.1.53

#### **reinforced insulation**

insulation of hazardous-live-parts which provides a degree of protection against electric shock equivalent to **double insulation**

Note 1 to entry: **Reinforced insulation** may comprise several layers which cannot be tested singly as **basic insulation** or **supplementary insulation**.

[SOURCE: IEC 60050-851:2008, 851-15-07]

### 3.1.54

#### **plasma cutting system**

combination of power source, torch, and associated safety devices for plasma cutting/gouging

[SOURCE: IEC 60050-851:2008, 851-13-03]

### 3.1.55

#### **plasma cutting power source**

equipment for supplying current and voltage and having the required characteristics suitable for plasma cutting/gouging and which may supply gas and cooling liquid

Note 1 to entry: A **plasma cutting power source** can also supply services to other equipment and auxiliaries, for example auxiliary power, cooling liquid and gas.

[SOURCE: IEC 60050-851:2008, 851-13-04]

### 3.1.56

#### **safety extra-low voltage**

##### **SELV**

voltage which does not exceed 50 V AC or 120 V ripple free DC between conductors, or between any conductor and earth, in a circuit which is isolated from the supply mains by such means as a safety isolating transformer

Note 1 to entry: Maximum voltage lower than 50 V AC or 120 V ripple free DC is specified in particular requirements, especially when direct contact with live parts is allowed.

Note 2 to entry: The voltage limit is not exceeded at any load between full load and no-load when the source is a safety isolating transformer.

Note 3 to entry: "Ripple-free" is conventionally an r.m.s. ripple voltage not more than 10 % of the DC component; the maximum peak value does not exceed 140 V for a nominal 120 V ripple-free DC system and 70 V for a nominal 60 V ripple-free DC system.

Note 4 to entry: This entry revises IEC 851-15-08, which will be updated.

### 3.1.57

#### **supply circuit**

input circuit

conductive material in the equipment through which the supply current is intended to flow

### 3.1.58

#### **working voltage**

highest r.m.s. value of the AC or DC voltage across any particular insulation which can occur when the equipment is supplied at rated voltage

Note 1 to entry: Transients are disregarded.

Note 2 to entry: Both open circuit conditions and normal operating conditions are taken into account.

[SOURCE: IEC 60050-851:2008, 851-12-31]

### 3.1.59

#### **touch current**

electric current passing through a human body or through an animal body when it touches one or more accessible parts of an installation or of equipment



Note 1 to entry: **Touch current** is measured by using a measuring network that simulates the impedance of the human body.

[SOURCE: IEC 60050-195:1998/AMD1:2001, 195-05-21, modified – Addition of a note to entry.]

### 3.1.60

#### **remote control**

device or circuit external to the equipment used for monitoring or operational control

### 3.1.61

#### **single-fault condition**

condition in which one means for protection against hazard is defective

Note 1 to entry: If a **single-fault condition** results unavoidably in another **single-fault condition**, the two failures are considered as one **single-fault condition**.

### 3.1.62

#### **fixed installation**

particular combination of several types of apparatus and, where applicable, other devices, which are assembled, installed and intended to be used permanently at a predefined location

### 3.1.63

#### **protective circuit**

circuit intended to be bonded to protective earth to protect against electric shock

### 3.1.64

#### **class of insulation**

standard classification applied to an insulating material for use in electrical apparatus and machines and specifying the nature of the material and a recommended limiting temperature

[SOURCE: IEC 60050-811:1991, 811-13-33]

### 3.1.65

#### **functional insulation**

insulation between conductive parts, necessary for the proper functioning of the equipment

[SOURCE: IEC 60050-195:1998, 195-02-41]

### 3.1.66

#### **idle state**

operating state in which the power is switched on and the **welding circuit** is not energized

Note 1 to entry: For some types of equipment there is no **idle state**, but a welding state preceding arc striking.

Note 2 to entry: For a power source in a mechanised system, the configuration to achieve **idle state** is defined by the manufacturer.

Note 3 to entry: An **idle state** can include a low energy state in which a welding process cannot be started without automatic or manual reactivation.

## 3.2 Terms related to battery systems

### 3.2.1

#### **battery**

assembly of one or more **cells** intended to provide electrical current to the welding power source

### 3.2.2

#### **integral battery**

**battery** which is contained within the battery-powered welding power source and is not removed from the welding power source for charging purposes

Note 1 to entry: A **battery** that is to be removed from the battery-powered welding power source for disposal or recycling purposes only is considered to be an **integral battery**.

### 3.2.3

#### **detachable battery pack**

**battery** which is contained in a separate enclosure from the battery-powered welding power source and is intended to be removed from the welding power source for charging purposes

### 3.2.4

#### **separable battery pack**

**battery** which is contained in a separate enclosure from the battery-powered welding power source and is connected to the battery-powered welding power source by a cable

### 3.2.5

#### **battery system**

combination of a **battery**, the **charging system**, the welding power source and the interfaces between them as existing during operation of the welding power source or during charging

### 3.2.6

#### **C<sub>5</sub> rate**

current, in amperes, at which a **cell** or **battery** can be discharged for 5 h to the voltage cut-off point specified by the **cell** manufacturer

### 3.2.7

#### **cell**

basic functional unit consisting of an assembly of electrodes, electrolyte, container, terminals, and usually separators, that is a source of electric energy obtained by direct conversion of chemical energy

[SOURCE: IEC 60050-482:2004 482-01-01]

### 3.2.8

#### **charger**

part or all of the **charging system** contained in a separate enclosure

Note 1 to entry: As a minimum, the **charger** includes some of the power conversion circuitry. Not all **charging systems** include a separate **charger** as in the case where a welding power source may be charged utilizing a mains supply cable or may incorporate a plug for attachment to a mains receptacle.

### 3.2.9

#### **charging system**

combination of circuitry intended to charge, balance and/or maintain the state of charge of the **battery**

### 3.2.10

#### **fully charged cell**

#### **fully charged battery**

**cell** or **battery** charged to the maximum state of charge permitted by the **battery charging system** intended for use with the welding power source

### 3.2.11

#### **fully discharged cell**

#### **fully discharged battery**

**battery** or **cell** discharged until one of the following conditions occurs: discharge terminates due to protective circuitry or the **battery** (or **cell**) reaches a total voltage with an average voltage per **cell** equal to the end-of-discharge voltage for the **cell** chemistry being used unless a different end-of-discharge voltage is specified by the manufacturer of **battery/cell**

Note 1 to entry: The end-of-discharge voltages for common **cell** chemistries are provided in O.5.210.

### 3.2.12

#### **general purpose batteries**

#### **general purpose cells**

**batteries** and **cells** available from a variety of manufacturers, through a variety of outlets intended for a variety of different manufacturers' products

Note 1 to entry: 12 V automotive **batteries** and AA, C and D alkaline **cells** are examples of **general purpose**.

### 3.2.13

#### **maximum charging current**

highest current that a **cell** is permitted to pass during charging for a specified range of temperatures as specified by the **cell** manufacturer and evaluated in accordance with IEC 62133-1:— or IEC 62133-2:—

### 3.2.14

#### **specified operating region**

range of permissible operation of **cells**, expressed by **cell** parameter limits

#### 3.2.14.1

##### **specified operating region for charging**

conditions for voltage and current during charging in which the **cell** is permitted to operate as specified by the **cell** manufacturer and evaluated in accordance with IEC 62133-1:— or IEC 62133-2:—

### 3.2.15

#### **upper limit charging voltage**

highest voltage that a **cell** is permitted to attain during normal charging for a specified range of temperatures as specified by the **cell** manufacturer and evaluated in accordance with IEC 62133-1:— or IEC 62133-2:—

### 3.2.16

#### **venting**

condition that occurs, when a **cell** releases excessive internal pressure intended by design to preclude **explosion**

### 3.2.17

#### **electronic component**

part in which conduction is achieved principally by electrons moving through a vacuum, gas or semiconductor, with the exclusion of neon indicators

Note 1 to entry: Examples of **electronic components** are diodes, transistors, triacs and monolithic integrated circuits. Resistors, capacitors and inductors are not considered **electronic components**.

### 3.2.18

#### **basic protection**

protection against electric shock under fault-free conditions

[SOURCE: IEC 60050-195:1998, 195-06-01]

### 3.2.19

#### **battery voltage class A**

classification of an electric component or circuit with a maximum battery **working voltage** of 60 V DC

### 3.2.20

#### **battery voltage class B**

classification of an electric component or circuit with a maximum battery **working voltage** between 60 V DC and 1 500 V DC

### 3.2.21

#### **charring**

blackening of the cotton caused by combustion

Note 1 to entry: Discolouration of the cotton caused by smoke is acceptable.

### 3.2.22

#### **consecutive operating cycle**

immediate on cycle after the thermal control device resets

### 3.2.23

#### **explosion**

<of an explosive atmosphere> sudden increase of pressure and temperature, due to oxidation or other exothermic reaction

[SOURCE: IEC 60050-426:2008, 426-02-13]

## **4 Environmental conditions**

Welding power sources shall be capable of delivering **rated outputs** at rated **duty cycles** when the following environmental conditions prevail:

- a) range of ambient air temperature:  
during operation: –10 °C to +40 °C;
- b) relative humidity of the air:  
up to 50 % at 40 °C;  
up to 90 % at 20 °C;
- c) ambient air, free from abnormal amounts of dust, acids, corrosive gases or substances, etc. other than those generated by the welding process;
- d) altitude above sea level up to 1 000 m;
- e) base of the welding power source inclined up to 10°.

Welding power sources shall withstand storage and transport at an ambient air temperature of –20 °C to +55 °C without any damage to function and performance.

NOTE Different environmental conditions can be agreed upon between the manufacturer and the purchaser and the resulting welding power source is marked accordingly (see 15.1). Examples of these conditions are: high humidity, unusually corrosive fumes, steam, excessive oil vapour, abnormal vibration or shock, excessive dust, severe weather conditions, unusual coastal or shipboard conditions, vermin infestation and atmospheres conducive to the growth of mould.

## 5 Tests

### 5.1 Test conditions

Tests shall be carried out on new, dry and completely assembled welding power sources.

The heating test defined in 7.1 and the **thermal protection** test defined in 8.5 shall be carried out at ambient temperature of 40 °C, see to lerances in 7.1.2 e), with the exception of engine-driven power sources and **fixed installation** equipment, which shall be tested in accordance with the manufacturer's specification.

Other tests shall be carried out at an ambient air temperature given in Clause 4 a).

Liquid-cooled welding power sources shall be tested with liquid conditions as specified by the manufacturer.

Unless otherwise specified, the equipment shall be supplied by a **rated supply voltage** with a tolerance of  $\pm 5\%$ .

### 5.2 Measuring instruments

The accuracy of measuring instruments shall be:

- a) electrical measuring instruments: class I ( $\pm 1\%$  of full-scale reading), except for the measurement of insulation resistance and dielectric strength where the accuracy of the instruments is not specified, but shall be taken into account for the measurement;
- b) thermometer:  $\pm 2\text{ K}$ ;
- c) tachometer:  $\pm 1\%$  of full-scale reading.

### 5.3 Conformity of components

~~Components which due to failure can create a hazard, shall comply with the requirements of this document or with the requirements of the relevant IEC standards.~~

~~NOTE 1—An IEC component standard is considered relevant only if the component in question falls within its scope.~~

~~Evaluation and testing of components for correct application in the equipment shall be carried out in one of the following ways:~~

- ~~a) Where a component has been certified by a recognized testing authority for compliance with a relevant IEC component standard, that component shall be checked for correct application and use in accordance with its rating. The component shall be tested in accordance with this document with the exception of those tests which are part of the relevant IEC component standard.~~
- ~~b) Where a component has been certified by a recognized testing authority for compliance with a relevant IEC component standard, but is not being used in accordance with its specified ratings, that component shall be tested in accordance with this document.~~
- ~~c) Where a component has not been certified by a recognized testing authority for compliance with a relevant IEC component standard, that component shall be checked for correct application in the equipment by testing the component in accordance with this document or in accordance with the applicable tests of the relevant IEC component standard.~~

~~NOTE 2—The applicable test for compliance with a component standard is typically carried out separately. The number of test samples is typically the same as that required in the component standard.~~

- ~~d) Where a component has not been certified by a recognized testing authority for compliance with a relevant IEC component standard because no such standard exists, that component shall be tested in accordance with this document.~~
- ~~e) Where a component has been certified by a recognized testing authority for compliance to a non-IEC standard, that component shall be considered acceptable for use in the equipment provided that the applicable safety requirements of the non-IEC standard are at least as high as those of a relevant IEC standard. The component shall be tested in accordance with this document with the exception of those tests which are part of the non-IEC component standard.~~

Refer to Annex P for conformity of components.

## 5.4 Type tests

Unless otherwise specified, the tests in this document are **type tests**.

The welding power source shall be tested with any ancillary equipment fitted that could affect the test results.

All **type tests** shall be carried out on the same welding power source except where it is specified that a test may be carried out on another welding power source.

As a condition of conformity, the **type tests** given below shall be carried out in the following sequence with no drying time between f), g) and h):

- a) general **visual inspection**, see 3.1.7;
- b) insulation resistance, see 6.1.4 (preliminary check);
- c) enclosure, see 14.2;
- d) handling means, see 14.3;
- e) drop withstand, see 14.4;
- f) protection provided by the enclosure, see 6.2.1;
- g) insulation resistance, see 6.1.4;
- h) dielectric strength, see 6.1.5;
- i) general **visual inspection**, see 3.1.7.

The other tests included in this document and not listed here shall be carried out, but may be completed in any convenient sequence.

## 5.5 Routine tests

All **routine tests** shall be carried out on each welding power source. The following sequence is recommended:

- a) **visual inspection** in accordance with manufacturer's specification;
- b) continuity of the **protective circuit**, see 10.5.1;
- c) dielectric strength, see 6.1.5;
- d) **no-load voltage**:
  - 1) **rated no-load voltage**, see 11.1 by measurement only; or
  - 2) if applicable, **rated reduced no-load voltage**, see 13.2; or
  - 3) if applicable, **rated switched no-load voltage**, see 13.3;
- e) test to ensure rated minimum and maximum output values in accordance with 15.4 b) and 15.4 c). The manufacturer may select **conventional load**, short circuit load or other test conditions.

NOTE 1 In short circuit and other test conditions, the output values can differ from **conventional load** values.

NOTE 2 If justified by the design, measured values can be compensated due to variations of the supply network.

## 6 Protection against electric shock

### 6.1 Insulation

#### 6.1.1 General

The majority of welding power sources fall within the overvoltage category III in accordance with IEC 60664-1; mechanically powered welding power sources fall within overvoltage category II. All welding power sources shall be designed for use in environmental conditions of **pollution degree** 3 as a minimum.

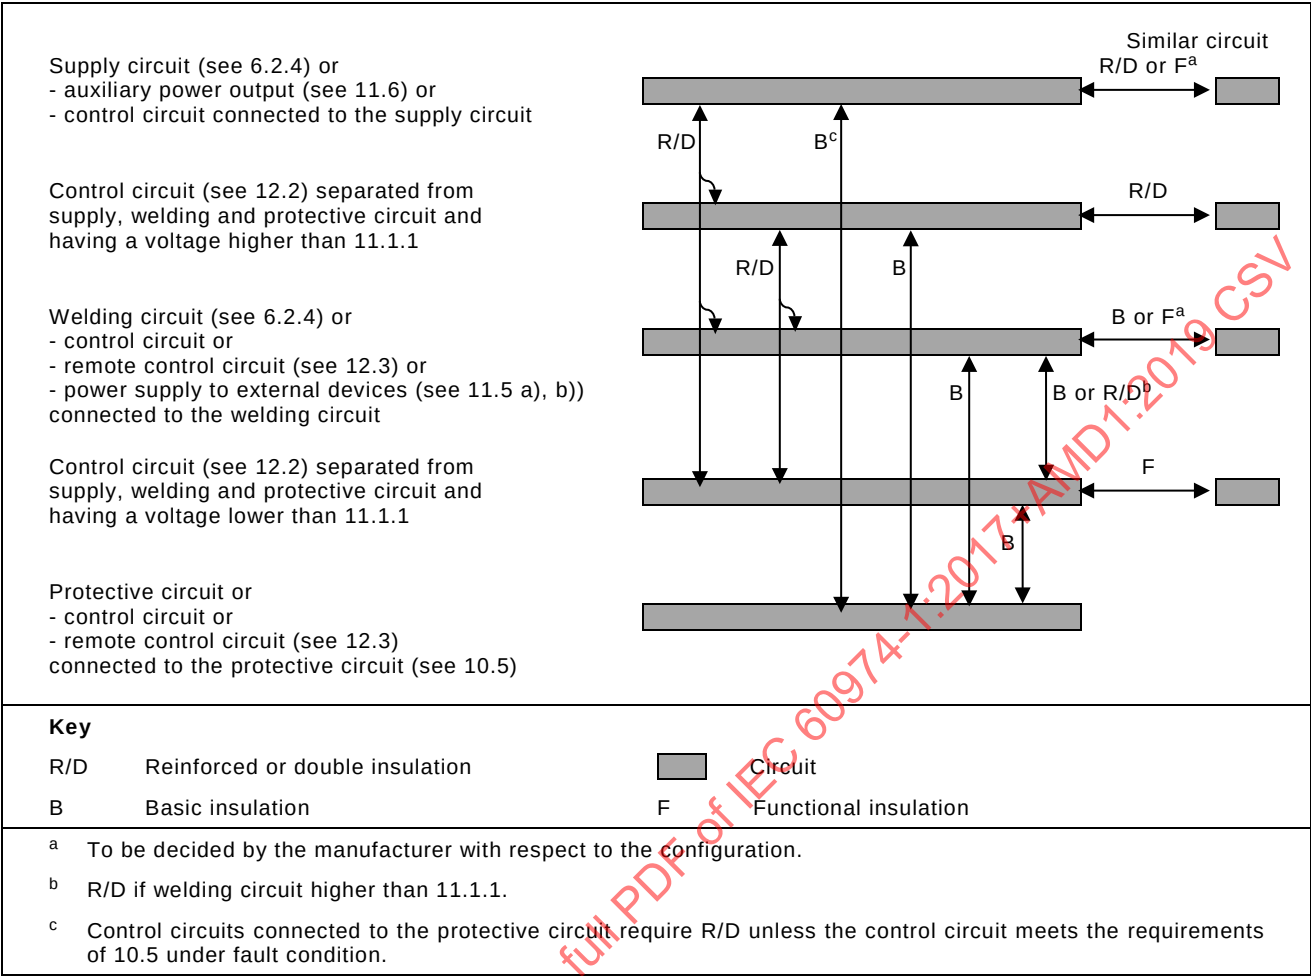
Components or subassemblies with **clearances** or **creepage distances** corresponding to **pollution degree** 2 are permitted if the **micro-environment** of the component or subassembly is improved (by means such as filtering, coating, potting, moulding) so that only non-conductive pollution or occasional temporary conductivity caused by condensation occurs.

Components or subassemblies with **clearances** or **creepage distances** corresponding to **pollution degree** 1 are permitted, if they are completely coated, potted or moulded in accordance with IEC 60664-3.

See Table 2 for printed wiring material **creepage distances**.

**Class I equipment** intended to be connected to an earthed three-phase three-wire system shall be designed with insulation based on line to line voltage values. **Class I equipment** designed with insulation based on line to neutral voltage values shall be provided with a caution that such equipment shall only be used on a supply network that is either a three-phase, four-wire system with an earthed neutral or a single-phase, three-wire, system with an earthed neutral.

The application of insulation in many configurations is illustrated in Figure 1, but other configurations and solutions are possible. If a particular configuration is not represented in Figure 1, the required insulation shall be determined by considering the effect of a single fault.



IEC

Figure 1 – Example of insulation configuration for Class I equipment

6.1.2 Clearances

For basic or **supplementary insulation**, and **reinforced insulation**, minimum **clearances** shall be in accordance with Table 1 for overvoltage category III. For other overvoltage categories, minimum **clearances** shall be in accordance with IEC 60664-1.



**Table 1 – Minimum clearances for overvoltage category III**

| Voltage line to neutral derived from nominal voltages AC or DC up to and including <sup>a</sup><br><br>V r.m.s.                                                 | Basic or supplementary insulation        |                                 |                     |     |     | Reinforced insulation                    |                                 |                     |     |     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|---------------------------------|---------------------|-----|-----|------------------------------------------|---------------------------------|---------------------|-----|-----|
|                                                                                                                                                                 | Rated impulse Test voltage<br><br>peak V | AC test voltage<br><br>V r.m.s. | Pollution degree    |     |     | Rated impulse test voltage<br><br>peak V | AC test voltage<br><br>V r.m.s. | Pollution degree    |     |     |
|                                                                                                                                                                 |                                          |                                 | 2                   | 3   | 4   |                                          |                                 | 2                   | 3   | 4   |
|                                                                                                                                                                 |                                          |                                 | Clearance<br><br>mm |     |     |                                          |                                 | Clearance<br><br>mm |     |     |
| 50                                                                                                                                                              | 800                                      | 566                             | 0,2                 | 0,8 | 1,6 | 1 500                                    | 1 061                           | 0,5                 | 0,8 | 1,6 |
| 100                                                                                                                                                             | 1 500                                    | 1 061                           | 0,5                 |     |     | 2 500                                    | 1 768                           | 1,5                 |     |     |
| 150                                                                                                                                                             | 2 500                                    | 1 768                           | 1,5                 |     |     | 4 000                                    | 2 828                           | 3                   |     |     |
| 300                                                                                                                                                             | 4 000                                    | 2 828                           | 3                   |     |     | 6 000                                    | 4 243                           | 5,5                 |     |     |
| 600                                                                                                                                                             | 6 000                                    | 4 243                           | 5,5                 |     |     | 8 000                                    | 5 657                           | 8                   |     |     |
| 1 000                                                                                                                                                           | 8 000                                    | 5 657                           | 8                   |     |     | 12 000                                   | 8 485                           | 14                  |     |     |
| NOTE 1 Values based on Tables F.1 and F.2 of IEC 60664-1:2007.                                                                                                  |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |
| NOTE 2 For other pollution degrees and overvoltage categories, see IEC 60664-1.                                                                                 |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |
| NOTE 3 If an autotransformer is connected to the supply circuit and provided as a part of a welding power source, the supply voltage determines the clearances. |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |
| <sup>a</sup> See Annex A.                                                                                                                                       |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |

For determining **clearances** as to accessible non-conductive surfaces, such surfaces shall be considered to be covered by metal foil wherever they can be touched by the standard test finger in accordance with IEC 60529.

**Clearances** shall not be interpolated.

For **supply circuit** terminals, see E.2.

**Clearances** between parts of the welding power source (for example electronic circuits or components) which are protected by an overvoltage limiting device (for example metal oxide varistor) may be rated in accordance with overvoltage category I (see IEC 60664-1).

The values of Table 1 shall also apply to the **welding circuit** within the welding power source and to **control circuits** when separated from the **supply circuit**, for example by a transformer.

If the **control circuit** is directly connected to the **supply circuit**, the values for the supply voltage shall apply.

*Conformity shall be checked by measurement in accordance with 6.2 of IEC 60664-1:2007 or where this is not possible, by submitting the welding power source to an impulse test using the voltages given in Table 1.*

For the impulse test, a minimum of three impulses of each polarity at the voltage given in Table 1 are applied with an interval of at least 1 s between impulses using a generator with an output waveform of 1,2/50 µs and an output impedance of less than 500 Ω.

Alternatively, either an AC test voltage as given in Table 1 may be applied for three cycles or a ripple free DC voltage, the value of which is equal to the impulse voltage, may be applied three times for 10 ms, for each polarity.

### 6.1.3 Creepage distances

**Creepage distances** for basic or **supplementary insulation**, shall be in accordance with Table 2.

**Creepage distances** for **double insulation** shall be the sum of the values for basic and **supplementary insulation** which form the **double insulation**.

**Creepage distances** for **reinforced insulation** shall be twice those determined for **basic insulation**.

For the purpose of dimensioning **creepage distances** to accessible non-conductive surfaces, such surfaces shall be considered to be covered by metal foil wherever they can be touched by the standard test finger in accordance with IEC 60529.

**Creepage distances** are given for the highest rated voltage of each line of Table 2. In the case of a lower rated voltage, interpolation is allowed.

For **supply circuit** terminals, see E.2.

The values of Table 2 shall also be applicable to the **welding circuit** within the welding power source and to **control circuits** when separated from the **supply circuit** by, for example, a transformer.

A **creepage distance** cannot be less than the associated **clearance**, so the shortest possible **creepage distance** is equal to the required **clearance**.

If the **control circuit** is connected directly to the **supply circuit**, the values for the supply voltage shall apply.

*Conformity shall be checked by linear measurement in accordance with 6.2 of IEC 60664-1:2007.*

**Table 2 – Minimum creepage distances**

| Working voltage | Creepage distances in millimetres |       |                  |                |      |      |                |      |      |
|-----------------|-----------------------------------|-------|------------------|----------------|------|------|----------------|------|------|
|                 | Basic or supplementary insulation |       |                  |                |      |      |                |      |      |
|                 | Printed wiring material           |       | Pollution degree |                |      |      |                |      |      |
|                 | Pollution degree                  |       |                  |                |      |      |                |      |      |
| V r.m.s         | 1                                 | 2     | 1                | 2              |      |      | 3              |      |      |
|                 | a                                 | b     | a                | Material group |      |      | Material group |      |      |
|                 | mm                                | mm    | mm               | I              | II   | III  | I              | II   | III  |
|                 |                                   |       |                  | mm             | mm   | mm   | mm             | mm   | mm   |
| 10              | 0,025                             | 0,04  | 0,08             | 0,4            | 0,4  | 0,4  | 1              | 1    | 1    |
| 12,5            | 0,025                             | 0,04  | 0,09             | 0,42           | 0,42 | 0,42 | 1,05           | 1,05 | 1,05 |
| 16              | 0,025                             | 0,04  | 0,1              | 0,45           | 0,45 | 0,45 | 1,1            | 1,1  | 1,1  |
| 20              | 0,025                             | 0,04  | 0,11             | 0,48           | 0,48 | 0,48 | 1,2            | 1,2  | 1,2  |
| 25              | 0,025                             | 0,04  | 0,125            | 0,5            | 0,5  | 0,5  | 1,25           | 1,25 | 1,25 |
| 32              | 0,025                             | 0,04  | 0,14             | 0,53           | 0,53 | 0,53 | 1,3            | 1,3  | 1,3  |
| 40              | 0,025                             | 0,04  | 0,16             | 0,56           | 0,8  | 1,1  | 1,4            | 1,6  | 1,8  |
| 50              | 0,025                             | 0,04  | 0,18             | 0,6            | 0,85 | 1,2  | 1,5            | 1,7  | 1,9  |
| 63              | 0,04                              | 0,063 | 0,2              | 0,63           | 0,9  | 1,25 | 1,6            | 1,8  | 2    |
| 80              | 0,063                             | 0,1   | 0,22             | 0,67           | 0,95 | 1,3  | 1,7            | 1,9  | 2,1  |
| 100             | 0,1                               | 0,16  | 0,25             | 0,71           | 1    | 1,4  | 1,8            | 2    | 2,2  |
| 125             | 0,16                              | 0,25  | 0,28             | 0,75           | 1,05 | 1,5  | 1,9            | 2,1  | 2,4  |
| 160             | 0,25                              | 0,4   | 0,32             | 0,8            | 1,1  | 1,6  | 2              | 2,2  | 2,5  |
| 200             | 0,4                               | 0,63  | 0,42             | 1              | 1,4  | 2    | 2,5            | 2,8  | 3,2  |
| 250             | 0,56                              | 1     | 0,56             | 1,25           | 1,8  | 2,5  | 3,2            | 3,6  | 4    |
| 320             | 0,75                              | 1,6   | 0,75             | 1,6            | 2,2  | 3,2  | 4              | 4,5  | 5    |
| 400             | 1                                 | 2     | 1                | 2              | 2,8  | 4    | 5              | 5,6  | 6,3  |
| 500             | 1,3                               | 2,5   | 1,3              | 2,5            | 3,6  | 5    | 6,3            | 7,1  | 8    |
| 630             | 1,8                               | 3,2   | 1,8              | 3,2            | 4,5  | 6,3  | 8              | 9    | 10   |
| 800             | 2,4                               | 4     | 2,4              | 4              | 5,6  | 8    | 10             | 11   | 12,5 |
| 1 000           | 3,2                               | 5     | 3,2              | 5              | 7,1  | 10   | 12,5           | 14   | 16   |
| 1 250           |                                   |       | 4,2              | 6,3            | 9    | 12,5 | 16             | 18   | 20   |
| 1 600           |                                   |       | 5,6              | 8              | 11   | 16   | 20             | 22   | 25   |
| 2 000           |                                   |       | 7,5              | 10             | 14   | 20   | 25             | 28   | 32   |
| 2 500           |                                   |       | 10               | 12,5           | 18   | 25   | 32             | 36   | 40   |
| 3 200           |                                   |       | 12,5             | 16             | 22   | 32   | 40             | 45   | 50   |
| 4 000           |                                   |       | 16               | 20             | 28   | 40   | 50             | 56   | 63   |
| 5 000           |                                   |       | 20               | 25             | 36   | 50   | 63             | 71   | 80   |
| 6 300           |                                   |       | 25               | 32             | 45   | 63   | 80             | 90   | 100  |
| 8 000           |                                   |       | 32               | 40             | 56   | 80   | 100            | 110  | 125  |
| 10 000          |                                   |       | 40               | 50             | 71   | 100  | 125            | 140  | 160  |

a Material group I, II, IIIa and IIIb.

b Material group I, II and IIIa.

NOTE In accordance with IEC 60664-1, the dimensions for creepage distance cannot be specified where permanently conductive pollution is present (Pollution degree 4).

**6.1.4 Insulation resistance**

The insulation resistance shall be not less than the values given in Table 3.

**Table 3 – Insulation resistance**

| Measurement <sup>a</sup>                                                                                                                                                                                                             |    |                                  | Resistance | Insulation           |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----|----------------------------------|------------|----------------------|
| Supply circuit                                                                                                                                                                                                                       | to | welding circuit                  | 5,0 MΩ     | Double or reinforced |
| Welding circuit                                                                                                                                                                                                                      | to | protective circuit               | 2,5 MΩ     | Basic                |
| Supply circuit                                                                                                                                                                                                                       | to | protective circuit               | 2,5 MΩ     | Basic                |
| Supply circuit of Class II equipment                                                                                                                                                                                                 | to | accessible surfaces <sup>b</sup> | 5,0 MΩ     | Double or reinforced |
| <sup>a</sup> Control circuits are tested together with the circuit to which they are galvanically connected. Accessible control circuits separated from all other circuits are tested according to the manufacturer's specification. |    |                                  |            |                      |
| <sup>b</sup> For measurement to accessible non-conductive surfaces, such surfaces shall be considered to be covered by metal foil.                                                                                                   |    |                                  |            |                      |

Any control or auxiliary circuit connected to the protective conductor terminal shall be considered as an exposed conductive part for the purpose of this test.

*Conformity shall be checked by the stabilized measurement of the insulation resistance by application of a DC voltage of 500 V at room temperature.*

During the measurement, torches shall be disconnected, solid-state electronic components and their protective devices may be short-circuited and liquid cooling units shall be tested without liquid.

**6.1.5 Dielectric strength**

The insulation shall withstand the following test voltages without any flashover or breakdown:

- first test of a welding power source: test voltages given in Table 4;
- repetition of the test of the same welding power source: test voltage 80 % of the values given in Table 4.

**Table 4 – Dielectric test voltages**

| Maximum rated voltage <sup>a</sup><br>V r.m.s.                                                                                                                                                                                        | AC dielectric test voltage<br>V r.m.s.                                                              |                    |                                                       |                                   |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------|--------------------|-------------------------------------------------------|-----------------------------------|
|                                                                                                                                                                                                                                       | All circuits to exposed conductive parts, supply circuit to all circuits except the welding circuit |                    | All circuits except supply circuit to welding circuit | Supply circuit to welding circuit |
| Supply <sup>a</sup> , welding <sup>b</sup> or control <sup>b</sup> circuits                                                                                                                                                           | Class I equipment                                                                                   | Class II equipment |                                                       |                                   |
| Up to 50                                                                                                                                                                                                                              | 500                                                                                                 | 1 000              | 500                                                   | 1 000                             |
| 220                                                                                                                                                                                                                                   | 1 100                                                                                               | 2 200              | 1 100                                                 | 2 200                             |
| 450                                                                                                                                                                                                                                   | 1 875                                                                                               | 3 750              | 1 875                                                 | 3 750                             |
| 700                                                                                                                                                                                                                                   | 2 500                                                                                               | 5 000              | 2 500                                                 | 5 000                             |
| 1 000                                                                                                                                                                                                                                 | 2 750                                                                                               | 5 500              | 2 750                                                 | 5 500                             |
| NOTE 1 The maximum rated voltage is valid for earthed and unearthed systems.                                                                                                                                                          |                                                                                                     |                    |                                                       |                                   |
| NOTE 2 In this document, the dielectric strength test of control circuits is limited to any circuit that enters or exits the enclosure apart from the supply circuit and the welding circuit.                                         |                                                                                                     |                    |                                                       |                                   |
| a For intermediate values, interpolation is allowed on all supply networks (supply circuit) operating outside the range of 220 V to 450 V and on all three-phase, three-wire earthed systems without voltage exemption (see Annex A). |                                                                                                     |                    |                                                       |                                   |
| b For intermediate values, interpolation is allowed on welding and control circuits.                                                                                                                                                  |                                                                                                     |                    |                                                       |                                   |

The AC test voltage shall be of an approximate sine wave-form with a peak value not exceeding 1,45 times the r.m.s. value, having a frequency of approximately 50 Hz or 60 Hz.

The maximum permissible setting of the tripping current shall be 100 mA. The high voltage transformer shall deliver the prescribed voltage up to the tripping current. Tripping is regarded as a flashover or a breakdown.

NOTE For the operator's safety, the lowest setting of the tripping current (less than or equal to 10 mA) is typical.

**Alternative test:** A DC test voltage of 1,4 times the r.m.s. test voltage may be used.

Components or subassemblies shall not be disconnected or short-circuited unless the conditions of a), b) or c) below are met:

- The components or subassemblies are designed and tested to relevant standards that specify a voltage lower than the test voltage level of this document. These components or subassemblies are not connected between supply and **welding circuits** and their disconnection or short-circuiting does not prevent a part of that circuit from being tested. Example: fan motors and pump motors.
- The components or subassemblies are completely incorporated within either the supply or the **welding circuit** and their disconnection does not prevent a part of that circuit from being tested. Example: electronic circuits.
- Interference suppression networks or protection capacitors between the supply or **welding circuit** and any exposed conductive part conform to the relevant standards.

**Control circuits** connected to the protective conductor terminal shall not be disconnected during testing and they are then tested as exposed conductive parts.

At the discretion of the manufacturer, the test voltage may be slowly raised to the full value.

The test voltages between the **supply circuit**, the exposed conductive parts and the **welding circuit** may be applied simultaneously. An example is given in Annex B.

Engine-driven welding power sources shall undergo the same test.

*Conformity shall be checked by application of the test voltage for*

- a) 60 s (**type test**);
- b) 5 s (**routine test**);
- or
- c) 1 s (**routine test with the test voltage increased by 20 %**).

## 6.2 Protection against electric shock in normal service (direct contact)

### 6.2.1 Protection provided by the enclosure

Welding power sources specifically designed for indoor use shall have a minimum degree of protection of IP21S using IEC 60529 test procedures and conditions.

Welding power sources specifically designed for outdoor use shall have a minimum degree of protection of IP23S using IEC 60529 test procedures and conditions.

Welding power sources with degree of protection IP23S may be stored, but are not intended to be used outside during precipitation unless sheltered.

Adequate drainage shall be provided by the enclosure. Retained water shall not interfere with the operation of the equipment or impair safety. The quantity of water that may enter the enclosure is not limited.

**Welding circuit** connections shall be protected as specified in 11.4.1.

**Remote controls** for welding power sources shall have a minimum degree of protection of IP2X using IEC 60529 test procedures and conditions.

*Conformity shall be checked by the following test:*

A welding power source shall be subjected to the appropriate water test without being energized. Immediately after the test, the welding power source shall be moved to a safe environment and subjected to the insulation resistance test, listed in 5.4 g) and dielectric strength test, listed in 5.4 h).

### 6.2.2 Capacitors

Each capacitor provided as part of a welding power source and connected either across a **supply circuit** or across a winding of a transformer providing **welding current** shall

- a) not contain more than 1 l of flammable liquid;
- b) be designed not to leak during normal service;
- c) be contained within the welding power source enclosure or other enclosure which conforms to the relevant requirements of this document.

*Conformity shall be checked by **visual inspection**.*

Capacitors shall not cause the welding power source to exhibit hazardous electrical breakdown or present risk of fire in event of a failure.

*Conformity shall be checked by the following test:*

The welding power source is operated at no-load at its **rated supply voltage** and with a supply fuse or circuit-breaker rated up to but not more than 200 % of the **rated maximum supply current** with all or any of the capacitors shorted until:

- 1) any fuse or over-current device in the welding power source has operated; or
- 2) the **supply circuit** fuse or circuit-breaker has cleared; or
- 3) the **supply circuit** components of the welding power source reach a steady state temperature, not higher than that allowed in 7.3.

If any undue heating or melting becomes apparent, the welding power source shall conform to the requirements of items a), c) and d) of 9.1.

There shall be no leakage of liquid during any of the **type tests** required by this document.

For interference suppression capacitors or capacitors having internal fusing or a circuit-breaker, this test is not required.

### 6.2.3 Automatic discharge of supply circuit capacitors

Each capacitor shall be provided with a means of automatic discharge which shall reduce the voltage across the capacitor to 60 V or less within the time necessary to give access to any current carrying part connected to the capacitor or an appropriate warning label shall be used. For any plug which has a voltage due to a capacitor, the access time is considered to be 1 s.

Capacitors having a rated capacitance not exceeding 0,1  $\mu\text{F}$  are not considered to present a risk of electric shock.

*Conformity shall be checked by **visual inspection** and by the following test.*

The welding power source is operated at the highest **rated supply voltage**. The welding power source is then disconnected from the supply network and the voltages are measured with instruments that do not significantly affect the values being measured.

### 6.2.4 Isolation of the welding circuit

The **welding circuit** shall be isolated from the **supply circuit** and from all other circuits having a voltage higher than the allowable **no-load voltage** in accordance with 11.1.1 (for example auxiliary power **supply circuits**) by reinforced or **double insulation** or equivalent means that meet the requirements of 6.1. If another circuit is connected to the **welding circuit**, the power of the other circuit shall be supplied by an isolating transformer or equivalent means.

The **welding circuit** shall not be connected internally to the connecting means for the external protective conductor, the enclosure, frame or core of the welding power source, except, if necessary, by an interference suppression network or protection capacitor.

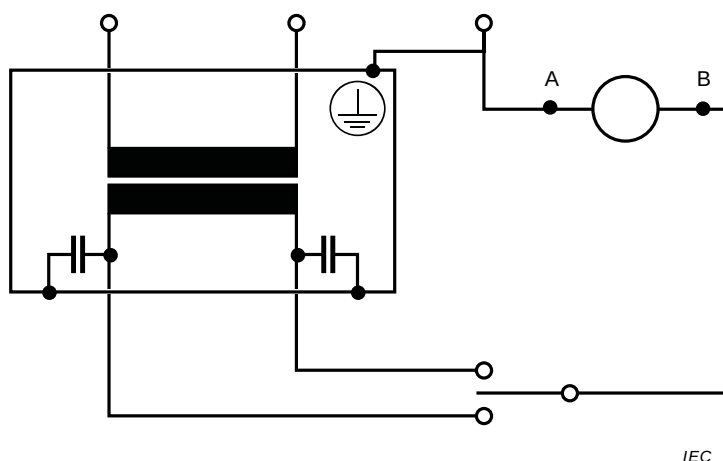
*Conformity shall be checked by tests given in 6.1.*

### 6.2.5 Welding circuit touch current

The **touch current** between the **welding circuit** connections and the protective conductor terminal shall not exceed 14,1 mA peak.

*Conformity shall be checked by **visual inspection** and measurement of the **touch current** with a circuit as shown in Figure 2 at the **rated supply voltage(s)** and no-load condition.*

The measuring network specified in Figure N.1 shall be connected as shown in Figure 2.



**Key**

A, B Measuring network connections

NOTE For class II equipment, use the PE-terminal of earthed supply network.

**Figure 2 – Measurement of welding circuit touch current**

**6.2.6 Touch current in normal condition**

The **touch current** for accessible conductive surfaces, not connected to the **protective circuit**, shall not exceed 0,7 mA peak under normal conditions.

Conformity shall be checked by measurement of the **touch current** with a circuit as shown in Figure 3, without simulating any fault and under the following conditions:

- the welding power source is:
  - isolated from the ground plane;
  - supplied by the highest **rated supply voltage**;
- the **welding circuit** is in the no-load condition;
- interference suppression capacitors are not disconnected.

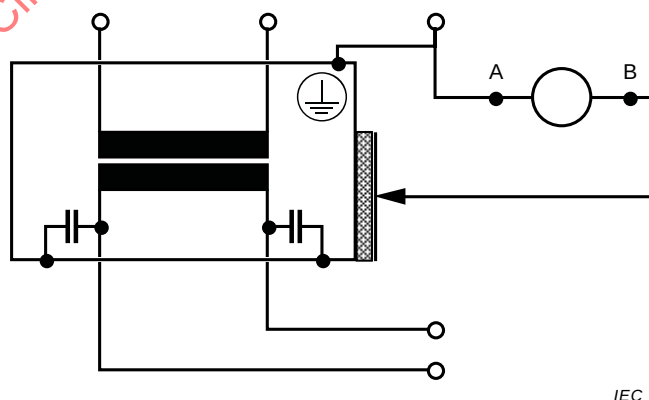


**Figure 3 – Measurement of touch current in normal condition**



## 6.3 Protection against electric shock in case of a fault condition (indirect contact)

### 6.3.1 Protective provisions

Welding power sources shall be **class I** or **class II equipment** in accordance with IEC 61140, with the exception of the **welding circuit**.

### 6.3.2 Isolation between windings of the supply circuit and the welding circuit

Windings of the **supply circuit** and the **welding circuit** shall be isolated by

- a) reinforced or **double insulation**  
or
- b) **basic insulation** to a metal screen between them which is connected to the protective conductor.

Between the windings of the **supply circuit** and the **welding circuit**, there shall be insulation which conforms to the values given in Table 5. Alternatively, other means specified in IEC 61558-1 may be used provided that the complete requirements of IEC 61558-1 are satisfied.

**Table 5 – Minimum distance through insulation**

| Rated supply voltage<br>V r.m.s. | Minimum distance through insulation<br>mm |                                        |
|----------------------------------|-------------------------------------------|----------------------------------------|
|                                  | Single layer                              | Total of three or more separate layers |
| up to 440                        | 1,3                                       | 0,35                                   |
| 441 to 690                       | 1,5                                       | 0,4                                    |
| 691 to 1 000                     | 2,0                                       | 0,5                                    |

Where there is a metal screen between the windings, the thickness of the insulation between each winding and the screen shall be at least half the values given in Table 5.

Conformity shall be checked by **visual inspection** and by measurement.

### 6.3.3 Internal conductors and connections

Internal conductors and connections shall be secured or positioned to prevent accidental loosening, which could cause electrical connection between

- a) the **supply circuit** or any other circuit and the **welding circuit** so that the output voltage could become higher than the allowable **no-load voltage**;
- b) the protective conductor, enclosure, frame or core and the **welding circuit**.

Where insulated conductors pass through metallic parts, they shall be provided with bushings of insulating material or the openings shall be smoothly rounded with a radius of at least 1,5 mm.

Bare conductors shall be so fixed that the **clearance** and **creepage distance** from each other and from conductive parts is maintained (see 6.1.2 and 6.3.2).

Conductors of different circuits may be laid side by side, may occupy the same duct (for example conduit, cable trunking system), or may be in the same multiconductor cable provided that the arrangement does not impair the proper functioning of the respective circuits. Where those circuits operate at different voltages, the conductors shall be separated

by suitable barriers or shall be insulated for the highest voltage to which any conductor within the same duct can be subjected.

*Conformity shall be checked by **visual inspection** and by measurement.*

#### 6.3.4 Additional requirements for plasma cutting systems

The plasma cutting torch, parts (e.g. parts typically replaced due to wear) and **plasma cutting power source**, recommended by the manufacturer, shall form a safe system.

Plasma tips, which for technical reasons cannot be protected against direct contact, shall be considered sufficiently protected for normal use and **single-fault condition** if the following requirements are fulfilled:

a) when no arc current is present:

the voltage between the plasma tip and the workpiece and/or earth is not higher than the values given in 11.1.1,

or

the **plasma cutting power source** is fitted with a **hazard reducing device** in accordance with Clause 13,

and

b) for manual systems, when an arc current is present:

the sides of a plasma tip cannot be touched by the standard test finger in accordance with IEC 60529 when it is placed on a flat surface with its centre line perpendicular to it,

or

the DC **load voltage** between the plasma tip and the workpiece and/or earth is not higher than values given in 11.1.1.

NOTE A single-fault is an abnormal condition resulting from the electrode being in contact with the plasma tip because of missing insulators, sticking of the plasma tip to the electrode, conductive material between plasma tip and electrode, wrong parts, loose parts, electrode abrasion, parts inserted incorrectly, excessive load or incorrect gas flow.

*Conformity shall be tested in accordance with 11.1 and by simulating a torch fault and testing in accordance with Clause 13. The torch shall be tested in accordance with IEC 60974-7.*

#### 6.3.5 Movable coils and cores

If movable coils or cores are used to adjust the **welding current**, the construction shall be such that the prescribed **clearances** and **creepage distances** are maintained, taking into account electrical and mechanical stresses.

*Conformity shall be checked by operating the mechanism 500 times over its complete movement between minimum and maximum at the rate specified by the manufacturer and by **visual inspection**.*

#### 6.3.6 Touch current in fault condition

For class I equipment, the weighted **touch current** in the case of an external protective conductor failure or disconnection shall not exceed 14,1 mA peak except for equipment with permanent connection by a reinforced protective conductor in accordance with IEC 61140.

Equipment for permanent connection with a reinforced protective conductor may have a leakage current up to 5 % of the **rated supply current** per phase.

*Conformity shall be checked using the configurations as shown in Annex N under the following conditions:*

- 1) the welding power source is:
  - isolated from the ground plane;
  - supplied by the highest **rated supply voltage**;
  - not connected to the protective earth except through measurement components;
- 2) the **welding circuit** is in the no-load condition;
- 3) interference suppression capacitors shall not be disconnected.

## 7 Thermal requirements

### 7.1 Heating test

#### 7.1.1 Test conditions

When placing the measuring devices, the only access permitted shall be through openings with cover plates, inspection doors or easily removable panels provided by the manufacturer. The ventilation in the test area and the measuring devices used shall not interfere with the normal ventilation of the welding power source or cause abnormal transfer of heat to or from it.

The welding power source is operated at **rated supply voltage**, with constant current, at a cycle time of  $(10 \pm 0,2)$  min:

- a) with the rated **welding current** ( $I_2$ ) at 60 % and/or 100 % **duty cycle** as appropriate;
- b) with the **rated maximum welding current** ( $I_{2max}$ ) at the corresponding **duty cycle**.

If it is known that neither a) nor b) gives maximum heating, then a test shall be made at the setting within the rated range which gives the maximum heating.

In the case of a welding power source rated for AC tungsten inert-gas welding, an unbalanced load could cause maximum heating. In this case, a test shall be carried out as given in Annex C.

The ambient temperature condition of 5.1 shall be fulfilled.

NOTE 1 This maximum heating is possible at the no-load condition.

NOTE 2 The tests, if relevant, follow each other without having the welding power source returned to the ambient air temperature.

#### 7.1.2 Tolerances of the test parameters

During the last 60 min of the heating test in accordance with 7.1.3, the following tolerances shall be met:

- a) **load voltage**:  $\begin{matrix} +10 \\ -2 \end{matrix}$  % of the appropriate **conventional load voltage**;
- b) **welding current**:  $\begin{matrix} +10 \\ -2 \end{matrix}$  % of the appropriate **conventional welding current**;
- c) **supply voltage**:  $\pm 5$  % of the appropriate **rated supply voltage**;
- d) **engine speed**:  $\pm 5$  % of the appropriate rated speed;
- e) **temperature**:  $\begin{matrix} +10 \\ -2 \end{matrix}$  K of the ambient temperature.

### 7.1.3 Duration of test

The heating test shall be carried out until the rate of the **temperature rise** does not exceed 2 K/h on any component for a period not less than 60 min.

## 7.2 Temperature measurement

### 7.2.1 Measurement conditions

The temperature shall be determined at the midpoint of the load time of the last cycle as follows:

- a) for windings, by measurement of the resistance, or by surface or embedded temperature sensors;

NOTE 1 The surface temperature sensor method is not preferred.

NOTE 2 In the case of windings of low resistance having switch contacts in series with them, the resistance measurement can give misleading results.

- b) for other parts, by surface temperature sensors.

### 7.2.2 Surface temperature sensor

The temperature is measured by a temperature sensor applied to accessible surfaces of windings or other parts in accordance with the conditions stipulated below.

NOTE 1 Typical temperature sensors are thermocouples, resistance thermometers, etc.

Bulb thermometers shall not be used for measuring temperatures of windings and surfaces.

Temperature sensors are placed at accessible spots where the maximum temperature is likely to occur. It is advisable to locate the predictable hot spots by means of a preliminary check.

NOTE 2 The size and spread of hot spots in windings depend on the design of the welding power source.

Efficient heat transmission between the point of measurement and the temperature sensor shall be ensured, and protection shall be provided for the temperature sensor against the effect of air currents and radiation.

### 7.2.3 Resistance

The **temperature rise** of windings is determined by the increase in their resistance and is obtained for copper by the following formula:

$$t_2 - t_a = \frac{(235 + t_1)(R_2 - R_1)}{R_1} + (t_1 - t_a)$$

where

$t_1$  is the temperature of the winding at the moment when  $R_1$  is measured (°C);

$t_2$  is the calculated temperature of the winding at the end of the test (°C);

$t_a$  is the ambient air temperature at the end of the test (°C);

$R_1$  is the initial resistance of the winding (Ω);

$R_2$  is the resistance of the winding at the end of the test (Ω).

For aluminium, the number 235 in the above formula is replaced by the number 225.

The temperature  $t_1$  shall be within  $\pm 3$  K of the ambient air temperature.

#### **7.2.4 Embedded temperature sensor**

The temperature is measured by thermocouples or other suitable temperature measuring instruments of comparable size embedded at the hottest parts.

Thermocouples shall be applied directly to windings and coils. Any integrally applied insulation on the conductors themselves is not required to be removed.

A thermocouple applied to the hottest point of a single layer winding is considered as embedded.

#### **7.2.5 Determination of the ambient air temperature**

The ambient air temperature is determined by at least three measuring devices. These are spaced uniformly around the welding power source, at approximately one-half of its height and 1 m to 2 m from its surface. They are protected from draughts and abnormal heating. The mean value of the temperature readings is adopted as the temperature of the ambient air.

In the case of forced air-cooled welding power sources, a single measuring device is placed where the air enters the cooling system. The mean of the readings taken at equal intervals of time during the last quarter of the duration of the test is adopted as the ambient air temperature.

#### **7.2.6 Recording of temperatures**

Where possible, temperatures are recorded while the equipment is in operation and after shutdown. On those parts where the recording of temperature is not possible while the equipment is in operation, temperatures are taken after shutdown as described below.

Whenever a sufficient time has elapsed between the instant of shutdown and the time of final temperature measurement to permit the temperature to fall, suitable corrections are applied to obtain as nearly as practicable the temperature at the instant of shutdown. This may be done by plotting a curve in accordance with Annex D. A minimum of four temperature readings is taken within 5 min from shutdown. In cases where successive measurements show an increasing temperature after shutdown, the highest value is taken.

To maintain the temperature during the stopping period, precautions shall be taken to shorten the stopping period of an engine-driven welding power source.

### **7.3 Limits of temperature rise**

#### **7.3.1 Windings, commutators and slip-rings**

The **temperature rise** for windings, commutators and slip-rings shall not exceed the values given in Table 6, regardless of the method of temperature measurement used.

**Table 6 – Temperature limits for windings, commutators and slip-rings**

| Class of insulation<br><br>°C | Maximum temperature<br><br>°C | Maximum temperature rise<br>K |            |                             |                                      |
|-------------------------------|-------------------------------|-------------------------------|------------|-----------------------------|--------------------------------------|
|                               |                               | Windings                      |            |                             | Commutators<br><br>and<br>slip-rings |
|                               |                               | Surface temperature sensor    | Resistance | Embedded temperature sensor |                                      |
| 105 (A)                       | 150                           | 55                            | 60         | 65                          | 60                                   |
| 120 (E)                       | 165                           | 70                            | 75         | 80                          | 70                                   |
| 130 (B)                       | 175                           | 75                            | 80         | 90                          | 80                                   |
| 155 (F)                       | 190                           | 95                            | 105        | 115                         | 90                                   |
| 180 (H)                       | 210                           | 115                           | 125        | 140                         | 100                                  |
| 200 (N)                       | 230                           | 130                           | 145        | 160                         | Not determined                       |
| 220 (R)                       | 250                           | 150                           | 160        | 180                         |                                      |

NOTE 1 Surface temperature sensor means that the temperature is measured with non-embedded sensors at the hottest accessible spot of the outer surface of the windings.

NOTE 2 Normally, the temperature at the surface is the lowest. The temperature determined by resistance measurement gives the average between all temperatures occurring in a winding. The highest temperature occurring in the windings (hot spot) can be measured by embedded temperature sensors.

NOTE 3 Other classes of insulation having higher values than those given in Table 6 are available (see IEC 60085).

No part shall be allowed to reach any temperature that will damage another part even though that part might conform to the requirements in Table 6.

Furthermore, for tests at other than 100 % **duty cycle**, the temperature occurring during any full cycle shall not exceed the maximum temperatures given in Table 6.

*Conformity shall be checked by measurement in accordance with 7.2.*

### 7.3.2 External surfaces

The **temperature rise** for external surfaces shall not exceed the values given in Table 7. Limits of **temperature rise** are given for:

- an unintentional contact period of 1 s for enclosures,
- a contact period of 4 s for buttons and
- a contact period of 60 s for handles.

**Table 7 – Temperature limits for external surfaces**

| External surface                                                | Maximum temperature rise<br>K | Burn threshold for contact<br>period <sup>a</sup><br>s |
|-----------------------------------------------------------------|-------------------------------|--------------------------------------------------------|
| Uncoated metal enclosures                                       | 25                            | 1                                                      |
| Painted metal enclosures                                        | 35                            | 1                                                      |
| Plastic enclosures                                              | 45                            | 1                                                      |
| Uncoated metal buttons                                          | 18                            | 4                                                      |
| Painted metal buttons                                           | 22                            | 4                                                      |
| Plastic buttons                                                 | 35                            | 4                                                      |
| Metal handles                                                   | 10                            | 60                                                     |
| Plastic handles                                                 | 20                            | 60                                                     |
| <sup>a</sup> Informative values in accordance with ISO 13732-1. |                               |                                                        |

For engine-driven welding power sources, the limits of Table 7 may be exceeded for surfaces that are:

- a) recognizable by appearance or function; or
- b) marked with the symbol IEC 60417-5041:2002-10; or
- c) located or guarded to prevent unintentional contact during normal operation.

NOTE Surfaces that are recognizable by appearance or function include parts such as exhaust parts, silencers, spark arrestors, or cylinder heads.

*Conformity shall be checked by measurement in accordance with 7.2 and **visual inspection**.*

### 7.3.3 Other components

The maximum temperature of other components shall not exceed their rated maximum temperature, in accordance with the relevant standard.

## 7.4 Loading test

Welding power sources shall withstand repeated load cycles without damage or functional failure. This test may be conducted on any welding power source that functions correctly.

*Conformity shall be checked by the following tests and by establishing that no damage or functional failure to the welding power source occur during the tests.*

Starting from the cold state, the welding power source is loaded at the **rated maximum welding current** until one of the following occurs:

- a) the **thermal protection** is actuated;
- b) the maximum temperature limit of the windings is reached;
- c) a period of 10 min is reached.

Immediately after reset of the **thermal protection** in a), or after b) or c), one of the following tests is carried out.

- 1) In the case of a **drooping characteristic** welding power source, the controls are set to provide **rated maximum welding current**. It is then loaded 60 times with a short circuit having an external resistance between 8 mΩ and 10 mΩ for 2 s, followed by a pause of 3 s.

- 2) In the case of a **flat characteristic** welding power source, it is loaded once with 1,5 times the **rated maximum welding current** at maximum available **load voltage** for 15 s. For welding power sources fitted with a protection device, which limits the **welding current** to a value lower than 1,5 times the **rated maximum welding current**, the test is carried out at the maximum **welding current** available at corresponding **load voltage**.

Immediately after test 1) or 2) is carried out, while equipment is still hot, the equipment shall be checked in accordance with 6.1.5.

## 7.5 Commutators and slip-rings

Commutators, slip-rings and their brushes shall show no evidence of injurious sparking or damage throughout the range of the engine-driven welding power source.

*Conformity shall be checked by **visual inspection** during*

- a) *the heating test in accordance with 7.1*  
*and*
- b) *the loading test in accordance with item 1) or 2) of 7.4.*

## 8 Thermal protection

### 8.1 General requirements

An electrically powered welding power source shall be fitted with **thermal protection** if the **duty cycle** at **rated maximum welding current** is lower than

- a) 35 % in the case of a **drooping characteristic**  
or
- b) 60 % in the case of a **flat characteristic**.

NOTE A **drooping characteristic** is generally used for manual metal arc welding and tungsten inert gas welding, while a **flat characteristic** is generally used for metal inert/active gas welding.

If a welding power source is fitted with **thermal protection**, the **thermal protection** shall meet the requirements of 8.2 to 8.7.

*Conformity shall be checked by **visual inspection**.*

### 8.2 Construction

The **thermal protection** shall be designed to prevent alteration of the temperature setting or operation.

*Conformity shall be checked by **visual inspection**.*

### 8.3 Location

The **thermal protection** shall be permanently located within the welding power source to ensure that the heat transfer is reliable.

*Conformity shall be checked by **visual inspection**.*

### 8.4 Operating capacity

The **thermal protection** shall be able to operate, when the welding power source delivers its **rated maximum welding current**:



- a) 100 times, in the case of a **duty cycle** of 35 % or higher  
or
- b) 200 times, in the case of a **duty cycle** lower than 35 %.

*Conformity shall be checked with a suitable overload producing the required number of consecutive interruptions of a circuit having the same electrical characteristics, especially current and reactance, as the circuit in which the **thermal protection** is used.*

After this test, the requirements of 8.5 and 8.6 shall be met.

## 8.5 Operation

The **thermal protection** shall prevent the welding power source windings from exceeding the maximum temperature limits given in Table 6.

The **thermal protection** shall not operate when the welding power source is loaded with the **rated maximum welding current** at the corresponding rated **duty cycle** indicated on the rating plate.

*Conformity shall be checked during operation in accordance with 7.1, at **rated maximum welding current**, at ambient temperature condition of 5.1 and without operation of the **thermal protection**. After that, the welding power source is overloaded in accordance with 9.4. Additionally, if the temperature condition of 5.1 does not give the maximum heating of windings, the test shall be carried out at ambient temperature that gives the maximum heating of windings.*

## 8.6 Resetting

The **thermal protection** shall not reset automatically or manually until the temperature has dropped below that of the **class of insulation** given in Table 6.

*Conformity shall be checked by operation and temperature measurement.*

## 8.7 Indication

Welding power sources fitted with **thermal protection** shall indicate that the **thermal protection** has reduced or disconnected the welding power source output. When the **thermal protection** has an automatic reset, the indicator shall be either a yellow light (or yellow flag within an aperture), or an alphanumeric display showing symbols or words whose meanings are given in the instruction manual.

*Conformity shall be checked by **visual inspection**.*

# 9 Abnormal operation

## 9.1 General requirements

A welding power source shall not breakdown and increases the risk of electric shock or fire, under the conditions of operation of 9.2 to 9.4. These tests are conducted without regard to temperature attained on any part, or the continued proper functioning of the welding power source. The only criterion is that the welding power source does not become unsafe. These tests may be conducted on any welding power sources that function correctly.

Welding power sources, protected internally by, for example, circuit-breaker or **thermal protection**, meet this requirement if the protection device operates before an unsafe condition occurs.

Conformity shall be checked by the following tests:

- A layer of dry absorbent surgical type cotton is placed under the welding power source, extending beyond each side for a distance of 150 mm.
- Starting from the cold state, the welding power source is operated in accordance with 9.2 to 9.4.
- During the test, the welding power source shall not emit flames, molten metal or other materials that ignite the cotton indicator.
- Following the test and not more than 5 min after the test, the welding power source shall be capable of withstanding a dielectric test in accordance with 6.1.5 b).

## 9.2 Stalled fan test

A welding power source, which relies on motor-driven fan(s) for conformity with the tests of Clause 7, is operated at **rated supply voltage** or **rated load speed** for a period of 4 h while the fan motor(s) is(are) mechanically stalled and the welding power source operated at the output condition of 7.1.

NOTE The intention of this test is to run the welding power source with the fan stationary to check the safety of both the fan and the welding power source.

## 9.3 Short circuit test

The welding power source is short circuited with the torch and the welding cables normally supplied by the manufacturer, or, if none are supplied, by a conductor 1,2 m in length and of the cross-section given in Table 8.

NOTE Cross sections for non-SI system are given in Table F.1

The welding power source at the maximum output setting is connected to that **rated supply voltage** that produces the highest **rated supply current** at **rated maximum welding current**. The **supply circuit** is protected by external fuses or a circuit-breaker with the rating and type as specified by the manufacturer.

**Table 8 – Cross-section of the output short-circuit conductor**

| Rated maximum welding current<br>A | Minimum cross-section <sup>a</sup><br>mm <sup>2</sup> |
|------------------------------------|-------------------------------------------------------|
| Up to 199                          | 25                                                    |
| 200 to 299                         | 35                                                    |
| 300 to 499                         | 50                                                    |
| 500 and above                      | 70                                                    |
| <sup>a</sup> See Annex F.          |                                                       |

The welding power source shall not clear the supply fuse or circuit-breaker when short circuited:

- for 15 s in the case of a **drooping characteristic**;
- three times for 1 s, within a period of 1 min, in the case of a **flat characteristic**.

The short circuit is then applied for 2 min or until the supply fuse or circuit-breaker clears.

The supply voltage shall not decrease by more than 10 % during this test.

Mechanically driven welding power sources are short circuited for 2 min at maximum output setting and set for operation at **rated load speed**.

#### 9.4 Overload test

The welding power source is operated for 4 h in accordance with 7.1.1 b) at 1,5 times the corresponding **duty cycle**.

If the welding power source is rated for more than 67 % **duty cycle**, this test is conducted at 100 % **duty cycle**.

If the welding power source is provided with output regulating taps, those taps producing the highest supply current shall be used.

If the **duty cycle** at the **rated maximum welding current** is 100 %, the welding power source need not be tested.

### 10 Connection to the supply network

#### 10.1 Supply voltage

Welding power sources shall be capable of operating at the **rated supply voltage**  $\pm 10$  %. This may give deviations from the **rated values**.

*Conformity shall be checked by the following test:*

The welding power source is connected to a **conventional load** and adjusted to minimum and maximum output. Each setting is tested at **rated supply voltage**  $\pm 10$  %. Verify presence of stable current flow in the **welding circuit** under these four conditions.

#### 10.2 Multi-supply voltage

Welding power sources which are designed to operate from different supply voltages shall be fitted with one of the following:

- a) an internal voltage selection panel where the adjustment for the supply voltage is made by links. A marking shall indicate the arrangement of links for each supply voltage;
- b) an internal terminal box or panel in which the terminals are clearly marked with the supply voltages;
- c) a switch for tap selection which shall be fitted with an interlocking system which prevents the switch being moved to an incorrect position. The interlocking system shall be adjusted only by the use of a tool;
- d) two supply cables, each fitted with a different plug, and a selector switch which ensures that the pins of the plug not in use cannot become live;
- e) a system to automatically configure the welding power source in accordance with the supply voltage.

NOTE Welding power sources can be fitted with an external indication of the supply voltage selected.

*Conformity shall be checked by **visual inspection** and the following tests.*

In the case d), a selector switch is additionally tested in accordance with 10.8.

#### 10.3 Means of connection to the supply circuit

Acceptable means of connection to the **supply circuit** are one of the following:

- a) terminals intended for the permanent connection of flexible supply cables;
- b) terminals intended for the connection of supply cables to a permanent installation;

c) appliance inlets fitted to the welding power source.

NOTE This requirement can also be met by using terminals on a device such as a switch, contactor, etc.

The means of connection to the **supply circuit** shall be chosen in accordance with the **maximum effective supply current**  $I_{1\text{eff}}$  and the maximum supply voltage and meet the requirements of the relevant standards or be designed in accordance with Annex E.

*Conformity shall be checked by **visual inspection**.*

#### 10.4 Marking of terminals

The terminal for the external protective conductor shall be marked with the symbol  (IEC 60417-5019:2006-08).

Optionally the following may be added:

- a) the letters: **PE**
- or
- b) the twin colours: **green and yellow**.

Additionally, three-phase equipment terminals shall be clearly marked in accordance with IEC 60445 or other relevant component standards. The identifying marking notation shall be located on or adjacent to the corresponding terminal.

*Conformity shall be checked by **visual inspection**.*

#### 10.5 Protective circuit

##### 10.5.1 Continuity requirement

The internal **protective circuit** shall be capable of withstanding currents likely to be encountered in the case of a fault.

**Class I** welding power sources shall have a suitable terminal, adjacent to the phase-conductor terminals, dimensioned in accordance with Annex E and Table E.1, for the connection of the external protective conductor. This terminal shall not be used for any other purpose (such as for clamping two parts of the casing together).

On and inside the welding power source, if there is a neutral-conductor terminal, this shall not be in electrical contact with the terminal for the connection of the protective conductor.

Both inside and outside the welding power source, insulated protective conductors shall have the twin colours green and yellow. If the welding power source is supplied with a flexible multi-conductor supply cable, this shall have the protective conductor with the twin colours green and yellow.

In some countries, the single colour green is also used to identify the protective conductor and the protective conductor terminal.

If the welding power source is fitted with a protective conductor, it shall be connected in such a way that if the cable is pulled away from the terminals, the phase conductors break before the protective conductor.

*Conformity shall be checked by **visual inspection** and the tests given in 10.5.2 and 10.5.3.*

The method of securing conductive parts to the **protective circuits**, for example paint-piercing washers, paint-piercing screws or non-painted surfaces shall be considered during **visual inspection**.

### 10.5.2 Type test

A current of 200 % of the **maximum effective supply current** as given on the **rating plate** is applied from an enclosure part, that is likely to become live, through the external protective conductor terminal for a period of time given in Table 9, using the smallest external protective conductor size given in Table 10.

NOTE The waveform of the test current is not defined as long as the effective value is used for comparison.

**Table 9 – Current and time requirements for protective circuits**

| Current<br>A | Time<br>min |
|--------------|-------------|
| Up to 30     | 2           |
| 31 to 60     | 4           |
| 61 to 100    | 6           |
| 101 to 200   | 8           |
| Above 200    | 10          |

**Table 10 – Minimum cross-sectional area of the external protective copper conductor**

| Cross-sectional area of phase<br>conductors supplying the equipment<br>$S$<br>mm <sup>2</sup> | Minimum cross-sectional area of the<br>external protective copper conductor<br>$S_p$<br>mm <sup>2</sup> |
|-----------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------|
| $S \leq 16$                                                                                   | $S$                                                                                                     |
| $16 < S \leq 35$                                                                              | 16                                                                                                      |
| $S > 35$                                                                                      | $S/2$                                                                                                   |

During the test there shall be no melting of any metal, deterioration of the bond to the welding power source, nor heating likely to cause a fire, nor shall the measured voltage drop from the enclosure part to the terminal exceed 4 V r.m.s.

### 10.5.3 Routine test

The test is to verify the continuity of the **protective circuit** by injecting a current of at least 10 A at 50 Hz or 60 Hz derived from a SELV source. The tests are to be made between the PE terminal and relevant points that are part of the **protective circuit**. The test time is 1 s.

The measured voltage between the PE terminal and the points of test shall not exceed the values given in Table 11:

**Table 11 – Verification of continuity of the protective circuit**

| Minimum effective protective conductor cross-sectional area of the branch under test<br>mm <sup>2</sup> | Maximum measured voltage drop<br>(values are given for a test current of 10 A)<br>V |
|---------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| 1,0                                                                                                     | 3,3                                                                                 |
| 1,5                                                                                                     | 2,6                                                                                 |
| 2,5                                                                                                     | 1,9                                                                                 |
| 4,0                                                                                                     | 1,4                                                                                 |
| > 6,0                                                                                                   | 1,0                                                                                 |

**10.6 Cable anchorage**

Welding power sources fitted with terminals for the connection of flexible supply cables shall be provided with a cable anchorage that relieves the electrical connection from strain.

The cable anchorage shall be so constructed that

- it is dimensioned for flexible cables having the range of cross-sectional area of conductor as specified in Table E.1;
- the method of anchorage can be easily recognized;
- the cable can be easily replaced;
- the cable cannot come into contact with conductive clamping screws of the cable anchorage if these screws are accessible or in electrical contact with exposed conductive parts;
- the cable is not retained by a metal screw which bears directly on it;
- at least one part of the cable anchorage is securely fixed to the welding power source;
- any screws that need to be loosened or tightened during cable replacement do not serve to fix any other component;
- when fitted to a **class II** welding power source, it shall be made of insulating material or so insulated that, if there is a cable insulation fault, no exposed conductive parts shall become live.

Conformity shall be checked by **visual inspection** and by the following test.

A flexible supply cable, which has the minimum cross-sectional area of the conductor specified, is connected at the point of connection to the equipment. The cable anchorage is fitted to the cable and tightened.

It shall then not be possible to push the cable so far into the welding power source that either the cable itself or internal parts of the welding power source are likely to be damaged.

The cable anchorage is then loosened and retightened 10 times.

The cable is then subjected for 1 min to a pull as specified in Table 12 without jerking.

**Table 12 – Pull**

| Nominal cross-sectional<br>area of the conductor<br>mm <sup>2</sup> | Pull<br>N |
|---------------------------------------------------------------------|-----------|
| 1,5                                                                 | 150       |
| 2,5                                                                 | 220       |
| 4,0                                                                 | 330       |
| 6 and above                                                         | 440       |

At the end of the test, the cable shall not have been displaced by more than 2 mm and the ends of the conductors shall not have been noticeably displaced in the terminals. To measure the displacement, prior to the test, a mark is provided at a distance of 20 mm from the cable anchorage on the cable with the cable in the stressed condition.

After the test, the displacement of this mark in relation to the cable anchorage is measured, with the cable in the stressed condition.

During the test, no visible damage (for example nicks, cuts or tears in the sheath) shall be caused to the cable.

The test is then repeated with the maximum cross-sectional area of the conductor specified.

### 10.7 Inlet openings

Where the supply cable passes through metallic parts, it shall be provided with a bushing of insulating material, or the openings shall be smoothly rounded with a radius of at least 1,5 mm.

Conformity shall be checked by **visual inspection**.

### 10.8 Supply circuit on/off switching device

Where a built-in **supply circuit** on/off switching device (for example switch, contactor or circuit-breaker) is provided, this shall:

- switch all ungrounded mains conductors, and
- plainly indicate whether the circuit is open or closed, and either
- be rated as follows:
  - voltage: not less than the values given on the **rating plate**,
  - current: not less than the highest effective supply current as given on the **rating plate**,
  - or
- be suitable for this application.

Conformity shall be checked by **visual inspection**; for c) in accordance with other relevant standards, and for d) by the following tests.

For the tests, the **supply circuit** on/off switching devices may be mounted external to the power source.

A welding power source is connected for the **rated supply voltage** that corresponds to the **rated maximum supply current** and, in addition for **class I equipment**, a fuse of 10 A to 20 A is placed

- in the case of an earthed **supply circuit**, in the protective earth connection;
- in the case of an unearthed **supply circuit**, between a phase conductor and the **protective circuit**.

During the tests, the supply voltage shall be maintained at not less than at the **rated value**.

Overload: The output of the welding power source is short-circuited in accordance with 9.3. The switching device is operated for 100 cycles at the rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

A switching device need not be tested if its **rated value** exceeds twice the **rated maximum supply current** of the welding power source.

Endurance: The output is connected to a **conventional load** and adjusted to produce the rated **welding current** at 100 % **duty cycle**. The switching device is operated for 1 000 cycles at a rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

A welding power source with more than one **rated supply voltage** is also tested at the rated maximum supply voltage.

There shall be no electrical or mechanical failure and, in addition for **class I equipment**, no clearing of the fuse.

NOTE A component having demonstrated that it passes these tests can be used in other similar applications if the other requirements are equal or less.

## 10.9 Supply cables

When supply cables are attached to the welding power source, they shall:

- a) be suitable for the application and meet national and local regulations;
- b) be dimensioned in accordance with the **maximum effective supply current**  $I_{1\text{eff}}$ ; and
- c) have a length of at least 2 m as measured from the exit point of the enclosure.

*Conformity shall be checked by **visual inspection**.*

NOTE Examples of local regulations are given in the Bibliography, e.g. EN 50525-2-21, Electrical code NFPA 70 (SE, SO, ST, STO or other extra hard usage cable) or CSA C22.1. PVC insulation has been proven not suitable for the application.

## 10.10 Supply coupling device (attachment plug)

If a supply coupling device is provided as a part of the arc welding equipment, its **rated values** shall be not less than:

- a) the rated current of the fuse required to comply with the tests specified in 9.3 regardless of whether or not an **supply circuit** switch is incorporated;
- b) the **maximum effective supply current**  $I_{1\text{eff}}$ .

For supply networks up to 125 V, the rated current shall, additionally, not be less than either c) or d):

- c) 70 % of the **rated maximum supply current** for equipment incorporating a supply switch;
- d) 70 % of the supply current measured with the output short-circuited at maximum setting for equipment not incorporating a supply switch.

Furthermore, the coupling device shall be suitable for industrial purposes.



NOTE Example of coupling devices suitable for industrial purposes can be found in IEC 60309-1.

*Conformity shall be checked by **visual inspection**, measurement and calculation.*

## 11 Output

### 11.1 Rated no-load voltage

#### 11.1.1 Rated no-load voltage for use in environments with increased risk of electric shock

If the welding power source is not fitted with a **hazard reducing device** in accordance with Clause 13, the **rated no-load voltage** shall not exceed:

- a) DC 113 V peak;
- b) AC 68 V peak and 48 V r.m.s.

Such welding power sources may be marked with S.

*Conformity shall be checked by measurement and by analysis of the circuit and/or by failure simulation in accordance with 11.1.5.*

#### 11.1.2 Rated no-load voltage for use in environments without increased risk of electric shock

If the welding power source is not fitted with a **hazard reducing device** in accordance with Clause 13, the **rated no-load voltage** shall not exceed

- a) DC 113 V peak;
- b) AC 113 V peak and 80 V r.m.s.

*Conformity shall be checked by measurement in accordance with 11.1.5.*

#### 11.1.3 Rated no-load voltage for the use with mechanically held torches with increased protection for the operator

The **rated no-load voltage** shall not exceed

- a) DC 141 V peak;
- b) AC 141 V peak and 100 V r.m.s.

These values may only be used if the following requirements are fulfilled:

- 1) the torch shall not be hand-held;
- 2) the **no-load voltage** shall be switched off automatically when the welding is stopped;  
and
- 3) the protection against direct contact with live parts shall be given by:
  - a minimum degree of protection of IP2X,
  - or
  - a **hazard reducing device** (see Clause 13).

*Conformity shall be checked by measurement in accordance with 11.1.5, by operation and by **visual inspection**.*

#### 11.1.4 Rated no-load voltage for special processes for example plasma cutting

The **rated no-load voltage** shall not exceed 500 V peak DC.

*Conformity shall be checked by measurement in accordance with 11.1.5, by operation and by **visual inspection**, except that the series combination of the 200  $\Omega$  fixed and 5 k $\Omega$  variable resistors may be replaced by a fixed resistance of 5 k $\Omega$ .*

A **rated no-load voltage** exceeding 113 V peak DC may only be used if the following requirements are fulfilled.

- a) These **plasma cutting power sources** with their corresponding torches shall prevent the output of **no-load voltage** if the torch is disassembled or disconnected from the **plasma cutting power source**.
- b) The **no-load voltage** shall be less than 68 V peak not later than 2 s after the **control circuit** (for example start switch) is opened.
- c) The voltage between the tip of the torch and the workpiece or earth shall be less than 68 V peak not later than 2 s after both pilot and main arcs are extinguished.

The conditions for complying with these requirements shall be given in the instructions.

Such **plasma cutting power sources** may be marked with the symbol 84 of Annex L.

*Conformity shall be checked by measurement by meter or oscilloscope in parallel with 5 k $\Omega$  minimum resistance.*

#### 11.1.5 Additional requirements

The **rated no-load voltage** at all possible output settings shall not exceed the values given in 11.1.1 to 11.1.4, summarized in Table 13.

During measurement, the actual supply voltage shall not vary from the **rated supply voltage** by greater than  $\pm 6\%$ . If the **no-load voltage** varies with supply voltage, then for a variation of supply voltage greater than  $\pm 1\%$ , the **no-load voltage** shall be linearly corrected in accordance with the actual supply voltage.

**Table 13 – Summary of allowable rated no-load voltages**

| Subclause | Working conditions                                                   | Rated no-load voltage                             |
|-----------|----------------------------------------------------------------------|---------------------------------------------------|
| 11.1.1    | Environment with increased risk of electric shock                    | DC 113 V peak<br>AC. 68 V peak and 48 V r.m.s.    |
| 11.1.2    | Environment without increased risk of electric shock                 | DC 113 V peak<br>AC. 113 V peak and 80 V r.m.s.   |
| 11.1.3    | Mechanically held torches with increased protection for the operator | DC. 141 V peak<br>AC. 141 V peak and 100 V r.m.s. |
| 11.1.4    | Plasma cutting                                                       | DC 500 V peak                                     |

Welding power sources shall be

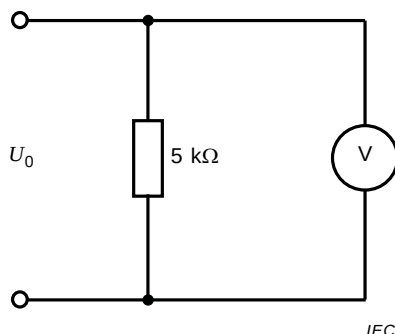
- a) designed to ensure that the output voltages given in Table 13 are not exceeded in the event of failure of any component (for example, open circuit or short circuit failure)
- or
- b) fitted with a protection system, which switches off the voltage at the output terminals within 0,3 s and shall not be reset automatically.

These values are not applicable to voltages for arc striking or arc stabilizing that could be superimposed.

*Conformity shall be checked by measurement and by analysis of the circuit and/or by failure simulation.*

### 11.1.6 Measuring circuits

For measuring r.m.s. values, a true r.m.s. meter shall be used together with a resistor of  $(5 \pm 0,25) \text{ k}\Omega$ , connected across the **welding circuit** terminals as shown in Figure 4.




**Key**

|       |                       |
|-------|-----------------------|
| $U_0$ | No-load voltage       |
| V     | True r.m.s. voltmeter |

**Figure 4 – Measurement of r.m.s. values**

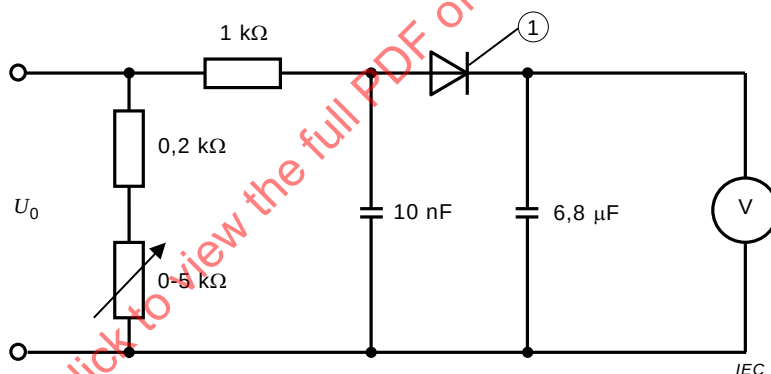To obtain reproducible measurements of peak values, omitting impulses which are not dangerous, a circuit as shown in Figure 5 shall be used.



**Key**

|       |                         |
|-------|-------------------------|
| $U_0$ | No-load voltage         |
| V     | Voltmeter               |
| 1     | Diode 1N4007 or similar |

**Figure 5 – Measurement of peak values**

The voltmeter shall indicate mean values. The measurement range chosen shall be as near as possible to the actual value of the **no-load voltage**. The voltmeter shall have an internal resistance of at least  $1 \text{ M}\Omega$ .

The tolerance of the component values in the measurement circuit shall not exceed  $\pm 5 \%$ .

For the **type test**, the rheostat is varied from  $0 \Omega$  to  $5 \text{ k}\Omega$  in order to obtain the highest peak value of the voltage measured with these loads of  $200 \Omega$  to  $5,2 \text{ k}\Omega$ . This measurement is repeated with the two connections to the measuring apparatus reversed.

The rheostat resistance and connection that produces the highest value of the voltage may be determined during the **type test**. This resistance and lead polarity may be used for the **routine test**.

## 11.2 Type test values of the conventional load voltage

### 11.2.1 Manual metal arc welding with covered electrodes

$$I_2 \text{ up to 600 A: } U_2 = (20 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 44 \text{ V}$$

### 11.2.2 Tungsten inert gas

$$I_2 \text{ up to 600 A: } U_2 = (10 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 34 \text{ V}$$

### 11.2.3 Metal inert/active gas and flux cored arc welding

$$I_2 \text{ up to 600 A: } U_2 = (14 + 0,05 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 44 \text{ V}$$

### 11.2.4 Submerged arc welding

$$I_2 \text{ up to 600 A: } U_2 = (20 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 44 \text{ V}$$

### 11.2.5 Plasma cutting

$$I_2 \text{ up to 170 A: } U_2 = (80 + 0,4 I_2) \text{ V}$$

$$I_2 \text{ between 170 A and 500 A: } U_2 = (131 + 0,1 I_2) \text{ V}$$

$$I_2 \text{ above 500 A: } U_2 = 181 \text{ V}$$

For plasma cutting, the manufacturer may specify additional **load voltages** as determined under typical cutting conditions.

NOTE The manufacturer-specified **load voltage** is used due to the nature of the plasma process. Factors that can influence the voltage at which satisfactory performance occurs include the interaction of the plasma torch design, recommended plasma gas, and standoff distance.

### 11.2.6 Plasma welding

$$I_2 \text{ up to 600 A: } U_2 = (25 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 49 \text{ V}$$

### 11.2.7 Plasma gouging

$$I_2 \text{ up to 300 A: } U_2 = (100 + 0,4 I_2) \text{ V}$$

$$I_2 \text{ over 300 A: } U_2 = 220 \text{ V}$$

For plasma gouging, the manufacturer may specify additional **load voltages** as determined under typical gouging conditions.

NOTE The manufacturer-specified **load voltage** is used due to the nature of the plasma process. Factors that can influence the voltage at which satisfactory performance occurs include the interaction of the plasma torch design, recommended plasma gas, and standoff distance.

### 11.2.8 Additional requirements

Throughout its range of adjustment, the electrically powered welding power sources shall be capable of delivering **conventional welding currents** ( $I_2$ ) at **conventional load voltages** ( $U_2$ ) in accordance with 11.2.1 to 11.2.7.

*Conformity shall be checked by sufficient measurements (see Annex H).*

### 11.3 Mechanical switching devices used to adjust output

A switch, contactor, circuit-breaker or other control device used to adjust or control the level of output from the welding power source shall have an endurance suitable for the application.

*Conformity shall be checked by the following test.*

The device is installed in a test welding power source and subjected to 6 000 cycles of operation over the complete range of mechanical movement with the output at the no-load condition. If the device is in the **supply circuit**, the welding power source is operated at the highest **rated supply voltage**. Check that no electrical or mechanical failure of the device or damage to the welding power source occurs.

NOTE A component having demonstrated that it passes these tests can be used in other similar applications, if the other requirements are equal or less.

### 11.4 Welding circuit connections

#### 11.4.1 Protection against unintentional contact

**Welding circuit** connections, with or without welding cables connected, shall be protected against unintentional contact by persons or by metal objects, for example vehicles, crane hooks, etc.

Examples of how such protection can be afforded.

- a) Any live part of a coupling device is recessed behind the plane of the access opening. Devices complying with IEC 60974-12 meet the requirement.
- b) A hinged cover or a protective guard is provided.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.2 Location of coupling devices

Uncovered coupling devices shall be located so that their openings are not tilted upwards.

NOTE Coupling devices fitted with an automatic closing device can have their openings tilted upwards.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.3 Outlet openings

Where welding cables pass through metallic parts, the edges of the opening shall be smoothly rounded with a radius of at least 1,5 mm.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.4 Three-phase multi-operator welding transformer

All welding output connections intended to be connected to the workpiece shall have a common interconnection within the welding power source.

Welding output connections of the same phase shall all be marked in the same way as each other.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.5 Marking

Connections designed specifically for attachment to the workpiece or to the electrode shall be so identified.

For DC welding power sources, the polarity shall be clearly marked, either on the welding output connections or on the polarity selector. This requirement is not relevant for **plasma cutting power sources**.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.6 Connections for plasma cutting torches

The torch shall be connected to and disconnected from the **plasma cutting power source**:

- a) within the **plasma cutting power source**, by use of a tool, by screws or coupling devices;  
or
- b) on the **plasma cutting power source**, by a coupling device which is:
  - 1) designed to avoid connection of incompatible torches  
or
  - 2) operated by use of a tool.

When the coupling device is disconnected, no voltage higher than the limits of SELV accessible to the operator shall be present.

*Conformity shall be checked by **visual inspection** and measurement.*

#### 11.5 Power supply to external devices connected to the welding circuit

When a welding power source supplies electrical power to an external device including a connection to the **welding circuit**, such power shall be supplied by one of the following:

- a) the **welding circuit**;
- b) a safety isolating transformer in accordance with IEC 61558-2-6 or equivalent means incorporated in the welding power source;
- c) an isolating transformer in accordance with IEC 61558-2-4 with a rated secondary voltage up to 120 V r.m.s. if all exposed conductive parts of the external device, as recommended by the manufacturer, are connected to the protective earth conductor that is protected against the **welding current**, for example by a current sensing relay or by insulation of the relevant metal parts, for example by an enclosure.

External devices include wire feed units, arc striking and stabilizing devices, torches, seam trackers or other devices containing a connection to the **welding circuit**.

*Conformity shall be checked by **visual inspection** and fault simulation.*

#### 11.6 Auxiliary power supply

In the case of welding power sources designed to supply electrical power to external devices which are not a part of the **welding circuit** (for example for lighting, external cooling system or electric tools), these auxiliary circuits and accessories shall comply with the standards and regulations relating to the use of these external devices.

The **welding circuit** shall be isolated from such **supply circuits** in accordance with 6.2.4 and 6.3.2.

Near the socket-outlet of the auxiliary power supply, the available current, voltage, **duty cycle** if less than 100 %, AC or DC and the status of the neutral (for example earthed or unearthed) as appropriate, shall be clearly and indelibly marked.

*Conformity shall be checked by **visual inspection** during the tests in accordance with 6.1.4, 6.1.5, 6.2.4 and 6.3.2 and by rubbing the marking in accordance with 15.1.*

## 11.7 Welding cables

If a welding power source is supplied with welding cables, they shall meet the requirements of IEC 60245-6 or meet national and local regulations.

If a **plasma cutting power source** is supplied with welding cables, they shall meet the current and **no-load voltage** ratings suitable for the application and meet national and local regulations.

NOTE 1 Example or local regulations are given in Bibliography, e.g. EN 50525-2-81:2011. Additional information about the current carrying capability of welding cables can be found in EN 50565-1:2014.

NOTE 2 PVC insulation has been proved not suitable for the application and is not recognised in welding cable product standards of IEC or CENELEC.

NOTE 3 The rated voltage of welding cables complying with IEC 60245-6 is typically not suitable for plasma cutting applications.

## 12 Control circuits

### 12.1 General requirement

All inputs and outputs of **control circuits** shall be tested at the maximum load as specified by the manufacturer. **Remote control** circuits may be tested without connection to the power source, provided that the power source can be simulated.

*Conformity shall be checked by measurement or analysis, as appropriate.*

### 12.2 Isolation of control circuits

A **control circuit** that leaves the enclosure that has a voltage lower than the allowable **no-load voltage** in accordance with 11.1.1, and that is separated from the **welding circuit** and **supply circuit** shall be:

- insulated from the **supply circuit** by double or **reinforced insulation**,
- insulated from all other circuits having a voltage higher than the allowable **no-load voltage** in accordance with 11.1.1 (e.g. auxiliary power **supply circuits**, plasma cutting circuit) by double or **reinforced insulation** and
- insulated from the **welding circuit** having a voltage lower than the allowable **no-load voltage** in accordance with 11.1.1 by **basic insulation**.

NOTE Example of insulation configuration for **Class I equipment** is given in 6.1.1.

*Conformity shall be checked by measurement or analysis, as appropriate.*

### 12.3 Working voltages of remote control circuits

The **working voltages** in **remote control** circuits that are designed to be handheld shall not exceed 50 V AC or 120 V ripple free DC between conductors, or between any conductor and **protective circuit**, under normal operating conditions and after a single fault.

NOTE **Working voltage** requirements for local or wide area computer networks are contained in IEC 60950-1.

*Conformity shall be checked by measurement or analysis, as appropriate.*

## 13 Hazard reducing device

### 13.1 General requirements

A **hazard reducing device** shall reduce the severity of the electric shock that can originate from **no-load voltages** exceeding the allowable **rated no-load voltage** for a given environment. Types of **hazard reducing devices** are given in 13.2.

Requirements are given in Table 14.

**Table 14 – Hazard reducing device requirements**

| Unreduced no-load voltage in accordance with subclause                           | Reduced no-load voltage in accordance with subclause | Operating time<br>s |
|----------------------------------------------------------------------------------|------------------------------------------------------|---------------------|
| Between 11.1.3 and 11.1.2                                                        | 11.1.1                                               | 0,3                 |
| Between 11.1.2 and 11.1.1                                                        | 11.1.1                                               | 2                   |
| For DC welding power source above 113 V, an operating time of 0,3 s is required. |                                                      |                     |

### 13.2 Types of hazard reducing devices

#### 13.2.1 Voltage reducing device

A voltage reducing device shall have automatically reduced the **rated no-load voltage** to a level not exceeding the values of 11.1.1 at the moment the resistance of the external **welding circuit** exceeds 200  $\Omega$ . The operating time is specified in Table 14.

Such welding power sources may be marked with the symbol 84 of Annex L.

*Conformity shall be checked by connecting a variable load resistor across the welding output connections of the welding power source. Voltage measurements and operating time are taken while the resistance is being increased.*

#### 13.2.2 Switching device for AC to DC

A switching device for AC to DC shall have automatically switched the rated AC **no-load voltage** to a rated DC **no-load voltage** not exceeding the values given in 11.1.1 at the moment the resistance of the external **welding circuit** exceeds 200  $\Omega$ . The operating time is specified in Table 14.

Such welding power sources may be marked with the symbol 84 of Annex L.

*Conformity shall be checked in accordance with 13.2.1.*

### 13.3 Requirements for hazard reducing devices

#### 13.3.1 Disabling the hazard reducing device

The design shall be such that the operator cannot disable or by-pass the **hazard reducing device** without the use of a tool.

*Conformity shall be checked by **visual inspection**.*



### 13.3.2 Interference with operation of a hazard reducing device

**Remote controls**, as specified by the manufacturer, and arc striking or arc stabilizing devices of the welding power source shall not interfere with the proper functioning of the **hazard reducing device**, i.e. **no-load voltage** limits shall not be exceeded.

*Conformity shall be checked by repeating the tests of 13.2.1 with any of the devices that could interfere with the operation of the **hazard reducing device**.*

### 13.3.3 Indication of satisfactory operation

A reliable device, for example a signal lamp, shall be provided which indicates that the **hazard reducing device** is operating satisfactorily. Where a signal lamp is used, it shall light when the voltage has been reduced or changed to DC.

*Conformity shall be checked by **visual inspection** during the test in accordance with 13.1.*

### 13.3.4 Fail to a safe condition

If the **hazard reducing device** fails to operate in accordance with 13.1, the voltage at the output terminals shall be reduced to a level not exceeding 11.1.1 in accordance with Table 14 and shall not be reset automatically.

*Conformity shall be checked by simulating a fault of the **hazard reducing device** and measuring the time to reach a safe condition after failure of the **hazard reducing device**.*

## 14 Mechanical provisions

### 14.1 General requirements

Equipment shall be constructed and assembled so that it has the strength and rigidity necessary to withstand the normal service to which it is likely to be subjected, without increasing the risk of electric shock or other hazards whilst maintaining the minimum **clearances** required. Equipment shall be provided with a case or cabinet that encloses all live and hazardous moving parts (such as pulleys, belts, fans, gears etc.) except that the following need not be fully enclosed:

- a) supply, control and welding cables;
- b) output terminals for the connection of welding cables.

After the tests in accordance with 14.2 to 14.5, the equipment shall comply with the provisions of this document. Some deformation of the structural parts or enclosure is permitted provided this does not reduce the level of safety protection.

Accessible parts shall have no sharp edges, rough surfaces or protruding parts likely to cause injury.

*Conformity shall be checked by **visual inspection** after meeting the requirements of 14.2 to 14.5.*

### 14.2 Enclosure

#### 14.2.1 Enclosure materials

Non-metallic materials intended to protect from contact with live parts, except welding and SELV circuits, shall have a flammability classification of V-1 or better in accordance with IEC 60695-11-10.

*Conformity is checked by inspection of non-metallic materials specification.*

#### 14.2.2 Enclosure strength

The enclosure, including air louvers, shall withstand an impact energy of 10 Nm in accordance with Annex I.

Handles, push buttons, adjustment dials etc. shall not be tested with the pendulum hammer.

Alternatively, the enclosure may be constructed of sheet metal with a minimum thickness in accordance with Annex J.

*Conformity shall be checked in accordance with a) or b) below.*

- a) By an impact test using a pendulum impact hammer in accordance with I.1 or using a free fall weight in accordance with I.2 or equivalent means as follows:
  - 1) one sample is tested;
  - 2) the welding power source is not energized during the test;
  - 3) select one impact point on each side, where risk of electrical shock or malfunction is highest;
  - 4) apply three impacts to selected impact points.
- b) By measurement of the thickness of the sheet metal.

#### 14.3 Handling means

##### 14.3.1 Mechanised handling

If means for mechanical handling are provided (for example eyelet or lug) for the purpose of lifting an assembled equipment, these shall be capable of withstanding the mechanical stress of a static pull with a force calculated from the mass of the assembled equipment as follows.

- a) For equipment with a mass of up to 150 kg, a force calculated from 10 times the mass shall be used.
- b) For equipment with a mass of greater than 150 kg, a force calculated from four times the mass or at least 15 kN shall be used.

If only a single lifting means is provided, it shall be designed so that a torque applied during lifting cannot cause it to be loosened.

*Conformity shall be checked by **visual inspection** and by the following test.*

The equipment is fitted with all the associated attachments, (excluding gas cylinders, separate trailers, carts and wheel undercarriages) that are likely to be installed and, in the case of engine-driven welding power sources, completely serviced and ready for operation. The equipment is anchored rigidly at its base and a chain or cable is attached to its lifting means, as recommended by the manufacturer, and an upward force is then exerted continuously for 10 s.

If two or more lifting means are provided, the chains or cables are arranged so that the force is equally shared between them and is applied at an angle not greater than 15° to the vertical.

##### 14.3.2 Manual handling

If means for manual handling are provided for lifting or carrying (for example handles, straps), these shall be capable of withstanding the mechanical stress of a static pull with a force calculated from the mass of the assembled equipment as follows.

A force calculated from four times the mass or at least 600 N shall be used.

*Conformity shall be checked by **visual inspection** and by the following test.*

The equipment is fitted with all the associated attachments, (excluding gas cylinders, separate trailers, carts and wheel undercarriages) that are likely to be installed. The equipment is anchored rigidly at its base and a chain or cable is attached to its handles or strap, as recommended by the manufacturer, and an upward force is then exerted continuously for 10 s.

#### 14.4 Drop withstand

Equipment shall be capable of withstanding a drop test. For this test, the equipment shall be equipped with all the associated attachments, cooling liquid and filler wire (excluding gas cylinders, separate trailers, carts and wheel undercarriages, unless these items are standard equipment and permanently affixed) that are recommended to be installed.

The heights for the drop test shall be as follows:

- a) equipment with a mass of up to 25 kg shall withstand a drop of  $250^{+10}_0$  mm;
- b) equipment with a mass of greater than 25 kg shall withstand a drop of  $100^{+10}_0$  mm.

NOTE 1 Mass of equipment includes mass of associated attachments, cooling liquid and filler wire.

*Conformity shall be checked by dropping the equipment three times on a hard and rigid surface. This test is so arranged that a different bottom edge of the equipment is struck each time it drops.*

NOTE 2 In practice, one corner will touch the impact surface first.

Engine-driven welding power sources shall be filled up and be ready for immediate use.

#### 14.5 Tilting stability

Equipment in its most unstable position shall not topple over when tilted up to 10°. Auxiliary items as specified by the manufacturer in accordance with the type of the equipment such as gas cylinders, wire feed unit or cooling device could affect the stability, and these shall be taken into account.

If the manufacturer specifies other auxiliary items, so that the requirement of this subclause cannot be met, then instructions shall be provided for anchorage or other means as necessary.

*Conformity shall be checked by the following test.*

The equipment is placed on a plane and tilted from the horizontal level.

### 15 Rating plate

#### 15.1 General requirements

A clearly and indelibly marked **rating plate** shall be fixed securely to or printed on each welding power source.

NOTE The purpose of the **rating plate** is to indicate to the user the electrical characteristics, which enables the comparison and correct selection of welding power sources.

Conformity shall be checked by **visual inspection** and by rubbing the marking by hand for 15 s with a piece of cloth soaked with water and again for 15 s with a piece of cloth soaked with petroleum spirit.

After this test, the marking shall be easily legible. It shall not be easy to remove the **rating plate** and it shall show no curling.

## 15.2 Description

The **rating plate** shall be divided into sections containing information and data for the

- a) identification;
- b) welding output;
- c) energy supply.

The arrangement and sequence of the data shall comply with the principle shown in Figure 6 (for examples, see Annex K).

The dimensions of the **rating plate** are not specified and may be chosen freely.

It is permissible to separate the above sections from each other and affix them at locations more accessible or convenient for the user.

For welding power sources to be used for several welding processes or for rotating welding power sources, either one combined or several separate **rating plate(s)** may be used.

NOTE Additional information can be given. Further useful information, for example **class of insulation**, **pollution degree** or power factor, can be given in technical literature supplied by the manufacturer (see 17.1).

|                   |            |        |               |      |
|-------------------|------------|--------|---------------|------|
| a) Identification |            |        |               |      |
| 1)                |            |        |               |      |
| 2)                |            | 3)     |               |      |
| 4) Optional       |            | 5)     |               |      |
| b) Welding output |            |        |               |      |
| 6)                | 8)         | 10)    |               |      |
|                   |            | 11)    | 11a)          | 11b) |
|                   |            |        |               | 11c) |
| 7)                | 9)         | 12)    | 12a)          | 12b) |
|                   |            |        |               | 12c) |
|                   |            | 13)    | 13a)          | 13b) |
|                   |            |        |               | 13c) |
| c) Energy supply  |            |        |               |      |
| 14)               | 15) or 18) | 16)    | 17)           |      |
|                   | or 19)     | or 20) | If applicable |      |
|                   |            |        | or 21)        |      |
| 22)               | Optional   | 23)    | If applicable |      |

IEC

Figure 6 – Principle of the rating plate

### 15.3 Contents


The following explanations refer to the numbered boxes shown in Figure 6.

#### a) Identification

- Box 1 Name and address of the manufacturer or distributor or importer and, optionally, a trade mark and the country of origin, if required.
- Box 2 Type (identification) as given by the manufacturer.
- Box 3 Traceability of design and manufacturing data, for example serial number.
- Box 4 Welding power source symbol (optional) for example:




Single-phase transformer




Three-phase transformer-rectifier




Single- or three-phase static frequency converter-transformer-rectifier




Inverter power source with AC and DC output




Three-phase motor-generator



Three-phase motor-generator-rectifier




Three-phase rotating frequency converter



Single-phase combined AC and DC power source



Engine-AC generator



Engine-generator-rectifier

- Box 5 Reference to the standards confirming that the welding power source complies with their requirements.

#### b) Welding output

- Box 6 Welding process symbol for example:



Manual metal arc welding with covered electrodes



Tungsten inert-gas welding



Metal inert and active gas welding including the use of flux cored wire



Self shielded flux cored arc welding



Submerged arc welding



Plasma cutting



Plasma gouging



Plasma welding

Box 7



Mark for welding power sources which are suitable for supplying power to welding operations carried out in an environment with increased risk of electric shock (if applicable).

NOTE 1 In addition, this symbol, of a suitable size, can be displayed on the front of the welding power source.

Box 8

Welding current symbol for example:



Direct current



Alternating current, and additionally the rated frequency in hertz for example: ~50 Hz



Direct and alternating current at the same output, and additionally the rated frequency in hertz

Box 9

$U_0$ ... V Rated no-load voltage

- 1) peak value in case of direct current;
- 2) r.m.s. value in case of alternating current.

NOTE 2 If a welding power source is fitted with a **hazard reducing device**, this is the voltage measured before the **hazard reducing device** has performed its function.

If several **no-load voltages** are adjustable, their range shall be given by the rated minimum and maximum **no-load voltage**.

Additionally, the following shall be given.

- 3)  $U_r$ ... V reduced rated no-load voltage in case of a voltage reducing device;  
4)  $U_s$ ... V switched rated no-load voltage in case of an AC to DC switching device.

Box 10 ... A/... V to... A/... V Range of output, minimum welding current and its corresponding conventional load voltage or less, maximum welding current and its corresponding conventional load voltage or greater.

Box 11  $X$  Duty cycle symbol.

Box 12  $I_2$  Rated welding current symbol.

Box 13  $U_2$  Conventional load voltage symbol.

Boxes 11a, 11b, 11c ... % Values of the duty cycle at an ambient temperature of 40 °C.

12a, 12b, 12c ... A Values of the rated welding current.

13a, 13b, 13c ... V Values of the conventional load voltage.

These boxes form a table with corresponding values of the three settings:


- 1) ... % duty cycle at the rated maximum welding current;
- 2) 60 % duty cycle;  
and
- 3) 100 % duty cycle as far as relevant.

Column a) need not be used if the duty cycle for the rated maximum welding current is 60 % or 100 %.

Column b) need not be used if the duty cycle at the rated maximum welding current is 100 %.

### c) Energy supply

Box 14 Energy supply symbol, for example:



Supply circuit, number of phases (for example 1 or 3), symbol for alternating current and the rated frequency (for example 50 Hz or 60 Hz)



Engine



Motor



Belt drive

| Box                                                    | Electrically powered welding power sources |                                  | Box | Mechanically powered welding power sources |                                          |
|--------------------------------------------------------|--------------------------------------------|----------------------------------|-----|--------------------------------------------|------------------------------------------|
| 15                                                     | $U_1 \dots$ V                              | Rated supply voltage             | 18  | $n \dots$ min <sup>-1</sup>                | Rated load speed                         |
| 16                                                     | $I_{1max} \dots$ A                         | Rated maximum supply current     | 19  | $n_0 \dots$ min <sup>-1</sup>              | Rated no-load speed                      |
| 17                                                     | $I_{1eff} \dots$ A                         | Maximum effective supply current | 20  | $n_i \dots$ min <sup>-1</sup>              | Rated idle speed, if applicable          |
| Boxes 15 to 17 form a table with corresponding values. |                                            |                                  | 21  | $P_{1max} \dots$ kW                        | Maximum power consumption, if applicable |

Box 22 IP.. Degree of protection, for example IP21 or IP23.

Box 23  Symbol for class II equipment, if applicable.

Conformity shall be checked by **visual inspection** and by checking of complete data.

#### 15.4 Tolerances

Manufacturers shall meet **rating plate** values within the following tolerances by controlling component and manufacturing tolerances:

- $U_0$  rated no-load voltage in V  $\pm 5$  % measured in accordance with 11.1, but in no case shall the values summarized in Table 13 be exceeded;
- $I_{2min}$  rated minimum welding current in A;  
 $U_{2min}$  minimum conventional load voltage in V;  
 The values of b) shall not be greater than those stated on the rating plate.
- $I_{2max}$  rated maximum welding current in A;  
 $U_{2max}$  maximum conventional load voltage in V;  
 The values of c) shall not be less than those stated on the rating plate.
- $n_0$  rated no-load speed of rotation in min<sup>-1</sup>  $\pm 5$  %;
- $P_{1max}$  maximum power consumption in kW  $^{+10}_0$  %;
- $I_{1max}$  rated maximum supply current in A  $\pm 10$  %.
- The efficiency measured on any equipment connected to the supply network shall not be less than the reported value. **Idle state** power consumption shall not be greater than the reported value.

Conformity shall be checked by measuring under **conventional welding conditions** (see 3.17).

#### 15.5 Direction of rotation

If necessary, the direction of rotation shall be indicated on rotating welding power sources.

Conformity shall be checked by **visual inspection**.

### 16 Adjustment of the output

#### 16.1 Type of adjustment

If the welding power source has a means to adjust the output current, output voltage or both, the adjustment may be continuous, step-by-step, or both.



In the case of a continuous adjustment with several ranges, there shall be no gap between the ranges.

*Conformity shall be checked by measuring.*

## 16.2 Marking of the adjusting device

The output of the welding power source corresponding to different control settings shall be clearly and indelibly marked either on or by the controls, or displayed digitally.

With the exception of welding power sources that are set or adjusted with or by means of a digital read-out, the following shall apply.

- a) The setting indications on the scales or control tables shall take into account the relationship between the **conventional load voltage** and the **conventional welding current**.
- b) Each position in the case of a step-by-step adjustment or each major graduation in the case of a continuous adjustment shall be clearly marked with
  - 1) a numerical indication of the controllable parameters;  
or, where this is not possible,
  - 2) an alphanumeric marking.In case 2), a table on the apparatus or in the instructions shall indicate, for each control position, the nominal value of the (control) parameter.
- c) In the case of multiple range adjustment, maximum and minimum values for each range shall be given.
- d) Welding power sources designed for use with more than one process, for which the **conventional load voltage** differs, shall be marked with a separate control scale for each process. If this is not possible, alphanumeric marks as given in b) shall be used.
- e) Where the welding power source is designed so that it can be supplied at several **rated supply voltages** and where, for the same control position, the numerical values of the welding parameters are not the same, separate scales or a separate series of alphanumeric markings shall be fitted.

*Conformity shall be checked by **visual inspection**.*

## 16.3 Indication of current or voltage control

Where there is a voltage or current control, the output setting shall be indicated in volts, amperes or an arbitrary reference scale.

The accuracy of voltage or current indication shall be

- a) between 100 % and 25 % of the maximum setting  $\pm 10$  % of the true value;
- b) below 25 % of the maximum setting  $\pm 2,5$  % of the maximum setting.

If the manufacturer provides an ammeter or a voltmeter on the equipment, this shall be of class 2,5 and be properly damped.

*Conformity shall be checked by measurement and **visual inspection**.*

## 17 Instructions and markings

### 17.1 Instructions

Each welding power source shall be delivered with instructions which shall include the following (as applicable):

- a) general description;
- b) mass of the welding power source and its various parts and correct methods of handling them, for example by fork-lift or crane, and precautions to be taken with gas cylinders, wire feeders, etc.;
- c) the meaning of indications, markings and graphical symbols;
- d) information for selection and connection to the supply network (for example suitable supply cables, connection devices or attachment plugs, including the type and rated values for RCD, fuse or circuit-breaker, see also caution of 6.1.1) by qualified personnel in accordance with relevant national and local regulations;

NOTE Some national and local regulations require use of RCDs. Types of RCDs and their use are given in Annex B of IEC TR 60755:2008. Only Type B" RCDs provide protection where **supply circuit** DC fault currents are likely to occur.

- e) correct operational use relating to the welding power sources (for example cooling requirements, location, control device, indicators, fuel type);
- f) welding capability, **static characteristic** (drooping and/or flat), **duty cycle** (duty factor) limitations and explanation of **thermal protection** if relevant;
- g) limitations of use relating to the degree of protection provided, for example welding power sources are not suitable for use in rain or snow;
- h) basic guidelines regarding protection against personal hazards for operators and persons in the work area (for example electric shock, fumes, gases, arc rays, hot metal, sparks, noise, back injury during manual handling);
- i) conditions under which extra precautions are to be observed when welding or cutting (for example environment with increased risk of electric shock, flammable surroundings, flammable products, closed containers, elevated working positions, etc.);
- j) how to maintain the welding power source, such as recommended cycles for partial and complete test and other operation (for example cleaning);
- k) a list of parts typically replaced due to wear;
- l) information on supply of electrical power to external devices, for example for lighting or electric tools;
- m) precautions against toppling over, if the welding power source shall be placed on tilted plane;
- n) warning against the use of a welding power source for pipe thawing;
- o) type (identification) of plasma cutting torches that are specified for use with the **plasma cutting power source**;
- p) pressure, flow rate and type of plasma gas and if relevant, of cooling gas or cooling liquid;
- q) steps or range of the output current and the corresponding plasma gas as a set of values;
- r) EMC classification in accordance with IEC 60974-10;
- s) for an engine-driven welding power source, warning against the carbon monoxide component of engine exhaust (example of National Labelling Regulation is given in *US Code of Federal Regulations, Title 16, Parts 1407*).

Other useful information may also be given, for example **class of insulation**, **pollution degree**, efficiency (see Annex M), etc.

*Conformity shall be checked by reading the instructions.*

## 17.2 Markings

Each welding power source shall be clearly and indelibly marked on or near the front panel or near the ON/OFF switching device with the following combination of symbols to signify “Caution! Read instruction manual”:



This marking shall also be used near the torch connector of plasma cutting power sources indicating that the operator should read the instruction manual before selecting and connecting a torch. A single marking readily visible within operator line of sight to the front panel, ON/OFF switching device and torch connector is permitted.

The following equivalent wording may be used:

**Warning:** Read instruction manuals before operating and servicing this equipment.

For other additional markings, see Annex L.

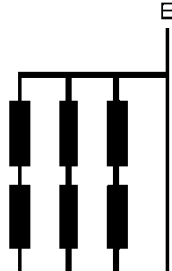
NOTE Precautionary labels appearing on power sources can consist of text only, text and symbols, or symbols only. Symbols-only precautionary labels are specified in ISO 17846.

*Conformity shall be checked by **visual inspection** and by testing in accordance with the durability test in 15.1.*

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annex A (informative)

### Nominal voltages of supply networks


| Voltage line-to-neutral derived from nominal voltages AC or DC up to and including | Nominal voltages presently used in the world                                      |                                                                                   |                                                                                    |                                                                                     |
|------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
|                                                                                    | Three-phase four-wire systems with earthed neutral                                | Three-phase three-wire systems earthed or unearthed (E)                           | Single-phase two-wire systems AC or DC                                             | Single-phase three-wire systems AC or DC                                            |
| V                                                                                  |  |  |  |  |
| 50                                                                                 |                                                                                   |                                                                                   | 12,5<br>25<br>42                                                                   | 24<br>30<br>48                                                                      |
| 100                                                                                | 66/115                                                                            | 66                                                                                | 60                                                                                 |                                                                                     |
| 150                                                                                | 120/208 <sup>a</sup> ,<br>127/220                                                 | 115, 120, 127                                                                     | 100 <sup>b</sup> ,<br>110, 120                                                     | 100-200 <sup>b</sup> ,<br>110-220,<br>120-240                                       |
| 300                                                                                | 220/380, 230/400,<br>240/415, 260/440,<br>277/480                                 | 200 <sup>b</sup> , 220,<br>230, 240,<br>260, 277                                  | 220                                                                                | 220-440                                                                             |
| 600                                                                                | 347/600, 380/660,<br>400/690, 417/720,<br>480/830                                 | 347, 380, 400,<br>415, 440, 480<br>500, 577, 600                                  | 480                                                                                | 480-960                                                                             |
| 1 000                                                                              |                                                                                   | 660,<br>690, 720,<br>830, 1 000                                                   | 1 000                                                                              |                                                                                     |
| NOTE 1 Values taken from Table B.2 of IEC 60664-1:2007.                            |                                                                                   |                                                                                   |                                                                                    |                                                                                     |
| NOTE 2 "E" means "earthed".                                                        |                                                                                   |                                                                                   |                                                                                    |                                                                                     |
| <sup>a</sup> Common practice of the United States of America and Canada.           |                                                                                   |                                                                                   |                                                                                    |                                                                                     |
| <sup>b</sup> Common practice of Japan.                                             |                                                                                   |                                                                                   |                                                                                    |                                                                                     |

## Annex B (informative)
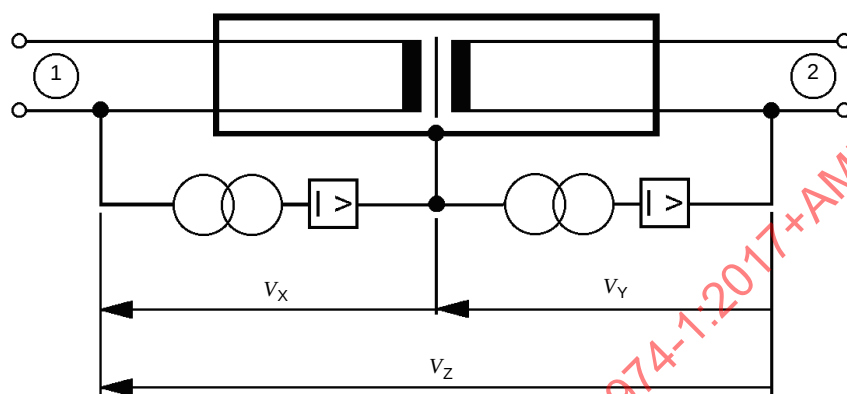
### Example of a combined dielectric test

Two high voltage transformers may be connected in series, correctly phased.

The common connection is to exposed conductive parts (see Figure B.1).



IEC

#### Key



Current sensing tripping device



Supply circuit



Welding circuit

$V_x$  Supply circuit to exposed conductive parts

$V_y$  Welding circuit to exposed conductive parts

$V_z$  Supply circuit to welding circuit

Figure B.1 – Combined high-voltage transformers

## Annex C (normative)

### Unbalanced load in case of AC tungsten inert-gas welding power sources

#### C.1 General

The difference in emissivity between the electrode and the workpiece in AC tungsten inert-gas welding causes an unbalanced welding voltage and a corresponding unbalance in the **welding current**.

This unbalance is called the DC component, and can cause saturation of the transformer of a transformer type welding power source. Such saturation will cause an abnormally high supply current that could cause severe over-heating.

Figure C.1 shows that the **welding current** has a DC component  $\bar{I}_2$  that may overheat the winding of the welding power source.


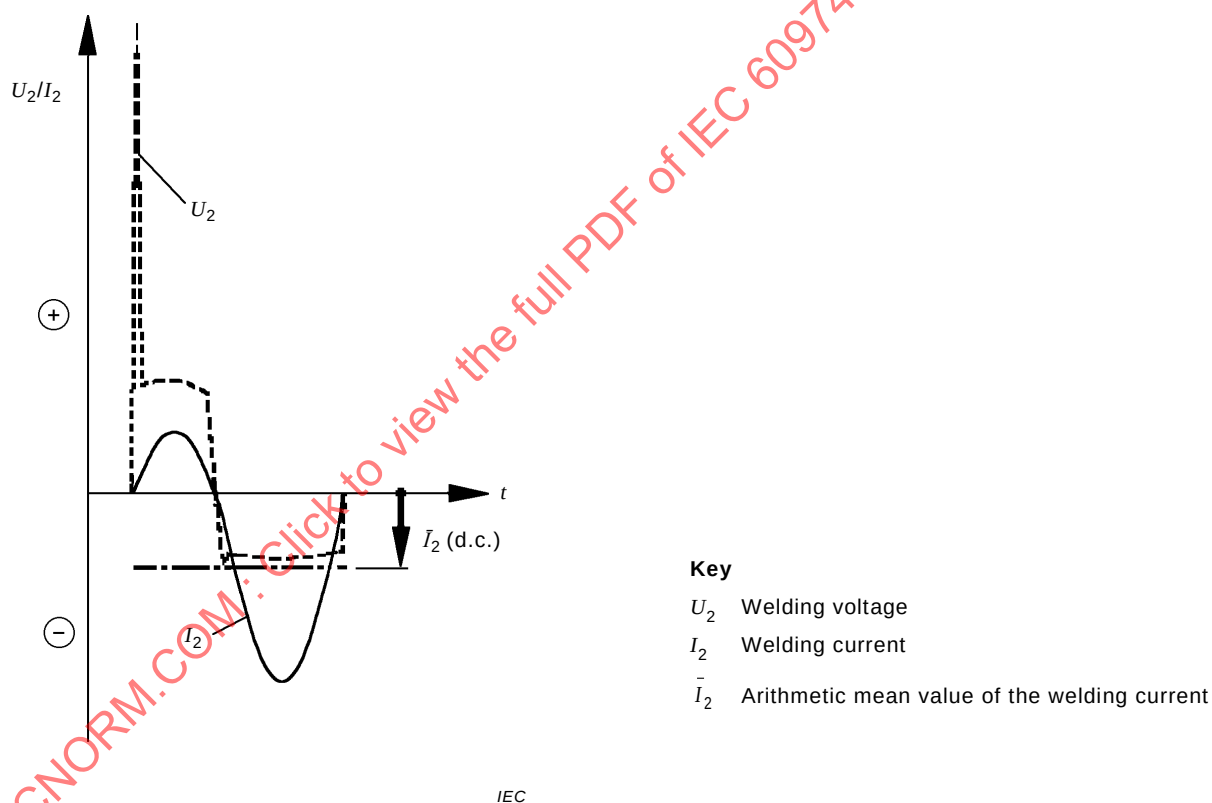


Figure C.1 – Voltage and current during AC tungsten inert-gas welding

#### C.2 Unbalanced load

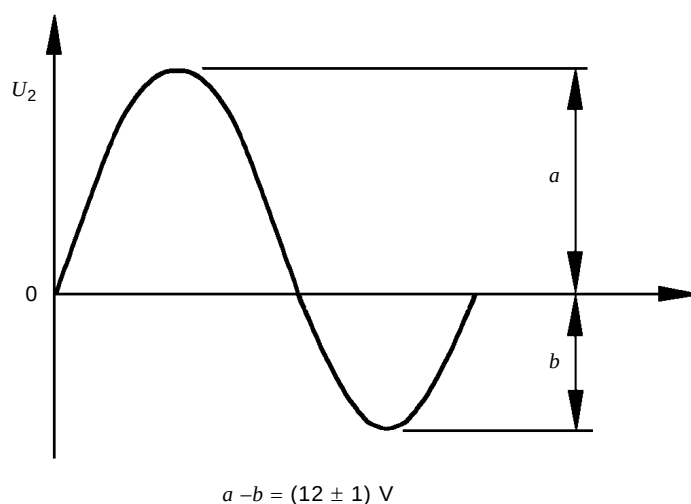To simulate the required **welding currents** for the heating test, a **conventional load** shall be used with a partial rectifying characteristic, so that if the polarity of the electrode is negative, the half-cycle voltage shall be  $(12 \pm 1)$  V less than the half-cycle voltage if the polarity of the electrode is positive (see Figure C.2).



#### Key

- $a$  peak voltage value when electrode is positive
- $b$  peak voltage value when electrode is negative

**Figure C.2 – Unbalanced voltage during AC tungsten inert-gas welding**

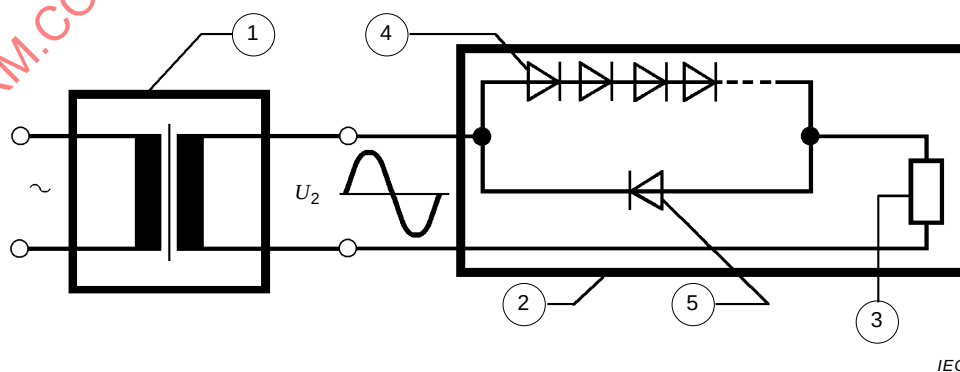
This difference of the half-cycle welding voltages is determined by passing a DC test current through the unbalanced load in both directions and measuring the DC **load voltage**.

Welding power sources that incorporate a balance control are tested with a **conventional load**, but with the balance control set to the condition producing the maximum unbalance, but not higher than 12 V.

### C.3 Example for an unbalanced load

The rectifying characteristic of the load is achieved by a circuit of diodes in accordance with Figure C.3.

The required voltage difference between the half-cycle voltages is adjusted by the numbers of diodes in the string.



#### Key

- |                   |                     |                |
|-------------------|---------------------|----------------|
| 1 Transformer     | 3 Conventional load | 5 Single diode |
| 2 Unbalanced load | 4 Series of diodes  |                |

**Figure C.3 – AC welding power source with unbalanced load**

## **Annex D**

(informative)

### **Extrapolation of temperature to time of shutdown**

When the temperature at the instant of shutdown cannot be recorded, it is necessary to use an extrapolation to obtain this temperature. The procedure for such extrapolation is as follows:

- a) the time is marked at the instant of shutdown;
- b) successive temperature readings are taken, and the elapsed time from shutdown noted for each;
- c) a minimum of four readings is taken for each temperature to be extrapolated;
- d) using logarithmic/linear graph paper, the readings are plotted so that the temperature is against the logarithmic scale, and the time from shutdown against the linear scale. A straight line extending back to  $t = 0$  will give the extrapolated temperature at shutdown.

Alternative: A mathematical regression analysis can be used as an alternative to the graphical method. If a linear regression is chosen, then the logarithms of the temperatures are used with the linear values of the reading times from the instant of shutdown. The regression analysis is solved for the time  $t = 0$  and the antilogarithm taken to find the true temperature.

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV



## Annex E (normative)

### Construction of supply circuit terminals

#### E.1 Size of terminals

The terminals shall be dimensioned in accordance with the **maximum effective supply current**  $I_{1\text{eff}}$  and it shall be possible to connect flexible conductors with cross-sectional areas as given in Table E.1. These values are based on wire rated at 60 °C.

**Table E.1 – Range of conductor dimensions to be accepted by the supply circuit terminals**

| Maximum effective supply current<br>A | Range of cross-sectional area of the conductor<br>mm <sup>2</sup> |
|---------------------------------------|-------------------------------------------------------------------|
| 10                                    | 1,5 to 2,5                                                        |
| 16                                    | 1,5 to 4                                                          |
| 25                                    | 2,5 to 6                                                          |
| 35                                    | 4 to 10                                                           |
| 50                                    | 6 to 16                                                           |
| 63                                    | 10 to 25                                                          |
| 80                                    | 16 to 35                                                          |
| 100                                   | 25 to 50                                                          |
| 125                                   | 35 to 70                                                          |
| 160                                   | 50 to 95                                                          |
| 200                                   | 70 to 120                                                         |
| 250                                   | 95 to 150                                                         |
| 315                                   | 120 to 240                                                        |
| 400                                   | 150 to 300                                                        |

Alternative cross-section ranges are permitted if the manufacturer indicates in the instructions the type and size of wire to be used.

*Conformity shall be checked by calculation and measurement.*

#### E.2 Connections at the terminals

Connections at the terminals shall be made by means of screws, nuts or other equivalent means and shall comply with the requirement given in 5.3.

NOTE Electrical quick-connect terminals are considered equivalent when fitted with two independent fixings, one clamping the insulation and the other clamping the conductor.

The terminal screws or nuts shall not be used to secure other parts or to connect other conductors.

*Conformity shall be checked by **visual inspection**.*

### E.3 Construction of the terminals

Conductors or their lugs shall be clamped between metallic parts and shall not be able to escape when the clamping means are tightened.

Live parts that can turn and reduce the **clearance** shall not rely on friction between mounting surfaces to prevent turning. A suitable lock washer, properly applied, shall be acceptable. Leads or busbars that are secured by other means need not have a lock washer.

Iron or steel, plain or plated, shall not be used for current carrying parts.

*Conformity shall be checked by **visual inspection** and by the temporary connection of conductors with the minimum and maximum cross-sectional area specified.*

### E.4 Fixing of the terminals

The terminals shall be securely fixed so that they cannot work loose when the clamping means are tightened or loosened. Furthermore, if friction alone is relied on to prevent turning or shifting of the terminals on the supporting surface, the **clearances** shall not be reduced below the values of Table 1 by shifting or turning. A pressure terminal connector need not be prevented from turning provided no **clearances** less than those required result when the terminals are turned 30° towards each other, or towards other uninsulated parts of opposite polarity, or towards grounded metal parts.

*Conformity shall be checked by **visual inspection** and by tightening and loosening 10 times the clamping means holding a conductor of the maximum cross-sectional area specified.*

The test shall be repeated using a conductor of the minimum cross-sectional area specified.

## Annex F (informative)

### Cross-reference to non-SI units

Cross references to non-SI units for short-circuit test (see 9.3) are given in Table F.1.

**Table F.1 – Cross-reference for mm<sup>2</sup> to American wire gauge (AWG)**

| mm <sup>2</sup> | AWG     |
|-----------------|---------|
| 1,5             | 15      |
| 2,5             | 13      |
| 4               | 11      |
| 6               | 9       |
| 10              | 7       |
| 16              | 5       |
| 25              | 3       |
| 35              | 1       |
| 50              | 1/0     |
| 70              | 2/0     |
| 95              | 3/0     |
| 120             | 250 MCM |
| 150             | 350 MCM |
| 240             | 600 MCM |
| 300             | 700 MCM |

## Annex G (informative)

### Suitability of supply network for the measurement of the true r.m.s. value of the supply current

The peak and r.m.s. values of the supply current ( $I_1$ ) can be substantially affected by the supply network impedance ( $R_s$ ). To obtain valid measurements, the supply network impedance is 4 % or less than the input impedance of the welding power source:

$$R_s \leq 0,04 \frac{U_1}{I_1} (\Omega) \quad (G.1)$$

where

$R_s$  is the impedance of the supply network in ohms;

$U_1$  is the **rated supply voltage** in volts;

$I_1$  is the **rated supply current** in amperes.

To determine the impedance of the supply network, it is loaded by a **conventional load** that is able to reduce the supply voltage at least 1 % below the unloaded value.

NOTE 1 If the rated voltage of this **conventional load** is lower than the supply voltage, a transformer can be used.

NOTE 2 Automatic supply network voltage regulators are turned off.

NOTE 3 If a transformer is used  $I_{1 \text{ unloaded}}$  is the no-load current of that transformer, otherwise  $I_{1 \text{ unloaded}} = 0 \text{ A}$ .

The impedance of the supply network is calculated by the following formula:

$$R_s = \frac{U_{1 \text{ unloaded}} - U_{1 \text{ loaded}}}{I_{1 \text{ loaded}} - I_{1 \text{ unloaded}}} (\Omega) \quad (G.2)$$

where

$R_s$  is the impedance of the supply network in ohms;

$U_{1 \text{ loaded}}$  is the supply voltage in volts when loaded by a **conventional load**;

$U_{1 \text{ unloaded}}$  is the supply voltage in volts when unloaded;

$I_{1 \text{ loaded}}$  is the supply current in amperes when loaded by a **conventional load**;

$I_{1 \text{ unloaded}}$  is the supply current in amperes when unloaded.

Example:

Supply network:

$$U_{1 \text{ unloaded}} = 230 \text{ V}$$

$$I_{1 \text{ unloaded}} = 1 \text{ A}$$

$$U_{1 \text{ loaded}} = 227 \text{ V}$$

$$I_{1 \text{ loaded}} = 31 \text{ A}$$

$$R_s = \frac{230 - 227}{31 - 1} = 0,10 \text{ } \Omega$$

Welding power source:  $U_1 = 230 \text{ V}$   $I_{1 \text{ max}} = 30 \text{ A}$

With these values, the condition in accordance with Formula (G.1) is fulfilled:

$$R_s = 0,10 \, \Omega \leq 0,04 \frac{230}{30} = 0,31 \, \Omega$$

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annex H (informative)

### Plotting of static characteristics

#### H.1 General

By varying the resistance of a **conventional load** connected to the output terminals of the welding power source, a set of values of **welding current** ( $I_2$ ) and corresponding **load voltage** ( $U_2$ ) may be obtained for a given output setting of the welding power source. The **static characteristic** is obtained by plotting these values on a graph with the **welding current** on the horizontal and the **load voltage** on the vertical axis.

The slope of the **static characteristic** is given by its tangent at the operating point.

#### H.2 Method

The number of values measured should be sufficient to enable a smooth curve to be plotted. In all cases, the **no-load voltage** and the **rated values** corresponding to each **duty cycle** (duty factor) stated on the **rating plate** should be recorded. For **drooping characteristic** welding power sources, the short-circuit current should also be recorded.

If the welding power source has a step-by-step setting, values should be measured at each position of the control. If a welding power source is designed for several supply voltages, the measurement should be repeated at each supply voltage.

For each point, the following should also be recorded: supply voltage ( $U_1$ ), supply current ( $I_1$ ), power delivered to the welding power source ( $P_1$ ).

For welding power sources with no feedback circuitry (for example simple transformers), the values of  $U_2$  and  $I_2$  should be multiplied by a correction factor of  $(U_1/U_1')$  if the measured supply voltage ( $U_1'$ ) differs from the **rated supply voltage** ( $U_1$ ). The power ( $P_1$ ) should be multiplied by  $(U_1/U_1')^2$ .

#### H.3 Analysis of the results

The series of curves obtained for the **static characteristics** of a welding power source may be used to confirm conformity to the relevant requirements of this document. If the negative slope at the operating point is greater than or equal to 7 V per 100 A, the **static characteristic** is considered to be drooping.

## Annex I

(normative)

## Test methods for a 10 Nm impact


### I.1 Pendulum impact hammer

The welding power source is placed against a rigid vertical surface and the impact is directed against the opposite side.

The angle of rotation  $\theta$  (see Figure I.1) is adjusted (see Table I.1) to account for hammer and swing arm tolerances with the objective of delivering the required impact energy of 10 Nm.

**Table I.1 – Angle of rotation  $\theta$  to obtain 10 Nm impact**
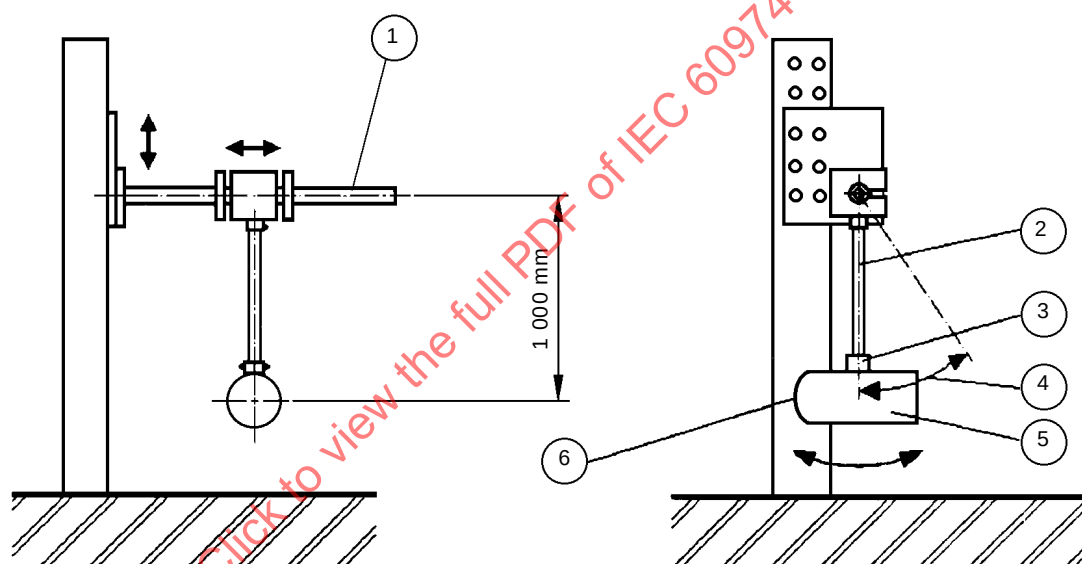
|                                                       |    |     |    |     |    |
|-------------------------------------------------------|----|-----|----|-----|----|
| <b>Hammer mass (kg)</b>                               | 1  | 1,5 | 2  | 2,5 | 3  |
| <b>Angle of rotation <math>\theta</math> (degree)</b> | 90 | 71  | 60 | 53  | 48 |



IEC

### Key

- 1 Support shaft (should not deflect more than 1,5 mm)
- 2 Swing arm, steel tubing (its mass is negligible)
- 3 Hammer collar (mass up to 100 g)
- 4 Angle of rotation  $\theta$
- 5 Steel hammer
- 6 Radius ( $50 \pm 2$ ) mm

**Figure I.1 – Test set-up**

## I.2 Free fall spherical steel weight

The welding power source is laid on a rigid horizontal surface. The mass of the free fall weight and the height of the free fall are given in Table I.2.

**Table I.2 – Mass of the free fall weight and height of the free fall**

|                   |      |      |      |      |      |      |      |
|-------------------|------|------|------|------|------|------|------|
| <b>Mass (kg)</b>  | 0,50 | 0,75 | 1,00 | 1,25 | 1,50 | 1,75 | 2,00 |
| <b>Height (m)</b> | 2,04 | 1,36 | 1,02 | 0,82 | 0,68 | 0,58 | 0,51 |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV



## **Annex J** (normative)

### **Thickness of sheet metal for enclosures**

The minimum thickness of sheet metal for enclosures shall be

- a) for steel, in accordance with Table J.1;
- b) for aluminium, brass or copper, in accordance with Table J.2.

The thickness values are based on a uniform deflection of the indicated sheet metal sizes, if loaded at the centre of their surface.

The thickness of an enclosure may be less than that given in Tables J.1 and J.2, if the enclosure shows the same deflection as an enclosure of the same size having the required thickness.

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

**Table J.1 – Minimum thickness of sheet metal for steel enclosures**

| Minimum thickness of uncoated steel <sup>a</sup><br>mm                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Without supporting frame <sup>b</sup> |                      | With supporting frame <sup>c</sup> |                      |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------|----------------------|------------------------------------|----------------------|
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Maximum width<br>mm                   | Maximum length<br>mm | Maximum width<br>mm                | Maximum length<br>mm |
| 0,50                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 105<br>125                            | Not limited<br>150   | 160<br>175                         | Not limited<br>210   |
| 0,65                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 155<br>180                            | Not limited<br>225   | 245<br>255                         | Not limited<br>320   |
| 0,80                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 205<br>230                            | Not limited<br>300   | 305<br>330                         | Not limited<br>410   |
| 1,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 320<br>360                            | Not limited<br>460   | 500<br>535                         | Not limited<br>635   |
| 1,35                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 460<br>510                            | Not limited<br>635   | 690<br>740                         | Not limited<br>915   |
| 1,50                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 560<br>635                            | Not limited<br>790   | 840<br>890                         | Not limited<br>1 095 |
| 1,70                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 635<br>740                            | Not limited<br>915   | 995<br>1 045                       | Not limited<br>1 295 |
| 2,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 840<br>890                            | Not limited<br>1 200 | 1 295<br>1 375                     | Not limited<br>1 680 |
| 2,35                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 1 070<br>1 200                        | Not limited<br>1 500 | 1 630<br>1 730                     | Not limited<br>2 135 |
| 2,70                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 1 325<br>1 525                        | Not limited<br>1 880 | 2 035<br>2 135                     | Not limited<br>2 620 |
| 3,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 1 600<br>1 860                        | Not limited<br>2 290 | 2 470<br>2 620                     | Not limited<br>3 230 |
| <sup>a</sup> 1) For stainless steel, only 80 % of the given values are necessary.<br>2) For zinc-coated steel, the thickness shall be adjusted to take into account the coating thickness (usually 0,05 mm to 0,1 mm).<br><sup>b</sup> Constructions considered to be without a supporting frame are for example:<br>1) a single sheet with single formed flanges;<br>2) a single sheet that is corrugated or ribbed;<br>3) an enclosure surface loosely attached to a frame, for example with spring clips or latch;<br>4) an enclosure surface having an unsupported edge.<br><sup>c</sup> These two columns apply when the enclosure is strengthened by one of the following means:<br>1) a supporting frame that is a structural channel, angle, or folded rigid section that is at least equal to the metal thickness of the enclosure, and is rigidly attached to the enclosure;<br>2) a supporting frame other than metal that has an equivalent torsional rigidity to a sheet steel angle in accordance with 1) above, and is fire resistant;<br>3) all of the edges of the enclosure are turned through a 90° angle to produce a formed flange with a minimum width of 10 mm. |                                       |                      |                                    |                      |

**Table J.2 – Minimum thickness of sheet metal for enclosures  
of aluminium, brass or copper**

| Minimum thickness<br>of metal<br>mm | Without supporting frame <sup>a</sup> |                      | With supporting frame <sup>b</sup> |                      |
|-------------------------------------|---------------------------------------|----------------------|------------------------------------|----------------------|
|                                     | Maximum width<br>mm                   | Maximum length<br>mm | Maximum width<br>mm                | Maximum length<br>mm |
| 0,55                                | 80<br>90                              | Not limited<br>110   | 180<br>220                         | Not limited<br>245   |
| 0,70                                | 105<br>130                            | Not limited<br>155   | 260<br>270                         | Not limited<br>345   |
| 0,90                                | 155<br>165                            | Not limited<br>205   | 360<br>385                         | Not limited<br>460   |
| 1,10                                | 205<br>245                            | Not limited<br>295   | 485<br>535                         | Not limited<br>640   |
| 1,45                                | 305<br>360                            | Not limited<br>410   | 715<br>765                         | Not limited<br>940   |
| 1,90                                | 460<br>510                            | Not limited<br>635   | 1 070<br>1 145                     | Not limited<br>1 400 |
| 2,40                                | 635<br>740                            | Not limited<br>915   | 1 525<br>1 630                     | Not limited<br>1 985 |
| 3,10                                | 940<br>1 070                          | Not limited<br>1 350 | 2 210<br>2 365                     | Not limited<br>2 900 |
| 3,85                                | 1 325<br>1 525                        | Not limited<br>1 880 | 3 125<br>3 305                     | Not limited<br>4 065 |

<sup>a</sup> Constructions considered to be without a supporting frame are for example:

- 1) a single sheet with single formed flanges;
- 2) a single sheet that is corrugated or ribbed;
- 3) an enclosure surface loosely attached to a frame, for example with spring clips or latch;
- 4) an enclosure surface having an unsupported edge.


<sup>b</sup> These two columns apply when the enclosure is strengthened by one of the following means:

- 1) a supporting frame that is a structural channel, angle, or folded rigid section that is at least equal to the metal thickness of the enclosure, and is rigidly attached to the enclosure;
- 2) a supporting frame other than metal that has an equivalent torsional rigidity to a sheet steel angle in accordance with a) above, and is fire resistant;
- 3) all of the edges of the enclosure are turned through a 90° angle to produce a formed flange with a minimum width of 10 mm.

## Annex K (informative)


### Examples of rating plates

Examples of rating plates are given in Figures K.1 to K.7

|                                                                                                      |                           |                                        |                                                                                         |            |                                      |
|------------------------------------------------------------------------------------------------------|---------------------------|----------------------------------------|-----------------------------------------------------------------------------------------|------------|--------------------------------------|
| a) Identification                                                                                    |                           |                                        |                                                                                         |            |                                      |
| 1) Manufacturer                                                                                      |                           | Trademark                              |                                                                                         |            |                                      |
| Address                                                                                              |                           |                                        |                                                                                         |            |                                      |
| 2) Type                                                                                              |                           | 3) Serial number                       |                                                                                         |            |                                      |
| 4)                  |                           | 5) IEC 60974-1<br>IEC 60974-10 Class A |                                                                                         |            |                                      |
| b) Welding output                                                                                    |                           |                                        |                                                                                         |            |                                      |
| 6)                  | 8) ~50 Hz                 | 10) 15 A / 20,6 V to 160 A / 27 V      |                                                                                         |            |                                      |
|                                                                                                      |                           | 11) X                                  | 11a) 35 %                                                                               | 11b) 60 %  | 11c) 100 %                           |
| 7)                 | 9) $U_0 = 48 \text{ V}$   | 12) $I_2$                              | 12a) 160 A                                                                              | 12b) 130 A | 12c) 100 A                           |
|                                                                                                      |                           | 13) $U_2$                              | 13a) 26 V                                                                               | 13b) 25 V  | 13c) 24 V                            |
| c) Energy supply                                                                                     |                           |                                        |                                                                                         |            |                                      |
| 14) <br>1 ~ 50 Hz | 15) $U_1 = 230 \text{ V}$ |                                        | 16) $I_{1\max} = 37 \text{ A}$                                                          |            | 17) $I_{1\text{eff}} = 22 \text{ A}$ |
|                                                                                                      | 22) IP23                  |                                        | 23)  |            |                                      |

IEC

Figure K.1 – Single-phase transformer

|                                                                                       |                                   |                                        |                                      |                                      |            |  |
|---------------------------------------------------------------------------------------|-----------------------------------|----------------------------------------|--------------------------------------|--------------------------------------|------------|--|
| a) Identification                                                                     |                                   |                                        |                                      |                                      |            |  |
| 1) Manufacturer<br>Address                                                            |                                   | Trademark                              |                                      |                                      |            |  |
| 2) Type                                                                               |                                   | 3) Serial number                       |                                      |                                      |            |  |
| 4)   |                                   | 5) IEC 60974-1<br>IEC 60974-10 Class A |                                      |                                      |            |  |
| b) Welding output                                                                     |                                   |                                        |                                      |                                      |            |  |
| 6)   | 8) ~450 Hz                        | 10) 60 A / 22,4 V to 500 A / 40 V      |                                      |                                      |            |  |
|                                                                                       |                                   | 11) X                                  | 11a) 35 %                            | 11b) 60 %                            | 11c) 100 % |  |
| 7)                                                                                    | 9) $U_0 = 78 \text{ V}$           | 12) $I_2$                              | 12a) 500 A                           | 12b) 400 A                           | 12c) 320 A |  |
|                                                                                       |                                   | 13) $U_2$                              | 13a) 40 V                            | 13b) 36 V                            | 13c) 33 V  |  |
| c) Energy supply                                                                      |                                   |                                        |                                      |                                      |            |  |
| 14)  | 18) $n = 2\,800 \text{ min}^{-1}$ |                                        |                                      |                                      |            |  |
|                                                                                       | 3 ~ 50 Hz                         | 15) $U_1 = 400 \text{ V}$              | 16) $I_{1\text{max}} = 68 \text{ A}$ | 17) $I_{1\text{eff}} = 40 \text{ A}$ |            |  |
| 22) IP23                                                                              |                                   | 23)                                    |                                      |                                      |            |  |


IEC

Figure K.2 – Three-phase rotating frequency converter

### Distributor-related plate

|                            |                  |
|----------------------------|------------------|
| a) Identification          |                  |
| 1) Manufacturer<br>Address | Trademark        |
| 2) Type                    | 3) Serial number |

### Manufacturer-related plate

|                                                                                                         |                                                                                         |
|---------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|
| a) Identification                                                                                       |                                                                                         |
| 4)                     | 5) IEC 60974-1<br>IEC 60974-10 Class A                                                  |
| b) Welding output                                                                                       |                                                                                         |
| 6)                     | 8)     |
| 10) 20 A / 20,8 V to 250 A / 30 V                                                                       |                                                                                         |
| 11) X                                                                                                   | 11a) 35 %<br>11b) 60 %<br>11c) 100 %                                                    |
| 7)                     | 9) $U_0 = 105 \text{ V}$                                                                |
| 12) $I_2$                                                                                               | 12a) 250 A<br>12b) 200 A<br>12c) 160 A                                                  |
| 13) $U_2$                                                                                               | 13a) 30 V<br>13b) 28 V<br>13c) 27 V                                                     |
| c) Energy supply                                                                                        |                                                                                         |
| 14) <br>1(3) ~ 50 Hz | 15) $U_1 = 230 \text{ V}$<br>$U_1 = 400 \text{ V}$                                      |
| 16) $I_{1\max} = 57 \text{ A}$<br>$I_{1\max} = 34 \text{ A}$                                            | 17) $I_{1\text{eff}} = 34 \text{ A}$<br>$I_{1\text{eff}} = 20 \text{ A}$                |
| 22) IP23                                                                                                | 23)  |


IEC

Figure K.3 – Subdivided rating plate: single-/three-phase transformer rectifier

|                                                                                       |                                                                                      |                                   |                                       |            |            |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|-----------------------------------|---------------------------------------|------------|------------|
| a) Identification                                                                     |                                                                                      |                                   |                                       |            |            |
| 1) Manufacturer<br>Address                                                            |                                                                                      | Trademark                         |                                       |            |            |
| 2) Type                                                                               |                                                                                      | 3) Serial number                  |                                       |            |            |
| 4)   |                                                                                      | 5) IEC 60974-1                    |                                       |            |            |
| b) Welding output                                                                     |                                                                                      |                                   |                                       |            |            |
| 6)   | 8)  | 10) 40 A / 21,6 V to 400 A / 36 V |                                       |            |            |
|                                                                                       |                                                                                      | 11) $X$                           | 11a) 35 %                             | 11b) 60 %  | 11c) 100 % |
| 7)   | 9) $U_0 = 110 \text{ V}$                                                             | 12) $I_2$                         | 12a) 400 A                            | 12b) 320 A | 12c) 255 A |
|                                                                                       |                                                                                      | 13) $U_2$                         | 13a) 36 V                             | 13b) 33 V  | 13c) 30 V  |
| c) Energy supply                                                                      |                                                                                      |                                   |                                       |            |            |
| 14)  | 18) $n = 3\,150 \text{ min}^{-1}$                                                    |                                   |                                       |            |            |
|                                                                                       | 19) $n_0 = 3\,300 \text{ min}^{-1}$                                                  | 20) $n_i = 980 \text{ min}^{-1}$  | 21) $P_{1\text{max}} = 34 \text{ kW}$ |            |            |
| 22) IP23                                                                              |                                                                                      | 23)                               |                                       |            |            |

IEC

Figure K.4 – Engine-generator-rectifier

|                                                                                                       |                                                                                         |                                        |            |                                       |            |
|-------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|----------------------------------------|------------|---------------------------------------|------------|
| a) Identification                                                                                     |                                                                                         |                                        |            |                                       |            |
| 1) Manufacturer<br>Address                                                                            |                                                                                         | Trademark                              |            |                                       |            |
| 2) Type                                                                                               |                                                                                         | 3) Serial number                       |            |                                       |            |
| 4)                   |                                                                                         | 5) IEC 60974-1<br>IEC 60974-10 Class A |            |                                       |            |
| b) Welding output                                                                                     |                                                                                         |                                        |            |                                       |            |
| 6)                   | 8)     | 10) 20 A / 20,8 V to 250 A / 32 V      |            |                                       |            |
| 7)                   | 9) $U_0 = 105 \text{ V}$                                                                | 11) $X$                                | 11a) 35 %  | 11b) 60 %                             | 11c) 100 % |
|                                                                                                       |                                                                                         | 12) $I_2$                              | 12a) 250 A | 12b) 200 A                            | 12c) 160 A |
|                                                                                                       |                                                                                         | 13) $U_2$                              | 13a) 30 V  | 13b) 28 V                             | 13c) 27 V  |
| c) Energy supply                                                                                      |                                                                                         |                                        |            |                                       |            |
| 14) <br>1(3) ~ 50 Hz | 15) $U_1$<br>230 V<br>400 V                                                             | 16) $I_{1\max}$<br>57 A<br>34 A        |            | 17) $I_{1\text{eff}}$<br>34 A<br>20 A |            |
| 22) IP23S                                                                                             | 23)  |                                        |            |                                       |            |

IEC

Figure K.5 – Single-/three-phase inverter type



|                                                                                       |                                                                                      |                                        |                          |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|----------------------------------------|--------------------------|
| a) Identification                                                                     |                                                                                      |                                        |                          |
| 1) Manufacturer<br>Address                                                            |                                                                                      | Trademark                              |                          |
| 2) Type                                                                               |                                                                                      | 3) Serial number                       |                          |
| 4) Li-ion                                                                             |                                                                                      | 5) IEC 60974-1<br>IEC 60974-10 Class A |                          |
| b) Welding output                                                                     |                                                                                      |                                        |                          |
| 6)   | 8)  | 10) 10 A / 20,4 V to 120 A / 24,8 V    |                          |
| 7)   | 9) $U_0 = 58 \text{ V}$                                                              | 12) $I_{2\max} = 120 \text{ A}$        |                          |
|                                                                                       |                                                                                      | 13) $U_2 = 24,8 \text{ V}$             |                          |
| c) Energy supply                                                                      |                                                                                      |                                        |                          |
| 14)  | 15) $U_b = 57,6 \text{ V}$                                                           | 16) $E = 5 \text{ Ah}$                 | 17) $I_b = 10 \text{ A}$ |
|                                                                                       | 19) For use only with _____ charger                                                  |                                        |                          |
| 22) IP23                                                                              |                                                                                      |                                        |                          |

IEC

Figure K.6 – Battery powered welding power source with integral battery

### Welding power source related plate

|                                                                                       |                                                                                      |                                        |  |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|----------------------------------------|--|
| a) Identification                                                                     |                                                                                      |                                        |  |
| 1) Manufacturer<br>Address                                                            |                                                                                      | Trademark                              |  |
| 2) Type                                                                               |                                                                                      | 3) Serial number                       |  |
| 4)                                                                                    |                                                                                      | 5) IEC 60974-1<br>IEC 60974-10 Class A |  |
| b) Welding output                                                                     |                                                                                      |                                        |  |
| 6)   | 8)  | 10) 10 A / 20,4 V to 120 A / 24,8 V    |  |
| 7)   | 9) $U_0 = 58 \text{ V}$                                                              | 12) $I_{2\max} = 120 \text{ A}$        |  |
|                                                                                       |                                                                                      | 13) $U_2 = 24,8 \text{ V}$             |  |
| c) Energy supply                                                                      |                                                                                      |                                        |  |
| 14)  | 15) $U_b = 57,6 \text{ V}$                                                           |                                        |  |
|                                                                                       | 19) For use only with _____ battery                                                  |                                        |  |
| 22) IP23                                                                              |                                                                                      |                                        |  |

### Battery related plate

|                                                       |                    |
|-------------------------------------------------------|--------------------|
| d) Separable and detachable battery packs             |                    |
| 1) type (identification) as given by the manufacturer |                    |
| Li-ion                                                | year and date code |
| $U_b = 57,6 \text{ V}$                                | $E = 5 \text{ Ah}$ |

IEC

Figure K.7 – Battery powered welding power source with detachable / separable battery

## **Annex L** (informative)

### **Graphical symbols for arc welding equipment**

#### **L.1 General**

Annex L describes symbols, which are not all internationally standardized, but of practical use in welding applications. IEC technical committee 26 and subcommittee 3C have decided to consider those symbols for a future possible inclusion in IEC 60417. When this process will be terminated, Annex L will be modified accordingly.

Annex L contains graphic symbols for arc welding and allied processes equipment to identify controls, indicators, connection points, functions, and to select processes.

The symbols are for use on the panel, the **rating plate** and any documentation for arc welding and allied processes equipment.

Annex L does not cover graphic symbols used to alert personnel of immediate or potential personal hazards in the use of the equipment.

NOTE 1 For safety symbols, see ISO 3864-1.

NOTE 2 For installation instructions, see IEC 60974-9.

#### **L.2 Use of symbols**

##### **L.2.1 General**

Symbols should be placed on equipment to instruct on use and operation. Examples of control panel are given in L.5.

##### **L.2.2 Selection of symbols**

Symbols specified in Clause L.3 can be used either as a single item or in combination to fit the intended application. Examples of combinations are given in L.4.

##### **L.2.3 Size of symbols**

For the application of these symbols, it may be necessary either to reduce or to enlarge the original to a suitable size. In the case of symbols composed of several graphic elements, or when reducing to minimum height, check that clear identification is still possible and legibility is adequate. Available light, user distance, and possible operating conditions as factors during size selection should also be considered.

Recommended minimum symbol size is 6 mm.

##### **L.2.4 Use of colour**

In general, the graphic form of a symbol reproduced in black on white or white on black should be sufficient for its identification.

For the purposes of these symbols, adequate contrast between symbol and background is most important. As long as the symbol is clearly delineated and fully legible, actual colour selection is not mandatory. Be aware that certain colours, such as red, orange, and yellow are designated as safety-alerting colours.

## L.3 Symbols

### L.3.1 General

Clause L.3 presents the symbols along with their reference number, function keyword or phrase, application and source.

### L.3.2 Letter symbols

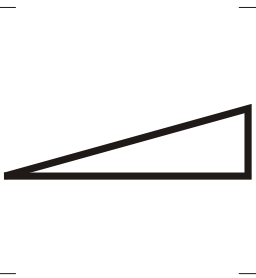
Table L.1 gives a list of letters, which may be used in a symbol.

**Table L.1 – Letters used as symbols**

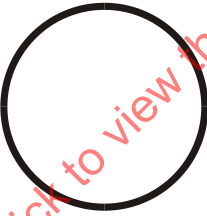
| Function, keyword or phrase                           | Letter        | Unit              |
|-------------------------------------------------------|---------------|-------------------|
| Amperage                                              | $I$           | A                 |
| Conventional welding current                          | $I_2$         | A                 |
| Conventional welding voltage                          | $U_2$         | V                 |
| Diameter                                              | $\varnothing$ | mm                |
| Duty cycle; duty factor                               | $X$           | %                 |
| Efficiency                                            | $\eta$        | %                 |
| Frequency                                             | $f$           | Hz                |
| Idle state power (idle state energy consumption rate) | $P_i$         | W (W·h/h)         |
| Power                                                 | $P$           | W                 |
| Rated no load current                                 | $I_0$         | A                 |
| Rated no load voltage                                 | $U_0$         | V                 |
| Rated supply current                                  | $I_1$         | A                 |
| Rated supply voltage                                  | $U_1$         | V                 |
| Speed of rotation                                     | $n$           | min <sup>-1</sup> |
| Supply power (supply energy consumption rate)         | $P_1$         | W (W·h/h)         |
| Temperature (change)                                  | $T$           | °C (K)            |
| Time                                                  | $t$           | s, min, h         |
| Voltage                                               | $U$           | V                 |
| Welding output power (welding output energy rate)     | $P_2$         | W (W·h/h)         |
| Rated peak voltage                                    | $U_p$         | V                 |



### L.3.3 Graphical symbols

#### L.3.3.1 Symbols to describe the switch or control

| N° | SOURCE                 | SYMBOL                                                                            | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                                   |
|----|------------------------|-----------------------------------------------------------------------------------|-----------------------------|-----------------------------------------------------------------------------------------------|
| 1. | IEC 60417-5004:2002-10 |  | Variability                 | To identify an increase/decrease of a quantity continuously<br><br>NOTE Symbol can be curved. |


#### L.3.3.2 Symbols to indicate switch or control position



| N° | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE             | APPLICATION                                                                                                                                                                          |
|----|------------------------|-------------------------------------------------------------------------------------|-----------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 2. | IEC 60417-5007:2002-10 |   | On (power)                              | To indicate connection to the mains, at least for mains switches or their positions, and all those cases where safety is involved                                                    |
| 3. | IEC 60417-5008:2002-10 |  | Off (power)                             | To indicate disconnection from the mains, at least for mains switches or their positions, and all those cases where safety is involved                                               |
| 4. | IEC 60417-5268:2002-10 |  | IN-position of a bi-stable push control | To identify the IN-position of a push control where the push control is used to energize or deenergize a function<br><br>NOTE 1 This symbol is used together with a function symbol. |
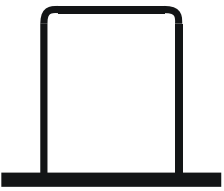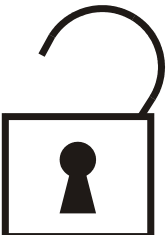
| N° | SOURCE                 | SYMBOL                                                                             | FUNCTION, KEYWORD OR PHRASE              | APPLICATION                                                                                                                                                                            |
|----|------------------------|------------------------------------------------------------------------------------|------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 5. | IEC 60417-5269:2002-10 |   | OUT-position of a bi-stable push control | To identify the OUT-position of a push control where the push control is used to energize or de-energize a function<br><br>NOTE 2 This symbol is used together with a function symbol. |
| 6. | IEC 60417-5569:2005-08 |   | Locked                                   | To identify a locked function or control<br><br>NOTE 3 This symbol is used together with a function symbol.                                                                            |
| 7. | IEC 60417-5570:2002-10 |  | Unlocked                                 | To identify an unlocked function or control<br><br>NOTE 4 This symbol is used together with a function symbol.                                                                         |

### L.3.3.3 Symbols to indicate switch or control function




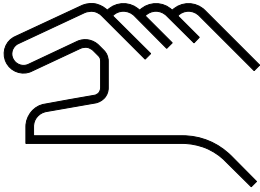
| N° | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE   | APPLICATION                                  |
|----|------------------------|-------------------------------------------------------------------------------------|-------------------------------|----------------------------------------------|
| 8. | IEC 60417-6302:2015-01 |  | Continuous welding            | To identify a continuous welding             |
| 9. | IEC 60417-6303:2015-01 |  | Intermittent (stitch) welding | To identify an intermittent (stitch) welding |





| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE  | APPLICATION                                                                    |
|-----|------------------------|-------------------------------------------------------------------------------------|------------------------------|--------------------------------------------------------------------------------|
| 10. | ISO 7000-0468:2004-01  |    | Arc spot welding             | To identify an arc spot welding                                                |
| 11. | ISO 7000-0096:2004-01  |    | Manual control               | To identify the switch position for manual control                             |
| 12. | IEC 60417-6318:2015-03 |   | Arc striking without contact | To identify a TIG arc striking function which initiates an arc without contact |
| 13. | IEC 60417-6319:2015-03 |  | Arc striking with contact    | To identify a TIG arc striking function which initiates an arc with contact    |
| 14. |                        |  | Pilot arc starting           | To identify pilot arc starting of a plasma torch                               |
| 15. | ISO 7000-0474:2004-01  |  | Purging of air (by gas)      | To identify purging of the air by gas                                          |
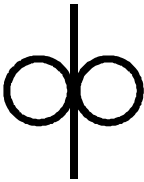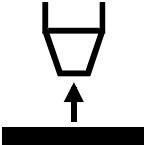
| N°  | SOURCE                | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE                       | APPLICATION                                         |
|-----|-----------------------|-------------------------------------------------------------------------------------|---------------------------------------------------|-----------------------------------------------------|
| 16. | ISO 7000-0823:2004-01 |    | Wire feed drive                                   | To identify a wire feeder or wire feed control      |
| 17. |                       |    | Wire burnback control                             | To identify burnback control at the end of the weld |
| 18. | ISO 7000-0004:2004-01 |   | Direction of continuous rotation (clockwise)      | To identify a direction of continuous rotation      |
| 19. | ISO 7000-0004:2004-01 |  | Direction of continuous rotation (anti clockwise) | To identify a direction of continuous rotation      |








### L.3.3.4 Symbols to indicate electrical connection
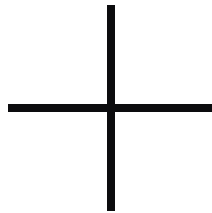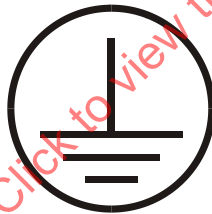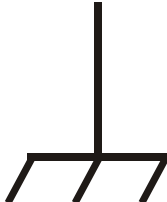
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                                      |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|--------------------------------------------------------------------------------------------------|
| 20. | IEC 60417-5005:2002-10 |    | Plus; plus pole             | To identify positive polarity                                                                    |
| 21. | IEC 60417-5006:2002-10 |    | Minus; minus pole           | To identify negative polarity                                                                    |
| 22. | IEC 60417-5017:2006-08 |   | Earth (ground)              | To identify the earth (ground) connection<br><br>NOTE 1 Not for a protective earth connection.   |
| 23. | IEC 60417-5019:2006-08 |  | Protective earth (ground)   | To identify the equipment connection point for the protective earth (ground)                     |
| 24. | IEC 60417-5020:2002-10 |  | Frame or chassis            | To identify the frame or chassis connection<br><br>NOTE 2 Not for a protective earth connection. |
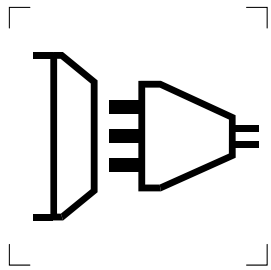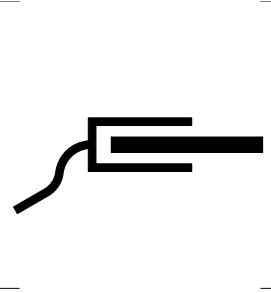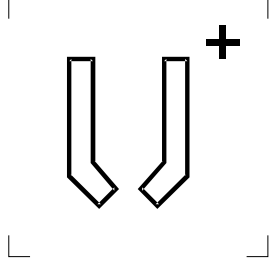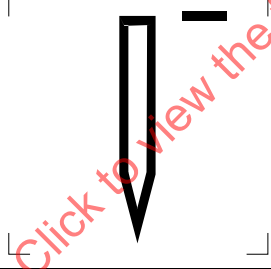
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE                                       | APPLICATION                                                                                                                       |
|-----|------------------------|-------------------------------------------------------------------------------------|-------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------|
| 25. | IEC 60417-5939:2002-10 |    | Power supply type of electric device                              | On device or equipment for example on arc welding equipment.<br>To identify the type of power supply, socket-outlet with 3-poles. |
| 26. | ISO 7000-0453:2004-01  |    | Workpiece connection                                              | To identify a workpiece connection                                                                                                |
| 27. | ISO 7000-0483:2004-01  |   | Connection to the nozzle of a plasma torch (positive terminal)    | To identify a plasma torch connection – nozzle connection to positive terminal                                                    |
| 28. | ISO 7000-0482:2004-01  |  | Connection to the electrode of a plasma torch (negative terminal) | To identify a plasma torch connection – electrode connection to negative terminal                                                 |




### L.3.3.5 Symbols to indicate fluid connection or control

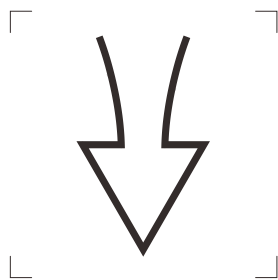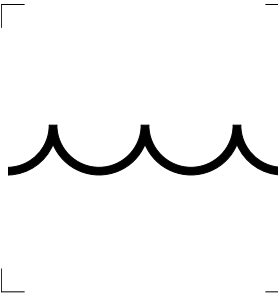
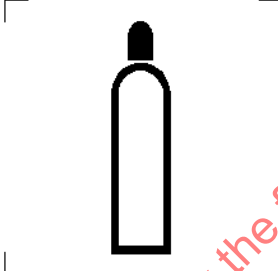
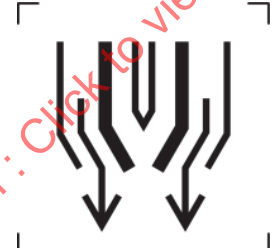
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                            |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|--------------------------------------------------------|
| 29. | IEC 60417-6315:2015-02 |    | Air flow                    | To indicate air flow                                   |
| 30. | ISO 7000-0536:2004-01  |    | Liquid                      | To indicate liquid, e.g coolant                        |
| 31. |                        |  | Gas supply                  | To identify a gas supply connection or control         |
| 32. | ISO 7000-0481:2004-01  |  | Plasma shielding gas        | To identify plasma shielding gas connection or control |
| 33. | ISO 7000-0480:2004-01  |  | Plasma gas                  | To identify plasma gas connection or control           |
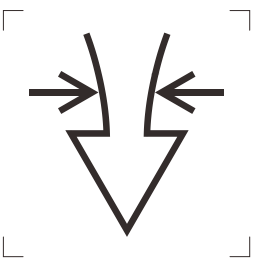
| N°  | SOURCE                 | SYMBOL                                                                            | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                  |
|-----|------------------------|-----------------------------------------------------------------------------------|-----------------------------|----------------------------------------------|
| 34. | IEC 60417-6316:2015-02 |  | Air pressure                | To identify air pressure function or control |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV






**L.3.3.6 Symbols to indicate auxiliary device, connection or function**
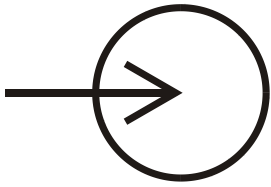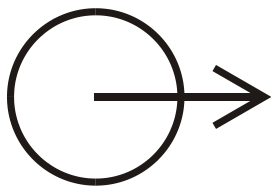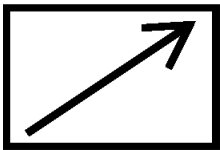
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                               |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-----------------------------------------------------------|
| 35. | IEC 60417-5034:2014-06 |    | Input                       | To identify input connection or control                   |
| 36. | IEC 60417-5035:2014-06 |    | Output                      | To identify output connection or control                  |
| 37. | ISO 7000-0093:2004-01  |  | Remote                      | To identify a remote control, connection or function      |
| 38. |                        |  | Foot control                | To identify a foot control device, connection or function |
| 39. |                        |  | Panel / Local               | To identify a panel/local function or control             |
| 40. | ISO 7000-0466:2004-01  |  | Hopper (powder, flux)       | To identify a flux (powder) hopper                        |

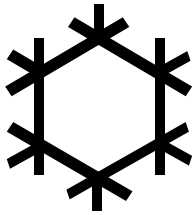
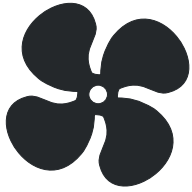
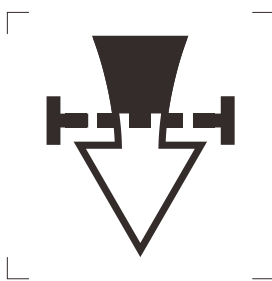
| N°  | SOURCE                 | SYMBOL                                                                             | FUNCTION, KEYWORD<br>OR PHRASE     | APPLICATION                                         |
|-----|------------------------|------------------------------------------------------------------------------------|------------------------------------|-----------------------------------------------------|
| 41. | ISO 7000-0027:2004-01  |   | Cooling                            | To identify a cooling device, connection or control |
| 42. | ISO 7000-0089:2004-01  |   | Ventilating or air circulating fan | To identify a ventilating or air circulating fan    |
| 43. | IEC 60417-6317:2015-02 |  | Air filter                         | To identify an air filter                           |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV



### L.3.3.7 Symbols to indicate control of the welding amperage/voltage
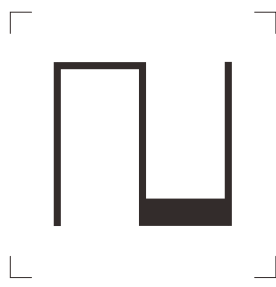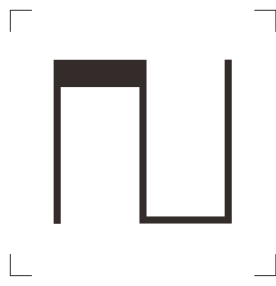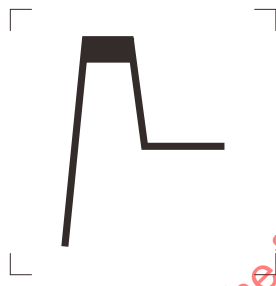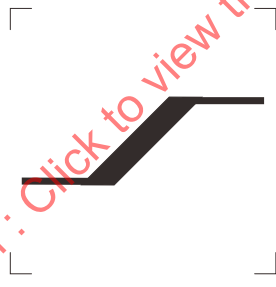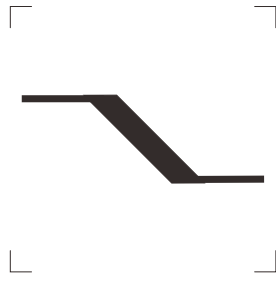
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                                                                                                 |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 44. | IEC 60417-6005:2006-12 |    | Pulse background            | To indicate a control of pulse background<br><br>NOTE 1 Control is identified by one letter chosen in Table L.1.                                            |
| 45. | IEC 60417-6006:2006-12 |    | Pulse peak                  | To indicate a control of pulse peak<br><br>NOTE 2 Control is identified by one letter chosen in Table L.1.                                                  |
| 46. | IEC 60417-6007:2006-12 |   | Hot start                   | To indicate a control or function increasing the energy at the beginning of the weld<br><br>NOTE 3 Control is identified by one letter chosen in Table L.1. |
| 47. | IEC 60417-6008:2006-12 |  | Slope (increasing)          | To indicate a control or function regulating the increase of a value<br><br>NOTE 4 Control is identified by one letter chosen in Table L.1.                 |
| 48. | IEC 60417-6009:2006-12 |  | Slope (decreasing)          | To indicate a control or function regulating the decrease of a value<br><br>NOTE 5 Control is identified by one letter chosen in Table L.1.                 |

### L.3.3.8 Symbols to indicate type of torch



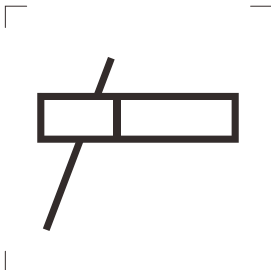
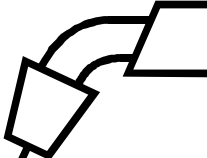
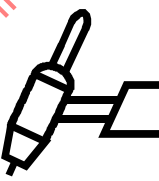
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE                | APPLICATION                                                                    |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------------------|--------------------------------------------------------------------------------|
| 49. |                        |    | Manual metal arc welding electrode holder  | To identify an electrode holder                                                |
| 50. | IEC 60417-6313:2015-01 |    | Air carbon arc gouging electrode holder    | To identify an air carbon arc gouging electrode holder                         |
| 51. |                        |   | MIG/MAG Torch                              | To identify a MIG/MAG torch                                                    |
| 52. |                        |  | Self shielded flux cored arc welding torch | To identify a self shielded flux cored arc welding torch without gas shielding |
| 53. |                        |  | TIG Torch                                  | To identify a TIG torch                                                        |
| 54. |                        |  | Plasma torch                               | To identify plasma torch for welding, cutting and/or gouging                   |


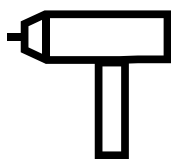
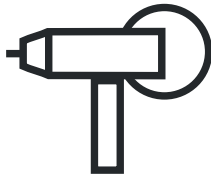


| N°  | SOURCE | SYMBOL                                                                             | FUNCTION, KEYWORD<br>OR PHRASE        | APPLICATION                                                                            |
|-----|--------|------------------------------------------------------------------------------------|---------------------------------------|----------------------------------------------------------------------------------------|
| 55. |        |   | Motorised gun                         | To identify a gun incorporating a wire drive system                                    |
| 56. |        |   | Motorised gun with filler wire supply | To identify a gun incorporating a wire drive system and including a filler wire supply |
| 57. |        |  | Submerged arc torch                   | To identify a torch for submerged arc welding                                          |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV





### L.3.3.9 Symbols to indicate processes
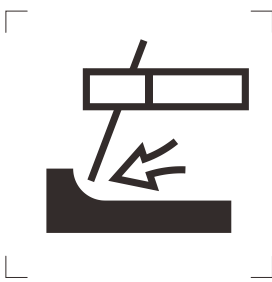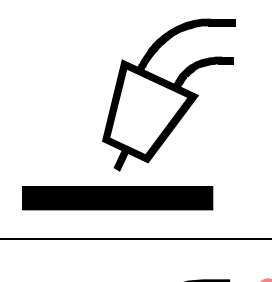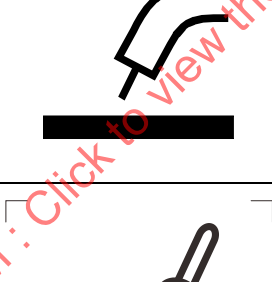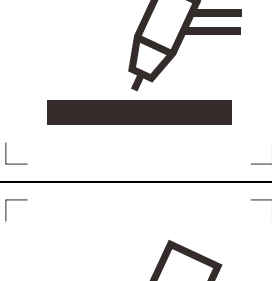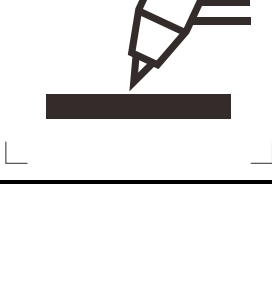
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE          | APPLICATION                                                              |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------------|--------------------------------------------------------------------------|
| 58. | IEC 60417-6306:2015-01 |    | MMA welding                          | To identify MMA welding                                                  |
| 59. | IEC 60417-6314:2015-01 |    | Air carbon arc gouging               | To identify air carbon arc gouging                                       |
| 60. | IEC 60417-6308:2015-01 |   | MIG/MAG welding                      | To identify MIG/MAG welding                                              |
| 61. | IEC 60417-6309:2015-01 |  | Flux cored self shielded arc welding | To identify flux cored self shielded arc welding (without gas shielding) |
| 62. | IEC 60417-6307:2015-01 |  | TIG welding                          | To identify TIG welding                                                  |
| 63. | IEC 60417-6312:2015-01 |  | Plasma welding                       | To identify plasma arc welding                                           |
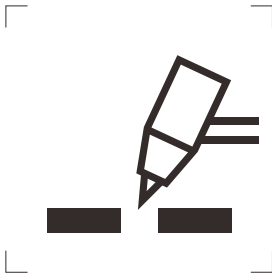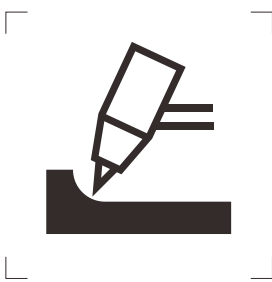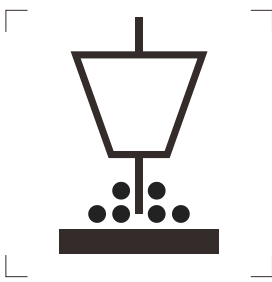
| N°  | SOURCE                 | SYMBOL                                                                             | FUNCTION, KEYWORD OR PHRASE | APPLICATION                       |
|-----|------------------------|------------------------------------------------------------------------------------|-----------------------------|-----------------------------------|
| 64. | IEC 60417-6310:2015-01 |   | Plasma cutting              | To identify plasma arc cutting    |
| 65. | IEC 60417-6311:2015-01 |   | Plasma gouging              | To identify plasma gouging        |
| 66. | IEC 60417-6305:2015-01 |  | Submerged arc welding       | To identify submerged arc welding |

IECNORM.COM :: Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV





### L.3.3.10 Symbols to indicate control of welding characteristics

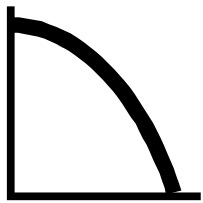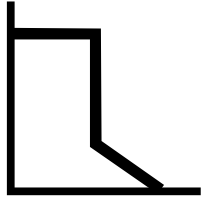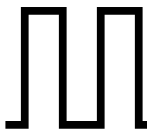
| N°  | SOURCE                | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE   | APPLICATION                                                                           |
|-----|-----------------------|-------------------------------------------------------------------------------------|-------------------------------|---------------------------------------------------------------------------------------|
| 67. | ISO 7000-0455:2004-01 |    | Flat characteristic           | To identify a substantially constant voltage characteristic                           |
| 68. | ISO 7000-0454:2004-01 |    | Drooping characteristic       | To identify a substantially drooping current characteristic                           |
| 69. |                       |   | Arc force                     | To indicate a control or function increasing current when low arc voltage is detected |
| 70. |                       |  | Pulsed                        | To identify a pulse value                                                             |
| 71. |                       |  | Variable inductance           | To identify a variable inductance function or control                                 |
| 72. |                       |  | High inductance or inductance | To identify inductance or used with other inductance symbols, high inductance         |
| 73. |                       |  | Medium inductance             | To identify medium inductance connection, function or control                         |

| N°  | SOURCE | SYMBOL                                                                            | FUNCTION, KEYWORD<br>OR PHRASE | APPLICATION                                                |
|-----|--------|-----------------------------------------------------------------------------------|--------------------------------|------------------------------------------------------------|
| 74. |        |  | Low inductance                 | To identify low inductance connection, function or control |



IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

### L.3.3.11 Symbols to describe the type of power source
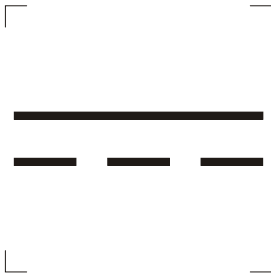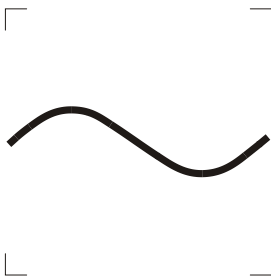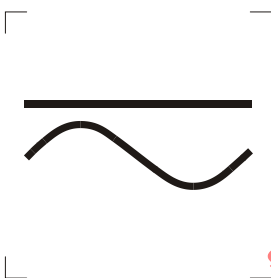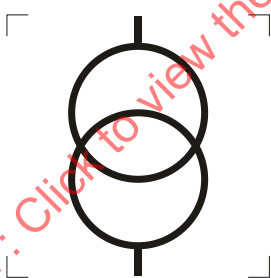
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE    | APPLICATION                                                                                                                                |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------|
| 75. | IEC 60417-5031:2002-10 |    | Direct current (DC)            | To identify that power source delivers direct current                                                                                      |
| 76. | IEC 60417-5032:2002-10 |    | Alternating current (AC)       | To identify that power source delivers alternating current<br><br>NOTE Symbol can be mixed with a number to indicate the number of phases. |
| 77. | IEC 60417-5033:2002-10 |   | Direct and alternating current | To identify that the power source delivers both direct and alternating current                                                             |
| 78. | IEC 60417-5156:2003-08 |  | Transformer                    | To identify a transformer                                                                                                                  |
| 79. | ISO 7000-1153:2004-01  |  | Generator                      | To identify a generator                                                                                                                    |
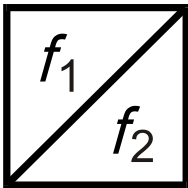
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                             |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-------------------------------------------------------------------------|
| 80. | IEC 60417-6304:2015-01 |    | Engine                      | To identify an engine driven power source                               |
| 81. | ISO 7000-0147:2004-01  |    | Electric motor              | To identify an electric motor                                           |
| 82. | IEC 60417-5970:2003-08 |   | Inverter                    | To identify a frequency conversion stage function                       |
| 83. | IEC 60417-5194:2002-10 |  | DC/AC-converter             | To identify a DC/AC-converter and its associated terminals and controls |


**L.3.3.12 Symbols to indicate protective component and class of protection**
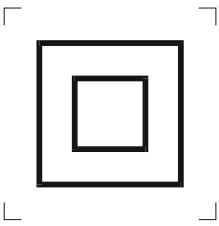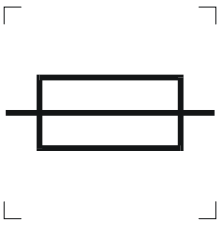
| N°  | SOURCE                 | SYMBOL                                                                            | FUNCTION, KEYWORD OR PHRASE                                                  | APPLICATION                                                                                                     |
|-----|------------------------|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------|
| 84. |                        |  | Suitable for welding in an environment with increased risk of electric shock | To identify a welding power source suitable for welding in an environment with increased risk of electric shock |
| 85. | IEC 60417-5172:2003-02 |  | Class II equipment                                                           | To identify class II equipment                                                                                  |
| 86. | IEC 60417-5016:2002-10 |  | Fuse                                                                         | To indicate a fuse                                                                                              |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV









### L.3.3.13 Symbols to inform users
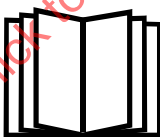
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                               |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-------------------------------------------------------------------------------------------|
| 87. | IEC 60417-5036:2002-10 |    | Dangerous voltage           | To identify a dangerous voltage                                                           |
| 88. | ISO 7000-0228:2004-01  |    | Disturbance                 | To identify a disturbance of the correct operation                                        |
| 89. | ISO 7000-0434A:2004-01 |   | Caution                     | To make operator aware of general hazard.                                                 |
| 90. | IEC 60417-5041:2002-10 |  | Caution hot surface         | To indicate that the marked item can be hot and should not be touched without taking care |
| 91. |                        |  | Read instruction manual     | To identify that the instruction manual should be read                                    |
| 92. | ISO 7000-0034:2004-01  |  | Temperature indication      | To identify the temperature indication for example excess temperature warning light       |

### L.4 Examples of combinations of symbols

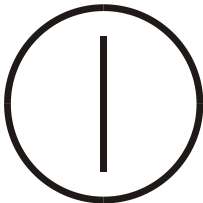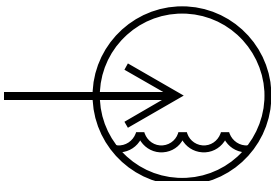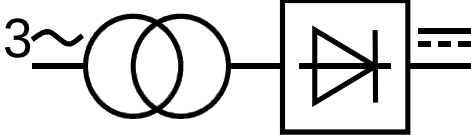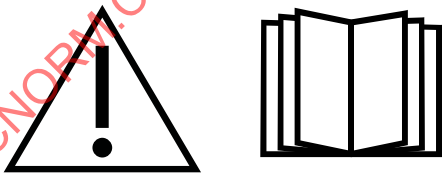
This clause gives examples of combination of symbols which can be used on arc welding and allied processes equipment.

| SYMBOL                                                                                                          | FUNCTION, KEYWORD OR PHRASE           | APPLICATION                                                                                                                                                                                             |
|-----------------------------------------------------------------------------------------------------------------|---------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p>IEC 60417-5010:2002-10</p> | On/off (push-push)                    | To indicate connection to or disconnection from the mains, at least for mains switches or their position, and all those cases where safety is involved. Each position, ON or OFF, is a stable position. |
|  <p>IEC 60417-6024:2009-11</p> | Input of liquid                       | To identify input of liquid                                                                                                                                                                             |
|                               | Three-phase transformer-rectifier     | To indicate welding power source symbol on the rating plate                                                                                                                                             |
|                              | Inverter power source AC/DC           | To indicate welding power source symbol on the rating plate                                                                                                                                             |
|                              | Slow wire feed start                  | To identify the slow advance of wire towards the workpiece at the start of the weld                                                                                                                     |
|                              | Caution ! Read the instruction manual | To indicate a hazard and identify that the instruction manual should be read                                                                                                                            |
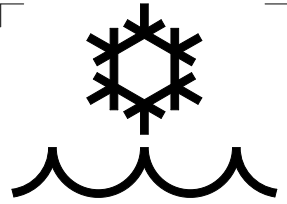
| SYMBOL                                                                                                                | FUNCTION, KEYWORD OR PHRASE  | APPLICATION                                                                               |
|-----------------------------------------------------------------------------------------------------------------------|------------------------------|-------------------------------------------------------------------------------------------|
| <br>ISO 7000-0544:2004-01            | Cooling water                |                                                                                           |
|                                      | Variability and OFF position | To identify a continuous increase/decrease of a quantity and an off position of a control |
| <br>ISO 7000-0469:2004-01, modified | MIG/MAG spot welding         | To identify MIG/MAG spot welding                                                          |
|                                    | Upslope time                 | To indicate a control of upslope time                                                     |


## L.5 Examples of control panels

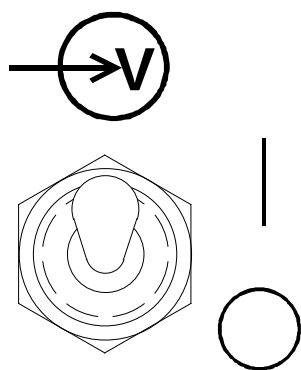This clause (see Figures L.1 to L.8) gives examples of control panels for arc welding and allied processes equipment.




IEC

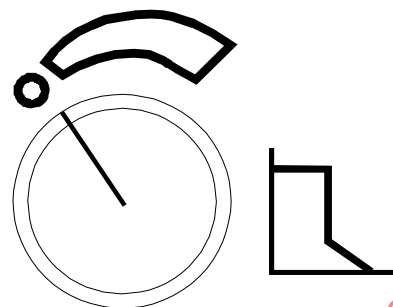Figure L.1 – Input voltage power switch




IEC

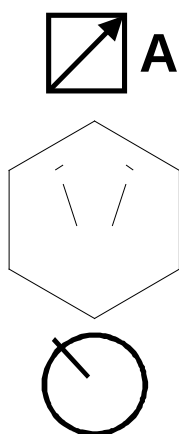
Figure L.2 – Arc force control potentiometer



IEC


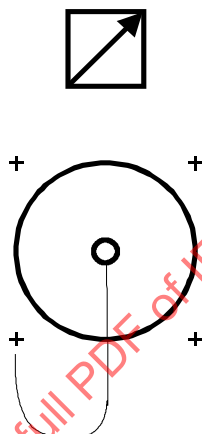


IEC

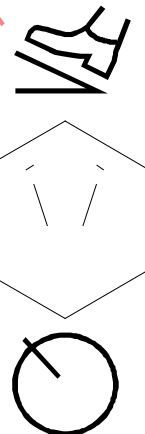


IEC

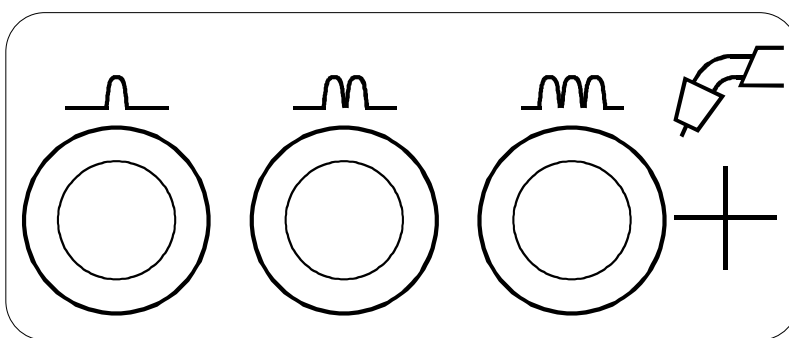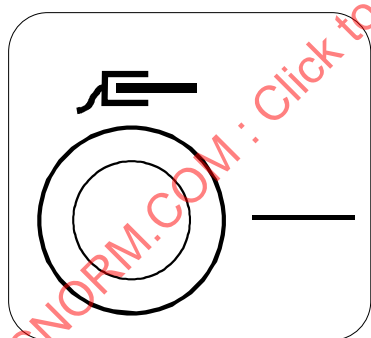Figure L.3 – Remote receptacle and selector switches




IEC

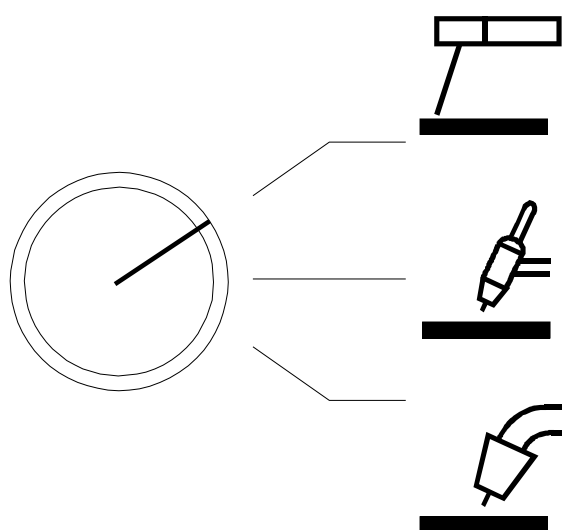Figure L.4 – Terminals with inductance selector for MIG/MAG welding




IEC

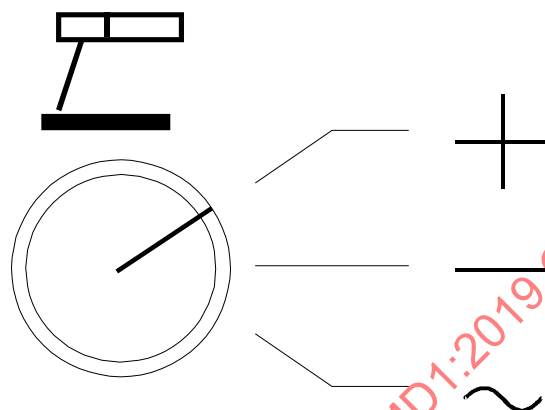Figure L.5 – Process switch  
(MMA, TIG, MIG)




IEC

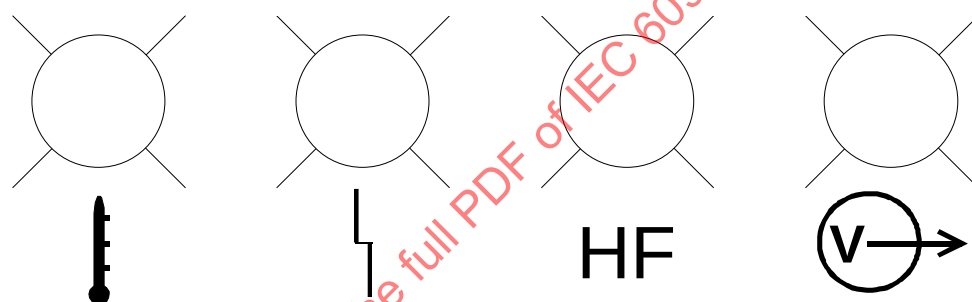Figure L.6 – Selector switch  
on AC/DC equipment



IEC

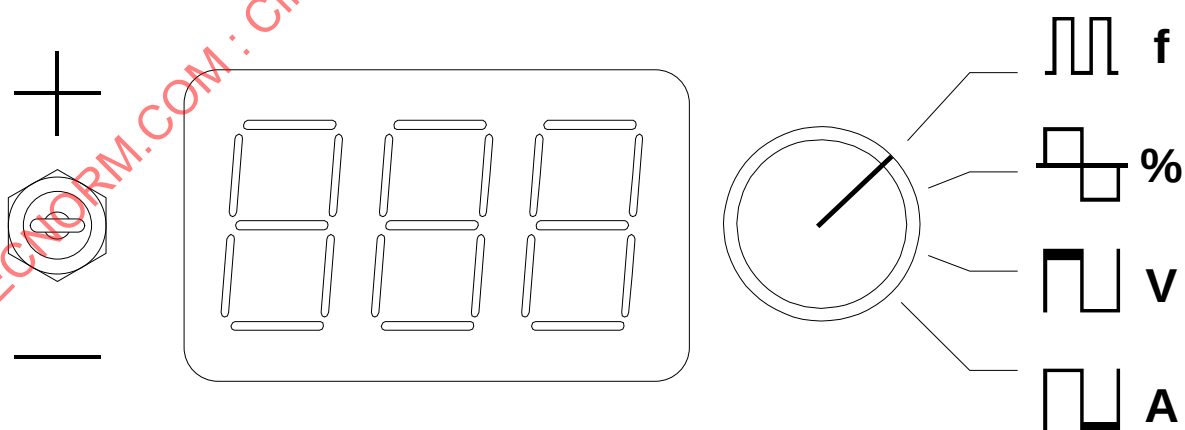Figure L.7 – Panel indicator lights (overheat, fault,  
arc striking, output voltage)



IEC

Figure L.8 – Setting pulsing parameters using digital display

## Annex M (informative)

### Efficiency and idle state power measurement

#### M.1 Measuring efficiency

To ensure repeatability and data accuracy in measuring efficiency, the following procedure shall be used:

- a) Use power meters to measure supply power and welding output power.
- b) Ensure conformance to 5.1 for test conditions.
- c) Ensure accuracy of power measurement is equal to or better than  $\pm 0,25\%$ .
- d) Ensure conformance of the supply network to Annex G.
- e) Measure the supply voltage of the supply-network-connected welding power source at the point of coupling of the welding power source to the supply network.
- f) Measure the **load voltage** at the welding power source **welding circuit** connections. For welding power sources that are provided with permanently connected welding cables, measure the **load voltage** at the exit point of the power source enclosure.
- g) Measure efficiency:
  - 1) if not stated in national regulation, using the process which results in the highest power consumption;
  - 2) at **conventional welding conditions** (given in 3.1.17) and **conventional load voltages** as specified in 11.2;
  - 3) halfway into the load cycle for **duty cycles** less than 100 %;
  - 4) excluding the power draw from external devices or auxiliary power supplies in the measurement (see 11.5 and 11.6).
- h) Record efficiency as a percentage rounded to two significant figures.

$$\text{Efficiency: } \eta = \frac{P_2}{P_1}$$

where

$P_2$  is the welding output power;

$P_1$  is the supply power consumption.

NOTE 1 This ratio, lying between 0 and 1, is expressed as a percentage.

NOTE 2 Efficiency can depend on factors such as output load, supply network voltage (for equipment with multiple input voltages), operating modes, and environmental conditions.

#### M.2 Measuring idle state power

To ensure repeatability and data accuracy in measuring **idle state** power consumption, the following procedure shall be used:

- 1) Ensure the power source is at **thermal equilibrium**.
- 2) Measure **idle state** power after
  - a) any cool-down period of the power source (e.g. after the fan and cooling pump has stopped); and

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

- b) the power source has switched into a low energy **idle state** (if equipped).

Do not include the power draw from external devices or auxiliary power supplies in the measurement (see 11.5 and 11.6).

The idle state power consumption shall be stated as an average value.

NOTE Idle state power measurements are influenced by variations in instantaneous power.

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

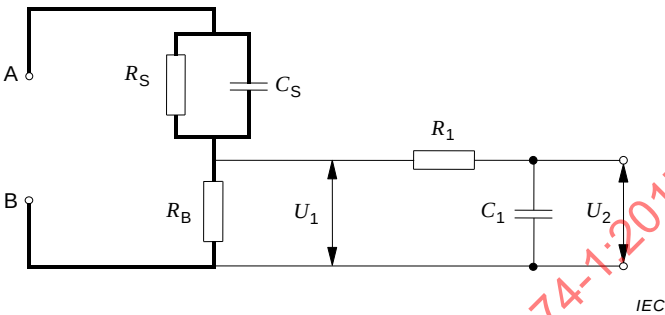


Annex N  
(normative)

Touch current measurement in fault condition

For measuring the **touch current** in fault condition, the measuring network in accordance with Figure N.1 and the appropriate configurations in Figures N.2 and N.3 shall be used with an appropriate measuring device.

Caution! An **expert** shall perform this test. The protective conductor is disabled for this test.



Key


|                                              |                |                                  |                 |
|----------------------------------------------|----------------|----------------------------------|-----------------|
| A, B                                         | Test terminals | $C_S$                            | 0,22 $\mu$ F    |
| $R_S$                                        | 1 500 $\Omega$ | $R_1$                            | 10 000 $\Omega$ |
| $R_B$                                        | 500 $\Omega$   | $C_1$                            | 0,022 $\mu$ F   |
| $U_1$                                        | r.m.s. voltage | $U_2$                            | peak voltage    |
| Weighted touch current (perception/reaction) |                | $= \frac{U_2}{500}$ (peak value) |                 |

Figure N.1 – Measuring network for weighted touch current


For three-phase equipment, **touch current** in fault condition is measured with the switches (I) and (n) in the closed position and switch (e) in the open position. The measurement is then repeated with each of the switches (I) and (n) opened one by one, with the other switches closed, except switch (e). The measurements are similar for single-phase equipment, except that they shall be repeated for each position of the polarity switch (p).

The manufacturer shall identify the configuration (TN, TT, star IT, etc.) to which its equipment is intended to be connected in its final application. The equipment under test shall be tested to those identified configurations or the worst-case configuration.

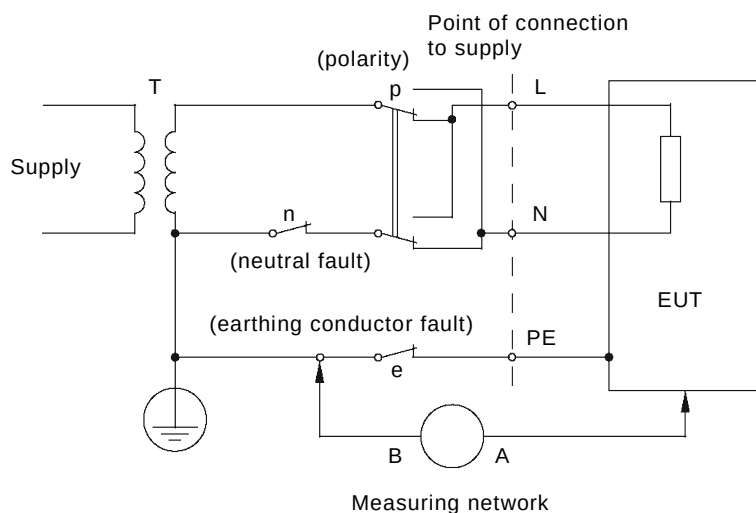The use of isolating transformer (T) is optional. When not used, safety precautions shall be taken to protect the test operator from any hazardous voltage on the enclosure and other accessible conductive parts of the equipment.



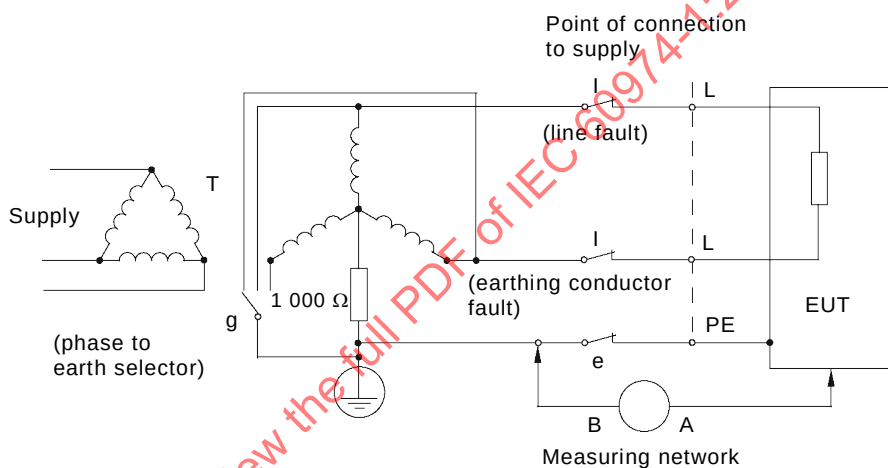a) Single-phase equipment on star TN or TT system



b) Single-phase equipment connected line-to-line on star TN or TT system







**Figure N.2 – Diagram for touch current measurement on fault condition at operating temperature for single-phase connection of appliances other than those of class II**

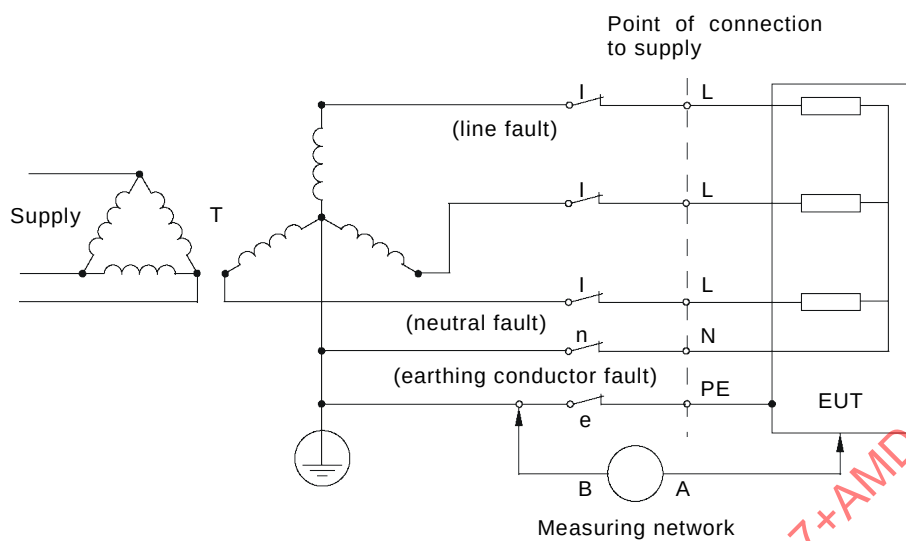

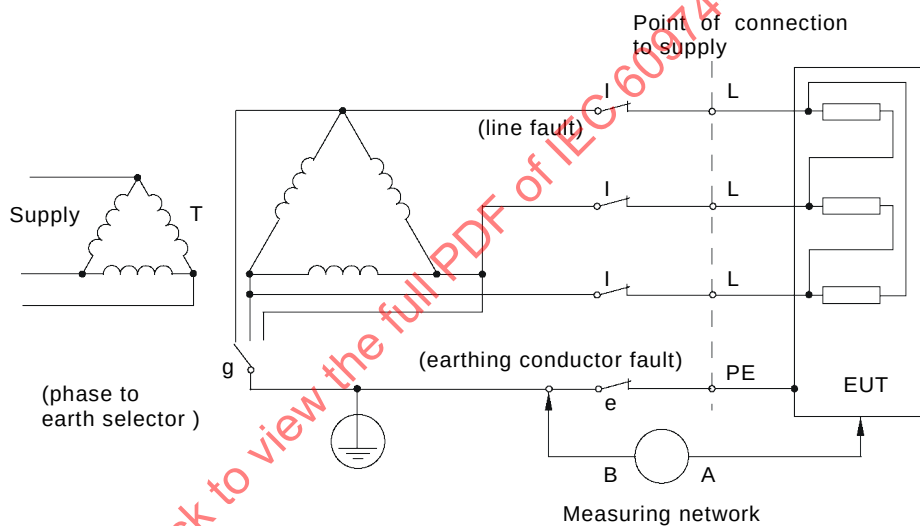
a) Three-phase equipment on star TN or TT system



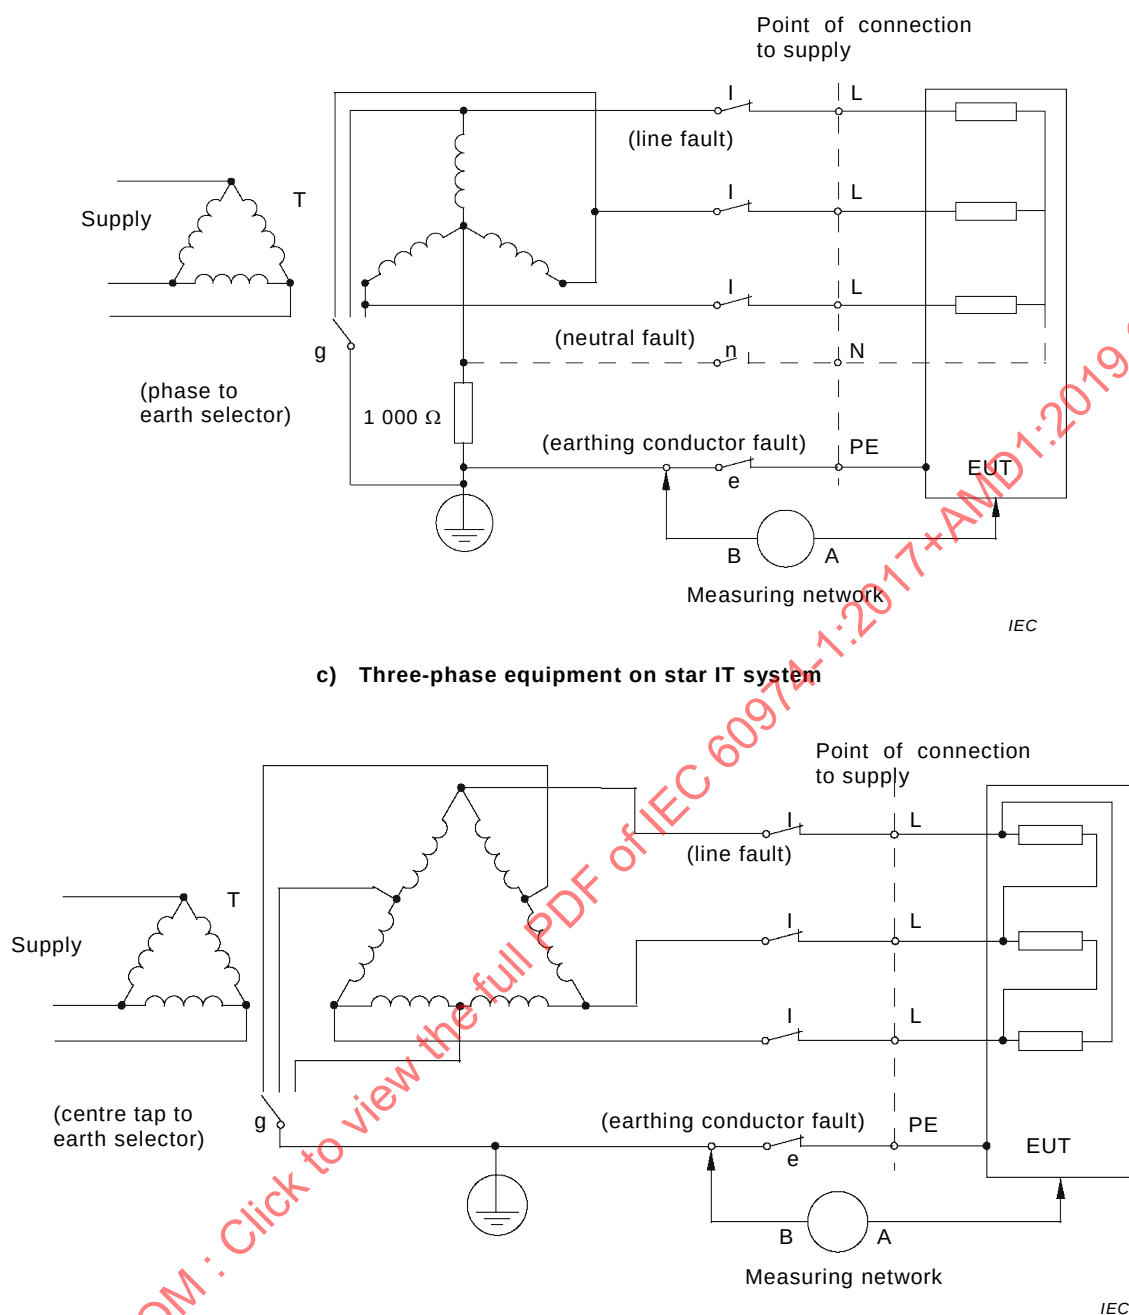b) Three-phase equipment on unearthed three-phase three-line system



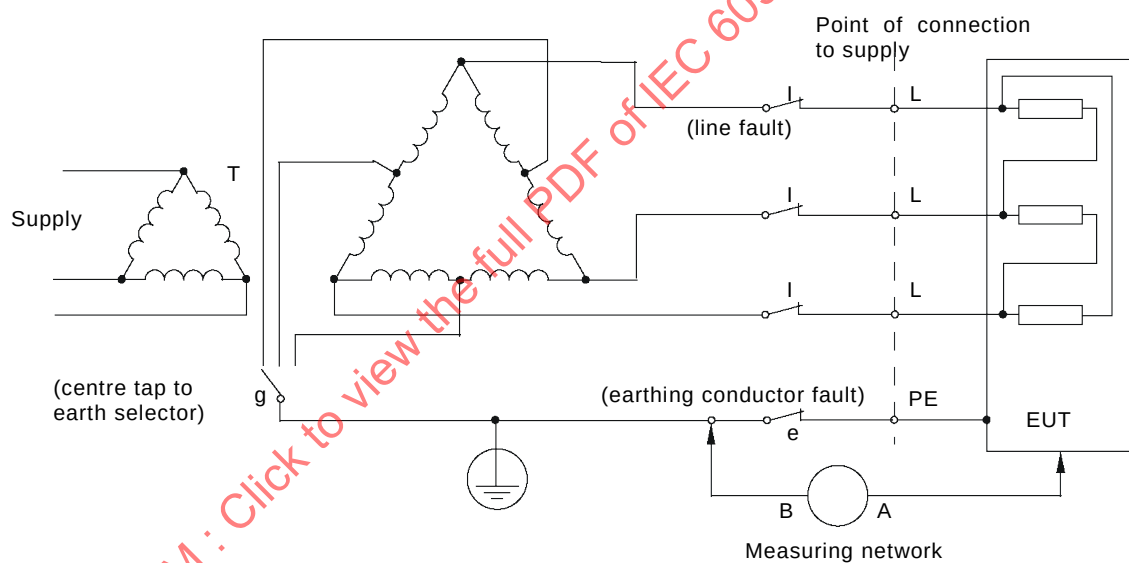c) Three-phase equipment on star IT system



d) Three-phase equipment on earthed centred three-phase three-line system

Figure N.3 – Diagram for touch current measurement on fault condition for three-phase four-wire system connection of appliances other than those of class II

## Annex O (normative)

### Battery-powered welding power sources

#### O.1 General

Annex O applies to rechargeable battery-powered welding power sources for arc welding and allied processes and the **battery** packs for such equipment.

**Battery-powered welding power sources** are welding power sources powered either by:

- **integral batteries**,
- **detachable battery packs**,
- **separable battery packs**.

All clauses of this document apply unless otherwise specified in Annex O. If a clause is included in Annex O, the numbered clauses of Annex O replace or add to the numbered clauses of the main body. Unless otherwise specified, the content of clauses and subclauses in Annex O replaces the content of the corresponding clauses and subclauses in the main body. Additional subclauses are numbered O.x.201, O.x.202, etc.

Battery-powered welding power sources and **battery** packs covered by Annex O can be operated:

- completely disconnected and isolated from the supply network;
- connected to the supply network with the **welding circuit** isolated from supply network.

Requirements for protection against risk of electric shock depend on specific electrical topology.

If the battery-powered welding power source can also be used during charging, the insulation requirements have to be considered when designing the charging unit.

Since **battery** packs for welding power sources are submitted to different use patterns (such as rough use, high charging and discharging currents), their safety can be evaluated only by Annex O and not by using other standards for **battery** packs, such as the IEC 62133 series, unless otherwise indicated in Annex O. All relevant requirements of IEC 62133-1:— and IEC 62133-2:— are addressed in Annex O.

When evaluating the risk of fire associated with **detachable battery packs**, consideration has been given to the fact that these **battery** packs are unattended energy sources and have been evaluated as such in this document. Requirements in other standards regarding the risk of fire due to the charging of these **detachable battery packs** are therefore considered to be fulfilled.

Annex O also addresses requirements covering the use of lithium-ion **cells** employed in **battery systems** in welding power sources. The following shall be considered within the context of these requirements.

- These requirements address the safety of batteries during storage and use including discharge and charge, and not any possible hazards associated with toxicity nor potential hazards associated with transportation or disposal.

NOTE 1 IEC 62281 covers the safety aspects of lithium-ion batteries during transport.

- **Battery systems** covered by these requirements are not intended to be serviced by the end user.
- These requirements are intended to provide comprehensive evaluation of a **battery** only if used in products covered by this document.
- These requirements address the safety of **battery systems** during storage and use including discharge and charge. These requirements are only considered to be supplementary requirements in regards to battery **charger** fire and electric shock.
- These requirements refer to and require parameters supplied in reference to the **cells** that establish conditions for safe use of those **cells**. Those parameters form the basis of acceptance criteria for a number of tests contained herein. This document does not independently evaluate the safety of **cells**. These parameters, taken as a set, constitute the “**specified operating region**” for a **cell**. There may be several sets of **specified operating region(s)**.

Annex O does not apply to the safety of battery **chargers** themselves. However, it covers the safe functioning of **battery systems**. The equipment including charging unit, **battery** pack and welding power source shall meet the separation requirements of this document.

NOTE 2 IEC 60335-2-29 covers a variety of **chargers**.

Annex O does not provide comprehensive safety information for manufacturing, maintenance and repair personnel.

## O.4 Environmental conditions

*Addition to Clause 4 of this document:*

Battery conditions shall not exceed the battery's **specified operating region**. Depending on the technology used, different environmental conditions can be necessary and the resulting welding power source and/or **battery** pack shall be marked accordingly (see 15.1).

NOTE See IEC 62133-2:—<sup>3</sup>, Figure A.1 for details.

## O.5 Tests

### O.5.1 Test conditions

Successive testing performed on a **battery** can result in cumulative stress which can cause permanent damage to the **battery** and should be avoided. Additional samples may be used as necessary, except for the **type tests** where only one sample shall be used.

Tests shall be carried out on new, dry and completely assembled welding power sources.

The heating test defined in O.7.1 and the **thermal protection** test defined in 8.5 shall be carried out at ambient temperature of 40 °C, see tolerances in 7.1.2 e).

Other tests shall be carried out at an ambient air temperature given in Clause 4 a).

*Unless otherwise specified, tests shall be performed starting with a **fully charged battery**.*

---

<sup>3</sup> Under preparation.

Some of the tests may result in fire or explosion. It is therefore recommended that personnel should be protected from the flying fragments, explosive force, sudden release of heat, chemical burns, intense light and noise that may result from such explosions. The test area should be well ventilated to protect personnel from possible harmful fumes or gases.

*Addition to 5.1 of this document:*

**O.5.1.201** When measuring voltage, the peak value of any superimposed ripple exceeding 10 % of the average value shall be included. Transient voltages are ignored, such as a temporary increase of voltage, for example after the **battery** pack is removed from the charger.

**O.5.1.202** Measurements of **cell** voltages during the tests of lithium-ion systems shall be made using a single pole resistive-capacitive low pass filter with a cut-off frequency of 5 kHz  $\pm$  500 Hz. If charging voltage limits have been exceeded, the peak value of the voltage measured after this network shall be used. The measurement shall have measurement tolerance within  $\pm 1$  % for the combined filter circuit and voltmeter.

**O.5.1.203** Unless otherwise specified, all batteries shall be fully conditioned as follows: **batteries** shall be **fully discharged** and after a rest of two hours charged in accordance with the manufacturer's instructions.

**O.5.1.204** The location of thermocouples for **cell** temperature measurements shall be on the outer surface, half way along the longest dimension, of the **cell** that results in the highest temperature.

**O.5.1.205** Currents measured during **battery** charging shall be average currents with an averaging period of 1 s to 5 s. Current limits set by the battery manufacturer's specification shall not be exceeded.

**O.5.1.206** If not otherwise specified, a **fully charged battery** shall be used.

**O.5.1.207** When a **battery** comprised of a single **cell** is employed, instructions in this document referring to special preparations of a **cell** in a series configuration do not apply.

**O.5.1.208** For **battery** designs where there is a series arrangement of parallel clusters of cells, the cluster shall be treated as a single **cell** for those tests that require altering the amount of charge on a single **cell** prior to conducting the test.

**O.5.1.209** Unless the manufacturer specifies a different voltage, the end-of-discharge voltages for common **cell** chemistries are:

- 0,9 V per cell for nickel cadmium or nickel metal-hydride **batteries**;
- 1,75 V per cell for lead-acid **batteries**;
- 2,5 V per cell for lithium-ion **batteries**.

### **O.5.3 Conformity of components**

*Addition to 5.3 of this document:*

**Cells** employed in welding power sources or **cells** employed in **battery** packs shall comply with IEC 62133-1:— or IEC 62133-2:—, except for lead-acid **batteries**.

NOTE The above requirement for testing according to IEC 62133-1:— or IEC 62133-2:— does not include the **battery** pack itself.



## O.6 Protection against electric shock

### O.6.1 Insulation

#### O.6.1.1 General

*Addition to 6.1.1 of this document:*

Protection against electric shock from **battery voltage class B** circuits shall be composed of;

- **basic protection** measures against direct contact with live parts;
- measures for protection under **single-fault conditions**.

The protection measures shall meet the requirements as described in a) and b) or a) and c).

##### a) **Basic protection** measures

Persons shall be protected against direct contact with the live parts of the **battery voltage class B** electric circuits. The protection measures against direct contact shall be provided by one of the following:

- **basic insulation** of the live parts;
- enclosures, preventing access to the live parts.

The enclosures may be electrically conductive or non-conductive.

##### b) Protection under **single-fault conditions**

- Equipotential bonding

Exposed conductive parts of **battery voltage class B** electric equipment, including exposed conductive enclosures, shall be bonded together for potential equalization in accordance with the requirements in O.10.5.201.

- Insulation resistance

The **battery voltage class B** electric circuits intended to be not conductively connected to the supply network shall have sufficient insulation resistance in accordance with the requirements in O.6.1.4.

Requirements on insulation resistance for **battery voltage class B** electric circuits intended to be conductively connected to the supply network shall comply with 6.1.4.

##### c) Alternative approach for protection against electric shock

As an alternative to b), the equipment manufacturer shall conduct an appropriate risk assessment and establish a set of measures which give sufficient protection against electric shock under **single-fault conditions**.

#### O.6.1.4 Insulation resistance

*Addition to 6.1.4 of this document:*

The minimum insulation resistance from **battery voltage class B** circuits to accessible surfaces shall be at least 100  $\Omega/V$ . The reference shall be the maximum **working voltage**.

NOTE Hazard of electric shock occurs when electric currents depending on value and duration pass through the human body. Harmful effects can be avoided if the current is within zone DC-2 for DC or zone AC-2 for AC as shown in IEC TS 60479-1:2005, Figure 20 and Figure 22, respectively. The relation of harmful body currents and other wave forms and frequencies is described in IEC TS 60479-2. The insulation resistance requirements of 100  $\Omega/V$  for DC allow body currents of 10 mA.

To meet the above requirement for the entire circuit, it is necessary to have a higher insulation resistance for each component, depending on the number of the components and the structure of the circuit to which they belong.

*Conformity shall be checked by the following procedure*

## a) Preconditioning and conditioning

Prior to the measurement, the device under test (DUT) shall be subjected to a preconditioning period of at least 8 h at  $(5 \pm 2) ^\circ\text{C}$ , followed by a conditioning period of 8 h at a temperature of  $(23 \pm 5) ^\circ\text{C}$ , a humidity of  $90^{+10}_{-5} \%$ , and an atmospheric pressure of between 86 kPa and 106 kPa.

Alternative preconditioning and conditioning parameters may be selected provided transition across the dew point occurs shortly after the beginning of the conditioning period.

The insulation resistance shall be measured during the conditioning period at a rate from which the lowest value can be determined.

## b) Insulation resistance measurements

The insulation resistance of entire conductively connected **battery voltage class B** electric circuits may be measured using the test procedure for the measurement of the rechargeable energy storage system (RESS) given in ISO 6469-1:2009, 6.1.3.

If the system has several voltage ranges (e.g. because of boost converter) in a conductively connected circuit and some of the components cannot withstand the maximum **working voltage** of the entire circuit, the insulation resistances of components can be measured separately by applying their own maximum **working voltages** after those components are disconnected.

The measurements shall be performed using suitable instruments that can apply DC voltage (e.g. megohmmeter, provided they deliver the required test voltage).

**O.6.1.5 Dielectric strength**

*Addition to 6.1.5 of this document:*

a) **battery voltage class B** circuits not conductively connected to the supply network

For **battery voltage class B** circuits the test voltage, AC or DC, shall be greater than the highest voltage that can actually occur to the component. The test voltage shall be derived from the relevant over-voltages of the electric circuit to which the component is connected. Transient over-voltages that can be expected, including influences from other connections to the supply network, if any, shall be considered. The test voltage and its duration shall be specified, considering the applicable parts and sections of IEC 60664 by the manufacturer.

This test is intended to demonstrate the adequacy of the protection measures to isolate live parts of **battery voltage class B** electric circuits.

b) **battery voltage class B** circuits conductively connected to the supply network

These shall comply with 6.1.5.

*Addition to 6.1 of this document:*

**O.6.1.201 Creepage distances** (6.1.2) and **clearances** (6.1.3) do not apply to the construction of **battery cells** or the interconnections between **cells** in a **battery** pack.

**O.6.1.202** When evaluating a **battery** pack for protection against electric shock, **creepage distances**, **clearances** and distances through insulation, the **battery** pack shall be connected to the **charger**.

**O.6.2 Protection against electric shock in normal service**

*Addition to 6.2 of this document:*

**O.6.2.201** Battery-powered welding power sources and **battery** packs shall be so constructed and enclosed that there is adequate protection against electric shock.

*Conformity shall be checked by inspection, and by the tests of O.6.2.202 to O.6.2.205, as applicable.*

**O.6.2.202** For detachable and **separable battery packs** it shall not be possible to have two conductive, simultaneously **accessible parts** where the voltage between them exceeds 60 V DC.

**O.6.2.203** A **battery system** shall be short-circuit protected by an over-current interruption device. The over-current interruption device shall be suitable for this application.

**O.6.2.204** Batteries exceeding a voltage of 113 V DC shall be insulated in accordance with 6.2.4 (Isolation of the **welding circuit**).

**O.6.2.205** **Battery voltage class B** circuits up to a voltage of 113 V DC may be conductively connected to the welding circuit provided the **no-load voltage** does not exceed 60 V DC in a **single-fault condition**.

NOTE A switch-disconnector element in accordance with IEC 60947-3 having an appropriate rating is considered to meet the single-fault requirement.

## **O.7 Thermal requirements**

### **O.7.1 Heating test**

#### **O.7.1.1 Test conditions**

When placing the measuring devices, the only access permitted shall be through openings with cover plates, inspection doors or easily removable panels provided by the manufacturer. The ventilation in the test area and the measuring devices used shall not interfere with the normal ventilation of the welding power source or cause abnormal transfer of heat to or from it.

The welding power source is operated at constant current starting with a **fully charged battery**:

- a) with the **rated maximum welding current** ( $I_{2max}$ ) with **consecutive operating cycles**;
- b) with the **rated welding current** ( $I_2$ ) which allows continuous operation;

until the welding power source no longer operates due to the **battery** being discharged.

For welding power sources with **detachable battery packs** or **separable battery packs** the test is performed three times on one welding power source in immediate succession with **fully charged battery packs**.

If it is known that neither a) nor b) gives maximum heating, then a test shall be made at the setting within the rated range which gives the maximum heating.

Additionally for welding power sources where continuous charging during welding is possible a heating test as specified in 7.1 shall be conducted where the charge of the **battery** is the same at the end of the test as it was at the beginning.

The ambient temperature condition of O.5.1 shall be fulfilled before starting the test and the batteries shall be conditioned as specified in O.5.1.203.

NOTE 1 This maximum heating is possible at the no-load condition.

NOTE 2 Operation time of welding equipment changes with **battery** temperature, which could lead to higher component temperatures at different ambient temperatures (e.g. 20 °C).

### O.7.1.3 Duration of test

The heating test for the continuous operation shall be carried out at the highest welding current and **conventional load voltage** that fully discharges the **battery** without interruption (e.g. thermal protection or automatic means).

## O.7.2 Temperature measurement

### O.7.2.1 Measurement conditions

The temperature shall be determined as follows:

- a) for windings, by measurement of the resistance, or by surface or embedded temperature sensors;

NOTE 1 The surface temperature sensor method is not preferred.

NOTE 2 In the case of windings of low resistance having switch contacts in series with them, the resistance measurement can give misleading results.

- b) for other parts, by surface temperature sensors.

### O.7.4 Loading test

Welding power sources shall withstand repeated load cycles without damage or functional failure. This test may be conducted on any welding power source that functions correctly.

*Conformity shall be checked by the following tests and by establishing that no damage or functional failure to the welding power source occur during the tests.*

Starting from the cold state, the welding power source is loaded at the **rated maximum welding current** until one of the following occurs:

- a) the **thermal protection** is actuated;
- b) the maximum temperature limit of the windings is reached;
- c) the **battery** is fully discharged.

Immediately after reset of the **thermal protection** in a), or after b) or c), the following test is carried out.

Immediately, while equipment is still hot, the equipment shall be checked in accordance with 6.1.5 and O.6.1.5 if applicable.

*Addition to Clause 7 of this document:*

#### O.7.201 Normal charging of lithium-ion systems

Charging a lithium-ion **battery** under normal conditions shall not exceed the **specified operating region for charging** of the **cell**.

*Conformity shall be checked by the following tests.*

*The **battery** is charged in accordance with the **charging system** instructions starting with a **fully discharged battery**. Testing is carried out at an ambient temperature of  $(40 \pm 5) ^\circ\text{C}$  and*

- *if the welding power source is recommended to be operated at a minimum temperature lower than  $4 ^\circ\text{C}$ , the test is also conducted at that minimum temperature  $-5 ^\circ\text{C}$ ;*

- if the welding power source is recommended to be operated at a maximum temperature greater than 40 °C, the test is also conducted at that maximum temperature  $^{+5}_0$  °C.

For individual **cells**, the voltage, the temperature measured in accordance with O.5.1.20 and the charging current are monitored to ensure that the hotspot of the **battery** pack is within limits. In the case of parallel configurations, analysis may be used to avoid measuring the individual branch currents. The result shall not exceed their **specified operating region for charging** (e.g. limits of voltage and current dependent on the temperature).

NOTE 1 The following is an example result of such analysis: the charging current for each branch of a parallel connection would not need to be monitored, if the maximum deliverable current of the **charger** did not exceed the **maximum charging current** of a single **cell**.

For **batteries** employing series configurations, the test is repeated with a deliberately imbalanced **battery**. The imbalance is introduced into a **fully discharged battery** by charging one **cell** to approximately 50 % of full charge.

If it can be demonstrated through testing and/or design evaluation that an imbalance less than 50 % would actually occur in **normal use**, then this lower imbalance may be used.

NOTE 2 Examples are those designs that employ circuitry intended for maintaining balance between **cells** in the **battery** pack. Systems with a small number of **cells** in series may be shown to exhibit limited imbalance in practice, if the product ceases to operate with a **battery** prepared with a smaller initial imbalance.

NOTE 3 An example for a testing is repeated charging and discharging of a **battery** in accordance with the manufacturer's instructions until its capacity has decreased to 80 % of the rated capacity, using the imbalance at the end of the test.

## O.8 Thermal protection

### O.8.1 General requirements

A battery-powered welding power source shall be fitted with **thermal protection**. This **thermal protection** shall meet the requirements of 8.2, 8.3, O.8.4 and 8.5 to 8.7.

Conformity shall be checked by **visual inspection**.

### O.8.4 Operating capacity

The **thermal protection** shall be able to operate 200 times, when the welding power source delivers its **rated maximum welding current**.

Conformity shall be checked with a suitable overload of a circuit having the same electrical characteristics, especially current and reactance, as the circuit in which the **thermal protection** is used.

## O.9 Abnormal operation

### O.9.1 General requirements

All welding power sources and their battery packs shall not break down and increase the risk of electric shock or fire under the conditions of operations O.9.2 to O.9.207.

Conformity shall be checked by the following tests.

### O.9.2 Stalled fan test

A welding power source, which relies on motor-driven fan(s) for conformity with the tests of Clause 7, is operated with a **fully charged battery** while the fan motor(s) is(are) mechanically stalled and the welding power source is operated at the output condition of O.7.1.

### O.9.3 Short circuit test

The battery-powered welding power source is short circuited with the torch and the welding cables normally supplied by the manufacturer, or, if none are supplied, by a conductor 1,2 m in length and of the cross-section given in Table 8.

NOTE Cross sections for non-SI system are given in Table F.1

The battery-powered welding power source at the maximum output setting with a **fully charged battery** shall not clear fuses or circuit-breakers when short circuited:

- a) for 15 s in the case of a **drooping characteristic**;
- b) three times for 1 s, within a period of 1 min, in the case of a **flat characteristic**.

The short circuit is then applied for 2 min or until a protection device operates.

### O.9.4 Overload test

This subclause is not applicable.

*Addition to Clause 9 of this document:*

#### O.9.201 Welding power source – abnormal conditions

The battery-powered welding power source, **battery** pack and the cables of b) and c), as appropriate, are placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm. The test is conducted until failure or until the test sample returns to within 5 K of the ambient temperature or, if neither of these occurs, until at least 3 h has elapsed. A new sample may be used for each fault listed below. No **explosion** shall occur during or after the test. There shall be adequate protection against electric shock as defined in O.6.2. No **charring** or burning of the cotton shall result. **Venting** of the **cells** is permitted.

The resistance for the short in items a), b) and c) shall not exceed 10 mΩ. **Charring** or igniting of the cotton from the shorting means is not considered a failure.

Fuses, **thermal cut-outs**, **thermal links**, **temperature limiters**, electronic devices or any component(s) or conductors(s) that interrupt the discharge current may operate during the above tests. If these devices are relied upon to pass the test, the test is to be repeated two more times, using two additional sample devices, and shall open the circuit in the same manner, unless the test is otherwise satisfactorily completed. Alternatively, the test may be repeated with the open-circuited device bridged.

- a) Combinations of exposed terminals of a **detachable battery pack** are shorted so as to produce the worst result. **Battery** pack terminals that can be contacted using either test probe B of IEC 61032:1997 or test probe 13 of IEC 61032:1997 are considered exposed. The means of shorting shall be selected or positioned such that **charring** or ignition of the cotton is not influenced.
- b) Any cable provided between the **separable battery pack** and the battery-powered welding power source shall be shorted at the point likely to produce the most adverse effects.
- c) Any cable provided between the **battery** pack or the battery-powered welding power source and the **charger** shall be shorted at the point likely to produce the most adverse effects.



### O.9.202 Welding circuit components – abnormal conditions

The following fault conditions are considered for the power circuit path of the welding power source and, if necessary, applied one at a time, consequential faults being taken into consideration:

- a) open-circuit at the terminal of any component;
- b) short-circuit of capacitors, unless they comply with IEC 60384-14;
- c) short-circuit of any two terminals of an **electronic component**, other than a monolithic integrated circuit. This fault is not applied between the two circuits of an optocoupler;
- d) failure of triacs in the diode mode;
- e) failure of a monolithic integrated circuit or other circuits that cannot be assessed by the fault conditions a) to d). In this case the possible hazardous situations of the welding power source are assessed to ensure that safety does not rely on the correct functioning of such a component. All possible output signals are considered under fault conditions within the integrated circuit. If it can be shown that a particular output signal is unlikely to occur, then the relevant fault is not considered.

Components such as thyristors and triacs are not subjected to fault condition e).

Positive temperature coefficient resistors (PTCs) are not short-circuited if they are used within their manufacturer's declared specification.

For simulation of the conditions, the welding power source is operated at no-load condition adjusted to maximum output setting.

The test is conducted until failure or until one of the following occurs:

- thermal equilibrium is achieved; or
- the test samples return to within 5 K of the ambient temperature; or
- a test period of 3 h has elapsed.

NOTE Examination of the welding power source and its circuit diagram will reveal the fault conditions which have to be simulated through circuit analysis, so that testing can be limited to those cases which may be expected to give the most unfavourable result.

### O.9.203 Lithium-ion charging systems – abnormal conditions

This subclause applies only to lithium-ion **batteries**.

The **charging system** and **battery** of a lithium-ion system shall be so designed that the risk of fire and **explosion** as a result of abnormal operation during charging is obviated as far as is practical.

*Conformity shall be checked by the following test.*

*A sample containing the **battery** and the associated assemblies of the **charging system** are placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm. The **battery system** is operated as specified in O.17.1 t) 1) with all of the categories of abnormal conditions listed below in a) to d).*

- a) Components in the **charging system** are faulted as in O.9.202 a) to e), one at a time, if the outcome of such a fault is uncertain based upon analysis. For each fault condition introduced, the state of the battery before charging is as follows:
  - a series configured **battery** shall have a deliberate imbalance. The imbalance is introduced into a **fully discharged battery** by charging one **cell** to approximately 50 % of full charge; or

- if the test of O.7.201 is conducted with an imbalance of less than 50 %, a series configured **battery** shall have a deliberate imbalance as established in O.7.201; or
  - a single **cell** or parallel only configuration **battery** shall be **fully discharged**.
- b) If the test of O.7.201 is conducted with an imbalance of less than 50 % due to the function of circuit(s), and if a single fault of any component within that circuit(s) is shown to result in the loss of that function, then a series configured **battery** shall be charged with a deliberate imbalance. The imbalance is introduced into a **fully discharged battery** by charging one **cell** to approximately 50 % of full charge.
- c) For a **battery** with a series configuration, all cells are at approximately 50 % charge, except for one which is shorted. The battery is then charged.
- d) With a **fully charged battery** connected to the **charger**, a short is introduced to the **charging system** across a component or between adjacent PCB tracks at a location expected to produce the most unfavourable results to evaluate the effect of back-feed from the **battery**. For a **charger** with a cable that connects to the **battery**, the short shall be introduced at the point likely to produce the most adverse effects. The resistance of the short shall not exceed 10 mΩ.

During the tests, each **cell** voltage is continuously monitored to determine if it has exceeded the limit condition. **Venting** of the **cells** is permitted.

The test is conducted until the sample under test experiences a failure, returns to within 5 K of the ambient temperature or, if neither of these, until at least 7 h or twice the normal charge period has elapsed, whichever is longer.

Tests are considered passed if all of the following are true:

- *There has been no **explosion** during the test.*
- *No **charring** or burning of the cotton has resulted. **Charring** or igniting of the cotton from the shorting means is not considered a failure.*
- *The **cells** shall not have exceeded the **upper limit charging voltage** by more than 150 mV or, if they have, then the **charging system** shall be permanently disabled from recharging the **battery**. To determine if recharging is disabled, the **battery** shall be discharged by using the welding power source tested (in the case of an integral system) or by using a new sample of the welding power source (in the case of a detachable **battery system**) to approximately 50 % charge, followed by an attempt to recharge the **battery** normally. There shall be no charging current after 10 min or after 25 % of the nominal capacity has been delivered, whichever occurs first.*
- *There shall be no evidence of damage to the **cell** vent to impair compliance with O.14.204.*

#### O.9.204 Lithium-ion battery short circuit

This subclause applies only to lithium-ion **batteries**.

There shall be no risk of fire or **explosion** when the main discharge connections of a series configured **integral battery**, **detachable battery pack** or **separable battery pack** are shorted under conditions of extreme imbalance.

*Conformity shall be checked by the following test.*

*The test is conducted with all the **cells** of the **battery fully charged** and one **cell fully discharged**.*

*A **detachable battery pack** or **separable battery pack** is placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm.*



A welding power source containing an **integral battery** is placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm.

The main discharge connections of the **battery** are shorted with a resistance not to exceed 10 m $\Omega$ . The test is conducted until the test sample experiences a failure or until the test sample returns to within 5 K of the ambient temperature. There shall be no **explosion** during or after the test. As a result of the test, there shall be no **charring** or burning of the cotton. **Venting of cells** is acceptable.

**Charring** or igniting of the cotton from the shorting means is not considered a failure.

Fuses, **thermal cut-outs**, **thermal links**, **temperature limiters**, electronic devices or any component(s) or conductor(s) that interrupt the discharge current may operate during the above tests. If these devices are relied upon to pass the test, the test is to be repeated two more times, using two additional samples, and shall open the circuit in the same manner, unless the test is otherwise satisfactorily completed. Alternatively, the test may be repeated with the open-circuited device bridged.

#### O.9.205 Batteries other than lithium-ion – overcharging

**Batteries** comprised of **cells** other than the lithium-ion type shall withstand abusive overcharging without risk of fire or **explosion**.

Conformity shall be checked by the following test.

The **battery** is placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm and charged at a rate of 10 times the **C<sub>5</sub> rate** for the **battery** for 85 min. There shall be no **explosion** and no **charring** or burning of the cotton. **Venting** of the **cells** is acceptable.

#### O.9.206 Battery pack disconnection

Plugs, connectors and switches in the electrical current path of **battery** packs shall be suitable for this application and shall be able to disconnect the **battery** pack from battery-powered welding power sources without risk of fire and without risk of electrical shock.

This clause does not apply to a welding power source with an **integral battery**.

Conformity shall be checked by **visual inspection** according to O.6.1.202 after the following tests.

The **fully charged battery** pack operating the battery-powered welding power source the output of which is connected to a **conventional load** and adjusted to produce the **rated maximum welding current** is disconnected 10 times.

#### O.9.207 General purpose batteries

For **general purpose** batteries replaceable by the user additional risk analysis should be performed by the manufacturer.

### O.10 Connection to the supply network

Clause 10 is applicable only for **battery voltage class B** circuits conductively connected to the supply network, except as follows:

### O.10.5 Protective circuit

*Addition to 10.5 of this document:*

#### O.10.5.201 Continuity test for equipotential bonding of battery voltage class B circuits

All components forming the equipotential bonding current path (conductors, connections) shall withstand the maximum current in a single-fault situation.

The resistance of the equipotential bonding path between any two exposed conductive parts of the **battery voltage class B** electric circuit that can be touched simultaneously by a person shall not exceed 0,1  $\Omega$ .

The equipotential bonding resistances shall be tested by injecting a current of at least 10 A at 50 Hz or 60 Hz derived from a SELV source, which shall be passed through the potential current path between any two exposed conductive parts for at least 5 s. This path shall be isolated from other unintended potential paths for measurement. These conducting parts shall include **battery voltage class B** component housings, connections to battery-powered welding power source and the enclosures.

The voltage drop between any two reachable exposed conductive parts in a distance up to 2,5 m shall be measured and the resistance calculated from the current and this voltage drop.

NOTE 2,5 m is the usual distance which a person can reach.

### O.10.8 Supply circuit on/off switching device

*Addition to 10.8 of this document:*

Where a built-in **battery** circuit on/off switching device (for example switch, contactor or circuit-breaker) is provided, this shall:

- a) plainly indicate whether the circuit is open or closed, and
- b) be rated as follows:
  - voltage: not less than the rated **battery** voltage,
  - current: not less than the **battery** current at conventional welding condition with rated maximum welding current,or
- c) be suitable for this application.

*Conformity shall be checked by **visual inspection** for b) in accordance with other relevant standards, and for c) by the following tests.*

**Overload:** The output of the **fully charged** battery-powered welding power source is short-circuited in accordance with O.9.3. The switching device is operated for 100 cycles at the rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

**Endurance:** The output is connected to a **conventional load** and adjusted to produce the **rated maximum welding current**. The switching device is operated for 1 000 cycles at a rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

*Addition to Clause 10 of this document:*

**O.10.201** For battery-powered welding power sources with **separable battery packs**, the external flexible cable shall have anchorages such that the conductors are relieved from strain, including twisting, where they are connected within the welding power source, and protected from abrasion.

*Conformity shall be checked by test in accordance with 10.6.*

## **O.14 Mechanical provisions**

### **O.14.1 General requirements**

*Addition to 14.1 of this document:*

Following the test, the battery-powered welding power source and **battery** pack shall not catch fire or explode.

In addition, the following applies for lithium-ion **batteries** after the test of O.14.2.2 and O.14.4:

- the open circuit voltage of the **battery** shall not be less than 90 % of the voltage measured immediately prior to the test;
- the **battery** shall demonstrate normal discharging and recharging after the test;
- there shall be no damage to the **cell** vent that impairs compliance with O.14.204.

### **O.14.2 Enclosure**

#### **O.14.2.2 Enclosure strength**

*Addition to 14.2.2 of this document:*

**Detachable battery packs** shall be fitted during enclosure strength test.

For **detachable battery packs** or **separable battery packs** with a mass greater than or equal to 3 kg the test is repeated on the **battery** packs separately.

#### **O.14.4 Drop withstand**

Equipment with any **detachable battery pack** attached shall be capable of withstanding a drop test. For this test, the equipment shall be equipped with all the associated attachments, cooling liquid and filler wire (excluding gas cylinders, separate trailers, carts and wheel undercarriages, unless these items are standard equipment and permanently affixed) that are recommended to be installed.

The heights for the drop test shall be as follows:

- a) equipment with a mass of up to 25 kg shall withstand a drop of 250 mm;
- b) equipment with a mass of greater than 25 kg shall withstand a drop of 100 mm.

NOTE 1 Mass of equipment includes mass of associated attachments, cooling liquid and filler wire.

*Conformity shall be checked by dropping the equipment three times on a hard and rigid surface. This test is so arranged that a different bottom edge of the equipment is struck each time it drops.*

NOTE 2 In practice, one corner will touch the impact surface first.

*In addition, for **detachable battery packs** or **separable battery packs** with a mass less than 3 kg, the test is repeated on the **battery** packs separately three times from a height of 1 m. The sample shall be positioned to vary the point of impact.*

*Addition to Clause 14 of this document:*

**O.14.201** It shall not be possible to install a **detachable battery pack** or a **separable battery pack** in reverse polarity.

*Conformity shall be checked by inspection.*

#### **O.14.202** Lithium-ion **battery** enclosure pressure test

This subclause applies only to lithium-ion **batteries**.

An enclosure for lithium-ion **batteries** shall be designed such that it will safely release gasses that may be generated as a result of **venting**.

*Conformity shall be checked by measurement in the case of a) or by the test of b):*

- a) *the total area of the openings in the enclosure allowing gasses to pass without obstruction shall be equal to or greater than 20 mm<sup>2</sup>; or*
- b) *the enclosure shall be tested as follows.*

*A total of (21 ± 2,1) ml of air shall be delivered at an initial pressure of (2 070 ± 207) kPa through a (2,87 ± 0,05) mm diameter orifice to the enclosure of a welding power source with **integral battery** or the enclosure of a **detachable battery pack** or **separable battery pack**. The pressure within the enclosure shall drop below 70 kPa in 30 s. There shall be no rupturing that would cause the enclosure to fail to meet the requirements of this document. An additional volume, not to exceed 3 ml, is allowed to be added to the enclosure volume as may be required for test fittings.*

**O.14.203** The manufacturer shall instruct the user that only **general purpose batteries** specified by the manufacturer shall be used as the primary energy source for battery-powered welding power sources.

*Conformity shall be checked by inspection.*

**O.14.204** Vents of battery **cells** shall not be obstructed in such a way as to defeat their operation if **venting** is relied upon for safety.

*Conformity shall be checked by inspection or, if in doubt, by inspecting the **cells** after conclusion of the abnormal tests of O.9.201 a), b) and c) to ensure that **cells** have not vented by any means other than through the **cell vent**.*

**O.14.205** User accessible interfaces between elements of a **battery system** shall not employ connectors of the following types:

- standard mains inlet connectors, except for mains supply connections;
- barrel connectors with outside diameters of 6,5 mm or less;
- phone plugs with a diameter of 3,5 mm or less.

*Conformity shall be checked by inspection.*

### **O.15** Rating plate

#### **O.15.3** Contents

##### a) Identification

Box 4      Welding power source symbol if applicable (optional) and type of **integral battery** for example:

|        |                                       |
|--------|---------------------------------------|
| NiCd   | nickel cadmium <b>batteries</b>       |
| NiMH   | nickel metal-hydride <b>batteries</b> |
| Li-ion | lithium-ion <b>batteries</b>          |

b) Welding output

|        |                      |                                                    |
|--------|----------------------|----------------------------------------------------|
| Box 12 | $I_{2max} = \dots A$ | Symbol and value of rated maximum welding current. |
| Box 13 | $U_2 = \dots V$      | Symbol and value of the conventional load voltage. |
| Boxes  | 11a, 11b, 11c        | Not applicable.                                    |
|        | 12a, 12b, 12c        | Not applicable.                                    |
|        | 13a, 13b, 13c        | Not applicable.                                    |

Alternatively for welding power sources where continuous charging during welding is possible in accordance with O.7.1.1, the **duty cycle** as specified in 15.3 b) may be used.

c) Energy supply

|              |                                    |
|--------------|------------------------------------|
| Box 14       | Energy supply symbol, for example: |
| $\text{---}$ | Direct current                     |

| Box                                                    | Welding power sources with integral battery |                                                                            | Box | Welding power sources with detachable or separable battery |                                       |
|--------------------------------------------------------|---------------------------------------------|----------------------------------------------------------------------------|-----|------------------------------------------------------------|---------------------------------------|
| 15                                                     | $U_b \dots V$                               | Rated battery voltage                                                      | 15  | $U_b \dots V$                                              | Rated battery voltage                 |
| 16                                                     | $E \dots W \cdot h$                         | Rated battery capacity based on the rated capacity of the cells determined | 19  | battery                                                    | Battery specified by the manufacturer |
| 17                                                     | $I_b \dots A$                               | Rated charging current                                                     |     |                                                            |                                       |
| 19                                                     | charger                                     | Charger specified by the manufacturer                                      |     |                                                            |                                       |
| Boxes 15 to 17 form a table with corresponding values. |                                             |                                                                            |     |                                                            |                                       |

Addition to 15.3 of this document:

d) Separable and detachable battery packs shall also be marked with additional information as follows:

- type (identification) as given by the manufacturer;
- the year of manufacture and a date code identifying at least the month of manufacture;
- rated **battery** voltage;
- the capacity assigned by the manufacturer in  $W \cdot h$ , based on the rated capacity of the **cells** determined;
- for alkaline or other non-acid electrolyte **batteries**, the type of **battery** such as Li-Ion, NiCd and NiMH.

NOTE In Canada and the United States of America, the following additional requirements apply.

A battery-powered welding power source provided with a **detachable battery pack** or a **separable battery pack** shall be marked: "For use only with      battery", or the equivalent, where the underlined space is completed with the manufacturer's name or trademark, a catalogue number, a series identification, or the equivalent, of the **battery** pack. Alternatively, the statement "See instruction manual for additional battery packs" or the equivalent may be employed in addition to at least one **battery** pack referenced by catalogue number.

A **detachable battery pack**, a **separable battery pack**, or a battery-powered welding power source provided with an **integral battery** shall be marked "For use only with      charger", or the equivalent, where the underlined space is completed with the manufacturer's name or trademark, a catalogue number, a series identification, or the equivalent, of the **charger**. Alternatively, the statement "See instruction manual for additional chargers," or the equivalent may be employed in addition to at least one **charger** referenced by catalogue number.

## O.17 Instructions and markings

### O.17.1 Instructions

Addition to 17.1 of this document:

t) For battery-powered welding power sources:

- 1) Instructions regarding **battery** charging, information regarding ambient temperature range for welding power source and **battery** use and storage, and the recommended ambient temperature range for the **charging system** during charging;
- 2) For a battery-powered welding power source intended for use with a **detachable battery pack** or a **separable battery pack**: instructions indicating the appropriate **battery** packs for use, such as by a catalogue number, series identification or the equivalent;
- 3) Instructions indicating the appropriate **charger** for use, such as by a catalogue number, series identification or the equivalent;
- 4) Information regarding durability and lifetime of battery, typical welding range for a **fully charged battery** and typical charging times;
- 5) Warnings concerning battery-powered welding power sources:
  - Recharge only with the charger specified by the manufacturer. A charger that is suitable for one type of battery pack may create a risk of fire when used with another battery pack.
  - Use welding power sources only with specifically designated battery packs. Use of any other battery packs may create a risk of injury and fire.
  - When battery pack is not in use, keep it away from other metal objects, like paper clips, coins, keys, nails, screws or other small metal objects that can make a connection from one terminal to another. Shorting the battery terminals together may cause burns or a fire.
  - Under abusive conditions, liquid may be ejected from the battery; avoid contact. If contact accidentally occurs, flush with water. If liquid contacts eyes, additionally seek medical help. Liquid ejected from the battery may cause irritation or burns.
  - Do not use a battery pack or welding power source that is damaged or modified. Damaged or modified batteries may exhibit unpredictable behaviour resulting in fire, explosion or risk of injury.
  - Do not expose a battery pack or welding power source to fire or excessive temperature. Exposure to fire or temperature above 130 °C may cause explosion.

NOTE 1 The temperature "130 °C" can be replaced by the temperature "265 °F".

- Follow all charging instructions and do not charge the battery pack or welding power source outside the temperature range specified in the instructions. Charging improperly or at temperatures outside the specified range may damage the battery and increase the risk of fire.

NOTE 2 In Europe (EN 62841-1), the following additional requirement applies:

For battery-powered welding power sources with **integral battery**: instruction, how the **integral battery** can be removed safely from the welding power source after the welding power source's end of life, and information about the type of **battery** such as Li-Ion, NiCd and NiMH.

### O.17.2 Markings

*Addition to 17.2 of this document:*

Marking of **battery voltage Class B** electric components:

The symbol W012 in accordance with ISO 7010:2011 shown in Figure O.1 shall appear on (preferably) or near **battery voltage class B** electric power sources.

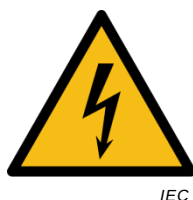


**Figure O.1 – Marking of battery voltage class B electric components**

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annex P (normative)

### Conformity of components

Components and subassemblies which, due to failure, can create a hazard, such as power supplies and built-in information technology equipment, shall be used in accordance with their specified ratings unless a specific exception is made. They shall conform to one of the following:

- a) applicable safety requirements of a relevant IEC standard. Conformity with other requirements of the component standard is not required. If necessary for the application, components shall be subjected to the tests of this document, except when those tests are identical or equivalent to the tests required to check conformity with the relevant component standard;

For example, if components meet the safety requirements of IEC 60950-1 but are rated for a less severe environment than the applicable environment of Clause 4 and 6.1.1, they shall also meet relevant additional requirements of this document.

- b) the requirements of this standard and, where necessary for the application, any additional applicable safety requirements of the relevant IEC component standard;
- c) if there is no relevant IEC standard, the requirements of this document;
- d) applicable safety requirements of a non-IEC standard which are at least as high as those of the relevant IEC standard, provided that the component has been approved to the non-IEC standard by a recognized testing authority.

NOTE Tests performed by a recognized testing authority which confirm conformity with applicable safety requirements need not be repeated, even if the tests were performed using a non-IEC standard.

Figure P.1 is a flow chart showing methods of conformity verification.

*Conformity is checked by inspection and, if necessary, by test.*

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV



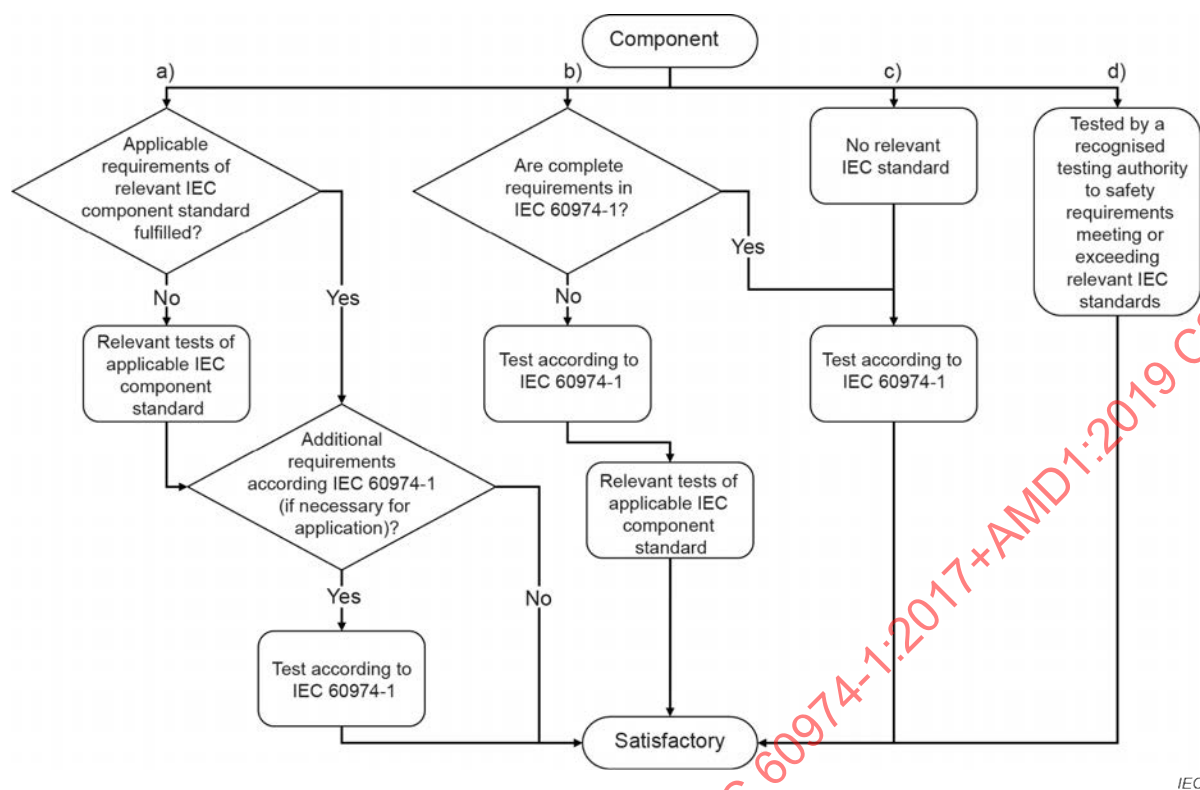


Figure P.1 – Flow chart for conformity methods of Annex P

## Bibliography

IEC 60038:2009, *IEC standard voltages*

IEC 60050-195:1998, *International Electrotechnical Vocabulary – Part 195: Earthing and protection against electric shock*  
IEC 60050-195:1998/AMD1:2001

IEC 60050-811:1991, *International Electrotechnical Vocabulary – Chapter 811: Electric traction*

IEC 60050-826:2004, *International Electrotechnical Vocabulary – Part 826: Electrical installations*

IEC 60076-12, *Power transformers – Part 12: Loading guide for dry-type power transformers*

IEC 60085, *Electrical insulation – Thermal evaluation and designation*

IEC 60204-1, *Safety of machinery – Electrical equipment of machines – Part 1: General requirements*

IEC 60309-1, *Plugs, socket-outlets and couplers for industrial purposes – Part 1: General requirements*

IEC 60335-2-29, *Household and similar electrical appliances – Safety – Part 2-29: Particular requirements for battery chargers*

IEC 60384-14, *Fixed capacitors for use in electronic equipment – Part 14: Sectional specification – Fixed capacitors for electromagnetic interference suppression and connection to the supply mains*

IEC TS 60479-1:2005, *Effects of current on human beings and livestock – Part 1: General aspects*

IEC TS 60479-2, *Effects of current on human beings and livestock – Part 2: Special aspects*

IEC TR 60755:2008, *General requirements for residual current operated protective devices*

IEC 60950-1, *Information technology equipment – Safety – Part 1: General requirements*

IEC 60974-3, *Arc welding equipment – Part 3: Arc striking and stabilizing devices*

IEC 60974-4, *Arc welding equipment – Part 4: Periodic inspection and testing*

IEC 60974-6, *Arc welding equipment – Part 6: Limited duty equipment*

IEC 60974-9, *Arc welding equipment – Part 9: Installation and use*

IEC 60974-10, *Arc welding equipment – Part 10: Electromagnetic compatibility (EMC) requirements*

IEC 60974-12, *Arc welding equipment – Part 12: Coupling devices for welding cables*

IEC 61032:1997, *Protection of persons and equipment by enclosures – Probes for verification*

IEC 61558-1, *Safety of power transformers, power supplies, reactors and similar products – Part 1: General requirements and tests*

IEC 62281, *Safety of primary and secondary lithium cells and batteries during transport*

ISO 3864-1, *Graphical symbols – Safety colours and safety signs – Part 1: Design principles for safety signs and safety markings*

ISO 6469-1:2009, *Electrically propelled road vehicles – Safety specifications – Part 1: On-board rechargeable energy storage system (RESS)*

ISO 6469-3, *Electrically propelled road vehicles – Safety specifications – Part 3: Protection of persons against electric shock*

ISO 7000, *Graphical symbols for use on equipment* (available at: <http://www.graphical-symbols.info/equipment>)

ISO 13732-1, *Ergonomics of the thermal environment – Methods for the assessment of human responses to contact with surfaces – Part 1: Hot surfaces*

ISO 17846, *Welding and allied processes – Health and safety – Wordless precautionary labels for equipment and consumables used in arc welding and cutting*

CSA C22.1, *Canadian electrical code*

EN 50525-1, *Electric cables – Low voltage energy cables of rated voltages up to and including 450/750 V ( $U_0/U$ ) – Part 1: General requirements*

EN 50525-2-21, *Electric cables – Low voltage energy cables of rated voltages up to and including 450/750 V ( $U_0/U$ ) – Part 2-21: Cables for general applications – Flexible cables with crosslinked elastomeric insulation*

EN 50525-2-81, *Electric cables – Low voltage energy cables of rated voltages up to and including 450/750 V ( $U_0/U$ ) – Part 2-81: Cables for general applications – Cables with crosslinked elastomeric covering for arc welding*

EN 62841-1, *Electric motor-operated hand-held tools, transportable tools and lawn and garden machinery – Safety – Part 1: General requirements*

NFPA 70, *National Electrical code*

US Code of Federal Regulations, Title 16: Commercial Practices – Parts 1407: Portable Generators: Requirements to provide performance and technical data by labelling

## SOMMAIRE

|                                                                                                 |     |
|-------------------------------------------------------------------------------------------------|-----|
| AVANT-PROPOS .....                                                                              | 159 |
| 1 Domaine d'application .....                                                                   | 161 |
| 2 Références normatives .....                                                                   | 161 |
| 3 Termes et définitions .....                                                                   | 162 |
| 3.1 Termes généraux .....                                                                       | 163 |
| 3.2 Termes relatifs aux systèmes de batterie .....                                              | 172 |
| 4 Conditions ambiantes .....                                                                    | 175 |
| 5 Essais .....                                                                                  | 175 |
| 5.1 Conditions d'essai .....                                                                    | 175 |
| 5.2 Instruments de mesure .....                                                                 | 176 |
| 5.3 Conformité des composants .....                                                             | 176 |
| 5.4 Essais de type .....                                                                        | 176 |
| 5.5 Essais individuels de série .....                                                           | 176 |
| 6 Protection contre les chocs électriques .....                                                 | 177 |
| 6.1 Isolement .....                                                                             | 177 |
| 6.1.1 Généralités .....                                                                         | 177 |
| 6.1.2 Distances d'isolement dans l'air .....                                                    | 178 |
| 6.1.3 Lignes de fuite .....                                                                     | 180 |
| 6.1.4 Résistance d'isolement .....                                                              | 182 |
| 6.1.5 Rigidité diélectrique .....                                                               | 182 |
| 6.2 Protection contre les chocs électriques en service normal (contact direct) .....            | 184 |
| 6.2.1 Degré de protection procuré par l'enveloppe .....                                         | 184 |
| 6.2.2 Condensateurs .....                                                                       | 184 |
| 6.2.3 Décharge automatique des condensateurs sur le circuit d'alimentation .....                | 185 |
| 6.2.4 Isolation du circuit de soudage .....                                                     | 185 |
| 6.2.5 Courant de contact d'un circuit de soudage .....                                          | 186 |
| 6.2.6 Courant de contact en condition normale .....                                             | 186 |
| 6.3 Protection contre les chocs électriques en cas de défaut (contacts indirects) .....         | 187 |
| 6.3.1 Mesures de protection .....                                                               | 187 |
| 6.3.2 Isolation entre les enroulements du circuit d'alimentation et le circuit de soudage ..... | 187 |
| 6.3.3 Conducteurs et connexions internes .....                                                  | 188 |
| 6.3.4 Exigences supplémentaires pour les systèmes de coupage par plasma .....                   | 188 |
| 6.3.5 Noyaux et bobines mobiles .....                                                           | 189 |
| 6.3.6 Courant de contact en cas de défaut .....                                                 | 189 |
| 7 Exigences thermiques .....                                                                    | 189 |
| 7.1 Essai d'échauffement .....                                                                  | 189 |
| 7.1.1 Conditions d'essai .....                                                                  | 189 |
| 7.1.2 Tolérances des paramètres d'essai .....                                                   | 190 |
| 7.1.3 Durée de l'essai .....                                                                    | 190 |
| 7.2 Mesurage des températures .....                                                             | 190 |
| 7.2.1 Conditions de mesure .....                                                                | 190 |
| 7.2.2 Capteur de température en surface .....                                                   | 190 |
| 7.2.3 Résistance .....                                                                          | 191 |
| 7.2.4 Capteur de température incorporé .....                                                    | 191 |

|        |                                                                                                                        |     |
|--------|------------------------------------------------------------------------------------------------------------------------|-----|
| 7.2.5  | Détermination de la température de l'air ambiant .....                                                                 | 191 |
| 7.2.6  | Enregistrement des températures .....                                                                                  | 192 |
| 7.3    | Limites d'échauffement .....                                                                                           | 192 |
| 7.3.1  | Enroulements, collecteurs et bagues collectrices .....                                                                 | 192 |
| 7.3.2  | Surfaces externes.....                                                                                                 | 193 |
| 7.3.3  | Autres composants .....                                                                                                | 193 |
| 7.4    | Essai en charge .....                                                                                                  | 193 |
| 7.5    | Collecteurs et bagues collectrices .....                                                                               | 194 |
| 8      | Protection thermique .....                                                                                             | 194 |
| 8.1    | Exigences générales.....                                                                                               | 194 |
| 8.2    | Construction .....                                                                                                     | 195 |
| 8.3    | Emplacement.....                                                                                                       | 195 |
| 8.4    | Capacité de fonctionnement.....                                                                                        | 195 |
| 8.5    | Fonctionnement .....                                                                                                   | 195 |
| 8.6    | Réenclenchement .....                                                                                                  | 195 |
| 8.7    | Indication .....                                                                                                       | 196 |
| 9      | Fonctionnement anormal .....                                                                                           | 196 |
| 9.1    | Exigences générales.....                                                                                               | 196 |
| 9.2    | Essai de ventilateur bloqué .....                                                                                      | 196 |
| 9.3    | Essai de courant de court-circuit.....                                                                                 | 196 |
| 9.4    | Essai de surcharge .....                                                                                               | 197 |
| 10     | Raccordement au réseau d'alimentation .....                                                                            | 197 |
| 10.1   | Tension d'alimentation .....                                                                                           | 197 |
| 10.2   | Tension d'alimentation multiple .....                                                                                  | 198 |
| 10.3   | Moyens de raccordement au circuit d'alimentation .....                                                                 | 198 |
| 10.4   | Marquage des bornes .....                                                                                              | 198 |
| 10.5   | Circuit de protection.....                                                                                             | 199 |
| 10.5.1 | Exigence de continuité du circuit de protection .....                                                                  | 199 |
| 10.5.2 | Essai de type .....                                                                                                    | 199 |
| 10.5.3 | Essai individuel de série .....                                                                                        | 200 |
| 10.6   | Serre-câble.....                                                                                                       | 200 |
| 10.7   | Entrées de câbles .....                                                                                                | 202 |
| 10.8   | Dispositif de commutation marche/arrêt sur le circuit d'alimentation.....                                              | 202 |
| 10.9   | Câbles d'alimentation.....                                                                                             | 203 |
| 10.10  | Dispositif de connexion à l'alimentation (fiche de prise de courant montée) .....                                      | 203 |
| 11     | Sortie .....                                                                                                           | 203 |
| 11.1   | Tension à vide assignée .....                                                                                          | 203 |
| 11.1.1 | Tension à vide assignée dans le cas d'environnements avec risque<br>accru de choc électrique .....                     | 203 |
| 11.1.2 | Tension à vide assignée dans le cas d'environnements sans risque<br>accru de choc électrique .....                     | 204 |
| 11.1.3 | Tension à vide assignée dans le cas de torches tenues mécaniquement<br>avec une protection accrue de l'opérateur ..... | 204 |
| 11.1.4 | Tension à vide assignée pour les procédés spéciaux, par exemple le<br>coupage par plasma .....                         | 204 |
| 11.1.5 | Exigences supplémentaires .....                                                                                        | 205 |
| 11.1.6 | Circuits de mesure.....                                                                                                | 205 |
| 11.2   | Valeurs d'essais de type de la tension conventionnelle en charge.....                                                  | 207 |
| 11.2.1 | Soudage manuel électrique à l'arc avec électrodes enrobées .....                                                       | 207 |

|        |                                                                                        |     |
|--------|----------------------------------------------------------------------------------------|-----|
| 11.2.2 | Soudage à l'arc en atmosphère inerte avec électrode de tungstène .....                 | 207 |
| 11.2.3 | Soudage à l'arc sous protection de gaz inerte / actif et avec fil fourré dans gaz..... | 207 |
| 11.2.4 | Soudage à l'arc sous flux en poudre .....                                              | 207 |
| 11.2.5 | Coupage par plasma.....                                                                | 207 |
| 11.2.6 | Soudage plasma.....                                                                    | 207 |
| 11.2.7 | Gougeage par plasma .....                                                              | 207 |
| 11.2.8 | Exigences supplémentaires .....                                                        | 207 |
| 11.3   | Dispositifs de commutation mécaniques utilisés pour ajuster la sortie .....            | 208 |
| 11.4   | Raccordement au circuit de soudage .....                                               | 208 |
| 11.4.1 | Protection contre les contacts involontaires .....                                     | 208 |
| 11.4.2 | Emplacement des dispositifs de connexion .....                                         | 208 |
| 11.4.3 | Ouvertures de sortie .....                                                             | 208 |
| 11.4.4 | Transformateur de soudage multiopérateur triphasé .....                                | 208 |
| 11.4.5 | Marquage .....                                                                         | 209 |
| 11.4.6 | Connexions pour les torches de coupage par plasma .....                                | 209 |
| 11.5   | Alimentation de dispositifs extérieurs raccordés au circuit de soudage.....            | 209 |
| 11.6   | Sortie d'alimentation auxiliaire .....                                                 | 210 |
| 11.7   | Câbles de soudage .....                                                                | 210 |
| 12     | Circuits de commande .....                                                             | 210 |
| 12.1   | Exigence générale .....                                                                | 210 |
| 12.2   | Isolation des circuits de commande .....                                               | 210 |
| 12.3   | Tensions locales des circuits de commande à distance.....                              | 211 |
| 13     | Dispositif réducteur de risques .....                                                  | 211 |
| 13.1   | Exigences générales.....                                                               | 211 |
| 13.2   | Types de dispositifs réducteurs de risques.....                                        | 211 |
| 13.2.1 | Dispositif réducteur de tension.....                                                   | 211 |
| 13.2.2 | Dispositif de commutation de courant alternatif à courant continu .....                | 212 |
| 13.3   | Exigences pour les dispositifs réducteurs de risques .....                             | 212 |
| 13.3.1 | Mise hors service d'un dispositif réducteur de risques .....                           | 212 |
| 13.3.2 | Interférences avec le fonctionnement d'un dispositif réducteur de risques .....        | 212 |
| 13.3.3 | Indicateur de fonctionnement satisfaisant .....                                        | 212 |
| 13.3.4 | Non-danger en cas de défaillance.....                                                  | 212 |
| 14     | Dispositions mécaniques .....                                                          | 212 |
| 14.1   | Exigences générales.....                                                               | 212 |
| 14.2   | Enveloppe.....                                                                         | 213 |
| 14.2.1 | Matériaux de l'enveloppe .....                                                         | 213 |
| 14.2.2 | Résistance de l'enveloppe .....                                                        | 213 |
| 14.3   | Moyens de manutention .....                                                            | 213 |
| 14.3.1 | Moyens de manutention mécanisés .....                                                  | 213 |
| 14.3.2 | Moyens de manutention manuels.....                                                     | 214 |
| 14.4   | Essai de chute .....                                                                   | 214 |
| 14.5   | Essai de stabilité.....                                                                | 215 |
| 15     | Plaque signalétique .....                                                              | 215 |
| 15.1   | Exigences générales.....                                                               | 215 |
| 15.2   | Description .....                                                                      | 215 |
| 15.3   | Contenu .....                                                                          | 216 |

|                                                                                                                                                                                   |                                                                     |     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------|-----|
| 15.4                                                                                                                                                                              | Tolérances .....                                                    | 219 |
| 15.5                                                                                                                                                                              | Direction de la rotation .....                                      | 220 |
| 16                                                                                                                                                                                | Réglage de la sortie .....                                          | 220 |
| 16.1                                                                                                                                                                              | Type de réglage .....                                               | 220 |
| 16.2                                                                                                                                                                              | Marquage du dispositif de réglage .....                             | 220 |
| 16.3                                                                                                                                                                              | Indication du dispositif de commande de courant ou de tension ..... | 221 |
| 17                                                                                                                                                                                | Instructions et marquages .....                                     | 221 |
| 17.1                                                                                                                                                                              | Instructions .....                                                  | 221 |
| 17.2                                                                                                                                                                              | Marquages .....                                                     | 222 |
| Annexe A (informative) Tensions nominales des réseaux d'alimentation .....                                                                                                        |                                                                     | 224 |
| Annexe B (informative) Exemple d'un essai diélectrique combiné .....                                                                                                              |                                                                     | 225 |
| Annexe C (normative) Charge déséquilibrée dans le cas de sources de courant de soudage à l'arc en atmosphère inerte avec électrode de tungstène (TIG) en courant alternatif ..... |                                                                     | 226 |
| C.1                                                                                                                                                                               | Généralités .....                                                   | 226 |
| C.2                                                                                                                                                                               | Charge déséquilibrée .....                                          | 227 |
| C.3                                                                                                                                                                               | Exemple d'une charge déséquilibrée .....                            | 227 |
| Annexe D (informative) Extrapolation de température par rapport au temps de coupure.....                                                                                          |                                                                     | 229 |
| Annexe E (normative) Construction des bornes de raccordement du circuit d'alimentation .....                                                                                      |                                                                     | 230 |
| E.1                                                                                                                                                                               | Dimensions des bornes .....                                         | 230 |
| E.2                                                                                                                                                                               | Raccordement aux bornes .....                                       | 230 |
| E.3                                                                                                                                                                               | Construction des bornes .....                                       | 231 |
| E.4                                                                                                                                                                               | Fixation des bornes .....                                           | 231 |
| Annexe F (informative) Correspondance avec les unités non SI .....                                                                                                                |                                                                     | 232 |
| Annexe G (informative) Adaptation du réseau d'alimentation pour le mesurage de la valeur efficace vraie du courant d'alimentation .....                                           |                                                                     | 233 |
| Annexe H (informative) Traçage des caractéristiques statiques .....                                                                                                               |                                                                     | 235 |
| H.1                                                                                                                                                                               | Généralités .....                                                   | 235 |
| H.2                                                                                                                                                                               | Méthode .....                                                       | 235 |
| H.3                                                                                                                                                                               | Analyse des résultats .....                                         | 235 |
| Annexe I (normative) Méthodes d'essai pour un choc de 10 Nm .....                                                                                                                 |                                                                     | 236 |
| I.1                                                                                                                                                                               | Marteau pendulaire de choc .....                                    | 236 |
| I.2                                                                                                                                                                               | Corps de chute sphérique en acier .....                             | 237 |
| Annexe J (normative) Épaisseur des tôles métalliques pour enveloppes .....                                                                                                        |                                                                     | 238 |
| Annexe K (informative) Exemples de plaques signalétiques .....                                                                                                                    |                                                                     | 241 |
| Annexe L (informative) Symboles graphiques pour le matériel de soudage électrique à l'arc .....                                                                                   |                                                                     | 248 |
| L.1                                                                                                                                                                               | Généralités .....                                                   | 248 |
| L.2                                                                                                                                                                               | Utilisation des symboles .....                                      | 248 |
| L.2.1                                                                                                                                                                             | Généralités .....                                                   | 248 |
| L.2.2                                                                                                                                                                             | Sélection des symboles .....                                        | 248 |
| L.2.3                                                                                                                                                                             | Dimension des symboles .....                                        | 248 |
| L.2.4                                                                                                                                                                             | Utilisation de la couleur .....                                     | 249 |
| L.3                                                                                                                                                                               | Symboles .....                                                      | 249 |
| L.3.1                                                                                                                                                                             | Généralités .....                                                   | 249 |
| L.3.2                                                                                                                                                                             | Symboles littéraux .....                                            | 249 |
| L.3.3                                                                                                                                                                             | Symboles graphiques .....                                           | 250 |

|                                                                                                      |                                                                           |     |
|------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------|-----|
| L.4                                                                                                  | Exemples de combinaisons de symboles .....                                | 270 |
| L.5                                                                                                  | Exemples de panneaux de commande .....                                    | 272 |
| Annexe M (informative) Mesurage du rendement énergétique et de la puissance en état au ralenti ..... |                                                                           | 275 |
| M.1                                                                                                  | Mesurage du rendement .....                                               | 275 |
| M.2                                                                                                  | Mesurage de la puissance en état au ralenti .....                         | 275 |
| Annexe N (normative) Mesurage du courant de contact en condition de défaut .....                     |                                                                           | 277 |
| Annexe O (normative) Sources de courant de soudage alimentées par batterie .....                     |                                                                           | 282 |
| O.1                                                                                                  | Généralités .....                                                         | 282 |
| O.4                                                                                                  | Conditions ambiantes.....                                                 | 283 |
| O.5                                                                                                  | Essais.....                                                               | 283 |
| O.5.1                                                                                                | Conditions d'essai .....                                                  | 283 |
| O.5.3                                                                                                | Conformité des composants.....                                            | 285 |
| O.6                                                                                                  | Protection contre les chocs électriques .....                             | 285 |
| O.6.1                                                                                                | Isolation.....                                                            | 285 |
| O.6.2                                                                                                | Protection contre les chocs électriques en service normal .....           | 287 |
| O.7                                                                                                  | Exigences thermiques.....                                                 | 287 |
| O.7.1                                                                                                | Essai d'échauffement .....                                                | 287 |
| O.7.2                                                                                                | Mesurage des températures .....                                           | 288 |
| O.7.4                                                                                                | Essai en charge.....                                                      | 288 |
| O.7.201                                                                                              | Chargement normal des systèmes ion-lithium .....                          | 289 |
| O.8                                                                                                  | Protection thermique.....                                                 | 290 |
| O.8.1                                                                                                | Exigences générales .....                                                 | 290 |
| O.8.4                                                                                                | Capacité de fonctionnement .....                                          | 290 |
| O.9                                                                                                  | Fonctionnement anormal.....                                               | 290 |
| O.9.1                                                                                                | Exigences générales .....                                                 | 290 |
| O.9.2                                                                                                | Essai de ventilateur bloqué.....                                          | 290 |
| O.9.3                                                                                                | Essai de courant de court-circuit.....                                    | 290 |
| O.9.4                                                                                                | Essai de surcharge .....                                                  | 291 |
| O.9.201                                                                                              | Source de courant de soudage – conditions anormales .....                 | 291 |
| O.9.202                                                                                              | Composants du circuit de soudage – conditions anormales .....             | 291 |
| O.9.203                                                                                              | Systèmes de charge ion-lithium – conditions anormales .....               | 292 |
| O.9.204                                                                                              | Court-circuit des batteries ion-lithium.....                              | 293 |
| O.9.205                                                                                              | Batteries autres que les batteries ion-lithium – surcharge .....          | 294 |
| O.9.206                                                                                              | Déconnexion du bloc de batteries .....                                    | 294 |
| O.9.207                                                                                              | Batteries à usage général .....                                           | 295 |
| O.10                                                                                                 | Raccordement au réseau d'alimentation.....                                | 295 |
| O.10.5                                                                                               | Circuit de protection .....                                               | 295 |
| O.10.8                                                                                               | Dispositif de commutation marche/arrêt sur le circuit d'alimentation..... | 295 |
| O.14                                                                                                 | Dispositions mécaniques.....                                              | 296 |
| O.14.1                                                                                               | Exigences générales .....                                                 | 296 |
| O.14.2                                                                                               | Enveloppe .....                                                           | 296 |
| O.14.4                                                                                               | Essai de chute .....                                                      | 296 |
| O.15                                                                                                 | Plaque signalétique .....                                                 | 298 |
| O.15.3                                                                                               | Contenu.....                                                              | 298 |
| O.17                                                                                                 | Instructions et marquages.....                                            | 299 |
| O.17.1                                                                                               | Instructions.....                                                         | 299 |
| O.17.2                                                                                               | Marquages .....                                                           | 300 |



|                                                      |     |
|------------------------------------------------------|-----|
| Annexe P (normative) Conformité des composants ..... | 301 |
| Bibliographie.....                                   | 303 |

|                                                                                                                                                                                                      |     |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----|
| Figure 1 – Exemple de configuration d'isolation pour le matériel de classe I .....                                                                                                                   | 178 |
| Figure 2 – Mesurage du courant de contact d'un circuit de soudage .....                                                                                                                              | 186 |
| Figure 3 – Mesurage du courant de contact en condition normale .....                                                                                                                                 | 187 |
| Figure 4 – Mesurage des valeurs efficaces .....                                                                                                                                                      | 206 |
| Figure 5 – Mesurage des valeurs de crête .....                                                                                                                                                       | 206 |
| Figure 6 – Principe de la plaque signalétique .....                                                                                                                                                  | 216 |
| Figure B.1 – Transformateurs haute tension combinés.....                                                                                                                                             | 225 |
| Figure C.1 – Tension et courant au cours du soudage TIG en courant alternatif.....                                                                                                                   | 226 |
| Figure C.2 – Tension déséquilibrée au cours du soudage TIG en courant alternatif .....                                                                                                               | 227 |
| Figure C.3 – Source de courant alternatif de soudage avec charge déséquilibrée .....                                                                                                                 | 228 |
| Figure I.1 – Montage d'essai.....                                                                                                                                                                    | 236 |
| Figure K.1 – Transformateur monophasé .....                                                                                                                                                          | 241 |
| Figure K.2 – Convertisseur de fréquence rotatif triphasé.....                                                                                                                                        | 242 |
| Figure K.3 – Plaque signalétique subdivisée: transformateur redresseur mono-/triphase .....                                                                                                          | 243 |
| Figure K.4 – Moteur thermique-générateur-redresseur .....                                                                                                                                            | 244 |
| Figure K.5 – Type d'onduleur mono-/triphase.....                                                                                                                                                     | 245 |
| Figure K.6 – Source de courant de soudage alimentée par batterie incorporée .....                                                                                                                    | 246 |
| Figure K.7 – Source de courant de soudage alimentée par batterie amovible/démontable .....                                                                                                           | 247 |
| Figure L.1 – Bouton d'amenée de tension.....                                                                                                                                                         | 273 |
| Figure L.2 – Potentiomètre de commande de la force de l'arc .....                                                                                                                                    | 273 |
| Figure L.3 – Prises de commande à distance et boutons de sélection .....                                                                                                                             | 273 |
| Figure L.4 – Bornes avec sélecteurs d'inductance pour le soudage MIG/MAG .....                                                                                                                       | 273 |
| Figure L.5 – Bouton de choix de procédé (MMA, TIG, MIG) .....                                                                                                                                        | 274 |
| Figure L.6 – Bouton de sélection sur matériel à courant alternatif/continu .....                                                                                                                     | 274 |
| Figure L.7 – Voyants lumineux du panneau (surchauffe, défaut, amorçage d'arc, tension de sortie) .....                                                                                               | 274 |
| Figure L.8 – Réglage des paramètres de pulsation par affichage numérique .....                                                                                                                       | 274 |
| Figure N.1 – Réseau de mesure du courant de contact pondéré .....                                                                                                                                    | 277 |
| Figure N.2 – Diagramme pour le mesurage du courant de contact en condition de défaut à la température de fonctionnement pour une connexion monophasée d'appareils autres que ceux de classe II ..... | 279 |
| Figure N.3 – Diagramme pour le mesurage du courant de contact en condition de défaut pour une connexion triphasée à quatre fils d'appareils autres que ceux de classe II .....                       | 281 |
| Figure O.1 – Marquage des composants électriques de la classe de tension de batterie B.....                                                                                                          | 300 |
| Figure P.1 – Diagramme pour les méthodes de conformité de l'Annexe P .....                                                                                                                           | 302 |

|                                                                                                 |     |
|-------------------------------------------------------------------------------------------------|-----|
| Tableau 1 – Distances d'isolement dans l'air minimales pour la catégorie de surtension III..... | 180 |
| Tableau 2 – Lignes de fuite minimales .....                                                     | 182 |

|                                                                                                                |     |
|----------------------------------------------------------------------------------------------------------------|-----|
| Tableau 3 – Résistance d'isolement.....                                                                        | 183 |
| Tableau 4 – Tensions d'essai diélectrique.....                                                                 | 184 |
| Tableau 5 – Distance minimale à travers l'isolation.....                                                       | 188 |
| Tableau 6 – Limites de température pour les enroulements, collecteurs et bagues collectrices .....             | 193 |
| Tableau 7 – Limites de température des surfaces externes .....                                                 | 194 |
| Tableau 8 – Section du conducteur de court-circuit de sortie .....                                             | 198 |
| Tableau 9 – Exigences de courant et de temps pour les circuits de protection .....                             | 201 |
| Tableau 10 – Section minimale du conducteur de protection externe en cuivre .....                              | 201 |
| Tableau 11 – Vérification de la continuité du circuit de protection .....                                      | 201 |
| Tableau 12 – Traction .....                                                                                    | 202 |
| Tableau 13 – Résumé des tensions à vide assignées admissibles .....                                            | 206 |
| Tableau 14 – Exigences pour le dispositif réducteur de risques .....                                           | 212 |
| Tableau E.1 – Plage de dimensions des conducteurs à introduire dans les bornes du circuit d'alimentation ..... | 231 |
| Tableau F.1 – Correspondance entre les mm <sup>2</sup> et les dimensions américaines (AWG).....                | 233 |
| Tableau I.1 – Angle de rotation $\theta$ pour obtenir un choc de 10 Nm.....                                    | 237 |
| Tableau I.2 – Masse du corps de chute et hauteur de chute.....                                                 | 238 |
| Tableau J.1 – Épaisseur minimale des tôles pour les enveloppes en acier .....                                  | 240 |
| Tableau J.2 – Épaisseur minimale des tôles pour enveloppes d'aluminium, de laiton ou de cuivre.....            | 241 |
| Tableau L.1 – Lettres utilisées comme symboles .....                                                           | 250 |

## COMMISSION ÉLECTROTECHNIQUE INTERNATIONALE

### MATÉRIEL DE SOUDAGE À L'ARC –

#### Partie 1: Sources de courant de soudage

##### AVANT-PROPOS

- 1) La Commission Électrotechnique Internationale (IEC) est une organisation mondiale de normalisation composée de l'ensemble des comités électrotechniques nationaux (Comités nationaux de l'IEC). L'IEC a pour objet de favoriser la coopération internationale pour toutes les questions de normalisation dans les domaines de l'électricité et de l'électronique. À cet effet, l'IEC – entre autres activités – publie des Normes Internationales, des Spécifications techniques, des Rapports techniques, des Spécifications accessibles au public (PAS) et des Guides (ci-après dénommés "Publication(s) de l'IEC"). Leur élaboration est confiée à des comités d'études, aux travaux desquels tout Comité national intéressé par le sujet traité peut participer. Les organisations internationales, gouvernementales et non gouvernementales, en liaison avec l'IEC, participent également aux travaux. L'IEC collabore étroitement avec l'Organisation Internationale de Normalisation (ISO), selon des conditions fixées par accord entre les deux organisations.
- 2) Les décisions ou accords officiels de l'IEC concernant les questions techniques représentent, dans la mesure du possible, un accord international sur les sujets étudiés, étant donné que les Comités nationaux de l'IEC intéressés sont représentés dans chaque comité d'études.
- 3) Les Publications de l'IEC se présentent sous la forme de recommandations internationales et sont agréées comme telles par les Comités nationaux de l'IEC. Tous les efforts raisonnables sont entrepris afin que l'IEC s'assure de l'exactitude du contenu technique de ses publications; l'IEC ne peut pas être tenue responsable de l'éventuelle mauvaise utilisation ou interprétation qui en est faite par un quelconque utilisateur final.
- 4) Dans le but d'encourager l'uniformité internationale, les Comités nationaux de l'IEC s'engagent, dans toute la mesure possible, à appliquer de façon transparente les Publications de l'IEC dans leurs publications nationales et régionales. Toutes divergences entre toutes Publications de l'IEC et toutes publications nationales ou régionales correspondantes doivent être indiquées en termes clairs dans ces dernières.
- 5) L'IEC elle-même ne fournit aucune attestation de conformité. Des organismes de certification indépendants fournissent des services d'évaluation de conformité et, dans certains secteurs, accèdent aux marques de conformité de l'IEC. L'IEC n'est responsable d'aucun des services effectués par les organismes de certification indépendants.
- 6) Tous les utilisateurs doivent s'assurer qu'ils sont en possession de la dernière édition de cette publication.
- 7) Aucune responsabilité ne doit être imputée à l'IEC, à ses administrateurs, employés, auxiliaires ou mandataires, y compris ses experts particuliers et les membres de ses comités d'études et des Comités nationaux de l'IEC, pour tout préjudice causé en cas de dommages corporels et matériels, ou de tout autre dommage de quelque nature que ce soit, directe ou indirecte, ou pour supporter les coûts (y compris les frais de justice) et les dépenses découlant de la publication ou de l'utilisation de cette Publication de l'IEC ou de toute autre Publication de l'IEC, ou au crédit qui lui est accordé.
- 8) L'attention est attirée sur les références normatives citées dans cette publication. L'utilisation de publications référencées est obligatoire pour une application correcte de la présente publication.
- 9) L'attention est attirée sur le fait que certains des éléments de la présente Publication de l'IEC peuvent faire l'objet de droits de brevet. L'IEC ne saurait être tenue pour responsable de ne pas avoir identifié de tels droits de brevets et de ne pas avoir signalé leur existence.

**Cette version consolidée de la Norme IEC officielle et de son amendement a été préparée pour la commodité de l'utilisateur.**

**L'IEC 60974-1 édition 5.1 contient la cinquième édition (2017-02) [documents 26/610/FDIS et 26/613/RVD] et son amendement 1 (2019-01) [documents 26/653/CDV et 26/669/RVC].**

**Dans cette version Redline, une ligne verticale dans la marge indique où le contenu technique est modifié par l'amendement 1. Les ajouts sont en vert, les suppressions sont en rouge, barrées. Une version Finale avec toutes les modifications acceptées est disponible dans cette publication.**

La Norme internationale IEC 60974-1 a été établie par le comité d'études 26 de l'IEC: Soudage électrique.

Cette cinquième édition constitue une révision technique.

Les modifications majeures par rapport à l'édition précédente sont les suivantes:

- amélioration de la Figure 1 (6.1.1);
- modification du Tableau 3 (6.1.4);
- description des mesurages du rendement énergétique dans l'Annexe M;
- introduction des sources de courant de soudage alimentées par batterie dans le domaine d'application. Les exigences sont donc décrites dans l'Annexe O.

Cette publication a été rédigée selon les Directives ISO/IEC, Partie 2.

Dans la présente norme, les caractères d'imprimerie suivants sont utilisés:

- critères de conformité: caractères *italiques*.
- termes définis à l'Article 3: caractères **gras**.

Une liste de toutes les parties de la série IEC 60974, publiées sous le titre général *Matériel de soudage à l'arc*, peut être consultée sur le site web de l'IEC.

Le comité a décidé que le contenu de la publication de base et de son amendement ne sera pas modifié avant la date de stabilité indiquée sur le site web de l'IEC sous "<http://webstore.iec.ch>" dans les données relatives à la publication recherchée. A cette date, la publication sera

- reconduite,
- supprimée,
- remplacée par une édition révisée, ou
- amendée.

**IMPORTANT** – Le logo "*colour inside*" qui se trouve sur la page de couverture de cette publication indique qu'elle contient des couleurs qui sont considérées comme utiles à une bonne compréhension de son contenu. Les utilisateurs devraient, par conséquent, imprimer cette publication en utilisant une imprimante couleur.

## MATÉRIEL DE SOUDAGE À L'ARC –

### Partie 1: Sources de courant de soudage

#### 1 Domaine d'application

La présente partie de l'IEC 60974 s'applique aux sources de courant de soudage à l'arc et aux procédés connexes conçus pour un **usage industriel et professionnel** qui sont alimentés sous une tension ne dépassant pas 1000 V, alimentés par batterie ou entraînés par des moyens mécaniques.

Le présent document spécifie les exigences de sécurité et de fonctionnement des sources de courant de soudage et des **systèmes de coupage par plasma**.

Le présent document ne s'applique pas aux sources de courant de soudage et de coupage à l'arc à service limité qui sont utilisées essentiellement par des non professionnels et qui sont conçues selon l'IEC 60974-6.

Le présent document inclut les exigences relatives aux sources de courant de soudage alimentées par batterie et aux blocs de batteries qui sont donnés à l'Annexe O.

Le présent document ne s'applique pas aux essais des sources de courant pendant l'entretien périodique ou après réparation.

NOTE 1 Des procédés connexes typiques sont le coupage à l'arc électrique et la projection à l'arc électrique.

NOTE 2 Des systèmes en courant alternatif possédant une tension nominale comprise entre 100 V et 1000 V sont présentés dans le Tableau 1 de l'IEC 60038:2009.

NOTE 3 Le présent document ne contient pas les exigences de compatibilité électromagnétique (CEM).

#### 2 Références normatives

Les documents suivants cités dans le texte constituent, pour tout ou partie de leur contenu, des exigences du présent document. Pour les références datées, seule l'édition citée s'applique. Pour les références non datées, la dernière édition du document de référence s'applique (y compris les éventuels amendements).

IEC 60050-151, *Vocabulaire Électrotechnique International – Partie 151: Dispositifs électriques et magnétiques* (disponible sous: <http://www.electropedia.org>)

IEC 60050-851, *Vocabulaire Électrotechnique International – Partie 851: Soudage électrique* (disponible sous: <http://www.electropedia.org>)

IEC 60245-6, *Conducteurs et câbles isolés au caoutchouc – Tension assignée au plus égale à 450/750 V – Partie 6: Câbles souples pour électrodes de soudage à l'arc*

IEC 60417, *Symboles graphiques utilisables sur le matériel* (disponible sous: <http://www.graphical-symbols.info/equipment>)

IEC 60445, *Principes fondamentaux et de sécurité pour les interfaces homme-machines, le marquage et l'identification – Identification des bornes de matériels, des extrémités de conducteurs et des conducteurs*

IEC 60529, *Degrés de protection procurés par les enveloppes (Code IP)*

IEC 60664-1:2007, *Coordination de l'isolement des matériels dans les systèmes (réseaux) à basse tension – Partie 1: Principes, exigences et essais*

IEC 60664-3, *Coordination de l'isolement des matériels dans les systèmes (réseaux) à basse tension – Partie 3: Utilisation de revêtement, d'empotage ou de moulage pour la protection contre la pollution*

IEC 60695-11-10, *Essais relatifs aux risques du feu – Partie 11-10: Flammes d'essai – Méthodes d'essai horizontal et vertical à la flamme de 50 W*

IEC 60974-7, *Matériel de soudage à l'arc – Partie 7: Torches*

IEC 61140, *Protection contre les chocs électriques – Aspects communs aux installations et aux matériels*

IEC 61558-2-4, *Sécurité des transformateurs, bobines d'inductance, blocs d'alimentation et produits analogues pour des tensions d'alimentation jusqu'à 1 100 V – Partie 2-4: Règles particulières et essais pour les transformateurs de séparation des circuits et les blocs d'alimentation incorporant des transformateurs de séparation des circuits*

IEC 61558-2-6, *Sécurité des transformateurs, bobines d'inductance, blocs d'alimentation et produits analogues pour des tensions d'alimentation jusqu'à 1 100 V – Partie 2-6: Règles particulières et essais pour les transformateurs de sécurité et les blocs d'alimentation incorporant des transformateurs de sécurité*

IEC 62133-1:— 1, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary cells, and for batteries made from them, for use in portable applications – Part 1: Nickel systems* (disponible en anglais seulement)

IEC 62133-2:— 2, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary lithium cells, and for batteries made from them, for use in portable applications – Part 2: Lithium systems* (disponible en anglais seulement)

ISO 7010:2011, *Symboles graphiques – Couleurs de sécurité et signaux de sécurité – Signaux de sécurité enregistrés*

### 3 Termes et définitions

Pour les besoins du présent document, les termes et définitions donnés dans l'IEC 60050-151, l'IEC 60050-851 et l'IEC 60664-1 ainsi que les suivants s'appliquent.

L'ISO et l'IEC tiennent à jour des bases de données terminologiques destinées à être utilisées en normalisation, consultables aux adresses suivantes:

- IEC Electropedia: disponible à l'adresse <http://www.electropedia.org/>
- ISO Online browsing platform: disponible à l'adresse <http://www.iso.org/obp>

<sup>1</sup> En préparation. Stade au moment de la publication: IEC CDV 62133-1:2015.

<sup>2</sup> En préparation. Stade au moment de la publication: IEC CDV 62133-2:2015.

### 3.1 Termes généraux

#### 3.1.1

##### **source de courant de soudage**

##### **source de courant de soudage à l'arc**

équipement destiné à fournir un courant électrique et une tension et ayant des caractéristiques appropriées au soudage à l'arc et à des procédés connexes

Note 1 à l'article: Une **source de courant de soudage** peut également alimenter d'autres équipements et accessoires, par exemple des tensions auxiliaires, liquide de refroidissement, électrode fusible pour soudage à l'arc et gaz pour la protection de l'arc et de la zone de soudage.

Note 2 à l'article: Cet article révisé l'IEV 851-13-01, qui sera mis à jour.

#### 3.1.2

##### **usage industriel et professionnel**

usage prévu uniquement par des **experts** ou des **personnes averties**

[SOURCE: IEC 60050-851:2008, 851-11-12]

#### 3.1.3

##### **expert**

##### **personne compétente**

##### **personne qualifiée**

personne qui peut juger le travail assigné et reconnaître les dangers possibles sur la base de sa formation, ses connaissances, son expérience et sa connaissance du matériel concerné

Note 1 à l'article: Plusieurs années de pratique dans le domaine technique concerné peuvent être prises en considération pour l'estimation de la formation professionnelle.

[SOURCE: IEC 60050-851:2008, 851-11-10]

#### 3.1.4

##### **personne avertie**

personne informée des tâches assignées et des dangers possibles dus à des négligences

Note 1 à l'article: Si nécessaire, la personne a subi une formation.

[SOURCE: IEC 60050-851:2008, 851-11-13]

#### 3.1.5

##### **essai de type**

essai effectué sur un ou plusieurs dispositifs réalisés selon une conception donnée, afin de vérifier si ces dispositifs satisfont aux exigences de la norme concernée

[SOURCE: IEC 60050-851:2008, 851-12-05]

#### 3.1.6

##### **essai individuel de série**

essai effectué sur chaque dispositif en cours ou en fin de fabrication pour vérifier qu'il satisfait aux exigences de la norme concernée ou à des critères spécifiés

[SOURCE: IEC 60050-851:2008, 851-12-06]

#### 3.1.7

##### **examen visuel**

examen à l'œil nu destiné à vérifier qu'il n'y a pas de désaccord apparent par rapport aux dispositions de la norme concernée

[SOURCE: IEC 60050-851:2008, 851-11-11]

### 3.1.8

#### **caractéristique tombante**

**caractéristique** externe **statique** d'une source de courant de soudage qui, dans la zone normale de soudage, est telle que la pente négative est supérieure ou égale à 7 V/100 A

Note 1 à l'article: Cet article révisé l'IEV 851-12-34, qui sera mis à jour.

### 3.1.9

#### **caractéristique plate**

**caractéristique** externe **statique** d'une source de courant de soudage qui, dans la zone normale de soudage, est telle que lorsque le courant croît, la tension décroît de moins de 7 V/100 A ou croît de moins de 10 V/100 A

[SOURCE: IEC 60050-851:2008, 851-12-35]

### 3.1.10

#### **caractéristique statique**

relation entre la tension et le courant aux bornes de sortie d'une source de courant de soudage quand elle est connectée à une **charge conventionnelle**

Note 1 à l'article: Cet article révisé l'IEV 851-12-32, qui sera mis à jour.

### 3.1.11

#### **circuit de soudage**

tous les éléments conducteurs à travers lesquels le passage du **courant de soudage** est prévu

Note 1 à l'article: En soudage à l'arc, l'arc fait partie du **circuit de soudage**.

Note 2 à l'article: Dans certains procédés de soudage à l'arc, l'arc peut être établi entre deux électrodes. Dans un tel cas, la pièce mise en œuvre ne fait pas nécessairement partie du **circuit de soudage**.

[SOURCE: IEC 60050-851:2008, 851-14-10]

### 3.1.12

#### **circuit de commande**

circuit interne ou externe servant à commander le fonctionnement du matériel et/ou la protection des circuits de puissance

EXEMPLE 1 **Circuits de commande** destinés à réaliser l'interface entre la source de courant de soudage et un matériel externe conçu par le constructeur.

EXEMPLE 2 **Circuits de commande** destinés à réaliser l'interface entre la source de courant de soudage et d'autres types de matériels accessoires.

Note 1 à l'article: Cet article révisé l'IEV 851-14-11, qui sera mis à jour.

### 3.1.13

#### **courant de soudage**

courant fourni par une source de courant de soudage pendant le soudage

### 3.1.14

#### **tension en charge**

tension entre les bornes de sortie lorsque la source de courant de soudage débite un **courant de soudage**

[SOURCE: IEC 60050-851:2008, 851-12-04]



### 3.1.15

#### **tension à vide**

tension, à l'exclusion de toute tension d'amorçage ou de stabilisation, se trouvant entre les bornes de sortie accessibles d'une source de courant de soudage lorsque le **circuit de soudage** est ouvert, mais sous tension

Note 1 à l'article: Cet article révisé l'IEV 851-12-24, qui sera mis à jour.

### 3.1.16

#### **valeur conventionnelle**

valeur normalisée utilisée pour la mesure d'un paramètre en vue de comparaison, étalonnage, essai, etc.

Note 1 à l'article: Les **valeurs conventionnelles** ne s'appliquent pas nécessairement au cours d'une opération de soudage.

[SOURCE: IEC 60050-851:2008, 851-12-07]

### 3.1.17

#### **condition conventionnelle de soudage**

condition de la source de courant de soudage sous tension et à l'état thermiquement stabilisé définie par un **courant de soudage conventionnel** établi sous **la tension conventionnelle en charge** correspondante dans une **charge conventionnelle** pour la **tension d'alimentation**, la fréquence ou la vitesse de rotation **assignées**

[SOURCE: IEC 60050-851:2008, 851-12-26]

### 3.1.18

#### **charge conventionnelle**

charge résistive constante pratiquement non inductive ayant un facteur de puissance non inférieur à 0,99

[SOURCE: IEC 60050-851:2008, 851-12-27]

### 3.1.19

#### **courant de soudage conventionnel**

$I_2$

courant débité par une source de courant de soudage dans une **charge conventionnelle** sous la **tension conventionnelle en charge** correspondante

Note 1 à l'article: Les valeurs de  $I_2$  sont données en valeurs efficaces pour le courant alternatif et en valeurs arithmétiques moyennes pour le courant continu.

### 3.1.20

#### **tension conventionnelle en charge**

$U_2$

**tension en charge** d'une source de courant de soudage, liée au **courant conventionnel de soudage** par une relation linéaire spécifiée

Note 1 à l'article: Les valeurs de  $U_2$  sont données en valeurs efficaces pour le courant alternatif et en valeurs moyennes arithmétiques pour le courant continu.

Note 2 à l'article: La relation linéaire spécifiée varie suivant le procédé de soudage (voir 11.2).

Note 1 à l'article: Cet article révisé l'IEV 851-12-30, qui sera mis à jour.

### 3.1.21

#### **valeur assignée**

valeur, assignée généralement par le constructeur, pour une condition de fonctionnement spécifiée d'un composant, d'un dispositif ou d'un matériel

### 3.1.22

#### **plaque signalétique**

plaque, fixée de façon permanente sur un dispositif électrique, où sont inscrites de façon indélébile les caractéristiques assignées et d'autres informations, selon les exigences de la norme applicable

[SOURCE: IEC 60050-151:2001, 151-16-12]

### 3.1.23

#### **puissance assignée**

**valeurs assignées** de la puissance de l'équipement

Note 1 à l'article: Cet article révisé l'IEV 851-12-17, qui sera mis à jour.

### 3.1.24

#### **courant de soudage assigné maximal**

$I_{2max}$

valeur maximale du **courant conventionnel de soudage** pouvant être fournie par la source de courant de soudage à son réglage maximal dans la **condition conventionnelle de soudage**

[SOURCE: IEC 60050-851:2008, 851-12-14]

### 3.1.25

#### **courant de soudage assigné minimal**

$I_{2min}$

valeur minimale du **courant conventionnel de soudage** qui peut être fournie par la source de courant de soudage à son réglage minimal dans les **conditions conventionnelles de soudage**

[SOURCE: IEC 60050-851:2008, 851-12-15]

### 3.1.26

#### **tension à vide assignée**

$U_0$

**tension à vide** dans les conditions assignées de tension d'alimentation et de fréquence ou de **vitesse de rotation assignée à vide**

Note 1 à l'article: Si une source de courant de soudage est équipée d'un **dispositif réducteur de risques**, il s'agit de la tension mesurée avant que le **dispositif réducteur de risques** n'ait rempli sa fonction.

### 3.1.27

#### **tension à vide assignée réduite**

$U_r$

**tension à vide** d'une source de courant de soudage équipée d'un dispositif réducteur de tension immédiatement après l'action du dispositif pour diminuer la tension

### 3.1.28

#### **tension à vide assignée commutée**

$U_s$

**tension continue à vide** d'une source de courant de soudage équipée d'un dispositif de commutation courant alternatif à courant continu

### 3.1.29

#### **tension assignée d'alimentation**

$U_1$

valeur efficace d'une tension d'alimentation pour laquelle le matériel est conçu

**3.1.30**  
**courant assigné d'alimentation**

$I_1$   
valeur efficace d'un courant d'alimentation absorbé par la source de courant de soudage dans une **condition conventionnelle de soudage** assignée

**3.1.31**  
**courant d'alimentation assigné à vide**

$I_0$   
valeur efficace d'un courant d'alimentation absorbé par la source de courant de soudage à **tension à vide assignée**

**3.1.32**  
**courant d'alimentation assigné maximal**

$I_{1\max}$   
valeur maximale du **courant d'alimentation assigné**

Note 1 à l'article: Cet article révisé l'IEV 851-12-13, qui sera mis à jour.

**3.1.33**  
**courant d'alimentation effectif maximal**

$I_{1\text{eff}}$   
valeur maximale du courant effectif d'alimentation, calculée à partir du **courant d'alimentation assigné** ( $I_1$ ), du **facteur de marche** ( $X$ ) correspondant et du courant d'alimentation à vide ( $I_0$ ), par la formule:

$$I_{1\text{eff}} = \sqrt{I_1^2 \times X + I_0^2 \times (1 - X)}$$

Note 1 à l'article: Le courant d'alimentation effectif maximal n'est pas toujours calculé au facteur de marche correspondant au courant d'alimentation assigné maximal.

[SOURCE: IEC 60050-851:2008, 851-12-39]

**3.1.34**  
**vitesse assignée en charge**

$n$   
vitesse de rotation d'un groupe électrogène de soudage lorsqu'il fonctionne au **courant de soudage assigné maximal**

Note 1 à l'article: Cet article révisé l'IEV 851-12-12, qui sera mis à jour.

**3.1.35**  
**vitesse de rotation assignée à vide**

$n_0$   
vitesse de rotation d'un groupe électrogène de soudage lorsque le **circuit de soudage** extérieur est ouvert

Note 1 à l'article: Si un moteur thermique est équipé d'un dispositif réducteur de vitesse en l'absence de soudage,  $n_0$  sera mesurée avant fonctionnement de ce dispositif.

Note 2 à l'article: Cet article révisé l'IEV 851-12-16, qui sera mis à jour.

**3.1.36**  
**vitesse de rotation assignée au ralenti**

$n_i$   
vitesse à vide réduite d'une source de courant de soudage pilotée par un moteur

[SOURCE: IEC 60050-851:2008, 851-12-18]

### 3.1.37 facteur de marche

X

REPLACÉ: cycle de marche  
rapport, sur un intervalle de temps donné, de la durée en charge non interrompue à la durée totale

Note 1 à l'article: Ce rapport, compris entre 0 et 1, est exprimé en pourcentage.

Note 2 à l'article: Pour les besoins du présent document, la durée complète d'un cycle est de 10 min. Par exemple, dans le cas d'un **facteur de marche** de 60 %, une période de charge continue de 6 min est suivie d'une période de marche à vide de 4 min.

### 3.1.38 distance d'isolement dans l'air distance d'isolement distance la plus courte dans l'air entre deux parties conductrices

[SOURCE: IEC 60664-1:2007, 3.2]

### 3.1.39 ligne de fuite distance la plus courte, le long de la surface d'un isolant solide, entre deux parties conductrices

[SOURCE: IEC 60664-1:2007, 3.3]

### 3.1.40 degré de pollution nombre caractérisant la pollution prévue du **micro-environnement**

Note 1 à l'article: Afin d'évaluer les **lignes de fuite** et les **distances d'isolement dans l'air**, les quatre **degrés de pollution** suivants sont définis au 4.6.2 de l'IEC 60664-1:2007 pour le **micro-environnement**.

- a) **Degré de pollution 1:** Il n'existe pas de pollution ou il se produit seulement une pollution sèche, non conductrice. La pollution n'a pas d'influence.
- b) **Degré de pollution 2:** Il ne se produit qu'une pollution non conductrice. Cependant, dans certains cas, une conductivité temporaire provoquée par la condensation doit être envisagée.
- c) **Degré de pollution 3:** Présence d'une pollution conductrice ou d'une pollution sèche, non conductrice, qui devient conductrice par suite de la condensation qui peut se produire.
- d) **Degré de pollution 4:** Une conductivité persistante apparaît, due à la poussière conductrice, à la pluie ou à la neige.

[SOURCE: IEC 60664-1:2007, 3.13, modifiée – Modification de la Note à l'article.]

### 3.1.41 micro-environnement environnement immédiat de l'isolation qui influence en particulier le dimensionnement des **lignes de fuite**

[SOURCE: IEC 60664-1:2007, 3.12.2]

### 3.1.42 groupe de matériau matériaux classés en quatre groupes selon les valeurs de leur indice de résistance au cheminement (IRC) conformément à l'IEC 60664-1

Note 1 à l'article: Les quatre groupes suivants sont définis dans l'IEC 60664-1:

- Groupe de matériau I  $600 \leq \text{IRC}$

- Groupe de matériau II  $400 \leq IRC < 600$
- Groupe de matériau IIIa  $175 \leq IRC < 400$
- Groupe de matériau IIIb  $100 \leq IRC < 175$

### 3.1.43

#### **échauffement**

différence entre la température d'une partie du matériel et celle de l'air ambiant

### 3.1.44

#### **équilibre thermique**

état atteint lorsque l'**échauffement** constaté d'une partie quelconque du matériel ne dépasse pas 2 K/h

### 3.1.45

#### **protection thermique**

système destiné à assurer la protection d'une partie, et donc l'ensemble de l'équipement contre les températures excessives résultant de certaines conditions de surcharge thermique

Note 1 à l'article: Elle peut être réarmée (soit manuellement, soit automatiquement) lorsque la température redescend à la valeur de réenclenchement.

Note 2 à l'article: Cet article révisé l'IEV 851-15-03, qui sera mis à jour.

### 3.1.46

#### **environnement avec risque accru de choc électrique**

environnement dans lequel la probabilité de choc électrique due au soudage à l'arc est accrue par rapport aux conditions normales du soudage à l'arc

Note 1 à l'article: De tels environnements se trouvent, par exemple:

- a) dans des emplacements où la liberté de mouvement restreinte oblige l'opérateur à souder dans une position inconfortable (à genoux, assis, allongé, par exemple), en contact physique avec des parties conductrices;
- b) dans des emplacements totalement ou partiellement limités par des éléments conducteurs, présentant une probabilité élevée de contact involontaire ou accidentel par l'opérateur;
- c) dans des emplacements mouillés, humides ou chauds lorsque l'humidité ou la transpiration réduit considérablement la résistance de la peau du corps humain et les propriétés isolantes des accessoires.

### 3.1.47

#### **dispositif réducteur de risques**

dispositif conçu pour réduire le danger de choc électrique pouvant résulter de la **tension à vide**

[SOURCE: IEC 60050-851:2008, 851-15-01]

### 3.1.48

#### **matériel de classe I**

matériel dont l'**isolation principale** est la disposition de protection principale et dont l'équipotentialité de protection assure la protection contre les défauts

[SOURCE: IEC 60050-851:2008, 851-15-10]

### 3.1.49

#### **matériel de classe II**

matériel dont l'**isolation principale** est la mesure de protection principale, et l'**isolation supplémentaire** est la mesure de protection en cas de défaut, ou dont les protections principales et protections en cas de défaut sont assurées par une **isolation renforcée**

[SOURCE: IEC 60050-851:2008, 851-15-11]

### 3.1.50

#### **isolation principale**

isolation des parties actives dangereuses qui assure la protection principale

[SOURCE: IEC 60050-851:2008, 851-15-04]

### 3.1.51

#### **isolation supplémentaire**

isolation indépendante prévue, en plus de l'**isolation principale**, en tant que protection en cas de défaut

[SOURCE: IEC 60050-851:2008, 851-15-05]

### 3.1.52

#### **double isolation**

isolation comprenant à la fois une **isolation principale** et une **isolation supplémentaire**

[SOURCE: IEC 60050-851:2008, 851-15-06]

### 3.1.53

#### **isolation renforcée**

isolation des parties actives dangereuses assurant un degré de protection contre les chocs électriques équivalant à celui d'une **double isolation**

Note 1 à l'article: L'**isolation renforcée** peut comporter plusieurs couches qui ne peuvent pas être essayées séparément en tant qu'**isolation principale** ou **isolation supplémentaire**.

[SOURCE: IEC 60050-851:2008, 851-15-07]

### 3.1.54

#### **système de coupage par plasma**

combinaison de source de courant électrique, torche et dispositifs de sécurité associés pour le coupage et le gougeage par plasma

[SOURCE: IEC 60050-851:2008, 851-13-03]

### 3.1.55

#### **source de courant électrique de coupage par plasma**

équipement destiné à fournir un courant électrique et une tension, ayant des caractéristiques appropriées pour le coupage et le gougeage par plasma et pouvant fournir du gaz et du liquide de refroidissement

Note 1 à l'article: Une **source de courant électrique de coupage plasma** peut également fournir des services à d'autres équipements et accessoires, par exemple tensions auxiliaires, liquide de refroidissement et gaz.

[SOURCE: IEC 60050-851:2008, 851-13-04]

### 3.1.56

#### **très basse tension de sécurité**

##### **TBTS**

tension n'excédant pas 50 V en courant alternatif ou 120 V en courant continu lissé entre conducteurs ou entre un conducteur quelconque et la terre dans un circuit dont la séparation du réseau d'alimentation est assurée par des moyens tels qu'un transformateur de sécurité

Note 1 à l'article: Une tension maximale inférieure à 50 V en courant alternatif ou 120 V en courant continu lissé peut être spécifiée dans des règles particulières, plus spécialement lorsque le contact direct avec des parties actives est possible.

Note 2 à l'article: Lorsque la source est un transformateur de sécurité, il convient que la limite de tension ne soit pas dépassée à toute charge comprise entre la pleine charge et à vide.

Note 3 à l'article: «Lissé» se dit par convention d'une tension en courant continu lorsque le rapport de la valeur efficace de l'ondulation à la composante continue ne dépasse pas 10 %. La valeur crête maximale ne dépasse pas 140 V pour un système en courant continu lissé de tension nominale 120 V, et 70 V pour un système en courant continu lissé de tension nominale 60 V.

Note 4 à l'article: Cet article révisé l'IEV 851-15-08, qui sera mis à jour.

### **3.1.57**

#### **circuit d'alimentation**

circuit d'entrée

matériau conducteur dans le matériel, à travers lequel le passage du courant d'alimentation est prévu

### **3.1.58**

#### **tension locale**

valeur efficace la plus élevée de la tension en courant alternatif ou continu qui peut apparaître à travers n'importe quelle isolation lorsqu'un matériel est alimenté sous la tension assignée

Note 1 à l'article: Les surtensions transitoires sont négligées.

Note 2 à l'article: Il est tenu compte à la fois des conditions à vide et des conditions normales de fonctionnement.

[SOURCE: IEC 60050-851:2008, 851-12-31]

### **3.1.59**

#### **courant de contact**

courant électrique passant dans le corps humain ou dans le corps d'un animal lorsque ce corps est en contact avec une ou plusieurs parties accessibles d'une installation ou de matériels

Note 1 à l'article: Le **courant de contact** est mesuré à l'aide d'un réseau de mesure simulant l'impédance du corps humain.

[SOURCE: IEC 60050-195:1998/AMD1:2001, 195-05-21, modifiée – Ajout d'une note à l'article.]

### **3.1.60**

#### **commande à distance**

dispositif ou circuit extérieur au matériel, utilisé pour la surveillance ou la commande du fonctionnement

### **3.1.61**

#### **condition de défaut simple**

condition dans laquelle un seul moyen de protection contre les dangers est défectueux

Note 1 à l'article: Lorsqu'une **condition de défaut simple** résulte dans une autre **condition de défaut simple**, les deux défauts sont considérés comme une **condition de défaut simple**.

### **3.1.62**

#### **installation fixe**

combinaison particulière de plusieurs types d'appareils et, le cas échéant, d'autres dispositifs, qui sont assemblés, installés et destinés à être utilisés de façon permanente sur un emplacement prédéfini

### **3.1.63**

#### **circuit de protection**

circuit destiné à être relié à la terre de protection pour la protection contre les chocs électriques

### 3.1.64

#### **classe d'isolation**

repère dans une nomenclature appliquée à un matériau d'isolation utilisé dans les machines ou appareils électriques et spécifiant la nature des matériaux et la limite de température recommandée

[SOURCE: IEC 60050-811:1991, 811-13-33]

### 3.1.65

#### **isolation fonctionnelle**

isolation entre parties conductrices, nécessaire pour le bon fonctionnement du matériel

[SOURCE: IEC 60050-195:1998, 195-02-41]

### 3.1.66

#### **état au ralenti**

état de fonctionnement dans lequel l'alimentation est activée mais le **circuit de soudage** n'est pas mis sous tension

Note 1 à l'article: Pour certains types de matériels, il n'y a pas d'**état au ralenti**, mais un état de soudage précédant l'amorçage de l'arc.

Note 2 à l'article: Pour une source de courant dans un système mécanisé, la configuration réalisant l'**état au ralenti** est définie par le constructeur.

Note 3 à l'article: Un **état au ralenti** peut inclure un état énergétique faible dans lequel un procédé de soudage ne peut être initié sans une réactivation automatique ou manuelle.

## 3.2 Termes relatifs aux systèmes de batterie

### 3.2.1

#### **batterie**

assemblage d'un ou de plusieurs **éléments** destinés à fournir du courant électrique à la source de courant de soudage

### 3.2.2

#### **batterie incorporée**

**batterie** qui est placée à l'intérieur de la source de courant de soudage alimentée par batterie et qui n'est pas retirée de cette source pour le chargement

Note 1 à l'article: Une **batterie** qui doit être retirée de la source de courant de soudage alimentée par batterie uniquement pour sa mise au rebut ou son recyclage est considérée comme une **batterie incorporée**.

### 3.2.3

#### **bloc de batteries amovibles**

**batterie** qui est à l'intérieur d'une enveloppe séparée de la source de courant de soudage alimentée par batterie et qui est destinée à être retirée de cette source pour le chargement

### 3.2.4

#### **bloc de batteries démontables**

**batterie** qui est à l'intérieur d'une enveloppe séparée de la source de courant de soudage alimentée par batterie et qui est raccordée à cette source par un câble

### 3.2.5

#### **système de batterie**

combinaison d'une **batterie**, du **système de charge**, de la source de courant de soudage et des interfaces entre eux tels qu'ils existent pendant le fonctionnement de la source de courant de soudage ou pendant le chargement



### 3.2.6

#### **régime C<sub>5</sub>**

courant, en ampères, auquel un **élément** ou une **batterie** peut être déchargé(e) pendant 5 h au point de coupure de la tension spécifié par le constructeur d'**éléments**

### 3.2.7

#### **élément**

unité fonctionnelle de base, consistant en un assemblage d'électrodes, d'électrolyte, de conteneur, de bornes et généralement de séparateurs, qui est une source d'énergie électrique obtenue par transformation directe d'énergie chimique

[SOURCE: IEC 60050-482:2004, 482-01-01]

### 3.2.8

#### **chargeur**

tout ou partie du **système de charge** contenu dans une enveloppe séparée

Note 1 à l'article: Au minimum, le **chargeur** comprend certains des circuits de conversion du courant. Tous les **systèmes de charge** ne possèdent pas un **chargeur** séparé comme dans le cas où une source de courant de soudage peut être chargée en utilisant un câble d'alimentation secteur ou peut incorporer une fiche de prise de courant pour sa fixation à une prise secteur.

### 3.2.9

#### **système de charge**

combinaison de circuits destinés à charger, équilibrer et/ou maintenir l'état de charge de la **batterie**

### 3.2.10

#### **batterie complètement chargé**

#### **élément complètement chargé**

**batterie** ou **élément** chargé(e) à l'état maximal de charge permis par le **système de charge de batterie** destiné(e) à être utilisé(e) avec la source de courant de soudage

### 3.2.11

#### **batterie complètement déchargé**

#### **élément complètement déchargé**

**batterie** ou **élément** qui a été déchargé(e) jusqu'à ce qu'une des conditions suivantes se produise: la décharge prend fin du fait de l'intervention d'un circuit de protection ou la **batterie** (ou **élément**) atteint une tension totale avec une tension moyenne par **élément** égale à la tension de fin de décharge pour la chimie des **éléments** utilisés sauf si une autre tension de fin de décharge est spécifiée par le constructeur de **batteries/d'éléments**

Note 1 à l'article: Les tensions de fin de décharge pour les chimies courantes de l'**élément** sont fournies en O.5.210.

### 3.2.12

#### **batteries à usage général**

#### **éléments à usage général**

**batteries** et **éléments** disponibles chez plusieurs constructeurs, au niveau d'une variété de points de vente des produits de différents constructeurs

Note 1 à l'article: Les **batteries** de 12 V pour automobiles et les **éléments** alcalins AA, C et D sont des exemples d'**usage général**.

### 3.2.13

#### **courant de charge maximal**

courant le plus élevé qu'un **élément** est autorisé à recevoir pendant le chargement pour une plage spécifique de températures, tel que spécifié par le constructeur d'**éléments** et évalué conformément à l'IEC 62133-1:— ou à l'IEC 62133-2:—

### 3.2.14

#### **région de fonctionnement spécifiée**

plage de fonctionnement admissible pour les **éléments**, exprimée par les limites des paramètres des **éléments**

#### 3.2.14.1

##### **région de fonctionnement spécifiée pour le chargement**

conditions relatives à la tension et au courant pendant le chargement dans lesquelles l'**élément** est autorisé à fonctionner, telles que spécifiées par le constructeur d'**éléments** et évaluées conformément à l'IEC 62133-1:— ou à l'IEC 62133-2:—

### 3.2.15

#### **tension en charge maximale**

tension la plus élevée qu'un **élément** est autorisé à atteindre pendant le chargement normal pour une plage spécifique de températures, telle que spécifiée par le constructeur d'**éléments** et évaluée conformément à l'IEC 62133-1:— ou à l'IEC 62133-2:—

### 3.2.16

#### **échappement de gaz**

condition dans laquelle un **élément** libère une pression interne excessive prévue par conception, de manière à prévenir l'**explosion**

### 3.2.17

#### **composant électronique**

pièce dans laquelle la conduction est obtenue principalement par des électrons qui se déplacent à travers un vide, un gaz ou un semiconducteur, à l'exclusion des indicateurs en néon

Note 1 à l'article: Des exemples de **composants électroniques** incluent les diodes, transistors, triacs et les circuits intégrés monolithiques. Les résistances, condensateurs et inductances ne sont pas considérés comme des **composants électroniques**.

### 3.2.18

#### **protection principale**

protection contre les chocs électriques en l'absence de défaut

[SOURCE: IEC 60050-195:1998, 195-06-01]

### 3.2.19

#### **classe de tension de batterie A**

classification d'un composant électrique ou d'un circuit électrique ayant une **tension de service** pour batterie maximale de 60 V en courant continu

### 3.2.20

#### **classe de tension de batterie B**

classification d'un composant électrique ou d'un circuit électrique ayant une **tension de service** pour batterie maximale comprise entre 60 V en courant continu et 1 500 V en courant continu

### 3.2.21

#### **carbonisation**

noircissement du coton causé par une combustion

Note 1 à l'article: La décoloration du coton causée par la fumée est acceptable.

### 3.2.22

#### **cycle de fonctionnement consécutif**

mise en cycle immédiate après réenclenchement du dispositif de commande thermique

### 3.2.23

#### **explosion**

<d'une atmosphère explosive> augmentation soudaine de la pression et de la température due à une oxydation ou une autre réaction exothermique

[SOURCE: IEC 60050-426:2008, 426-02-13]

## 4 Conditions ambiantes

Les sources de courant de soudage doivent être capables de fournir leurs **puissances assignées** pour les **facteurs de marche** assignés dans les conditions ambiantes suivantes:

- a) plage de températures de l'air ambiant:  
pendant le soudage:  $-10\text{ °C}$  à  $+40\text{ °C}$ ;
- b) humidité relative de l'air:  
inférieure ou égale à 50 % à  $40\text{ °C}$ ;  
inférieure ou égale à 90 % à  $20\text{ °C}$ ;
- c) air ambiant exempt de quantités anormales de poussières, d'acides, de gaz corrosifs ou substances corrosives, etc. autres que celles créées au cours de l'opération de soudage;
- d) altitude au-dessus du niveau de la mer inférieure ou égale à 1 000 m;
- e) base de la source de courant de soudage inclinée jusqu'à  $10^\circ$ .

Les sources de courant de soudage doivent résister au stockage et au transport à une température de l'air ambiant comprise entre  $-20\text{ °C}$  et  $+55\text{ °C}$  sans subir aucune dégradation de leur fonctionnement ni de leurs performances.

NOTE Des conditions ambiantes différentes peuvent faire l'objet d'un accord entre le constructeur et l'acheteur et la source de courant de soudage est marquée en conséquence (voir 15.1). Parmi ces conditions, il est possible de citer: humidité élevée, fumées corrosives inhabituelles, vapeur d'eau, excès de vapeur d'huile, vibration ou choc anormal(e), excès de poussières, conditions climatiques sévères, conditions inhabituelles au bord de la mer ou à bord d'un navire, infestation de vermine et conditions favorisant la croissance de moisissures.

## 5 Essais

### 5.1 Conditions d'essai

Les essais doivent être effectués sur des sources de courant de soudage neuves, sèches et complètement assemblées.

L'essai d'échauffement défini au 7.1 et l'essai de **protection thermique** défini au 8.5 doivent être effectués à une température ambiante de  $40\text{ °C}$ , voir les tolérances au 7.1.2 e), à l'exception des groupes électrogènes de soudage et des matériels d'**installations fixes**, qui doivent être soumis à des essais conformément aux spécifications du constructeur.

D'autres essais doivent être effectués à une température de l'air ambiant indiquée à l'Article 4 a).

Les sources de courant de soudage refroidies par liquide doivent être soumises à l'essai en présence de liquide comme cela est spécifié par le constructeur.

Sauf spécification contraire, le matériel doit être alimenté sous une **tension assignée d'alimentation** avec une tolérance de  $\pm 5\%$ .

## 5.2 Instruments de mesure

L'exactitude des instruments de mesure doit être:

- a) instruments de mesure électriques: classe I ( $\pm 1\%$  de la lecture à pleine échelle), à l'exception du mesurage de la résistance d'isolement et de la rigidité diélectrique, pour lequel l'exactitude des instruments de mesure n'est pas spécifiée, mais doit être prise en compte pour le mesurage;
- b) thermomètre:  $\pm 2\text{ K}$ ;
- c) tachymètre:  $\pm 1\%$  de la lecture à pleine échelle.

## 5.3 Conformité des composants

~~Les composants qui en cas de défaillance peuvent provoquer un danger doivent être conformes aux exigences du présent document ou aux exigences des normes IEC appropriées.~~

~~NOTE 1 Une norme de composant IEC n'est considérée comme appropriée que si le composant en question relève de son domaine d'application.~~

~~L'évaluation et les essais des composants, pour permettre une application correcte dans le matériel, doivent être effectués selon l'une des procédures suivantes:~~

- ~~a) Lorsque la conformité d'un composant à une norme IEC appropriée a été certifiée par un organisme d'essai reconnu, l'application correcte et l'utilisation selon ses caractéristiques assignées doivent être vérifiées. Ce composant doit être soumis aux essais conformément à la présente document, à l'exception des essais qui font partie de la norme IEC appropriée du composant.~~
- ~~b) Lorsque la conformité d'un composant à une norme IEC appropriée a été certifiée par un organisme d'essai reconnu, mais que le composant n'est pas utilisé selon ses caractéristiques assignées spécifiées, il doit être soumis aux essais conformément au présent document.~~
- ~~c) Lorsque la conformité d'un composant à une norme IEC appropriée n'a pas été certifiée par un organisme d'essai reconnu, l'application correcte de ce composant dans le matériel doit être vérifiée conformément au présent document ou conformément aux essais applicables de la norme IEC appropriée du composant.~~

~~NOTE 2 L'essai applicable pour démontrer la conformité à une norme de composant est, en général, effectué de manière séparée. Le nombre d'échantillons d'essai est, en général, le même que celui exigé dans la norme du composant.~~

- ~~d) Lorsque la conformité d'un composant à une norme IEC appropriée n'a pas été certifiée par un organisme d'essai reconnu car une telle norme n'existe pas, ce composant doit être soumis aux essais conformément au présent document.~~
- ~~e) Lorsque la conformité d'un composant à une norme non établie par l'IEC a été certifiée par un organisme d'essai reconnu, l'utilisation de ce composant doit être considérée comme acceptable dans le matériel à condition que les exigences de sécurité applicables de la norme non établie par l'IEC soient au moins aussi sévères que les exigences d'une norme IEC appropriée. Le composant doit être soumis aux essais conformément au présent document à l'exception des essais qui font partie de la norme du composant non établie par l'IEC.~~

Se reporter à l'Annexe P pour la conformité des composants.

## 5.4 Essais de type

Sauf spécification contraire, les essais du présent document sont des **essais de type**.

La source de courant de soudage à l'essai doit comprendre tous les matériels accessoires qui pourraient affecter les résultats des essais.

Tous les **essais de type** doivent être effectués sur la même source de courant de soudage, sauf s'il est spécifié qu'un essai peut être effectué sur une autre source de courant de soudage.

Pour vérifier la conformité, les **essais de type** indiqués ci-après doivent être effectués dans l'ordre suivant sans temps de séchage entre f), g) et h):

- a) **examen visuel** général, voir 3.1.7;
- b) résistance d'isolement, voir 6.1.4 (contrôle préliminaire);
- c) enveloppe, voir 14.2;
- d) moyens de manutention, voir 14.3;
- e) essai de résistance à la chute, voir 14.4;
- f) protection procurée par l'enveloppe, voir 6.2.1;
- g) résistance d'isolement, voir 6.1.4;
- h) rigidité diélectrique, voir 6.1.5;
- i) **examen visuel** général, voir 3.1.7.

Les autres essais prévus par le présent document qui ne sont pas mentionnés ici doivent être effectués, mais peuvent être effectués dans l'ordre le plus pratique.

## 5.5 Essais individuels de série

Tous les **essais individuels de série** doivent être effectués sur chaque source de courant de soudage. L'ordre suivant est recommandé:

- a) **examen visuel** conforme à la spécification du constructeur;
- b) continuité du **circuit de protection**, voir 10.5.1;
- c) rigidité diélectrique, voir 6.1.5;
- d) **tension à vide**:
  - 1) **tension à vide assignée**, voir 11.1 par mesurage uniquement; ou
  - 2) si applicable, **tension à vide assignée réduite**, voir 13.2; ou
  - 3) si applicable, **tension à vide assignée commutée**, voir 13.3;
- e) essai pour garantir les valeurs de sortie minimales et maximales assignées selon 15.4 b) et 15.4 c). Le constructeur peut choisir des essais sur **charge conventionnelle**, en court-circuit ou sous d'autres conditions d'essai.

NOTE 1 En court-circuit et sous d'autres conditions d'essai, les valeurs de sortie peuvent différer des valeurs obtenues sur **charge conventionnelle**.

NOTE 2 Lorsque la conception le justifie, les valeurs mesurées peuvent être compensées en raison des variations du réseau d'alimentation.

## 6 Protection contre les chocs électriques

### 6.1 Isolement

#### 6.1.1 Généralités

La majorité des sources de courant de soudage appartiennent à la catégorie de surtension III, conformément à l'IEC 60664-1; les sources de courant de soudage à moteur thermique appartiennent à la catégorie de surtension II. Toutes les sources de courant de soudage doivent être conçues pour une utilisation dans les conditions d'environnement présentant au moins un **degré de pollution** 3.

Les composants ou sous-ensembles présentant des **distances d'isolement dans l'air** ou des **lignes de fuite** correspondant au **degré de pollution 2** sont permis, si le **micro-environnement** du composant ou du sous-ensemble est amélioré (par des moyens tels que le filtrage, le revêtement, l'empotage ou le moulage) de sorte que seule la pollution non conductrice ou la conductivité occasionnelle temporaire due à la condensation se produise.

Les composants ou sous-ensembles présentant des **distances d'isolement dans l'air** ou des **lignes de fuite** correspondant au **degré de pollution 1** sont permis s'ils sont totalement revêtus, empotés ou moulés conformément à l'IEC 60664-3.

Voir le Tableau 2 pour les **lignes de fuite** des cartes imprimées.

Le **matériel de classe I** destiné à être connecté à un système triphasé à trois fils relié à la terre doit être conçu avec une isolation basée sur les valeurs de la tension entre phases. Le **matériel de classe I** conçu avec une isolation basée sur les valeurs de la tension phase-neutre doit comporter un avertissement indiquant qu'un tel matériel ne doit être utilisé que sur un réseau d'alimentation qui est soit triphasé à quatre fils avec un neutre relié à la terre soit monophasé à trois fils avec un neutre relié à la terre.

L'application de l'isolation dans plusieurs configurations est représentée à la Figure 1, mais d'autres configurations et solutions sont possibles. Si une configuration particulière n'est pas représentée à la Figure 1, l'isolation exigée doit être déterminée en examinant l'effet d'un défaut simple.

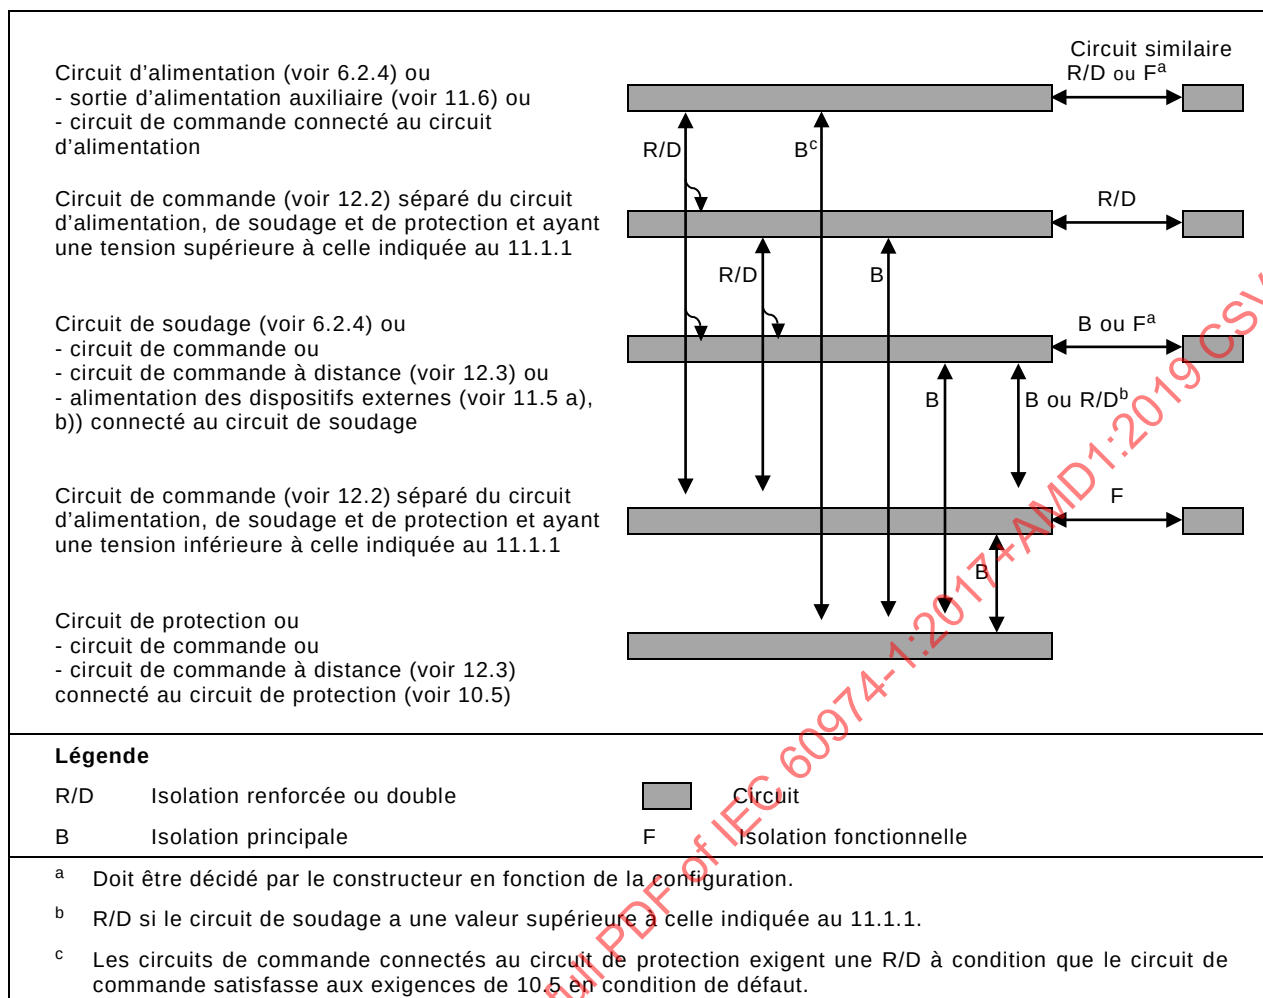


Figure 1 – Exemple de configuration d'isolation pour le matériel de classe I

### 6.1.2 Distances d'isolement dans l'air

Pour l'**isolation principale** ou **supplémentaire** et pour l'**isolation renforcée**, les **distances d'isolement dans l'air** minimales doivent être conformes au Tableau 1 pour la catégorie de surtension III. Pour d'autres catégories de surtension, les **distances d'isolement dans l'air** minimales doivent être conformes à l'IEC 60664-1.

**Tableau 1 – Distances d'isolement dans l'air minimales pour la catégorie de surtension III**

| Tension phase-neutre dérivée des tensions nominales en courant alternatif ou en courant continu jusqu'à et y compris <sup>a</sup><br><br>V eff.                                                                   | Isolation principale ou supplémentaire               |                                                     |                                 |     |     | Isolation renforcée                                  |                                                     |                                 |     |     |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------|-----------------------------------------------------|---------------------------------|-----|-----|------------------------------------------------------|-----------------------------------------------------|---------------------------------|-----|-----|
|                                                                                                                                                                                                                   | Tension assignée d'essai en impulsion<br><br>V crête | Tension d'essai en courant alternatif<br><br>V eff. | Degré de pollution              |     |     | Tension assignée d'essai en impulsion<br><br>V crête | Tension d'essai en courant alternatif<br><br>V eff. | Degré de pollution              |     |     |
|                                                                                                                                                                                                                   |                                                      |                                                     | 2                               | 3   | 4   |                                                      |                                                     | 2                               | 3   | 4   |
|                                                                                                                                                                                                                   |                                                      |                                                     | Distance d'isolement dans l'air |     |     |                                                      |                                                     | Distance d'isolement dans l'air |     |     |
|                                                                                                                                                                                                                   |                                                      |                                                     |                                 |     |     |                                                      |                                                     |                                 |     |     |
| mm                                                                                                                                                                                                                |                                                      |                                                     | mm                              |     |     |                                                      |                                                     |                                 |     |     |
| 50                                                                                                                                                                                                                | 800                                                  | 566                                                 | 0,2                             | 0,8 | 1,6 | 1 500                                                | 1 061                                               | 0,5                             | 0,8 | 1,6 |
| 100                                                                                                                                                                                                               | 1 500                                                | 1 061                                               | 0,5                             |     |     | 2 500                                                | 1 768                                               | 1,5                             |     |     |
| 150                                                                                                                                                                                                               | 2 500                                                | 1 768                                               | 1,5                             |     |     | 4 000                                                | 2 828                                               | 3                               |     |     |
| 300                                                                                                                                                                                                               | 4 000                                                | 2 828                                               | 3                               |     |     | 6 000                                                | 4 243                                               | 5,5                             |     |     |
| 600                                                                                                                                                                                                               | 6 000                                                | 4 243                                               | 5,5                             |     |     | 8 000                                                | 5 657                                               | 8                               |     |     |
| 1 000                                                                                                                                                                                                             | 8 000                                                | 5 657                                               | 8                               |     |     | 12 000                                               | 8 485                                               | 14                              |     |     |
| NOTE 1 Valeurs basées sur les Tableaux F.1 et F.2 de l'IEC 60664-1:2007.                                                                                                                                          |                                                      |                                                     |                                 |     |     |                                                      |                                                     |                                 |     |     |
| NOTE 2 Pour les autres degrés de pollution et catégories de surtension, voir l'IEC 60664-1.                                                                                                                       |                                                      |                                                     |                                 |     |     |                                                      |                                                     |                                 |     |     |
| NOTE 3 Si un autotransformateur est raccordé au circuit d'alimentation et fourni en tant qu'élément d'une source de courant de soudage, la tension d'alimentation détermine les distances d'isolement dans l'air. |                                                      |                                                     |                                 |     |     |                                                      |                                                     |                                 |     |     |
| <sup>a</sup> Voir l'Annexe A.                                                                                                                                                                                     |                                                      |                                                     |                                 |     |     |                                                      |                                                     |                                 |     |     |

Afin de déterminer les **distances d'isolement dans l'air** par rapport aux surfaces accessibles non conductrices, de telles surfaces doivent être considérées comme étant recouvertes d'une feuille métallique à tout endroit où elles peuvent être touchées par le doigt d'essai normalisé conforme à l'IEC 60529.

Les **distances d'isolement dans l'air** ne doivent pas être interpolées.

Pour les bornes du **circuit d'alimentation**, voir E.2.

Les **distances d'isolement dans l'air** entre des éléments de la source de courant de soudage (par exemple circuits ou composants électroniques) qui sont protégés par un dispositif limiteur des surtensions (par exemple varistance métal-oxyde) peuvent être définies conformément à la catégorie de surtension I (voir IEC 60664-1).

Les valeurs du Tableau 1 doivent également s'appliquer au **circuit de soudage** à l'intérieur de la source de courant de soudage et aux **circuits de commande** lorsqu'ils sont séparés du **circuit d'alimentation**, par exemple par un transformateur.

Si le **circuit de commande** est directement raccordé au **circuit d'alimentation**, les valeurs correspondant à la tension d'alimentation doivent s'appliquer.

*La conformité doit être vérifiée par mesurage, conformément au 6.2 de l'IEC 60664-1:2007 ou, si cela n'est pas possible, en soumettant la source de courant de soudage à un essai par impulsion avec les tensions indiquées au Tableau 1.*

Pour l'essai par impulsion, un minimum de trois impulsions espacées d'au moins 1 s pour chaque polarité est appliqué avec la tension indiquée au Tableau 1, en utilisant un générateur



d'impulsions ayant une forme d'onde de sortie de 1,2/50  $\mu$ s et une impédance de sortie inférieure à 500  $\Omega$ .

En variante, une tension d'essai en courant alternatif comme indiquée au Tableau 1 peut être appliquée pendant trois cycles ou une tension en courant continu sans ondulation dont la valeur est égale à la tension d'impulsion peut être appliquée trois fois pendant 10 ms, dans chaque polarité.

### 6.1.3 Lignes de fuite

Pour l'**isolation** principale ou **supplémentaire**, les **lignes de fuite** doivent être conformes au Tableau 2.

Les **lignes de fuite** pour la **double isolation** doivent être la somme des valeurs pour l'isolation principale et l'**isolation supplémentaire** qui forment la **double isolation**.

Les **lignes de fuite** pour l'**isolation renforcée** doivent être deux fois celles déterminées pour l'**isolation principale**.

Afin de déterminer les **lignes de fuite** par rapport aux surfaces accessibles non conductrices, de telles surfaces doivent être considérées comme étant recouvertes d'une feuille métallique à tout endroit où elles peuvent être touchées par le doigt d'essai normalisé conforme à l'IEC 60529.

Les **lignes de fuite** sont données pour la tension assignée la plus élevée de chaque ligne du Tableau 2. Dans le cas d'une tension assignée plus faible, l'interpolation est autorisée.

Pour les bornes du **circuit d'alimentation**, voir E.2.

Les valeurs du Tableau 2 doivent s'appliquer également au **circuit de soudage** à l'intérieur de la source de courant de soudage et aux **circuits de commande** lorsqu'ils sont séparés du **circuit d'alimentation**, par exemple par un transformateur.

Une **ligne de fuite** ne peut pas être inférieure à la **distance d'isolement dans l'air** associée, la **ligne de fuite** la plus courte possible est donc égale à la **distance d'isolement dans l'air** exigée.

Si le **circuit de commande** est directement raccordé au **circuit d'alimentation**, les valeurs correspondant à la tension d'alimentation doivent s'appliquer.

*La conformité doit être vérifiée par mesurage linéaire, conformément au 6.2 de l'IEC 60664-1:2007.*

**Tableau 2 – Lignes de fuite minimales**

| Tension locale | Lignes de fuite en millimètres         |       |                    |                    |          |           |                    |          |           |
|----------------|----------------------------------------|-------|--------------------|--------------------|----------|-----------|--------------------|----------|-----------|
|                | Isolation principale ou supplémentaire |       |                    |                    |          |           |                    |          |           |
|                | Matériau des cartes imprimées          |       | Degré de pollution |                    |          |           |                    |          |           |
|                | Degré de pollution                     |       |                    |                    |          |           |                    |          |           |
| V.eff.         | 1                                      | 2     | 1                  | 2                  |          |           | 3                  |          |           |
|                | a                                      | b     | a                  | Groupe de matériau |          |           | Groupe de matériau |          |           |
|                | mm                                     | mm    | mm                 | I<br>mm            | II<br>mm | III<br>mm | I<br>mm            | II<br>Mm | III<br>mm |
| 10             | 0,025                                  | 0,04  | 0,08               | 0,4                | 0,4      | 0,4       | 1                  | 1        | 1         |
| 12,5           | 0,025                                  | 0,04  | 0,09               | 0,42               | 0,42     | 0,42      | 1,05               | 1,05     | 1,05      |
| 16             | 0,025                                  | 0,04  | 0,1                | 0,45               | 0,45     | 0,45      | 1,1                | 1,1      | 1,1       |
| 20             | 0,025                                  | 0,04  | 0,11               | 0,48               | 0,48     | 0,48      | 1,2                | 1,2      | 1,2       |
| 25             | 0,025                                  | 0,04  | 0,125              | 0,5                | 0,5      | 0,5       | 1,25               | 1,25     | 1,25      |
| 32             | 0,025                                  | 0,04  | 0,14               | 0,53               | 0,53     | 0,53      | 1,3                | 1,3      | 1,3       |
| 40             | 0,025                                  | 0,04  | 0,16               | 0,56               | 0,8      | 1,1       | 1,4                | 1,6      | 1,8       |
| 50             | 0,025                                  | 0,04  | 0,18               | 0,6                | 0,85     | 1,2       | 1,5                | 1,7      | 1,9       |
| 63             | 0,04                                   | 0,063 | 0,2                | 0,63               | 0,9      | 1,25      | 1,6                | 1,8      | 2         |
| 80             | 0,063                                  | 0,1   | 0,22               | 0,67               | 0,95     | 1,3       | 1,7                | 1,9      | 2,1       |
| 100            | 0,1                                    | 0,16  | 0,25               | 0,71               | 1        | 1,4       | 1,8                | 2        | 2,2       |
| 125            | 0,16                                   | 0,25  | 0,28               | 0,75               | 1,05     | 1,5       | 1,9                | 2,1      | 2,4       |
| 160            | 0,25                                   | 0,4   | 0,32               | 0,8                | 1,1      | 1,6       | 2                  | 2,2      | 2,5       |
| 200            | 0,4                                    | 0,63  | 0,42               | 1                  | 1,4      | 2         | 2,5                | 2,8      | 3,2       |
| 250            | 0,56                                   | 1     | 0,56               | 1,25               | 1,8      | 2,5       | 3,2                | 3,6      | 4         |
| 320            | 0,75                                   | 1,6   | 0,75               | 1,6                | 2,2      | 3,2       | 4                  | 4,5      | 5         |
| 400            | 1                                      | 2     | 1                  | 2                  | 2,8      | 4         | 5                  | 5,6      | 6,3       |
| 500            | 1,3                                    | 2,5   | 1,3                | 2,5                | 3,6      | 5         | 6,3                | 7,1      | 8         |
| 630            | 1,8                                    | 3,2   | 1,8                | 3,2                | 4,5      | 6,3       | 8                  | 9        | 10        |
| 800            | 2,4                                    | 4     | 2,4                | 4                  | 5,6      | 8         | 10                 | 11       | 12,5      |
| 1 000          | 3,2                                    | 5     | 3,2                | 5                  | 7,1      | 10        | 12,5               | 14       | 16        |
| 1 250          |                                        |       | 4,2                | 6,3                | 9        | 12,5      | 16                 | 18       | 20        |
| 1 600          |                                        |       | 5,6                | 8                  | 11       | 16        | 20                 | 22       | 25        |
| 2 000          |                                        |       | 7,5                | 10                 | 14       | 20        | 25                 | 28       | 32        |
| 2 500          |                                        |       | 10                 | 12,5               | 18       | 25        | 32                 | 36       | 40        |
| 3 200          |                                        |       | 12,5               | 16                 | 22       | 32        | 40                 | 45       | 50        |
| 4 000          |                                        |       | 16                 | 20                 | 28       | 40        | 50                 | 56       | 63        |
| 5 000          |                                        |       | 20                 | 25                 | 36       | 50        | 63                 | 71       | 80        |
| 6 300          |                                        |       | 25                 | 32                 | 45       | 63        | 80                 | 90       | 100       |
| 8 000          |                                        |       | 32                 | 40                 | 56       | 80        | 100                | 110      | 125       |
| 10 000         |                                        |       | 40                 | 50                 | 71       | 100       | 125                | 140      | 160       |

<sup>a</sup> Groupes de matériaux I, II, IIIa et IIIb.

<sup>b</sup> Groupes de matériaux I, II et IIIa.

NOTE Conformément à l'IEC 60664-1, les dimensions de la ligne de fuite ne peuvent pas être spécifiées en présence d'une pollution conductrice en permanence (Degré de pollution 4).

#### 6.1.4 Résistance d'isolement

La résistance d'isolement ne doit pas être inférieure aux valeurs indiquées au Tableau 3.

**Tableau 3 – Résistance d'isolement**

| Mesurage <sup>a</sup>                                                                                                                                                                                                                                            |                 |                                   | Résistance | Isolation           |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|-----------------------------------|------------|---------------------|
| Circuit d'alimentation                                                                                                                                                                                                                                           | par rapport au  | circuit de soudage                | 5,0 MΩ     | Double ou renforcée |
| Circuit de soudage                                                                                                                                                                                                                                               | par rapport au  | circuit de protection             | 2,5 MΩ     | Principale          |
| Circuit d'alimentation                                                                                                                                                                                                                                           | par rapport au  | circuit de protection             | 2,5 MΩ     | Principale          |
| Circuit d'alimentation du matériel de Classe II                                                                                                                                                                                                                  | par rapport aux | surfaces accessibles <sup>b</sup> | 5,0 MΩ     | Double ou renforcée |
| <sup>a</sup> Les circuits de commande sont soumis à l'essai avec le circuit auquel ils sont reliés de façon galvanique. Les circuits de commande accessibles séparés de tous les autres circuits sont soumis à l'essai selon les spécifications du constructeur. |                 |                                   |            |                     |
| <sup>b</sup> Pour le mesurage par rapport aux surfaces accessibles non conductrices, ces surfaces doivent être considérées comme étant recouvertes d'une feuille métallique.                                                                                     |                 |                                   |            |                     |

Tout circuit de commande ou circuit auxiliaire relié à la borne du conducteur de protection doit, pour cet essai, être considéré comme une partie conductrice accessible.

*La conformité doit être vérifiée par mesurage stabilisé de la résistance d'isolement par application d'une tension continue égale à 500 V, à la température ambiante.*

Pendant le mesurage, les torches doivent être déconnectées, les composants électroniques à semiconducteurs et leurs dispositifs de protection peuvent être court-circuités et les unités de refroidissement par liquide doivent être soumises aux essais sans liquide.

#### 6.1.5 Rigidité diélectrique

L'isolation doit supporter les tensions d'essai suivantes sans contournement ni claquage:

- premier essai d'une source de courant de soudage: tensions d'essai indiquées au Tableau 4;
- répétition de l'essai sur la même source de courant de soudage: tension d'essai égale à 80 % des valeurs indiquées au Tableau 4.

**Tableau 4 – Tensions d'essai diélectrique**

| Tension assignée maximale <sup>a</sup><br>V eff. | Tension alternative d'essai diélectrique<br>V eff.                                                                                                      |                       |                                                                                        |                                                          |
|--------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------|----------------------------------------------------------------------------------------|----------------------------------------------------------|
|                                                  | Entre tous les circuits et les parties conductrices accessibles, entre le circuit d'alimentation et tous les autres circuits sauf le circuit de soudage |                       | Entre tous les circuits, sauf entre le circuit d'alimentation et le circuit de soudage | Entre le circuit d'alimentation et le circuit de soudage |
|                                                  | Matériel de classe I                                                                                                                                    | Matériel de classe II |                                                                                        |                                                          |
| Jusqu'à 50                                       | 500                                                                                                                                                     | 1 000                 | 500                                                                                    | 1 000                                                    |
| 220                                              | 1 100                                                                                                                                                   | 2 200                 | 1 100                                                                                  | 2 200                                                    |
| 450                                              | 1 875                                                                                                                                                   | 3 750                 | 1 875                                                                                  | 3 750                                                    |
| 700                                              | 2 500                                                                                                                                                   | 5 000                 | 2 500                                                                                  | 5 000                                                    |
| 1 000                                            | 2 750                                                                                                                                                   | 5 500                 | 2 750                                                                                  | 5 500                                                    |

NOTE 1 La tension assignée maximale est valable pour les systèmes mis à la terre ou non.

NOTE 2 L'essai de rigidité diélectrique des circuits de commande est limité dans le présent document à tous les circuits qui entrent ou sortent de l'enveloppe, autres que le circuit d'alimentation et le circuit de soudage.

<sup>a</sup> Pour les valeurs intermédiaires, l'interpolation est permise sur tous les réseaux d'alimentation (circuit d'alimentation) fonctionnant en dehors de la plage comprise entre 220 V et 450 V et sur tous les systèmes triphasés à trois fils reliés à la terre sans exemption de tension (voir l'Annexe A).

<sup>b</sup> Pour les valeurs intermédiaires, l'interpolation est permise sur les circuits de soudage et de commande.

La tension d'essai en courant alternatif doit être de forme sensiblement sinusoïdale avec une valeur de crête ne dépassant pas 1,45 fois la valeur efficace, et d'une fréquence d'environ 50 Hz ou 60 Hz.

Le réglage maximal admissible du courant de déclenchement doit être 100 mA. Le transformateur haute tension doit délivrer la tension spécifiée jusqu'au courant de déclenchement. Un déclenchement est considéré comme un contournement ou un claquage.

NOTE Pour la sécurité de l'opérateur, le réglage le plus faible possible du courant de déclenchement (inférieur ou égal à 10 mA) est généralement utilisé.

**Essai en variante:** Une tension d'essai en courant continu égale à 1,4 fois la tension d'essai efficace peut être utilisée.

Les composants ou sous-ensembles ne doivent pas être déconnectés ou court-circuités sauf si les conditions de a), b) ou c) ci-dessous sont remplies:

- Les composants ou sous-ensembles sont conçus et soumis à l'essai conformément aux normes appropriées qui spécifient une tension plus faible que le niveau de tension d'essai du présent document. Ces composants ou sous-ensembles ne sont pas connectés entre le circuit d'alimentation et le **circuit de soudage** et leur déconnexion ou mise en court-circuit n'empêche pas de soumettre à l'essai une partie du circuit. Exemples: moteurs de ventilateurs et moteurs de pompes.
- Les composants ou sous-ensembles sont complètement incorporés soit dans le circuit d'alimentation soit dans le **circuit de soudage** et leur déconnexion n'empêche pas de soumettre à l'essai une partie du circuit. Exemple: circuits électroniques.
- Les circuits destinés à éliminer les parasites ou les condensateurs destinés à la protection entre le circuit d'alimentation ou le **circuit de soudage** et toutes les parties conductrices accessibles qui sont conformes aux normes appropriées.

Les **circuits de commande** connectés à une borne conductrice de protection ne doivent pas être déconnectés pendant l'essai et ils sont alors soumis à l'essai comme des parties conductrices accessibles.

À la discrétion du constructeur, la tension d'essai peut être portée lentement à sa pleine valeur.

Les tensions d'essai entre le **circuit d'alimentation**, les parties conductrices accessibles et le **circuit de soudage** peuvent être appliquées simultanément. Un exemple est donné à l'Annexe B.

Les groupes électrogènes de soudage doivent être soumis au même essai.

*La conformité doit être vérifiée par application de la tension d'essai pendant*

- a) 60 s (**essai de type**);
- b) 5 s (**essai individuel de série**);
- ou
- c) 1 s (**essai individuel de série avec tension d'essai augmentée de 20 %**).

## **6.2 Protection contre les chocs électriques en service normal (contact direct)**

### **6.2.1 Degré de protection procuré par l'enveloppe**

Les sources de courant de soudage conçues spécifiquement pour un usage à l'intérieur doivent avoir un degré de protection minimal de IP21S en utilisant les conditions et procédures d'essai de l'IEC 60529.

Les sources de courant de soudage conçues spécifiquement pour un usage à l'extérieur doivent avoir un degré de protection minimal de IP23S en utilisant les conditions et procédures d'essai de l'IEC 60529.

Les sources de courant de soudage avec un degré de protection IP23S peuvent être stockées à l'extérieur mais ne sont pas prévues pour y être utilisées sans protection pendant des précipitations.

Un drainage approprié doit être assuré par l'enveloppe. Si de l'eau est retenue, elle ne doit pas empêcher le fonctionnement correct du matériel ou compromettre la sécurité. La quantité d'eau qui peut pénétrer dans l'enveloppe n'est pas limitée.

Les dispositifs de connexion au **circuit de soudage** doivent être protégés comme cela est spécifié au 11.4.1.

Les **commandes à distance** destinées aux sources de courant de soudage doivent avoir un degré de protection minimal de IP2X en utilisant les conditions et procédures d'essai de l'IEC 60529.

*La conformité doit être vérifiée par l'essai suivant:*

Une source de courant de soudage doit être soumise à l'essai à l'eau approprié sans être alimentée. Immédiatement après l'essai, la source de courant de soudage doit être placée dans un environnement sûr et soumise à l'essai de résistance d'isolement indiqué en 5.4 g) et à l'essai de rigidité diélectrique indiqué en 5.4 h).

### **6.2.2 Condensateurs**

Un condensateur fourni comme partie d'une source de courant de soudage et connecté aux bornes du **circuit d'alimentation** ou de l'enroulement d'un transformateur fournissant le **courant de soudage** doit

- a) ne pas contenir plus de 1 l de liquide inflammable;

- b) être conçu pour ne pas fuir en service normal;
- c) être contenu à l'intérieur de l'enveloppe de la source de courant de soudage ou dans une enveloppe qui satisfait aux exigences applicables du présent document.

*La conformité doit être vérifiée par **examen visuel**.*

Les condensateurs ne doivent pas soumettre la source de courant de soudage à des dangers électriques ou d'incendie en cas de défaillance.

*La conformité doit être vérifiée par l'essai suivant:*

La source de courant de soudage est mise en fonctionnement à sa **tension assignée d'alimentation**, à vide avec un fusible ou disjoncteur d'alimentation de calibre au maximum égal à 200 % du **courant d'alimentation assigné maximal**, avec tous les condensateurs ou un des condensateurs court-circuités jusqu'à:

- 1) fusion d'un fusible ou déclenchement du dispositif contre les surintensités dans la source de courant de soudage; ou
- 2) fusion du fusible du **circuit d'alimentation** ou déclenchement du disjoncteur; ou
- 3) obtention, sur les composants du **circuit d'alimentation** de la source de courant de soudage, de températures constantes inférieures ou égales à celles permises en 7.3.

Si un échauffement anormal ou un ramollissement apparaît, la source de courant de soudage doit satisfaire aux exigences des points a), c) et d) du 9.1.

Il ne doit pas y avoir de fuite de liquide au cours des **essais de type** exigés par le présent document.

Pour les condensateurs d'antiparasitage ou les condensateurs ayant un fusible intégré ou un disjoncteur, cet essai n'est pas exigé.

### **6.2.3 Décharge automatique des condensateurs sur le circuit d'alimentation**

Chaque condensateur doit être équipé d'un moyen de décharge automatique qui doit réduire la tension aux bornes du condensateur à une valeur inférieure ou égale à 60 V dans le temps nécessaire pour donner accès à toute partie conductrice connectée au condensateur ou une étiquette d'avertissement appropriée doit être utilisée. Pour toute fiche de prise de courant mise sous tension par l'intermédiaire d'un condensateur, le temps d'accès est considéré comme étant de 1 s.

Les condensateurs de capacité assignée inférieure ou égale à 0,1  $\mu\text{F}$  ne sont pas considérés comme entraînant un risque de choc électrique.

*La conformité doit être vérifiée par **examen visuel** et par l'essai suivant.*

La source de courant de soudage est mise en fonctionnement sous la **tension assignée d'alimentation** la plus élevée. La source de courant de soudage est alors déconnectée du réseau d'alimentation et les tensions sont mesurées au moyen d'instruments n'ayant pas d'influence notable sur les valeurs à mesurer.

### **6.2.4 Isolation du circuit de soudage**

Le **circuit de soudage** doit être électriquement séparé du **circuit d'alimentation** et de tous les autres circuits ayant une tension supérieure à la **tension à vide** admissible conformément au 11.1.1 (**circuits d'alimentation** auxiliaires, par exemple) par une **double isolation** ou une isolation renforcée ou par des moyens équivalents satisfaisant aux exigences du 6.1. Si un

autre circuit est connecté au **circuit de soudage**, la puissance de l'autre circuit doit être fournie par l'intermédiaire d'un transformateur de séparation ou par un dispositif équivalent.

Le **circuit de soudage** ne doit pas être connecté, à l'intérieur de la source de courant de soudage, aux moyens de connexion du conducteur de protection externe, à l'enveloppe, au châssis ou au noyau magnétique de la source de courant de soudage sauf, si nécessaire, par l'intermédiaire d'un condensateur d'antiparasitage ou de protection.

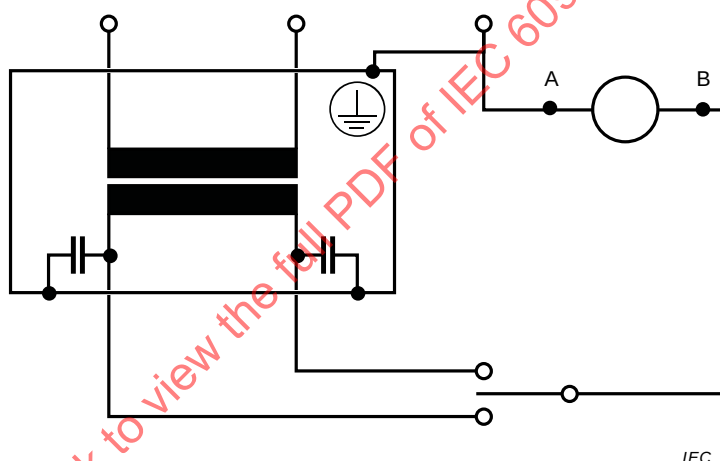
La conformité doit être vérifiée par les essais indiqués au 6.1.

#### 6.2.5 Courant de contact d'un circuit de soudage

Le **courant de contact** entre les connexions du **circuit de soudage** et la borne du conducteur de protection ne doit pas dépasser une valeur de crête de 14,1 mA.

La conformité doit être vérifiée par **examen visuel** et par mesure du **courant de contact** sur un circuit tel qu'indiqué en Figure 2 à la/aux **tension(s) d'alimentation assignée(s)** et en condition à vide.

Le réseau de mesure spécifié à la Figure N.1 doit être raccordé comme cela est représenté à la Figure 2.



#### Légende

A, B Connexions du réseau de mesure

NOTE Pour le matériel de classe II, utiliser la borne PE du réseau d'alimentation relié à la terre.

Figure 2 – Mesurage du courant de contact d'un circuit de soudage

#### 6.2.6 Courant de contact en condition normale

Le **courant de contact** pour les surfaces conductrices accessibles, non raccordées au **circuit de protection**, ne doit pas dépasser la valeur de crête de 0,7 mA en conditions normales.

La conformité doit être vérifiée par mesure du **courant de contact** avec un circuit tel que représenté à la Figure 3, sans simulation de défaut et dans les conditions suivantes:

- a) la source de courant de soudage est:
  - isolée du plan de masse;
  - alimentée par la **tension assignée d'alimentation** la plus élevée;
- b) le **circuit de soudage** est placé en condition à vide;

c) les condensateurs d'antiparasitage ne sont pas déconnectés.

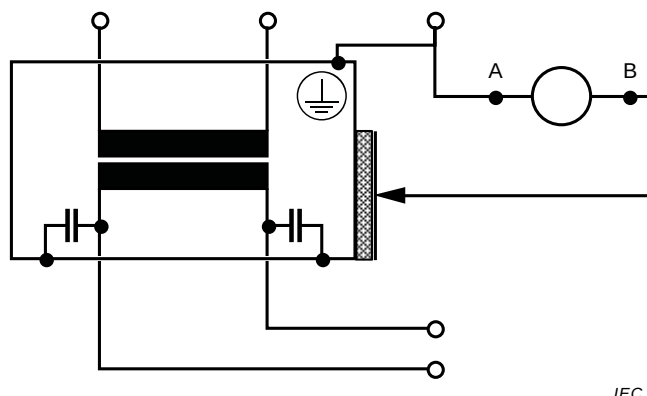


Figure 3 – Mesurage du courant de contact en condition normale

### 6.3 Protection contre les chocs électriques en cas de défaut (contacts indirects)

#### 6.3.1 Mesures de protection

Les sources de courant de soudage doivent être un **matériel de classe I** ou **de classe II**, conformément à l'IEC 61140, à l'exception du **circuit de soudage**.

#### 6.3.2 Isolation entre les enroulements du circuit d'alimentation et le circuit de soudage

Les enroulements du **circuit d'alimentation** et du **circuit de soudage** doivent être isolés au moyen

- a) d'une **double isolation** ou d'une isolation renforcée  
ou
- b) d'une **isolation principale** par rapport à un écran métallique situé entre eux et raccordé au conducteur de protection.

Entre les enroulements du **circuit d'alimentation** et du **circuit de soudage**, il doit y avoir une isolation conforme aux valeurs données dans le Tableau 5. En variante, d'autres moyens spécifiés dans l'IEC 61558-1 peuvent être utilisés, à condition que toutes les exigences de l'IEC 61558-1 soient satisfaites.

Tableau 5 – Distance minimale à travers l'isolation

| Tension assignée d'alimentation<br>V eff. | Distance minimale à travers l'isolation<br>mm |                                            |
|-------------------------------------------|-----------------------------------------------|--------------------------------------------|
|                                           | Une seule couche                              | Total de trois couches<br>séparées ou plus |
| Jusqu'à 440                               | 1,3                                           | 0,35                                       |
| 441 à 690                                 | 1,5                                           | 0,4                                        |
| 691 à 1 000                               | 2,0                                           | 0,5                                        |

Lorsqu'il y a un écran métallique entre les enroulements, l'épaisseur de l'isolation entre chaque enroulement et l'écran doit être au moins égale à la moitié des valeurs données dans le Tableau 5.

La conformité doit être vérifiée par **examen visuel** et par **mesurage**.



### 6.3.3 Conducteurs et connexions internes

Les conducteurs et connexions internes doivent être fixés ou placés de façon à éviter un desserrage accidentel qui pourrait entraîner des contacts électriques entre

- a) le **circuit d'alimentation** ou tout autre circuit et le **circuit de soudage** de sorte que la tension de sortie pourrait devenir plus élevée que la **tension à vide** admissible;
- b) le conducteur de protection, l'enveloppe, le châssis ou le circuit magnétique et le **circuit de soudage**.

Lorsque les conducteurs isolés traversent des parties métalliques, des manchons en matériau isolant doivent être prévus ou bien les arêtes des ouvertures doivent être usinées avec un rayon d'au moins 1,5 mm.

Les conducteurs nus doivent être fixés de sorte que les **distances d'isolement dans l'air et lignes de fuite** entre eux et par rapport aux parties conductrices soient maintenues (voir 6.1.2 et 6.3.2).

Les conducteurs de différents circuits peuvent être positionnés côte à côte, peuvent occuper le même conduit (par exemple la même canalisation, le même système de câblage), ou peuvent être dans les mêmes câbles multiconducteurs à condition que la disposition ne compromette pas le bon fonctionnement des circuits respectifs. Quand de tels circuits fonctionnent à des tensions différentes, les conducteurs doivent être séparés par des barrières appropriées ou doivent être isolés en fonction de la plus forte tension à laquelle chacun des conducteurs du même conduit peut être soumis.

*La conformité doit être vérifiée par **examen visuel** et par mesurage.*

### 6.3.4 Exigences supplémentaires pour les systèmes de coupage par plasma

La torche de coupage par plasma, les pièces (par exemple, les pièces généralement remplacées en raison de l'usure) ainsi que la **source de courant électrique de coupage par plasma**, recommandées par le constructeur, doivent former un système sûr.

Les tuyères qui, pour des raisons techniques, ne peuvent pas être protégées contre les contacts directs, doivent être considérées comme étant suffisamment protégées en utilisation normale ou en **cas de défaut simple**, lorsqu'elles répondent aux exigences suivantes:

- a) en l'absence du courant d'alimentation de l'arc:
  - la tension entre la tuyère et la pièce mise en œuvre et/ou la terre ne dépasse pas les valeurs données en 11.1.1,
  - ou
  - la **source de courant électrique de coupage par plasma** est équipée d'un **système réducteur de risques** conformément à l'Article 13,
- et
- b) pour les systèmes manuels, en présence du courant d'alimentation de l'arc:
  - les côtés de la tuyère ne peuvent pas être touchés par le doigt d'essai normalisé conforme à l'IEC 60529 quand elle est placée sur une surface plane avec sa ligne d'axe qui lui est perpendiculaire,
  - ou
  - la **tension continue en charge** entre la tuyère et la pièce mise en œuvre et/ou la terre ne dépasse pas les valeurs données en 11.1.1.

NOTE Un défaut simple est une condition anormale résultant d'une électrode en contact avec la tuyère due à l'absence de canons isolants, au collage de la tuyère avec l'électrode, à un élément conducteur entre la tuyère et l'électrode, à des pièces inadaptées, à des pièces desserrées, à l'abrasion de l'électrode, à des pièces mal positionnées, à une charge excessive ou à un débit de gaz incorrect.

*La conformité doit être vérifiée conformément à 11.1 et par simulation d'un défaut de torche et par essai conformément à l'Article 13. La torche doit être soumise à l'essai conformément à l'IEC 60974-7.*

### 6.3.5 Noyaux et bobines mobiles

Si des noyaux ou bobines mobiles sont utilisés pour le réglage du **courant de soudage**, la construction doit être telle que les **distances d'isolement dans l'air** et les **lignes de fuite** exigées soient maintenues, en tenant compte des contraintes électriques et mécaniques.

*La conformité doit être vérifiée en faisant fonctionner 500 fois le mécanisme, sur la totalité de sa course, de la position minimale à la position maximale, à la cadence spécifiée par le constructeur et par **examen visuel**.*

### 6.3.6 Courant de contact en cas de défaut

Pour le matériel de classe I, le **courant de contact** pondéré en cas de défaillance ou de déconnexion d'un conducteur de protection externe ne doit pas dépasser une valeur de crête de 14,1 mA à l'exception des matériels destinés à être raccordés de façon permanente avec un conducteur de protection renforcé conformément à l'IEC 61140.

Les matériels destinés à être raccordés de façon permanente avec un conducteur de protection renforcé peuvent avoir un courant de fuite pouvant atteindre 5 % du **courant assigné d'alimentation** par phase.

*La conformité doit être vérifiée en utilisant les configurations présentées dans l'Annexe N dans les conditions suivantes:*

- 1) la source de courant de soudage est:
  - isolée du plan de masse;
  - alimentée par la plus haute **tension assignée d'alimentation**;
  - non raccordée à la terre de protection sauf à travers les équipements de mesure;
- 2) le **circuit de soudage** est en condition à vide;
- 3) les condensateurs d'antiparasitage ne doivent pas être déconnectés.

## 7 Exigences thermiques

### 7.1 Essai d'échauffement

#### 7.1.1 Conditions d'essai

Lors de la mise en place des dispositifs de mesure, les seuls accès autorisés doivent être les ouvertures équipées de couvercles, portes de visite ou panneaux aisément amovibles prévus par le constructeur. La ventilation dans la zone d'essai et les dispositifs de mesure utilisés ne doivent pas interférer avec la ventilation normale de la source de courant de soudage ni provoquer des échanges anormaux de chaleur dans un sens ou dans l'autre.

La source de courant de soudage est mise en fonctionnement à la **tension assignée d'alimentation** avec un courant constant, à un cycle de  $(10 \pm 0,2)$  min:

- a) avec le **courant de soudage** assigné ( $I_2$ ) égal à 60 % et/ou à 100 % du **facteur de marche** selon le cas;
- b) avec le **courant de soudage assigné maximal** ( $I_{2max}$ ) et le **facteur de marche** correspondant.

S'il est connu que ni a) ni b) ne donnent l'échauffement maximal, un essai doit alors être effectué au réglage de la plage assignée qui donne l'échauffement maximal.

Dans le cas d'une source de courant de soudage prévue pour soudage à l'arc en atmosphère inerte avec électrode de tungstène en courant alternatif, un déséquilibre de charge pourrait provoquer un échauffement maximal. Dans ce cas, un essai doit être effectué comme indiqué à l'Annexe C.

La condition de température ambiante du 5.1 doit être remplie.

NOTE 1 Il est possible que l'échauffement maximal soit obtenu au cours de la marche à vide.

NOTE 2 S'il y a lieu, les essais peuvent être effectués les uns après les autres sans que la source de courant de soudage ne revienne à la température de l'air ambiant.

### 7.1.2 Tolérances des paramètres d'essai

Pendant les 60 dernières minutes de l'essai d'échauffement, conformément à 7.1.3, les tolérances suivantes doivent être satisfaites:

- a) **tension en charge:**  $\begin{matrix} +10 \\ -2 \end{matrix}$  % de la **tension conventionnelle en charge** appropriée;
- b) **courant de soudage:**  $\begin{matrix} +10 \\ -2 \end{matrix}$  % du **courant de soudage conventionnel** approprié;
- c) **tension d'alimentation:**  $\pm 5$  % de la **tension assignée d'alimentation** appropriée;
- d) **vitesse du moteur:**  $\pm 5$  % de la vitesse assignée appropriée;
- e) **température:**  $\begin{matrix} +10 \\ -2 \end{matrix}$  K de la température ambiante.

### 7.1.3 Durée de l'essai

L'essai d'échauffement doit se poursuivre jusqu'à ce que la variation de température ne dépasse pas 2 K/h sur tout composant pendant une période au moins égale à 60 min.

## 7.2 Mesurage des températures

### 7.2.1 Conditions de mesure

La température doit être déterminée au milieu de la période de charge du dernier cycle comme suit:

- a) pour les enroulements, par mesurage de la résistance ou par des capteurs de température en surface ou incorporés;

NOTE 1 La méthode par capteurs de température en surface n'est pas privilégiée.

NOTE 2 Dans le cas d'enroulements de faible résistance ayant des contacts de commutation en série, le mesurage des résistances peut donner des résultats erronés.

- b) pour les autres parties, par des capteurs de température en surface.

### 7.2.2 Capteur de température en surface

La température est mesurée au moyen d'un capteur de température appliqué sur les surfaces accessibles des enroulements ou d'autres parties, conformément aux conditions stipulées ci-après.

NOTE 1 Les capteurs de température typiques sont par exemple des thermocouples, des thermomètres à résistance, etc.

Les thermomètres à bulbe ne doivent pas être utilisés pour le mesurage des températures des enroulements et des surfaces.

Les capteurs de température sont placés aux points accessibles où il est vraisemblable que la température sera maximale. Il est souhaitable de localiser les points chauds prévisibles par un examen préliminaire.

NOTE 2 La dimension et l'étendue des points chauds dans les enroulements dépendent de la conception de la source de courant de soudage.

Une transmission efficace de la chaleur doit être assurée entre le point de mesure et le capteur de température, et le capteur de température doit être protégé contre l'effet des courants d'air et des rayonnements.

### 7.2.3 Résistance

L'**échauffement** des enroulements est déterminé par l'accroissement de leur résistance et est obtenu, pour le cuivre, par la formule suivante:

$$t_2 - t_a = \frac{(235 + t_1)(R_2 - R_1)}{R_1} + (t_1 - t_a)$$

où

$t_1$  est la température de l'enroulement au moment du mesurage de  $R_1$  (°C);

$t_2$  est la température calculée de l'enroulement à la fin de l'essai (°C);

$t_a$  est la température de l'air ambiant à la fin de l'essai (°C);

$R_1$  est la résistance initiale de l'enroulement ( $\Omega$ );

$R_2$  est la résistance de l'enroulement à la fin de l'essai ( $\Omega$ ).

Pour l'aluminium, le nombre 235 dans la formule ci-dessus est remplacé par le nombre 225.

La température  $t_1$  doit être à  $\pm 3$  K de la température de l'air ambiant.

### 7.2.4 Capteur de température incorporé

La température est mesurée au moyen de thermocouples ou d'autres instruments de mesure de température adaptés de dimension comparable incorporés dans les parties les plus chaudes.

Les thermocouples doivent être placés directement sur les enroulements et les bobines. Il n'est pas exigé que toute isolation appliquée intégralement sur les conducteurs eux-mêmes soit enlevée.

Un thermocouple placé au point le plus chaud d'un enroulement monocouche est considéré comme incorporé.

### 7.2.5 Détermination de la température de l'air ambiant

La température de l'air ambiant est déterminée par au moins trois dispositifs de mesure. Ceux-ci sont espacés uniformément autour de la source de courant de soudage, à peu près à sa mi-hauteur et à une distance de 1 m à 2 m de sa surface. Ils sont protégés contre les courants d'air et les échauffements anormaux. La valeur moyenne des lectures de température faites est adoptée comme température de l'air ambiant.

Dans le cas de sources de courant de soudage à ventilation forcée, un seul dispositif de mesure est placé à l'entrée de l'air dans le système de refroidissement. La moyenne des lectures faites à intervalles réguliers pendant le dernier quart de la durée de l'essai est adoptée comme température de l'air ambiant.

## 7.2.6 Enregistrement des températures

Dans la mesure du possible, les températures sont enregistrées pendant que le matériel est en fonctionnement et après coupure. Sur les éléments pour lesquels l'enregistrement des températures n'est pas possible pendant que le matériel est en fonctionnement, les températures se mesurent après coupure, comme cela est décrit ci-après.

Chaque fois qu'il s'est écoulé, entre le moment de la coupure et le moment de mesure de la température finale, un temps suffisant pour que la température ait baissé, les corrections nécessaires sont apportées, de façon à obtenir une température aussi proche que possible de celle du moment de la coupure. Cela peut être fait en relevant une courbe conformément à l'Annexe D. Un minimum de quatre lectures de températures est fait dans un délai de 5 min après la coupure. Dans le cas où les mesurages successifs font apparaître une élévation de température après coupure, la valeur la plus élevée est retenue.

Pour maintenir la température pendant la période d'arrêt, des précautions doivent être prises pour raccourcir la période d'arrêt d'un groupe électrogène de soudage.

## 7.3 Limites d'échauffement

### 7.3.1 Enroulements, collecteurs et bagues collectrices

L'**échauffement** des enroulements, collecteurs et bagues collectrices ne doit pas dépasser les valeurs données au Tableau 6, quelle que soit la méthode de mesure des températures utilisée.

**Tableau 6 – Limites de température pour les enroulements, collecteurs et bagues collectrices**

| Classe<br>d'isolation | Température<br>Maximale | Échauffement maximal<br>K               |            |                                        |                                          |
|-----------------------|-------------------------|-----------------------------------------|------------|----------------------------------------|------------------------------------------|
|                       |                         | Enroulements                            |            |                                        | Collecteurs<br>et bagues<br>collectrices |
|                       |                         | Capteur de<br>température<br>de surface | Résistance | Capteur de<br>température<br>incorporé |                                          |
| °C                    | °C                      |                                         |            |                                        |                                          |
| 105 (A)               | 150                     | 55                                      | 60         | 65                                     | 60                                       |
| 120 (E)               | 165                     | 70                                      | 75         | 80                                     | 70                                       |
| 130 (B)               | 175                     | 75                                      | 80         | 90                                     | 80                                       |
| 155 (F)               | 190                     | 95                                      | 105        | 115                                    | 90                                       |
| 180 (H)               | 210                     | 115                                     | 125        | 140                                    | 100                                      |
| 200 (N)               | 230                     | 130                                     | 145        | 160                                    | Non déterminée                           |
| 220 (R)               | 250                     | 150                                     | 160        | 180                                    |                                          |

NOTE 1 Capteur de température de surface signifie que la température est mesurée au moyen de capteurs non incorporés au point le plus chaud accessible à la surface extérieure des enroulements.

NOTE 2 Normalement, la température à la surface est la plus faible. La méthode de résistance donne la valeur moyenne de toutes les températures apparaissant dans un enroulement. La température la plus élevée apparaissant dans les enroulements (point chaud) peut être mesurée au moyen de capteurs de température incorporés.

NOTE 3 D'autres classes d'isolation ayant des températures limites plus élevées que celles indiquées dans le Tableau 6 existent (voir IEC 60085).

Aucune partie ne doit atteindre une température qui provoquerait un dommage sur une autre partie, même si cette partie peut être conforme aux exigences du Tableau 6.

De plus, pour les essais avec un **facteur de marche** autre que 100 %, la température atteinte pendant tout cycle complet ne doit pas dépasser les températures maximales données au Tableau 6.

*La conformité doit être vérifiée par mesurage, conformément à 7.2.*

### 7.3.2 Surfaces externes

L'**échauffement** des surfaces externes ne doit pas dépasser les valeurs données au Tableau 7. Les limites d'**échauffement** sont données pour:

- une période de contact non intentionnel de 1 s pour les enveloppes,
- une période de contact de 4 s pour les boutons et
- une période de contact de 60 s pour les poignées.

**Tableau 7 – Limites de température des surfaces externes**

| Surface externe                                              | Échauffement maximal<br>K | Seuil de combustion pour la<br>période de contact <sup>a</sup><br>s |
|--------------------------------------------------------------|---------------------------|---------------------------------------------------------------------|
| Enveloppes métalliques non revêtues                          | 25                        | 1                                                                   |
| Enveloppes métalliques peintes                               | 35                        | 1                                                                   |
| Enveloppes en plastique                                      | 45                        | 1                                                                   |
| Boutons métalliques non revêtus                              | 18                        | 4                                                                   |
| Boutons métalliques peints                                   | 22                        | 4                                                                   |
| Boutons en plastique                                         | 35                        | 4                                                                   |
| Poignées métalliques                                         | 10                        | 60                                                                  |
| Poignées en plastique                                        | 20                        | 60                                                                  |
| <sup>a</sup> Valeurs informatives conformes à l'ISO 13732-1. |                           |                                                                     |

Pour les groupes électrogènes de soudage, les limites du Tableau 7 peuvent être dépassées pour les surfaces qui sont:

- a) reconnaissables par leur aspect ou leur fonction; ou
- b) marquées avec le symbole IEC 60417-5041:2002-10; ou
- c) situées ou protégées afin de prévenir un contact non intentionnel pendant un fonctionnement normal.

NOTE Les surfaces reconnaissables par leur aspect ou leur fonction incluent des éléments tels que les échappements, silencieux, pare-étincelles ou têtes de cylindre.

*La conformité doit être vérifiée par mesurage conformément à 7.2 et par **examen visuel**.*

### 7.3.3 Autres composants

La température maximale des autres composants ne doit pas dépasser leur température maximale assignée conformément à la norme appropriée.

## 7.4 Essai en charge

Les sources de courant de soudage doivent supporter des cycles de charge répétés sans dommage ou défaillance de fonctionnement. Cet essai peut être effectué sur toute source de courant de soudage qui fonctionne correctement.

*La conformité doit être vérifiée par les essais suivants et en s'assurant qu'aucun dommage ni défaillance de fonctionnement de la source de courant de soudage ne surviennent pendant les essais.*

La source de courant de soudage est chargée, en partant de l'état froid, au **courant de soudage assigné maximal** jusqu'à ce qu'un des phénomènes suivants se produise:

- a) la **protection thermique** fonctionne;
- b) la limite maximale de température des enroulements soit atteinte;
- c) une période de 10 min soit écoulée.

Immédiatement après le réenclenchement de la **protection thermique** dans le cas a), ou après les cas b) ou c), l'un des essais suivants est effectué.

- 1) Dans le cas d'une source de courant de soudage à **caractéristique tombante**, les commandes sont réglées pour fournir le **courant de soudage assigné maximal**. Elle est alors soumise 60 fois à un cycle comprenant un court-circuit de résistance externe comprise entre 8 mΩ et 10 mΩ et d'une durée de 2 s, suivi d'une marche à vide de 3 s.
- 2) Dans le cas d'une source de courant de soudage à **caractéristique plate**, la source est chargée une fois pendant 15 s par un courant égal à 1,5 fois le **courant de soudage assigné maximal** à la **tension en charge** maximale disponible. Si la source de courant de soudage est équipée d'un dispositif de protection qui limite le **courant de soudage** à une valeur inférieure à 1,5 fois le **courant de soudage assigné maximal**, l'essai est effectué au **courant maximal de soudage** pouvant être obtenu à la **tension en charge** correspondante.

Immédiatement après la réalisation de l'essai 1) ou 2), tandis que le matériel est encore chaud, celui-ci doit être vérifié conformément à 6.1.5.

## 7.5 Collecteurs et bagues collectrices

Les collecteurs, bagues collectrices et leurs balais ne doivent pas laisser apparaître de traces d'étincelles nuisibles ou de dommages, sur toute la plage de réglages du groupe électrogène de soudage.

*La conformité doit être vérifiée par **examen visuel** au cours*

- a) *de l'essai d'échauffement, conformément à 7.1*  
*et*
- b) *de l'essai de charge, conformément au point 1) ou 2) de 7.4.*

## 8 Protection thermique

### 8.1 Exigences générales

Une source de courant de soudage alimentée par le réseau électrique doit être équipée d'une **protection thermique** si le **facteur de marche** au **courant de soudage assigné maximal** est inférieur à

- a) 35 % dans le cas d'une **caractéristique tombante**  
*ou*
- b) 60 % dans le cas d'une **caractéristique plate**.

NOTE Une **caractéristique tombante** est généralement utilisée pour le soudage manuel à l'arc et pour le soudage à l'arc en atmosphère inerte avec électrode de tungstène, alors que la **caractéristique plate** est généralement utilisée pour le soudage à l'arc sous protection de gaz inerte ou actif.



Si la source de courant de soudage est équipée d'une **protection thermique**, la **protection thermique** doit satisfaire aux exigences de 8.2 à 8.7.

*La conformité doit être vérifiée par **examen visuel**.*

## 8.2 Construction

La **protection thermique** doit être conçue de façon à empêcher toute modification du réglage de la température ou du fonctionnement.

*La conformité doit être vérifiée par **examen visuel**.*

## 8.3 Emplacement

La **protection thermique** doit être située de façon permanente à l'intérieur de la source de courant de soudage pour assurer que le transfert de chaleur soit sûr.

*La conformité doit être vérifiée par **examen visuel**.*

## 8.4 Capacité de fonctionnement

La **protection thermique** doit pouvoir fonctionner lorsque la source de courant de soudage débite son **courant de soudage assigné maximal**:

- a) 100 fois dans le cas d'un **facteur de marche** supérieur ou égal à 35 %  
ou
- b) 200 fois dans le cas d'un **facteur de marche** inférieur à 35 %.

*La conformité doit être vérifiée avec une surcharge appropriée en provoquant le nombre exigé d'interruptions successives sur un circuit ayant les mêmes caractéristiques électriques, en particulier courant et réactance, que le circuit dans lequel la **protection thermique** est utilisée.*

Après cet essai, les exigences de 8.5 et 8.6 doivent être satisfaites.

## 8.5 Fonctionnement

La **protection thermique** doit fonctionner pour empêcher la température des enroulements de la source de courant de soudage de dépasser les limites de températures maximales indiquées au Tableau 6.

La **protection thermique** ne doit pas fonctionner lorsque la source de courant de soudage est chargée avec le **courant de soudage assigné maximal** au **facteur de marche** assigné correspondant indiqué sur la **plaque signalétique**.

*La conformité doit être vérifiée pendant le fonctionnement conformément à 7.1, au **courant de soudage assigné maximal**, à la température ambiante de 5.1 et sans fonctionnement de la **protection thermique**. Après cela, la source de courant de soudage est surchargée conformément à 9.4. De plus, si la condition de température de 5.1 ne provoque pas l'échauffement maximal des enroulements, l'essai doit être effectué à une température ambiante qui donne l'échauffement maximal des enroulements.*

## 8.6 Réenclenchement

La **protection thermique** ne doit pas se réenclencher, automatiquement ou manuellement, tant que la température n'est pas redescendue en dessous de celle de la **classe d'isolation** indiquée au Tableau 6.



*La conformité doit être vérifiée par des essais de fonctionnement et des mesurages de température.*

## 8.7 Indication

Les sources de courant de soudage équipées d'une **protection thermique** doivent indiquer que la **protection thermique** a réduit ou déconnecté la sortie de la source de courant de soudage. Lorsque la **protection thermique** est à réenclenchement automatique, l'indicateur doit être soit une lampe de signalisation jaune (ou un indicateur jaune placé dans une fenêtre) soit un affichage alphanumérique indiquant des symboles ou des termes dont la signification est donnée dans le manuel d'instructions.

*La conformité doit être vérifiée par **examen visuel**.*

## 9 Fonctionnement anormal

### 9.1 Exigences générales

Une source de courant de soudage ne doit pas subir de claquage ni accroître le risque de choc électrique ou d'incendie, dans les conditions de fonctionnement de 9.2 à 9.4. Ces essais sont effectués sans tenir compte de la température atteinte sur toutes les parties, ni du fonctionnement correct constant de la source de courant de soudage. Le seul critère est que la source de courant de soudage ne devienne pas dangereuse. Ces essais peuvent être effectués sur toute source de courant de soudage fonctionnant correctement.

Les sources de courant de soudage protégées à l'intérieur par exemple par un disjoncteur ou une **protection thermique** satisfont à cette exigence si le dispositif de protection fonctionne avant qu'une condition dangereuse ne survienne.

*La conformité doit être vérifiée par les essais suivants:*

- Une couche de coton chirurgical absorbant sec est placée sous la source de courant de soudage et étendue à 150 mm au-delà de chaque côté.
- La source de courant de soudage est mise en fonctionnement, en partant de l'état froid, selon 9.2 à 9.4.
- Pendant l'essai, la source de courant de soudage ne doit pas émettre de flammes, de métal fondu ou d'autres matériaux qui enflamment l'indicateur en coton.
- Après l'essai et dans les 5 min qui suivent, la source de courant de soudage doit être capable de supporter un essai de rigidité diélectrique conformément au 6.1.5 b).

### 9.2 Essai de ventilateur bloqué

Une source de courant de soudage qui dépend d'un ou plusieurs ventilateurs à moteur pour la conformité aux essais de l'Article 7, est mise en fonctionnement sous la **tension assignée d'alimentation** ou la **vitesse assignée en charge** pendant une durée de 4 h au cours de laquelle le ou les ventilateurs sont bloqués ou mis hors service, et la source de courant de soudage mise en fonctionnement dans les conditions de sortie de 7.1.

NOTE Le but de cet essai est de faire fonctionner la source de courant de soudage avec le ventilateur fixe pour vérifier à la fois la sécurité du ventilateur et de la source de courant de soudage.

### 9.3 Essai de courant de court-circuit

La source de courant de soudage est court-circuitée par la torche et les câbles de soudage normalement fournis par le constructeur ou, s'ils ne sont pas fournis, par un conducteur de 1,2 m de long et de la section donnée dans le Tableau 8.

NOTE Les sections pour les systèmes non SI sont données dans le Tableau F.1.

La source de courant de soudage au réglage de sortie maximal est reliée à la **tension assignée d'alimentation** qui produit le **courant assigné d'alimentation** le plus élevé, au **courant de soudage assigné maximal**. Le **circuit d'alimentation** est protégé par des fusibles extérieurs ou par un disjoncteur de type et calibre spécifiés par le constructeur.

**Tableau 8 – Section du conducteur de court-circuit de sortie**

| Courant de soudage assigné maximal<br>A | Section minimale <sup>a</sup><br>mm <sup>2</sup> |
|-----------------------------------------|--------------------------------------------------|
| Jusqu'à 199                             | 25                                               |
| 200 à 299                               | 35                                               |
| 300 à 499                               | 50                                               |
| 500 et plus                             | 70                                               |
| <sup>a</sup> Voir Annexe F.             |                                                  |

La source de courant de soudage ne doit pas faire fonctionner le fusible ou le disjoncteur lorsqu'elle est court-circuitée:

- a) pendant 15 s dans le cas d'une **caractéristique tombante**;
- b) trois fois pendant 1 s, pendant une période de 1 min, dans le cas d'une **caractéristique plate**.

Le court-circuit est alors appliqué pendant 2 min ou jusqu'au fonctionnement du fusible ou du disjoncteur.

La tension d'alimentation ne doit pas décroître de plus 10 % pendant cet essai.

Les sources de courant de soudage à moteur thermique sont court-circuitées pendant 2 min au réglage de sortie maximal et sont réglées pour fonctionner à la **vitesse assignée en charge**.

#### 9.4 Essai de surcharge

La source de courant de soudage est mise en fonctionnement pendant 4 h conformément à 7.1.1 b) pour 1,5 fois le **facteur de marche** correspondant.

Si la source de courant de soudage a un **facteur de marche** assigné supérieur à 67 %, cet essai est effectué avec un **facteur de marche** de 100 %.

Si la source de courant de soudage est équipée de plots pour régler la sortie, les plots produisant le plus fort courant d'alimentation doivent être utilisés.

Il n'est pas nécessaire de soumettre à l'essai une source de courant de soudage dont le **facteur de marche** au **courant de soudage assigné maximal** est égal à 100 %.

### 10 Raccordement au réseau d'alimentation

#### 10.1 Tension d'alimentation

Les sources de courant de soudage doivent pouvoir fonctionner avec la **tension assignée d'alimentation**  $\pm 10$  %. Cela peut donner des écarts par rapport aux **valeurs assignées**.

*La conformité doit être vérifiée par l'essai suivant:*

La source de courant de soudage est raccordée à une **charge conventionnelle** et réglée à la sortie maximale et minimale. Chaque réglage est soumis à l'essai avec la **tension assignée d'alimentation**  $\pm 10\%$ . Vérifier la présence d'une intensité stable de courant dans le **circuit de soudage** dans ces quatre conditions.

## 10.2 Tension d'alimentation multiple

Les sources de courant de soudage conçues pour fonctionner sous plusieurs tensions d'alimentation doivent comporter une des dispositions suivantes:

- a) un bornier interne sur lequel le réglage de la tension d'alimentation est effectué au moyen de barrettes. Un marquage doit indiquer la disposition des barrettes pour chaque tension d'alimentation;
- b) une boîte ou plaque à bornes interne dans laquelle les tensions d'alimentation sont clairement marquées sur les bornes;
- c) un interrupteur de sélection de prises qui doit être équipé d'un verrouillage évitant de le placer dans une position incorrecte. Le verrouillage ne doit pouvoir être mis en place qu'à l'aide d'un outil;
- d) deux câbles d'alimentation, chacun équipé d'une fiche différente et d'un interrupteur de sélection assurant que les broches de la fiche non utilisée ne puissent être sous tension;
- e) un système pour adapter automatiquement les sources de courant de soudage à la tension d'alimentation.

NOTE Les sources de courant de soudage peuvent être équipées d'une indication externe de la tension d'alimentation choisie.

*La conformité doit être vérifiée par **examen visuel** et par les essais suivants.*

Dans le cas d), un interrupteur de sélection est également soumis à l'essai conformément à 10.8.

## 10.3 Moyens de raccordement au circuit d'alimentation

Les moyens de raccordement au **circuit d'alimentation** acceptables sont:

- a) les bornes prévues pour le raccordement permanent de câbles d'alimentation souples;
- b) les bornes prévues pour le raccordement de câbles d'alimentation à une installation fixe;
- c) les connecteurs fixes à la source de courant de soudage.

NOTE Cette exigence peut également être remplie en utilisant des bornes sur un dispositif tel qu'un interrupteur, un contacteur, etc.

Les moyens de raccordement au **circuit d'alimentation** doivent être choisis conformément au **courant d'alimentation effectif maximal**  $I_{1\text{eff}}$  et à la tension d'alimentation maximale, et ils doivent satisfaire aux exigences des normes concernées ou être conçus conformément à l'Annexe E.

*La conformité doit être vérifiée par **examen visuel**.*

## 10.4 Marquage des bornes

La borne pour le conducteur de protection externe doit être marquée du symbole  (IEC 60417-5019:2006-08).

L'une ou l'autre des options suivantes peut être ajoutée:

- a) les lettres: **PE**

ou

b) la double coloration: **vert et jaune**.

De plus, les bornes des matériels triphasés doivent être clairement marquées conformément à l'IEC 60445 ou à d'autres normes relatives aux composants. Le marquage d'identification doit être placé sur ou à côté de la borne correspondante.

*La conformité doit être vérifiée par **examen visuel**.*

## 10.5 Circuit de protection

### 10.5.1 Exigence de continuité du circuit de protection

Le **circuit de protection** interne doit être capable de supporter les courants susceptibles d'exister en cas de défaut.

Les sources de courant de soudage de **classe I** doivent avoir, à proximité des bornes des conducteurs de phase, une borne appropriée dimensionnée conformément à l'Annexe E et au Tableau E.1 pour le raccordement du conducteur de protection externe. Cette borne ne doit être utilisée à aucune autre fin (par exemple pour fixer ensemble deux éléments de l'enveloppe).

Lorsque, à l'extérieur ou à l'intérieur de la source de courant de soudage, il y a une borne de raccordement du conducteur de neutre, celle-ci ne doit pas être en contact électrique avec la borne pour le raccordement du conducteur de protection.

À l'intérieur comme à l'extérieur de la source de courant de soudage, les conducteurs de protection isolés doivent avoir la double coloration vert/jaune. Si la source de courant de soudage est alimentée par un câble d'alimentation souple à plusieurs conducteurs, le conducteur de protection doit avoir la double coloration vert/jaune.

Dans certains pays, la couleur unique verte est également utilisée pour identifier le conducteur de protection et la borne du conducteur de protection.

Si la source de courant de soudage est équipée d'un conducteur de protection, il doit être connecté de façon telle que si le câble est arraché des bornes, les conducteurs de phase se cassent avant le conducteur de protection.

*La conformité doit être vérifiée par **examen visuel** et par les essais donnés en 10.5.2 et 10.5.3.*

La méthode de fixation des parties conductrices sur les **circuits de protection**, par exemple des rondelles ou vis pénétrant la peinture ou des surfaces non peintes, doit être prise en considération au cours de l'**examen visuel**.

### 10.5.2 Essai de type

Un courant égal à 200 % du **courant d'alimentation effectif maximal**, comme indiqué sur la **plaque signalétique**, est appliqué d'une partie de l'enveloppe susceptible d'être portée sous tension à travers la borne du conducteur de protection externe pendant une période de temps indiquée dans le Tableau 9 en utilisant la plus petite section de conducteurs externes, indiquée dans le Tableau 10.

NOTE La forme d'onde du courant d'essai n'est pas définie tant que la valeur efficace est utilisée pour la comparaison.

**Tableau 9 – Exigences de courant et de temps pour les circuits de protection**

| Courant<br>A | Temps<br>min |
|--------------|--------------|
| Jusqu'à 30   | 2            |
| 31 à 60      | 4            |
| 61 à 100     | 6            |
| 101 à 200    | 8            |
| Plus de 200  | 10           |

**Tableau 10 – Section minimale du conducteur de protection externe en cuivre**

| Section des conducteurs de phase<br>alimentant le matériel<br>$S$<br>$\text{mm}^2$ | Section minimale du conducteur de<br>protection externe en cuivre<br>$S_p$<br>$\text{mm}^2$ |
|------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------|
| $S \leq 16$                                                                        | $S$                                                                                         |
| $16 < S \leq 35$                                                                   | 16                                                                                          |
| $S > 35$                                                                           | $S/2$                                                                                       |

Pendant l'essai, il ne doit y avoir aucune fusion de métal, aucune détérioration de la liaison de la source de courant de soudage ni d'échauffement susceptible de provoquer un incendie, et la chute de tension mesurée à travers la partie de l'enveloppe et la borne ne doit pas dépasser 4 V en valeur efficace.

### 10.5.3 Essai individuel de série

L'essai doit vérifier la continuité du **circuit de protection** en injectant un courant d'au moins 10 A à 50 Hz ou 60 Hz provenant d'une source TBTS. Les essais doivent être effectués entre la borne PE et les points significatifs qui font partie du **circuit de protection**. La durée de l'essai est de 1 s.

La tension mesurée entre la borne PE et les points d'essai ne doit pas dépasser les valeurs données dans le Tableau 11:

**Tableau 11 – Vérification de la continuité du circuit de protection**

| Section minimale effective du<br>conducteur de protection de la boucle<br>en essai<br>$\text{mm}^2$ | Chute de tension maximale mesurée<br>(valeurs données pour un courant<br>d'essai de 10 A)<br>V |
|-----------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------|
| 1,0                                                                                                 | 3,3                                                                                            |
| 1,5                                                                                                 | 2,6                                                                                            |
| 2,5                                                                                                 | 1,9                                                                                            |
| 4,0                                                                                                 | 1,4                                                                                            |
| > 6,0                                                                                               | 1,0                                                                                            |

### 10.6 Serre-câble

Les sources de courant de soudage équipées de bornes pour le raccordement des câbles d'alimentation souples doivent être équipées d'un serre-câble qui protège le raccordement électrique contre les efforts de traction.

Le serre-câble doit être construit de sorte que

- a) il soit dimensionné pour des câbles souples ayant la plage de sections de conducteurs comme cela est spécifié au Tableau E.1;
- b) le mode d'attache puisse être facilement reconnaissable;
- c) le câble puisse être aisément remplacé;
- d) le câble ne puisse entrer en contact avec les vis de serrage conductrices du serre-câble si celles-ci sont accessibles ou en contact électrique avec des parties conductrices accessibles;
- e) le câble ne soit pas retenu par une vis métallique portant directement sur lui;
- f) au moins une partie du serre-câble soit fixée de façon sûre à la source de courant de soudage;
- g) aucune des vis qu'il est nécessaire de desserrer ou resserrer pendant le remplacement du câble ne soit utilisée pour la fixation d'autres parties;
- h) lorsqu'il est fixé sur une source de courant de soudage de **classe II**, il doit être réalisé en matériau isolant ou isolé de sorte que, s'il y a un défaut d'isolation du câble, les parties conductrices accessibles ne doivent pas devenir actives.

La conformité doit être vérifiée par **examen visuel** et par l'essai suivant.

Un câble d'alimentation souple, qui a la section minimale spécifiée du conducteur, est connecté au point de raccordement du matériel. Le serre-câble est fixé au câble et serré.

Il ne doit alors pas être possible de pousser le câble à l'intérieur de la source de courant de soudage au point que le câble lui-même ou des éléments internes de la source de courant de soudage puissent être endommagés.

Le serre-câble est alors desserré et resserré 10 fois.

Le câble est ensuite soumis pendant 1 min à une traction appliquée sans secousse, comme cela est spécifié au Tableau 12.

**Tableau 12 – Traction**

| Section nominale du conducteur<br>mm <sup>2</sup> | Traction<br>N |
|---------------------------------------------------|---------------|
| 1,5                                               | 150           |
| 2,5                                               | 220           |
| 4,0                                               | 330           |
| 6 et plus                                         | 440           |

À la fin de l'essai, le câble ne doit pas s'être déplacé de plus de 2 mm et les extrémités des conducteurs ne doivent pas s'être déplacées de façon perceptible dans les bornes. Afin de mesurer le déplacement, une marque est faite, avant l'essai, sur le câble tendu, à 20 mm du point d'ancrage.

Après l'essai, le déplacement de cette marque par rapport au serre-câble est mesuré, le câble étant soumis à l'effort.

Pendant l'essai, le câble ne doit pas être endommagé de façon visible (entailles, coupures ou déchirures du revêtement, par exemple).

L'essai est alors répété avec la section maximale de conducteur spécifiée.

## 10.7 Entrées de câbles

Lorsque le câble d'alimentation traverse des parties métalliques, il doit être prévu un manchon isolant ou les ouvertures doivent être arrondies avec un rayon d'au moins 1,5 mm.

*La conformité doit être vérifiée par **examen visuel**.*

## 10.8 Dispositif de commutation marche/arrêt sur le circuit d'alimentation

Lorsqu'un dispositif de commutation marche/arrêt intégré sur le **circuit d'alimentation** (par exemple un interrupteur, un contacteur ou un disjoncteur) est fourni, il doit:

- a) déconnecter tous les conducteurs du réseau non mis à la terre, et
- b) indiquer clairement si le circuit est ouvert ou fermé, et  
soit
- c) avoir les caractéristiques assignées suivantes:
  - tension: non inférieure aux valeurs données sur la **plaque signalétique**,
  - courant: non inférieur au courant d'alimentation effectif maximal mentionné sur la **plaque signalétique**,ou
- d) convenir pour cette application.

*La conformité doit être vérifiée par **examen visuel**; pour c) conformément aux autres normes concernées et pour d) par les essais suivants.*

Pour les essais, les dispositifs de commutation marche/arrêt du **circuit d'alimentation** peuvent être installés à l'extérieur de la source de courant.

Une source de courant de soudage est connectée à la **tension assignée d'alimentation** qui correspond au **courant d'alimentation assigné maximal**; en plus, pour un **matériel de classe I**, un fusible de 10 A à 20 A est placé

- dans le cas d'un **circuit d'alimentation** mis à la terre, dans la connexion de la terre de protection;
- dans le cas d'un **circuit d'alimentation** non mis à la terre, entre un conducteur de phase et le **circuit de protection**.

Pendant les essais, la tension d'alimentation doit être maintenue à une valeur au moins égale à la **valeur assignée**.

Surcharge: La sortie de la source de courant de soudage est court-circuitée conformément à 9.3. Le dispositif de commutation est mis en fonctionnement pendant 100 cycles à la cadence de 6 à 10 cycles par minute avec une durée de marche minimale de 1 s.

Il n'est pas nécessaire de soumettre à l'essai un dispositif de commutation si ses caractéristiques assignées dépassent deux fois le **courant d'alimentation assigné maximal** de la source de courant de soudage.

Endurance: La sortie est reliée à une **charge conventionnelle** et réglée pour produire le **courant de soudage** assigné à un **facteur de marche** de 100 %. Le dispositif de commutation est mis en fonctionnement pendant 1 000 cycles à une cadence de 6 à 10 cycles par minute avec une durée de marche minimale de 1 s.

Une source de courant de soudage ayant plus d'une **tension assignée d'alimentation** est aussi soumise à l'essai sous la tension d'alimentation maximale assignée.

Il ne doit y avoir aucune défaillance électrique ou mécanique, et en outre, pour un **matériel de classe I**, aucune fusion du fusible.

NOTE Un composant ayant prouvé sa conformité à ces essais peut être utilisé dans d'autres applications similaires si les autres exigences sont du même niveau ou inférieures.

## 10.9 Câbles d'alimentation

Lorsque les câbles d'alimentation font partie de la source de courant de soudage, ils doivent:

- a) être appropriés pour cette application et satisfaire aux réglementations nationales et locales;
- b) être dimensionnés pour le **courant d'alimentation effectif maximal**  $I_{1\text{eff}}$ ;  
et
- c) avoir une longueur au moins égale à 2 m, mesurée depuis le point de sortie de l'enveloppe.

*La conformité doit être vérifiée par **examen visuel**.*

NOTE Des exemples de réglementations locales sont donnés dans la Bibliographie, par exemple, EN 50525-2-21, Code électrique NFPA 70 (SE, SO, ST, STO ou autres câbles à très haute résistance) ou CSA C22.1. Il a été démontré que l'isolation PVC n'était pas adaptée à cette application.

## 10.10 Dispositif de connexion à l'alimentation (fiche de prise de courant montée)

Si un dispositif de connexion à l'alimentation est fourni comme partie du matériel de soudage à l'arc, ses **valeurs assignées** ne doivent pas être inférieures:

- a) au courant assigné du fusible exigé pour la conformité aux essais spécifiés en 9.3 qu'il y ait ou non un interrupteur du **circuit d'alimentation** incorporé;
- b) au **courant d'alimentation effectif maximal**  $I_{1\text{eff}}$ .

Pour les réseaux d'alimentation jusqu'à 125 V, le courant assigné doit, de plus, ne pas être inférieur soit à c) soit à d):

- c) 70 % du **courant d'alimentation assigné maximal** pour les matériels incorporant un interrupteur d'alimentation;
- d) 70 % du courant d'alimentation mesuré avec la sortie court-circuitée au réglage maximal pour les matériels n'incorporant pas un interrupteur d'alimentation.

De plus, le dispositif de connexion doit être approprié aux besoins industriels.

NOTE L'IEC 60309-1 fournit des exemples de dispositifs de connexion adaptés aux besoins industriels.

*La conformité doit être vérifiée par **examen visuel**, par **mesurage** et par **calcul**.*

## 11 Sortie

### 11.1 Tension à vide assignée

#### 11.1.1 Tension à vide assignée dans le cas d'environnements avec risque accru de choc électrique

Si la source de courant de soudage n'est pas équipée d'un **dispositif réducteur de risques** conformément à l'Article 13, la **tension à vide assignée** ne doit pas dépasser:

- a) une valeur de crête de 113 V en courant continu;
- b) une valeur de crête de 68 V et 48 V en valeur efficace en courant alternatif.

De telles sources de courant de soudage peuvent être marquées S.



*La conformité doit être vérifiée par mesurage et par analyse du circuit et/ou simulation de défaut conformément à 11.1.5.*

#### **11.1.2 Tension à vide assignée dans le cas d'environnements sans risque accru de choc électrique**

Si la source de courant de soudage n'est pas équipée d'un **dispositif réducteur de risques** conformément à l'Article 13, la **tension à vide assignée** ne doit pas dépasser:

- a) une valeur de crête de 113 V en courant continu;
- b) une valeur de crête de 113 V et 80 V en valeur efficace en courant alternatif.

*La conformité doit être vérifiée par mesurage conformément à 11.1.5.*

#### **11.1.3 Tension à vide assignée dans le cas de torches tenues mécaniquement avec une protection accrue de l'opérateur**

La **tension à vide assignée** ne doit pas dépasser

- a) une valeur de crête de 141 V en courant continu;
- b) une valeur de crête de 141 V et 100 V en valeur efficace en courant alternatif.

Ces valeurs ne peuvent être utilisées que lorsque les exigences suivantes sont remplies:

- 1) la torche ne doit pas être tenue à la main;
- 2) la **tension à vide** doit être coupée automatiquement lorsque le soudage est arrêté;  
et
- 3) la protection contre les contacts directs avec des parties actives doit être assurée au moyen:
  - d'un degré de protection minimal de IP2X,
  - ou
  - d'un **dispositif réducteur de risques** (voir l'Article 13).

*La conformité doit être vérifiée par mesurage conformément à 11.1.5, par une mise en fonctionnement et par **examen visuel**.*

#### **11.1.4 Tension à vide assignée pour les procédés spéciaux, par exemple le coupage par plasma**

La **tension à vide assignée** ne doit pas dépasser une valeur de crête de 500 V en courant continu.

*La conformité doit être vérifiée par mesurage conformément à 11.1.5, par une mise en fonctionnement et par **examen visuel**, avec l'exception suivante: la combinaison en série des résistances fixes de 200  $\Omega$  et variables de 5 k $\Omega$  peut être remplacée par une résistance fixe de 5 k $\Omega$ .*

Une **tension à vide assignée** dépassant une valeur de crête de 113 V en courant continu ne peut être appliquée que lorsque les exigences suivantes sont remplies.

- a) Ces **sources de courant électrique de coupage par plasma** avec leurs torches correspondantes doivent empêcher la sortie de la **tension à vide** lorsque la torche est démontée ou déconnectée de la **source de courant électrique de coupage par plasma**.
- b) La **tension à vide** doit être inférieure à 68 V crête au plus tard 2 s après ouverture du **circuit de commande** (par exemple interrupteur de démarrage).
- c) La tension entre la tuyère de la torche et la pièce mise en œuvre ou la terre doit être inférieure à 68 V crête au plus tard 2 s après l'extinction de l'arc pilote et de l'arc principal.

Les conditions de conformité à ces exigences doivent être données dans les instructions d'emploi.

De telles **sources de courant électrique de coupage par plasma** peuvent être marquées du symbole 84 de l'Annexe L.

*La conformité doit être vérifiée par mesurage avec un appareil de mesure ou un oscilloscope en parallèle avec une résistance de 5 k $\Omega$  minimum.*

### 11.1.5 Exigences supplémentaires

La **tension à vide assignée** pour tous les réglages de sortie possibles ne doit pas dépasser les valeurs données de 11.1.1 à 11.1.4, résumées dans le Tableau 13.

Au cours du mesurage, la variation de la tension d'alimentation réelle par rapport à la **tension assignée d'alimentation** ne doit pas dépasser  $\pm 6\%$ . Si la **tension à vide** varie avec la tension d'alimentation, alors, pour une variation de tension d'alimentation supérieure à  $\pm 1\%$ , la **tension à vide** doit être corrigée de façon linéaire en fonction de la tension d'alimentation réelle.

**Tableau 13 – Résumé des tensions à vide assignées admissibles**

| Paragraphe | Conditions de travail                                              | Tension à vide assignée                                                                   |
|------------|--------------------------------------------------------------------|-------------------------------------------------------------------------------------------|
| 11.1.1     | Environnement avec risque accru de choc électrique                 | courant continu 113 V crête<br>courant alternatif 68 V crête et 48 V en valeur efficace   |
| 11.1.2     | Environnement sans risque accru de choc électrique                 | courant continu 113 V crête<br>courant alternatif 113 V crête et 80 V en valeur efficace  |
| 11.1.3     | Torches tenues mécaniquement avec protection accrue de l'opérateur | courant continu 141 V crête<br>courant alternatif 141 V crête et 100 V en valeur efficace |
| 11.1.4     | Coupage par plasma                                                 | courant continu 500 V crête                                                               |

Les sources de courant de soudage doivent être

a) conçues pour garantir que les tensions de sortie données au Tableau 13 ne soient pas dépassées en cas de défaillance d'un composant quelconque (circuit ouvert ou court-circuit, par exemple)

ou

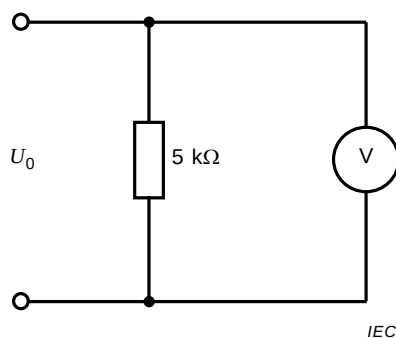
b) équipées d'un système de protection qui, en 0,3 s, interrompt automatiquement la tension aux bornes de sortie et ne doit pas être réenclenché automatiquement.

Ces valeurs ne sont pas applicables aux tensions d'amorçage et de stabilisation de l'arc pouvant être superposées.

*La conformité doit être vérifiée par mesurage et par analyse du circuit et/ou simulation de défaut.*

### 11.1.6 Circuits de mesure

Pour mesurer les valeurs efficaces, un appareil mesurant une valeur efficace vraie doit être utilisé, avec une résistance de  $(5 \pm 0,25)$  k $\Omega$ , connecté aux bornes du **circuit de soudage** comme représenté à la Figure 4.




**Légende**

$U_0$  Tension à vide  
V Voltmètre à valeurs efficaces vraies

**Figure 4 – Mesurage des valeurs efficaces**

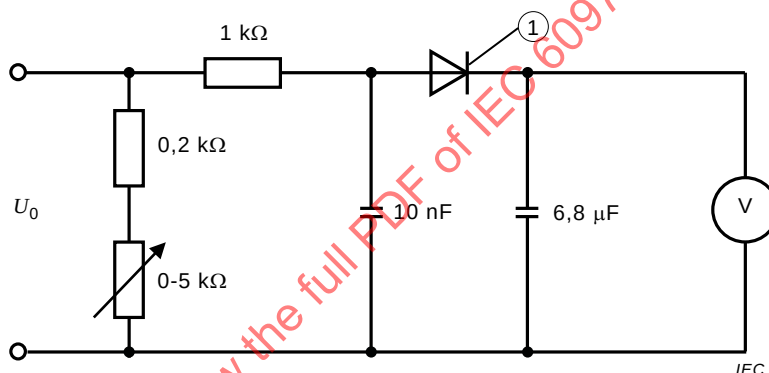Afin d'obtenir des résultats de mesure reproductibles des valeurs de crête, en ne tenant pas compte des impulsions qui ne sont pas dangereuses, un circuit conforme à la Figure 5 doit être utilisé.



**Légende**

$U_0$  Tension à vide  
V Voltmètre  
1 Diode 1N4007 ou similaire

**Figure 5 – Mesurage des valeurs de crête**

Le voltmètre doit indiquer des valeurs moyennes. L'étendue de mesure doit être choisie de façon à être aussi proche que possible de la **tension à vide**. Le voltmètre doit avoir une résistance interne d'au moins 1 MΩ.

La tolérance sur les valeurs des composants du circuit de mesure ne doit pas dépasser  $\pm 5\%$ .

Pour l'**essai de type**, le rhéostat est réglé de 0 Ω à 5 kΩ afin d'obtenir la plus grande valeur de la tension de crête mesurée avec ces charges de 200 Ω à 5,2 kΩ. Ce mesurage est répété avec les deux connexions à l'appareil de mesure inversées.

La résistance du rhéostat et la connexion qui produit la plus grande valeur de la tension peuvent être déterminées pendant l'**essai de type**. Cette résistance et la polarité principale peuvent être utilisées pour l'**essai individuel de série**.

## 11.2 Valeurs d'essais de type de la tension conventionnelle en charge

### 11.2.1 Soudage manuel électrique à l'arc avec électrodes enrobées

$I_2$  jusqu'à 600 A:  $U_2 = (20 + 0,04 I_2) \text{ V}$

$I_2$  supérieur à 600 A:  $U_2 = 44 \text{ V}$

### 11.2.2 Soudage à l'arc en atmosphère inerte avec électrode de tungstène

$I_2$  jusqu'à 600 A:  $U_2 = (10 + 0,04 I_2) \text{ V}$

$I_2$  supérieur à 600 A:  $U_2 = 34 \text{ V}$

### 11.2.3 Soudage à l'arc sous protection de gaz inerte / actif et avec fil fourré dans gaz

$I_2$  jusqu'à 600 A:  $U_2 = (14 + 0,05 I_2) \text{ V}$

$I_2$  supérieur à 600 A:  $U_2 = 44 \text{ V}$

### 11.2.4 Soudage à l'arc sous flux en poudre

$I_2$  jusqu'à 600 A:  $U_2 = (20 + 0,04 I_2) \text{ V}$

$I_2$  supérieur à 600 A:  $U_2 = 44 \text{ V}$

### 11.2.5 Coupage par plasma

$I_2$  jusqu'à 170 A:  $U_2 = (80 + 0,4 I_2) \text{ V}$

$I_2$  entre 170 A et 500 A:  $U_2 = (131 + 0,1 I_2) \text{ V}$

$I_2$  supérieur à 500 A:  $U_2 = 181 \text{ V}$

Pour le coupage par plasma, le constructeur peut spécifier des **tensions en charge** supplémentaires déterminées selon les conditions typiques de coupage.

NOTE La **tension en charge** spécifiée par le constructeur est utilisée en raison de la nature du procédé plasma. Les facteurs qui peuvent influencer la tension à laquelle les performances satisfaisantes sont obtenues incluent l'interaction de la conception de la torche plasma, le gaz plasma recommandé et la distance de sécurité.

### 11.2.6 Soudage plasma

$I_2$  jusqu'à 600 A:  $U_2 = (25 + 0,04 I_2) \text{ V}$

$I_2$  supérieur à 600 A:  $U_2 = 49 \text{ V}$

### 11.2.7 Gougeage par plasma

$I_2$  jusqu'à 300 A:  $U_2 = (100 + 0,4 I_2) \text{ V}$

$I_2$  supérieur à 300 A:  $U_2 = 220 \text{ V}$

Pour le gougeage par plasma, le constructeur peut spécifier des **tensions en charge** supplémentaires déterminées selon les conditions typiques de coupage.

NOTE La **tension en charge** spécifiée par le constructeur est utilisée en raison de la nature du procédé plasma. Les facteurs qui peuvent influencer la tension à laquelle des performances satisfaisantes sont obtenues incluent l'interaction de la conception de la torche plasma, le gaz plasma recommandé et la distance de sécurité.

### 11.2.8 Exigences supplémentaires

Sur toute sa plage de réglages, la source de courant de soudage alimentée électriquement doit pouvoir fournir les **courants conventionnels de soudage** ( $I_2$ ) sous les **tensions conventionnelles en charge** ( $U_2$ ), conformément aux spécifications de 11.2.1 à 11.2.7.

La conformité doit être vérifiée par un nombre suffisant de mesurages (voir Annexe H).

### 11.3 Dispositifs de commutation mécaniques utilisés pour ajuster la sortie

Un interrupteur, contacteur, disjoncteur ou autre dispositif de commande utilisé pour ajuster ou commander le niveau de sortie de la source de courant de soudage doit avoir une endurance adaptée à son application.

*La conformité doit être vérifiée par l'essai suivant.*

Le dispositif est installé dans une source de courant de soudage d'essai et soumis à 6 000 cycles de fonctionnement de la plage complète du mouvement mécanique avec la sortie en condition à vide. Si le dispositif est dans le **circuit d'alimentation**, la source de courant de soudage est mise en fonctionnement sous la **tension assignée d'alimentation** la plus élevée. Vérifier qu'il n'apparaît aucune défaillance électrique ou mécanique du dispositif et que la source de courant de soudage ne subit aucun dommage.

NOTE Un composant ayant prouvé sa conformité à ces essais peut être utilisé dans d'autres applications similaires si les autres exigences sont du même niveau ou inférieures.

### 11.4 Raccordement au circuit de soudage

#### 11.4.1 Protection contre les contacts involontaires

Les dispositifs de connexion au **circuit de soudage**, avec ou sans câbles connectés, doivent être protégés contre les contacts involontaires par des personnes ou des objets métalliques tels que véhicules, crochets de levage, etc.

Les exemples suivants montrent comment une telle protection peut être procurée.

- a) Toutes les parties actives du dispositif de connexion sont en retrait du plan des ouvertures d'accès. Les dispositifs conformes à l'IEC 60974-12 satisfont à ces exigences.
- b) Il existe un couvercle à charnière ou un système de protection.

*La conformité doit être vérifiée par **examen visuel**.*

#### 11.4.2 Emplacement des dispositifs de connexion

Les dispositifs de connexion non protégés doivent être disposés de sorte que leurs ouvertures ne soient pas orientées vers le haut.

NOTE Les dispositifs de connexion équipés d'un dispositif de fermeture automatique peuvent avoir leurs ouvertures orientées vers le haut.

*La conformité doit être vérifiée par **examen visuel**.*

#### 11.4.3 Ouvertures de sortie

Lorsque les câbles de soudage traversent des parties métalliques, les bords des ouvertures doivent être arrondis avec un rayon d'au moins 1,5 mm.

*La conformité doit être vérifiée par **examen visuel**.*

#### 11.4.4 Transformateur de soudage multiopérateur triphasé

Tous les dispositifs de connexion de sortie de soudage prévus pour le raccordement à la pièce mise en œuvre doivent avoir une interconnexion commune à l'intérieur de la source de courant de soudage.

Les dispositifs de connexion de sortie de soudage d'une même phase doivent tous être marqués de la même façon.

*La conformité doit être vérifiée par **examen visuel**.*

#### 11.4.5 Marquage

Les dispositifs de connexion conçus spécifiquement pour le raccordement à la pièce mise en œuvre ou à l'électrode doivent être identifiés en conséquence.

Pour les sources de courant de soudage à courant continu, la polarité doit être clairement marquée, soit sur les dispositifs de connexion de sortie eux-mêmes, soit sur le sélecteur de polarité. Cette exigence ne s'applique pas aux **sources de courant électrique de coupage par plasma**.

*La conformité doit être vérifiée par **examen visuel**.*

#### 11.4.6 Connexions pour les torches de coupage par plasma

La torche doit être connectée et déconnectée de la **source de courant électrique de coupage par plasma**:

- a) à l'intérieur de la **source de courant électrique de coupage par plasma**, au moyen d'un outil, par des écrous ou des dispositifs de connexion;  
ou
- b) sur la **source de courant électrique de coupage par plasma**, par un dispositif de connexion qui est:
  - 1) conçu pour éviter la connexion de torches incompatibles  
ou
  - 2) qui fonctionne avec l'aide d'un outil.

Quand le dispositif de connexion est déconnecté, il ne doit pas y avoir de tension supérieure aux limites de la TBTS accessible à l'opérateur.

*La conformité doit être vérifiée par **examen visuel** et par **mesurage**.*

#### 11.5 Alimentation de dispositifs extérieurs raccordés au circuit de soudage

Lorsqu'une source de courant de soudage fournit une alimentation électrique à un dispositif extérieur incluant une connexion au **circuit de soudage**, cette énergie doit être fournie par l'un des dispositifs suivants:

- a) le **circuit de soudage**;
- b) un transformateur de sécurité conforme à l'IEC 61558-2-6, ou des moyens équivalents, incorporés dans la source de courant de soudage;
- c) un transformateur de sécurité conforme à l'IEC 61558-2-4, avec une tension secondaire assignée jusqu'à 120 V en valeur efficace, si toutes les parties conductrices accessibles du dispositif extérieur sont connectées, selon les recommandations du constructeur, au conducteur de protection à la terre qui est protégé contre le **courant de soudage**, par exemple par un relais sensible au courant ou par isolation des parties métalliques concernées, par exemple par une enveloppe.

Les dispositifs extérieurs comprennent des dévidoirs, des systèmes d'amorçage et de stabilisation d'arc, des torches, des dispositifs de suivi de joint ou d'autres dispositifs contenant une connexion avec le **circuit de soudage**.

*La conformité doit être vérifiée par **examen visuel** et par **simulation de défaut**.*

## 11.6 Sortie d'alimentation auxiliaire

Si des sources de courant de soudage sont conçues pour fournir de l'énergie électrique à des dispositifs extérieurs ne faisant pas partie du **circuit de soudage** (par exemple pour l'éclairage, un système de refroidissement extérieur ou des outils électriques), ces circuits auxiliaires et accessoires doivent être conformes aux normes et réglementations qui régissent leur utilisation.

Le **circuit de soudage** doit être électriquement séparé de tels **circuits d'alimentation** conformément à 6.2.4 et 6.3.2.

Près des socles de prises de courant fournissant l'alimentation auxiliaire, le courant délivrable, la tension, le **facteur de marche** disponible lorsqu'il est inférieur à 100 %, le courant alternatif ou continu et le régime de neutre (par exemple mis à la terre ou non) suivant ce qui est approprié, doivent être marqués de façon claire et indélébile.

*La conformité doit être vérifiée par **examen visuel** au cours des essais conformément à 6.1.4, 6.1.5, 6.2.4 et 6.3.2 et en frottant le marquage conformément à 15.1.*

## 11.7 Câbles de soudage

Si une source de courant de soudage est fournie avec des câbles de soudage, ils doivent être conformes aux exigences de l'IEC 60245-6 ou satisfaire aux réglementations nationales et locales.

Si une **source de courant électrique de coupage par plasma** est fournie avec des câbles de soudage, ils doivent être conformes aux caractéristiques assignées de courant et de **tension à vide** correspondant à l'application et ils doivent respecter les réglementations nationales et locales.

NOTE 1 Des exemples de réglementations locales sont donnés dans la Bibliographie, par exemple, EN 50525-2-81:2011. Des informations complémentaires sur le courant admissible des câbles sont données dans l'EN 50565-1:2014.

NOTE 2 Il a été démontré que l'isolation PVC n'était pas adaptée à cette application et n'est pas reconnue par les normes IEC ou CENELEC relatives aux câbles de soudage.

NOTE 3 La tension assignée des câbles de soudage satisfaisant aux exigences de l'IEC 60245-6 n'est généralement pas adaptée aux applications de coupage par plasma.

## 12 Circuits de commande

### 12.1 Exigence générale

Toutes les entrées et sorties des **circuits de commande** doivent être soumises à des essais en charge maximale, comme spécifié par le constructeur. Les circuits de **commande à distance** peuvent être soumis à l'essai sans connexion à la source de courant, à condition que la source de courant puisse être simulée.

*La conformité doit être vérifiée par mesurage ou analyse, selon le cas.*

### 12.2 Isolation des circuits de commande

Un **circuit de commande** qui quitte l'enveloppe qui possède une tension inférieure à la **tension à vide** admissible conformément à 11.1.1, et qui est séparé des **circuits de soudage** et **d'alimentation**, doit être:

- a) isolé du **circuit d'alimentation** par une double isolation ou une **isolation renforcée**,

- b) isolé de tous les autres circuits possédant une tension supérieure à la **tension à vide** admissible conformément à 11.1.1 (**circuits d'alimentation** auxiliaires, circuit de coupage par plasma, par exemple), par une double isolation ou une **isolation renforcée** et
- c) isolé du **circuit de soudage** possédant une tension inférieure à la tension à vide admissible conformément à 11.1.1, par une **isolation principale**.

NOTE La configuration de l'isolation pour les **matériels de la Classe I** est présentée au 6.1.1.

*La conformité doit être vérifiée par mesurage ou analyse, selon le cas.*

### 12.3 Tensions locales des circuits de commande à distance

Les **tensions locales** dans les circuits de **commande à distance** conçus pour fonctionner à la main ne doivent pas dépasser 50 V en courant alternatif ou 120 V en courant continu lissé entre les conducteurs, ou entre tout conducteur et le **circuit de protection**, dans des conditions normales de fonctionnement et après un défaut simple.

NOTE Les exigences de **tension locale** pour les réseaux informatiques étendus ou locaux sont indiquées dans l'IEC 60950-1.

*La conformité doit être vérifiée par mesurage ou analyse, selon le cas.*

## 13 Dispositif réducteur de risques

### 13.1 Exigences générales

Un **dispositif réducteur de risques** doit réduire la sévérité du choc électrique pouvant être causé par des **tensions à vide** dépassant les valeurs autorisées de **tension assignée à vide** pour un environnement donné. Des exemples de **dispositifs réducteurs de risques** sont donnés en 13.2.

Les exigences sont indiquées dans le Tableau 14.

**Tableau 14 – Exigences pour le dispositif réducteur de risques**

| Tension à vide non réduite selon le paragraphe                                                                        | Tension à vide réduite selon le paragraphe | Temps de réaction s |
|-----------------------------------------------------------------------------------------------------------------------|--------------------------------------------|---------------------|
| Entre 11.1.3 et 11.1.2                                                                                                | 11.1.1                                     | 0,3                 |
| Entre 11.1.2 et 11.1.1                                                                                                | 11.1.1                                     | 2                   |
| Pour la source de courant de soudage en tension continue supérieure à 113 V, un temps de réaction de 0,3 s est exigé. |                                            |                     |

### 13.2 Types de dispositifs réducteurs de risques

#### 13.2.1 Dispositif réducteur de tension

Un dispositif réducteur de tension doit avoir automatiquement réduit la **tension à vide assignée** à un niveau ne dépassant pas les valeurs de 11.1.1 au moment où la résistance du **circuit de soudage** extérieur dépasse 200  $\Omega$ . Le temps de réaction est spécifié dans le Tableau 14.

De telles sources de courant de soudage peuvent être marquées du symbole 84 de l'Annexe L.

*La conformité doit être vérifiée en connectant une résistance de charge variable entre les dispositifs de connexion de sortie de la source de courant de soudage. Les mesurages de la tension et du temps de réaction sont effectués pendant que la résistance est augmentée.*



### 13.2.2 Dispositif de commutation de courant alternatif à courant continu

Un dispositif de commutation de courant alternatif à courant continu doit avoir commuté automatiquement la **tension à vide assignée** alternative à une **tension à vide** continue assignée ne dépassant pas les valeurs indiquées en 11.1.1 au moment où la résistance du **circuit de soudage** extérieur dépasse 200  $\Omega$ . Le temps de réaction est spécifié dans le Tableau 14.

De telles sources de courant peuvent être marquées du symbole 84 de l'Annexe L.

*La conformité doit être vérifiée conformément à 13.2.1.*

### 13.3 Exigences pour les dispositifs réducteurs de risques

#### 13.3.1 Mise hors service d'un dispositif réducteur de risques

La conception doit être telle que l'opérateur ne puisse mettre hors service ou court-circuiter le **dispositif réducteur de risques** sans l'usage d'un outil.

*La conformité doit être vérifiée par **examen visuel**.*

#### 13.3.2 Interférences avec le fonctionnement d'un dispositif réducteur de risques

Les **commandes à distance** spécifiées par le constructeur et les dispositifs d'amorçage ou de stabilisation d'arc de la source de courant de soudage ne doivent pas interférer avec le fonctionnement correct du **dispositif réducteur de risques**, c'est-à-dire que les limites de **tension à vide** ne doivent pas être dépassées.

*La conformité doit être vérifiée en répétant les essais du 13.2.1 avec tout dispositif susceptible d'interférer avec le fonctionnement du **dispositif réducteur de risques**.*

#### 13.3.3 Indicateur de fonctionnement satisfaisant

Un dispositif fiable, par exemple une lampe de signalisation, doit être prévu pour indiquer que le **dispositif réducteur de risques** fonctionne de façon satisfaisante. Lorsqu'une lampe de signalisation est utilisée, celle-ci doit être allumée lorsque la tension est réduite ou modifiée en tension continue.

*La conformité doit être vérifiée par **examen visuel** au cours de l'essai, conformément à 13.1.*

#### 13.3.4 Non-danger en cas de défaillance

Si le **dispositif réducteur de risques** ne fonctionne pas conformément à 13.1, la tension aux bornes de sortie doit être réduite à un niveau n'excédant pas 11.1.1 conformément au Tableau 14 et ne doit pas être réinitialisée automatiquement.

*La conformité doit être vérifiée en simulant un défaut du **dispositif réducteur de risques** et en mesurant le temps nécessaire pour parvenir à un état de non-danger après **défaillance du dispositif réducteur de risques**.*

## 14 Dispositions mécaniques

### 14.1 Exigences générales

Le matériel doit être fabriqué et assemblé de sorte qu'il ait la résistance et la rigidité nécessaires pour supporter le service normal auquel il est destiné sans augmentation des risques de choc électrique ou autres dangers, et que soient maintenues les **distances d'isolement dans l'air** minimales exigées. Le matériel doit avoir un boîtier ou une armoire

abritant toutes les parties actives et les parties mobiles dangereuses (telles que poulies, courroies, ventilateurs, engrenages, etc.) à l'exception des parties suivantes qui n'ont pas besoin d'être totalement enfermées.

- a) les câbles d'alimentation, de commande et de soudage;
- b) les bornes de sortie pour le raccordement des câbles de soudage.

Après les essais effectués conformément aux paragraphes 14.2 à 14.5, le matériel doit satisfaire aux dispositions du présent document. Quelques déformations d'éléments de la structure ou de l'enveloppe sont permises à condition que cela ne réduise pas le niveau de protection de sécurité.

Les parties accessibles ne doivent pas avoir de bords tranchants, de surfaces rugueuses ou de parties en saillie susceptibles de provoquer des blessures.

*La conformité doit être vérifiée par **examen visuel** après avoir satisfait aux exigences de 14.2 à 14.5.*

## **14.2 Enveloppe**

### **14.2.1 Matériaux de l'enveloppe**

Les matériaux non métalliques destinés à protéger contre le contact avec les parties actives, à l'exception des circuits de soudage et des circuits TBTS, doivent avoir une classification d'inflammabilité V-1 ou meilleure selon l'IEC 60695-11-10.

*La conformité est vérifiée par examen des spécifications des matériaux non métalliques.*

### **14.2.2 Résistance de l'enveloppe**

L'enveloppe, y compris les ouïes d'aération, doit supporter un choc de 10 Nm conforme à l'Annexe I.

Les poignées de manutention, les boutons poussoirs, les écrans de réglage, etc. ne doivent pas être soumis à l'essai avec le marteau pendulaire.

En variante, l'enveloppe peut être constituée d'une tôle d'épaisseur minimale conforme à l'Annexe J.

*La conformité doit être vérifiée conformément à a) ou b) ci-dessous.*

- a) Par un essai de choc en utilisant un marteau pendulaire de choc conformément à I.1 ou un corps de chute conformément à I.2 ou des moyens équivalents, comme suit:
  - 1) un échantillon est soumis à l'essai;
  - 2) la source de courant de soudage n'est pas sous tension pendant l'essai;
  - 3) choisir de chaque côté un point d'impact où le risque de choc électrique ou de dysfonctionnement est le plus élevé;
  - 4) appliquer trois chocs aux points d'impact choisis.
- b) Par mesurage de l'épaisseur de la tôle.

## **14.3 Moyens de manutention**

### **14.3.1 Moyens de manutention mécanisés**

Si des dispositifs pour une manutention mécanisée (par exemple des œillets ou anneaux) sont prévus pour le levage d'un matériel assemblé, ceux-ci doivent être capables de

supporter les contraintes mécaniques d'une traction statique appliquée avec une force calculée en fonction de la masse du matériel assemblé, comme suit.

- a) Pour le matériel dont la masse est inférieure ou égale à 150 kg, une force calculée à partir de 10 fois la masse doit être utilisée.
- b) Pour le matériel dont la masse est supérieure à 150 kg, une force calculée à partir de quatre fois la masse ou d'au moins 15 kN doit être utilisée.

Si un seul dispositif de levage est prévu, il doit être conçu de telle façon qu'un couple appliqué pendant le levage ne risque pas de le desserrer.

*La conformité doit être vérifiée par **examen visuel** et par l'essai suivant.*

Le matériel est équipé de tous les accessoires (à l'exception des bouteilles de gaz, traîneaux séparés, chariots et châssis à roues) qui sont susceptibles d'être installés et, dans le cas de groupes électrogènes de soudage, totalement équipé et prêt à être mis en marche. Le matériel est ensuite ancré rigidement sur sa base et une chaîne ou un câble est attaché à ses moyens de levage, comme recommandé par le constructeur; une traction est ensuite exercée vers le haut et de façon continue pendant 10 s.

Si deux ou plus de deux dispositifs de levage sont prévus, les chaînes et câbles sont disposés de façon que la force soit répartie équitablement et soit appliquée avec un angle maximal de 15° par rapport à la verticale.

#### 14.3.2 Moyens de manutention manuels

Si des dispositifs pour une manutention manuelle de levage ou portage (par exemple des poignées ou des sangles) sont prévus, ceux-ci doivent être capables de supporter les contraintes mécaniques d'une traction statique appliquée avec une force calculée en fonction de la masse du matériel assemblé, comme suit.

Une force calculée de quatre fois la masse ou au moins 600 N doit être utilisée.

*La conformité doit être vérifiée par **examen visuel** et par l'essai suivant.*

Le matériel est équipé de tous les accessoires (à l'exception des bouteilles de gaz, traîneaux séparés, chariots et châssis à roues) qui sont susceptibles d'être installés. Le matériel est ensuite ancré rigidement sur sa base et une chaîne ou un câble est attaché à ses poignées ou sangles, comme recommandé par le constructeur; une traction est ensuite exercée vers le haut et de façon continue pendant 10 s.

#### 14.4 Essai de chute

Le matériel doit être capable de supporter l'essai de chute. Pour cet essai, le matériel doit inclure tous les accessoires, le liquide de refroidissement et le fil d'apport (à l'exception des bouteilles de gaz, traîneaux séparés, chariots et châssis à roues, sauf s'ils font partie du matériel normal et sont fixés de façon permanente) qu'il est recommandé d'installer.

Pour l'essai de chute, les hauteurs doivent être les suivantes.

- a) le matériel d'une masse inférieure ou égale à 25 kg doit supporter une chute de  $250^{+10}_0$  mm;
- b) le matériel d'une masse supérieure à 25 kg doit supporter une chute de  $100^{+10}_0$  mm.

NOTE 1 La masse du matériel comprend la masse des accessoires, du liquide de refroidissement et du fil d'apport.

*La conformité doit être vérifiée en faisant tomber le matériel trois fois sur une surface dure et rigide. Cet essai est effectué de sorte qu'un bord inférieur différent du matériel reçoive le choc à chaque fois qu'il tombe.*

NOTE 2 En pratique, un coin touche la surface d'impact en premier.

Les groupes électrogènes de soudage doivent être prêts pour un usage immédiat avec leur plein fait.

#### 14.5 Essai de stabilité

Le matériel dans sa position la plus instable ne doit pas basculer pour une inclinaison allant jusqu'à 10°. Des équipements auxiliaires, comme spécifié par le constructeur suivant le type de matériel, tels que bouteilles de gaz, dévidoir ou système de refroidissement risquent d'affecter la stabilité et doivent être pris en compte.

Si le constructeur spécifie d'autres éléments auxiliaires qui abaissent la stabilité au-dessous des exigences du présent paragraphe, les instructions doivent alors prévoir l'ancrage ou d'autres moyens, si nécessaire.

*La conformité doit être vérifiée par l'essai suivant.*

Le matériel est placé sur un plan et est écarté du plan horizontal.

### 15 Plaque signalétique

#### 15.1 Exigences générales

Une **plaque signalétique** claire et indélébile doit être fixée de façon sûre ou imprimée sur chaque source de courant de soudage.

NOTE L'objet de la **plaque signalétique** est d'indiquer à l'utilisateur les caractéristiques électriques, ce qui permet des comparaisons et un choix correct des sources de courant de soudage.

*La conformité doit être vérifiée par **examen visuel** et en frottant le marquage pendant 15 s à la main avec un tissu imbibé d'eau puis à nouveau pendant 15 s avec un tissu imbibé d'essence.*

Après cet essai, le marquage doit être facilement lisible. Il ne doit pas être facile d'enlever la **plaque signalétique** et celle-ci ne doit pas se recroqueviller.

#### 15.2 Description

La **plaque signalétique** doit être divisée en sections contenant des informations et caractéristiques pour

- a) l'identification;
- b) la sortie de soudage;
- c) l'alimentation en énergie.

La disposition et la succession des données doivent être conformes au principe indiqué sur la Figure 6 (pour les exemples, voir l'Annexe K).

Les dimensions de la **plaque signalétique** ne sont pas spécifiées et peuvent être choisies librement.

Il est permis de séparer les sections ci-dessus les unes des autres et de les fixer à des emplacements plus accessibles ou pratiques pour l'utilisateur.

Pour les sources de courant de soudage destinées à être utilisées pour divers procédés de soudage ou pour les sources de courant de soudage tournantes, une plaque combinée ou plusieurs plaques séparées peuvent être utilisées.

NOTE Des informations complémentaires peuvent être données. D'autres informations utiles, par exemple la **classe d'isolation**, le **degré de pollution** ou le facteur de puissance, peuvent être données dans les ouvrages de référence techniques fournis par le constructeur (voir 17.1).

|                            |  |                   |    |                      |  |
|----------------------------|--|-------------------|----|----------------------|--|
| a) Identification          |  |                   |    |                      |  |
| 1)                         |  |                   |    |                      |  |
| 2)                         |  |                   | 3) |                      |  |
| 4) Facultatif              |  |                   | 5) |                      |  |
| b) Sortie de soudage       |  |                   |    |                      |  |
| 6)                         |  | 8)                |    | 10)                  |  |
|                            |  | 11)               |    | 11a) 11b) 11c)       |  |
| 7)                         |  | 9)                |    | 12) 12a) 12b) 12c)   |  |
|                            |  | 13)               |    | 13a) 13b) 13c)       |  |
| c) Alimentation en énergie |  |                   |    |                      |  |
| 14)                        |  | 15) or 18)        |    | 16)                  |  |
|                            |  | or 19)            |    | or 20) Si applicable |  |
| 22) Facultatif             |  | 23) Si applicable |    | or 21) Si applicable |  |

IEC

**Figure 6 – Principe de la plaque signalétique**

### 15.3 Contenu


Les explications suivantes se réfèrent aux cases numérotées indiquées à la Figure 6.

#### a) Identification

- Case 1 Nom et adresse du constructeur ou distributeur ou importateur et, éventuellement, une marque commerciale et le pays d'origine, si cela est exigé.
- Case 2 Type (identification) donné par le constructeur.
- Case 3 Traçabilité de conception et données relatives à la fabrication (par exemple numéro de série).
- Case 4 Symbole de la source de courant de soudage (facultatif), par exemple:




Transformateur monophasé




Transformateur-redresseur triphasé



Transformateur-redresseur à convertisseur de fréquence statique mono- ou triphasé




Source de courant de soudage à onduleur avec sortie en courant alternatif et continu




Moteur-générateur triphasé



Moteur-générateur-redresseur triphasé




Convertisseur de fréquence rotatif triphasé



Source de courant combinée alternatif et continu monophasé



Moteur thermique-générateur à courant alternatif



Moteur thermique-générateur-redresseur

Case 5 Référence aux normes confirmant que la source de courant de soudage est conforme à leurs exigences.

b) Sortie de soudage

Case 6 Symbole pour le procédé de soudage, par exemple:



Soudage à l'arc manuel avec électrodes enrobées



Soudage à l'arc en atmosphère inerte avec électrode de tungstène



Soudage à l'arc sous protection de gaz inerte/actif avec fil massif ou fil fourré



Soudage à l'arc avec fil fourré sans gaz



Soudage à l'arc sous flux en poudre



Coupage par plasma



Gougeage par plasma



Soudage plasma

Case 7  Marque pour les sources de courant de soudage pouvant être utilisées pour les opérations de soudage effectuées dans un environnement avec risque accru de choc électrique (si applicable).

NOTE 1 En outre, ce symbole, d'une taille appropriée, peut être placé sur la face avant de la source de courant de soudage.

Case 8 Symbole pour le courant de soudage, par exemple:



Courant continu



Courant alternatif, avec en plus la fréquence assignée, en hertz, par exemple: ~50 Hz



Courant continu et alternatif à la même sortie, et en plus la fréquence assignée en hertz

Case 9  $U_0$ ... V Tension à vide assignée

- 1) valeur de crête dans le cas du courant continu;
- 2) valeur efficace dans le cas du courant alternatif.

NOTE 2 Si une source de courant de soudage est équipée d'un **dispositif réducteur de risques**, celle-ci est la tension mesurée avant le fonctionnement du **dispositif réducteur de risques**.

Si plusieurs valeurs de **tension à vide** peuvent être obtenues, la plage doit être indiquée en inscrivant la **tension à vide** assignée minimale et maximale.

En outre, les valeurs suivantes doivent être données.

- 3)  $U_r$ ... V tension à vide assignée réduite dans le cas d'un dispositif réducteur de tension;
- 4)  $U_s$ ... V tension à vide assignée commutée dans le cas d'un dispositif de commutation courant alternatif à courant continu.

Case 10 ... A/... V à ... A/... V Plage de débits, courant minimal de soudage et tension conventionnelle en charge correspondante ou inférieure, courant maximal de soudage et sa tension conventionnelle en charge correspondante ou supérieure.

Case 11  $\alpha$  Symbole pour facteur de marche.

Case 12  $I_2$  Symbole pour courant de soudage assigné.

Case 13  $U_2$  Symbole pour la tension conventionnelle en charge.

Cases 11a, 11b, 11c ... % Valeurs du facteur de marche à une température ambiante de 40 °C.

12a, 12b, 12c ... A Valeurs du courant de soudage assigné.

13a, 13b, 13c ... V Valeurs de la tension conventionnelle en charge.

Ces cases forment un tableau avec les valeurs correspondant aux trois réglages:


- 1) ... % facteur de marche au courant de soudage assigné maximal;
- 2) 60 % facteur de marche;  
et
- 3) 100 % facteur de marche, si applicable.

La colonne a) peut ne pas être utilisée si le facteur de marche pour le courant de soudage assigné maximal est de 60 % ou 100 %.

La colonne b) peut ne pas être utilisée si le facteur de marche pour le courant de soudage assigné maximal est de 100 %.

c) Alimentation en énergie

Case 14 Symbole pour l'alimentation, par exemple:



Circuit d'alimentation, nombre de phases (par exemple 1 ou 3), symbole pour courant alternatif et fréquence assignée (par exemple 50 Hz ou 60 Hz)



Moteur thermique



Moteur électrique



Commande par courroie

| Case                                                                   | Sources de courant de soudage alimentées électriquement |                                         | Case | Sources de courant de soudage à moteur thermique |                                                        |
|------------------------------------------------------------------------|---------------------------------------------------------|-----------------------------------------|------|--------------------------------------------------|--------------------------------------------------------|
| 15                                                                     | $U_1 \dots V$                                           | Tension assignée d'alimentation         | 18   | $n \dots \text{min}^{-1}$                        | Vitesse assignée en charge                             |
| 16                                                                     | $I_{1\text{max}} \dots A$                               | Courant d'alimentation assigné maximal  | 19   | $n_0 \dots \text{min}^{-1}$                      | Vitesse de rotation assignée à vide                    |
| 17                                                                     | $I_{1\text{eff}} \dots A$                               | Courant d'alimentation effectif maximal | 20   | $n_1 \dots \text{min}^{-1}$                      | Vitesse de rotation assignée au ralenti, si applicable |
| Les cases 15 à 17 forment un tableau avec les valeurs correspondantes. |                                                         |                                         | 21   | $P_{1\text{max}} \dots \text{kW}$                | Consommation maximale, si applicable                   |

Case 22 IP.. Degré de protection, par exemple IP21 ou IP23.

Case 23  Symbole pour un matériel de classe II, si applicable.

La conformité doit être vérifiée par **examen visuel** et par contrôle de toutes les données.

#### 15.4 Tolérances

Les constructeurs doivent remplir les valeurs de la **plaque signalétique** avec les tolérances qui suivent en contrôlant les tolérances des composants et de la fabrication:

a)  $U_0$  tension à vide assignée en  $V \pm 5 \%$  mesurée conformément à 11.1, mais en aucun cas les valeurs résumées au Tableau 13 ne doivent être dépassées;

b)  $I_{2\text{min}}$  courant de soudage assigné minimal en A;

$U_{2\text{min}}$  tension conventionnelle minimale en charge en V;

Les valeurs de b) ne doivent pas être supérieures à celles indiquées sur la plaque signalétique.

c)  $I_{2\text{max}}$  courant de soudage assigné maximal en A;

$U_{2\text{max}}$  tension conventionnelle maximale en charge en V;



Les valeurs de c) ne doivent pas être inférieures à celles indiquées sur la plaque signalétique.

- d)  $n_0$  vitesse de rotation assignée à vide en  $\text{min}^{-1} \pm 5 \%$ ;
- e)  $P_{1\text{max}}$  consommation maximale en kW  $^{+10}_0 \%$ ;
- f)  $I_{1\text{max}}$  courant d'alimentation assigné maximal en A  $\pm 10 \%$ .
- g) Le rendement mesuré sur n'importe quel matériel raccordé au réseau d'alimentation ne doit pas être inférieur à la valeur indiquée. La puissance consommée en **état au ralenti** ne doit pas être supérieure à la valeur indiquée.

*La conformité doit être vérifiée par des mesurages effectués sous des **conditions conventionnelles de soudage** (voir 3.17).*

## 15.5 Direction de la rotation

Si nécessaire, la direction de la rotation doit être indiquée sur les sources de courant de soudage tournantes.

*La conformité doit être vérifiée par **examen visuel**.*

## 16 Réglage de la sortie

### 16.1 Type de réglage

Si la source de courant de soudage possède un moyen de réglage du courant de sortie, de la tension de sortie ou des deux, le réglage peut être continu, pas à pas ou les deux.

Dans le cas d'un réglage continu avec plusieurs plages, il ne doit pas y avoir de vide entre deux plages.

*La conformité doit être vérifiée par **mesurage**.*

### 16.2 Marquage du dispositif de réglage

La sortie de la source de courant de soudage correspondant aux différents réglages de commande doit être marquée de façon claire et indélébile, soit sur le dispositif de commande ou par ce dernier, soit par affichage numérique.

À l'exception des sources de courant de soudage qui sont réglées ou ajustées avec ou au moyen d'un affichage numérique, ce qui suit doit s'appliquer.

- a) Les indications de réglage sur les échelles ou les tableaux de commande doivent tenir compte de la relation entre la **tension conventionnelle en charge** et le **courant de soudage conventionnel**.
- b) Chaque position, dans le cas d'un réglage pas-à-pas, ou chaque graduation majeure, dans le cas d'un réglage continu, doit être marquée de façon claire
  - 1) d'une indication numérique des paramètres à commander;  
ou, si cela n'est pas possible,
  - 2) d'un marquage alphanumérique.

Dans le cas 2), un tableau sur l'appareil ou dans les instructions d'emploi doit indiquer pour chaque position de commande la valeur nominale du paramètre (de commande).

- c) Dans le cas d'un réglage à plusieurs plages, les valeurs maximales et minimales pour chaque plage doivent être données.

- d) Les sources de courant de soudage conçues pour plusieurs procédés ayant des **tensions conventionnelles en charge** différentes doivent être marquées avec une échelle de commande séparée pour chaque procédé. Si cela n'est pas possible, des marquages alphanumériques comme indiqué en b) doivent être utilisés.
- e) Lorsque la source de courant de soudage est conçue de telle façon qu'elle peut être alimentée par plusieurs **tensions d'alimentation assignées** et lorsque, pour une même position du dispositif de commande, les valeurs numériques des paramètres de soudage ne sont pas les mêmes, des échelles séparées ou des séries séparées de marquages alphanumériques doivent être prévues.

*La conformité doit être vérifiée par **examen visuel**.*

### 16.3 Indication du dispositif de commande de courant ou de tension

Lorsqu'il y a un dispositif de commande de tension ou de courant, le réglage de sortie doit être indiqué en volts, en ampères ou au moyen d'une échelle de référence arbitraire.

L'exactitude des indications de tension ou de courant doit se situer

- a) entre 100 % et 25 % du réglage maximal  $\pm 10$  % de la valeur vraie;
- b) au-dessous de 25 % du réglage maximal  $\pm 2,5$  % du réglage maximal.

Si le constructeur fournit un ampèremètre ou un voltmètre sur le matériel, celui-ci doit être de classe 2,5 et doit être correctement amorti.

*La conformité doit être vérifiée par mesurage et par **examen visuel**.*

## 17 Instructions et marquages

### 17.1 Instructions

Chaque source de courant de soudage doit être fournie avec des instructions qui doivent comprendre ce qui suit (si applicable):

- a) description générale;
- b) masse de la source de courant de soudage et de ses différentes parties, méthodes correctes de manutention, par exemple par élévateur à fourche ou grue, et précautions à prendre pour les bouteilles à gaz, dévidoirs, etc.;
- c) signification des indications, marquages et symboles graphiques;
- d) informations pour le choix et la connexion au réseau d'alimentation (par exemple câbles d'alimentation, dispositifs de raccordement ou fiches de prise de courant convenables, y compris les types et valeurs assignées de DDR (dispositif (à courant) différentiel résiduel), fusibles ou du disjoncteur, voir également l'avertissement en 6.1.1) par un personnel qualifié conformément aux réglementations nationales et locales applicables;

NOTE Certaines réglementations locales ou nationales exigent l'utilisation de DDR. Les types de DDR et leur utilisation sont donnés dans l'Annexe B de l'IEC TR 60755:2008. Seuls les DDR de type «B» assurent la protection lorsque des courants de défaut du **circuit d'alimentation** en courant continu sont susceptibles de se produire.

- e) conditions d'utilisation pour un fonctionnement correct des sources de courant de soudage (par exemple exigences de refroidissement, emplacement, dispositif de commande, indicateurs, type de combustible);
- f) capacités en soudage, **caractéristique statique** (tombante et/ou plate), limitations du **facteur de marche** et explications concernant la **protection thermique**, le cas échéant;
- g) limites d'emploi en fonction du degré de protection, par exemple les sources de courant de soudage ne sont pas utilisables sous la pluie ou la neige;

- h) lignes directrices concernant la protection contre les dangers personnels pour les opérateurs ou personnes travaillant à proximité (par exemple choc électrique, fumées, gaz, rayonnement de l'arc, métal chaud, étincelles, bruit, blessure au dos durant une manipulation manuelle);
- i) circonstances nécessitant le respect de précautions particulières en cours de soudage ou de coupage (par exemple environnement avec risques accrus de chocs électriques, environnement inflammable, produits inflammables, réservoirs fermés, travail en hauteur, etc.);
- j) comment assurer la maintenance de la source de courant de soudage, comme les cycles recommandés pour des essais partiels ou complets et autres opérations (par exemple nettoyage);
- k) une liste de pièces généralement remplacées du fait de l'usure;
- l) informations concernant l'alimentation en énergie électrique des dispositifs externes, par exemple l'éclairage ou les outils électriques;
- m) précautions contre le basculement, si la source de courant de soudage doit être placée sur un plan incliné;
- n) avertissement contre l'utilisation d'une source de courant de soudage pour dégeler des canalisations;
- o) type (identification) des torches de coupage par plasma qui sont spécifiées pour être utilisées avec la **source de courant électrique de coupage par plasma**;
- p) pression, débit et type de gaz plasma et, si applicable, de gaz de refroidissement ou de liquide de refroidissement;
- q) ensemble de valeurs associant paliers ou plage de courants de sortie et gaz plasma correspondant;
- r) la classification CEM selon l'IEC 60974-10;
- s) pour un groupe électrogène de soudage, un avertissement concernant le monoxyde de carbone émis par l'échappement du moteur thermique (un exemple de réglementation d'étiquetage nationale est donné dans l'*US Code of Federal Regulations, Title 16, Parts 1407*).

D'autres informations utiles peuvent également être données, par exemple la **classe d'isolation**, le **degré de pollution**, le rendement (voir Annexe M), etc.

La conformité doit être vérifiée par lecture des instructions.

## 17.2 Marquages

Chaque source de courant de soudage doit porter un marquage clair et indélébile sur ou à proximité de la face avant ou à proximité du bouton marche/arrêt avec la combinaison de symboles suivante pour signifier «Attention! Lire le manuel d'instructions»:



Ce marquage doit aussi être utilisé près du connecteur de torche des sources de courant électrique de coupage par plasma indiquant qu'il convient que l'opérateur lise le manuel d'instructions avant de sélectionner et de raccorder une torche. Un seul marquage bien visible dans la ligne visuelle de l'opérateur jusqu'à la face avant, au bouton marche/arrêt et au connecteur de torche est permis.

La phrase équivalente suivante peut être utilisée:

**Attention:** Lire les manuels d'instructions avant la mise en service  
et l'entretien de ce matériel

Pour d'autres marquages supplémentaires, voir l'Annexe L.

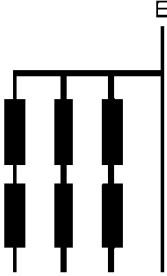
NOTE Les étiquettes de prévention figurant sur les sources de courant peuvent consister en du texte seul, du texte et des symboles ou des symboles seuls. Les étiquettes de prévention utilisant des symboles seuls sont spécifiées dans l'ISO 17846.

*La conformité doit être vérifiée par **examen visuel** et par un essai conforme à l'essai de durabilité de 15.1.*

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annexe A (informative)

### Tensions nominales des réseaux d'alimentation


| Tension phase<br>neutre déduite des<br>tensions<br>nominales<br>alternatives ou<br>continues<br>jusqu'à et<br>y compris<br><br>V | Tensions nominales utilisées actuellement dans le monde                                                                                                                    |                                                                                                                                                                                            |                                                                                                                                                                                          |                                                                                                                                                                                            |
|----------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                                                                                                                  | Systèmes triphasés<br>à quatre fils<br><br>avec neutre mis<br>à la terre<br><br><br><br>V | Systèmes triphasés<br>à trois fils<br><br>mis à la terre ou non<br>mis à la terre<br>(E)<br><br><br><br>V | Systèmes<br>monophasés à deux<br>fils<br><br>courant alternatif<br>ou courant continu<br><br><br><br>V | Systèmes<br>monophasés à trois<br>fils<br><br>courant alternatif<br>ou courant continu<br><br><br><br>V |
| 50                                                                                                                               |                                                                                                                                                                            |                                                                                                                                                                                            | 12,5 24<br>25 30<br>42 48                                                                                                                                                                | 30-60                                                                                                                                                                                      |
| 100                                                                                                                              | 66/115                                                                                                                                                                     | 66                                                                                                                                                                                         | 60                                                                                                                                                                                       |                                                                                                                                                                                            |
| 150                                                                                                                              | 120/208 <sup>a</sup> ,<br>127/220                                                                                                                                          | 115, 120, 127                                                                                                                                                                              | 100 <sup>b</sup><br>110, 120                                                                                                                                                             | 100-200 <sup>b</sup> ,<br>110-220,<br>120-240                                                                                                                                              |
| 300                                                                                                                              | 220/380, 230/400,<br>240/415, 260/440,<br>277/480                                                                                                                          | 200 <sup>b</sup> , 220,<br>230, 240,<br>260, 277                                                                                                                                           | 220                                                                                                                                                                                      | 220-440                                                                                                                                                                                    |
| 600                                                                                                                              | 347/600, 380/660,<br>400/690, 417/720,<br>480/830                                                                                                                          | 347, 380, 400,<br>415, 440, 480<br>500, 577, 600                                                                                                                                           | 480                                                                                                                                                                                      | 480-960                                                                                                                                                                                    |
| 1 000                                                                                                                            |                                                                                                                                                                            | 660,<br>690, 720,<br>830, 1 000                                                                                                                                                            | 1 000                                                                                                                                                                                    |                                                                                                                                                                                            |
| NOTE 1 Valeurs provenant du Tableau B.2 de l'IEC 60664-1:2007.                                                                   |                                                                                                                                                                            |                                                                                                                                                                                            |                                                                                                                                                                                          |                                                                                                                                                                                            |
| NOTE 2 "E" signifie "mis à la terre".                                                                                            |                                                                                                                                                                            |                                                                                                                                                                                            |                                                                                                                                                                                          |                                                                                                                                                                                            |
| <sup>a</sup> Usage courant aux États-Unis et au Canada.                                                                          |                                                                                                                                                                            |                                                                                                                                                                                            |                                                                                                                                                                                          |                                                                                                                                                                                            |
| <sup>b</sup> Usage courant au Japon.                                                                                             |                                                                                                                                                                            |                                                                                                                                                                                            |                                                                                                                                                                                          |                                                                                                                                                                                            |

## Annexe B (informative)
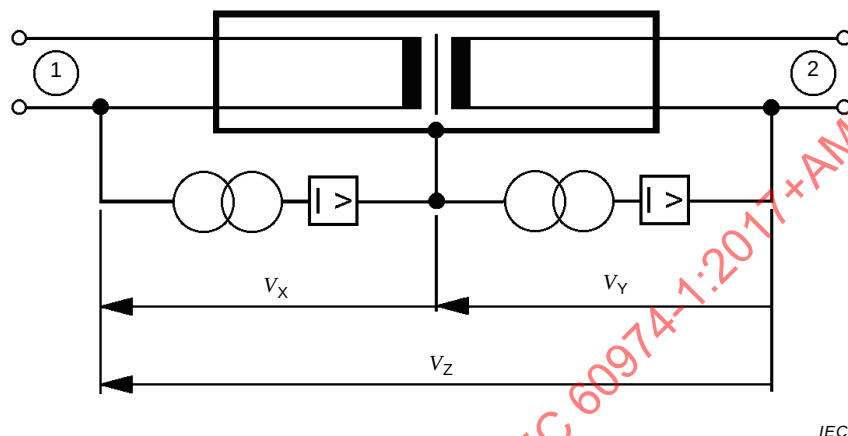
### Exemple d'un essai diélectrique combiné

Deux transformateurs haute tension peuvent être connectés en série, les phases étant correctement reliées.

La connexion commune est sur les parties conductrices accessibles (voir Figure B.1).



IEC

#### Légende



Dispositif de déclenchement sensible au courant



Circuit d'alimentation



Circuit de soudage

$V_x$  Entre circuit d'alimentation et parties conductrices accessibles

$V_y$  Entre circuit de soudage et parties conductrices accessibles

$V_z$  Entre circuit d'alimentation et circuit de soudage

Figure B.1 – Transformateurs haute tension combinés

## Annexe C (normative)

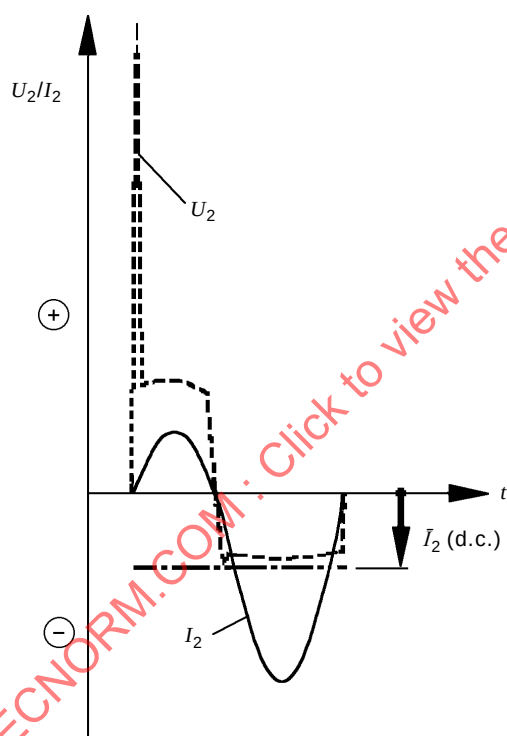
### Charge déséquilibrée dans le cas de sources de courant de soudage à l'arc en atmosphère inerte avec électrode de tungstène (TIG) en courant alternatif

#### C.1 Généralités

Dans le soudage en atmosphère inerte avec électrode de tungstène en courant alternatif, la différence dans la capacité d'émission de l'électrode et de la pièce mise en œuvre provoque un déséquilibre de la tension de soudage et un déséquilibre correspondant du **courant de soudage**.

Ce déséquilibre est appelé composante continue et peut provoquer une saturation du transformateur d'une source de courant de soudage du type à transformateur. Une telle saturation crée un courant d'alimentation anormalement élevé qui peut provoquer une surchauffe sévère.

La Figure C.1 indique que le **courant de soudage** a une composante continue  $\bar{I}_2$  qui peut surchauffer l'enroulement de la source de courant de soudage.



#### Légende


- $U_2$  Tension de soudage
- $I_2$  Courant de soudage
- $\bar{I}_2$  Valeur arithmétique moyenne du courant de soudage

IEC

Figure C.1 – Tension et courant au cours du soudage TIG en courant alternatif

## C.2 Charge déséquilibrée

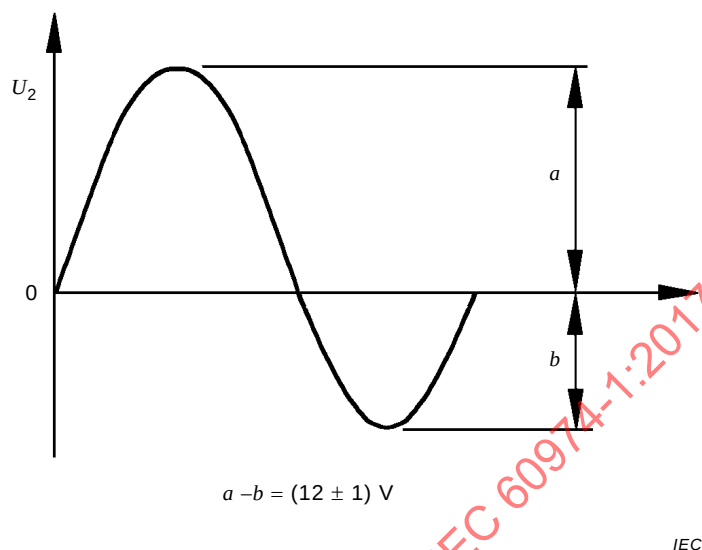Afin de simuler les **courants de soudage** exigés dans le cadre de l'essai d'échauffement, une **charge conventionnelle** avec une caractéristique de redressement partielle doit être utilisée de telle façon que, quand la polarité de l'électrode est négative, la tension à mi-cycle soit de  $(12 \pm 1)$  V inférieure à la tension à mi-cycle quand la polarité de l'électrode est positive (voir Figure C.2).



### Légende

$a$  tension de crête quand l'électrode est positive

$b$  tension de crête quand l'électrode est négative

**Figure C.2 – Tension déséquilibrée au cours du soudage TIG en courant alternatif**

Cette différence entre les tensions de soudage à mi-cycle est déterminée en faisant passer un courant d'essai continu à travers la charge déséquilibrée dans les deux directions et en mesurant la **tension en charge** en courant continu.

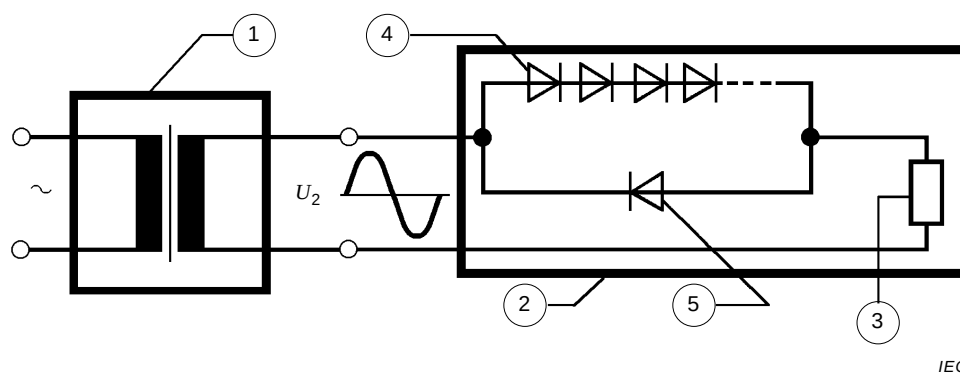
Les sources de courant de soudage incorporant une commande d'équilibre sont soumises à l'essai avec une **charge conventionnelle**, la commande d'équilibre étant ajustée à la condition qui produit le déséquilibre maximal mais non supérieur à 12 V.

## C.3 Exemple d'une charge déséquilibrée

Les caractéristiques de redressement de la charge sont obtenues par un circuit de diodes conformément à la Figure C.3.

La différence de tension exigée entre les tensions à mi-cycle est adaptée par le nombre de diodes montées en série.





**Légende**

- |   |                      |   |                        |   |              |
|---|----------------------|---|------------------------|---|--------------|
| 1 | Transformateur       | 3 | Charge conventionnelle | 5 | Diode unique |
| 2 | Charge déséquilibrée | 4 | Série de diodes        |   |              |

**Figure C.3 – Source de courant alternatif de soudage avec charge déséquilibrée**

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annexe D (informative)

### Extrapolation de température par rapport au temps de coupure

Lorsque l'enregistrement de la température au moment de la coupure n'est pas possible, il est nécessaire d'extrapoler pour obtenir cette température. La procédure d'extrapolation est la suivante:

- a) le temps est marqué au moment de la coupure;
- b) des lectures successives de températures sont faites en notant pour chacune le temps écoulé à partir de la coupure;
- c) un minimum de quatre lectures est fait pour chaque température à extrapoler;
- d) les lectures sont portées sur un papier logarithmique/linéaire, la température étant sur l'échelle logarithmique et le temps écoulé depuis la coupure sur l'échelle linéaire. Une ligne droite tracée en arrière jusqu'au point  $t = 0$  donne la température extrapolée au moment de la coupure.

Variante: Une analyse mathématique par régression peut être utilisée comme variante de la méthode graphique. Si une régression linéaire est choisie, les logarithmes des températures et les valeurs linéaires des temps de lecture à partir de la coupure sont utilisés. L'analyse par régression est effectuée pendant le temps  $t = 0$  et l'antilogarithme est pris pour déterminer la température vraie.

## Annexe E (normative)

### Construction des bornes de raccordement du circuit d'alimentation

#### E.1 Dimensions des bornes

Les bornes doivent être dimensionnées selon le **courant d'alimentation effectif maximal**  $I_{1\text{eff}}$ , et il doit être possible de fixer les conducteurs souples ayant les sections indiquées au Tableau E.1. Ces valeurs sont basées sur un fil prévu pour 60 °C.

**Tableau E.1 – Plage de dimensions des conducteurs à introduire dans les bornes du circuit d'alimentation**

| Courant d'alimentation effectif maximal<br>A | Plage de sections du conducteur<br>mm <sup>2</sup> |
|----------------------------------------------|----------------------------------------------------|
| 10                                           | 1,5 à 2,5                                          |
| 16                                           | 1,5 à 4                                            |
| 25                                           | 2,5 à 6                                            |
| 35                                           | 4 à 10                                             |
| 50                                           | 6 à 16                                             |
| 63                                           | 10 à 25                                            |
| 80                                           | 16 à 35                                            |
| 100                                          | 25 à 50                                            |
| 125                                          | 35 à 70                                            |
| 160                                          | 50 à 95                                            |
| 200                                          | 70 à 120                                           |
| 250                                          | 95 à 150                                           |
| 315                                          | 120 à 240                                          |
| 400                                          | 150 à 300                                          |

D'autres plages de sections sont permises si le constructeur indique dans les instructions d'emploi le type et la section des conducteurs à utiliser.

*La conformité doit être vérifiée par calcul et par mesurage.*

#### E.2 Raccordement aux bornes

Le raccordement aux bornes doit être réalisé au moyen de vis, d'écrous ou d'autres moyens équivalents et doit satisfaire aux exigences données au 5.3.

NOTE Les bornes électriques à connexion rapide sont définies comme étant équivalentes si elles sont équipées de deux fixations indépendantes, l'une serrant l'isolation et l'autre serrant le conducteur.

Les vis ou les écrous des bornes ne doivent pas être utilisés pour fixer d'autres parties ou raccorder d'autres conducteurs.

*La conformité doit être vérifiée par examen visuel.*

### E.3 Construction des bornes

Les conducteurs ou leurs cosses doivent être serrés entre des parties métalliques et ne doivent pas pouvoir s'échapper lorsque les moyens de fixation sont serrés.

Les parties actives qui peuvent tourner et réduire la **distance d'isolement dans l'air** ne doivent pas dépendre du frottement entre les surfaces de montage pour empêcher leur rotation. Une rondelle frein adaptée, montée correctement, doit être acceptable. Les conducteurs ou les barres omnibus qui sont fixés par d'autres moyens n'ont pas besoin d'avoir une rondelle frein.

Le fer ou l'acier, nu ou revêtu, ne doit pas être utilisé pour les parties transportant le courant.

*La conformité doit être vérifiée par **examen visuel** et en montant provisoirement des conducteurs ayant les sections minimales et maximales spécifiées.*

### E.4 Fixation des bornes

Les bornes doivent être fixées de façon sûre, de sorte qu'elles ne puissent se dévisser lorsque les moyens de fixation sont serrés ou desserrés. De plus, si seul le frottement empêche les bornes de tourner ou de se déplacer sur la surface d'appui, la rotation ou le déplacement ne doit pas réduire les **distances d'isolement dans l'air** entre bornes en dessous des valeurs du Tableau 1. Il n'est pas nécessaire d'empêcher un connecteur à pression de tourner si aucune **distance d'isolement dans l'air** ne devient inférieure aux distances exigées lorsque les bornes sont tournées de 30° l'une vers l'autre, vers d'autres parties non isolées de polarité opposée ou vers des parties métalliques mises à la terre.

*La conformité doit être vérifiée par **examen visuel** et en vissant et dévissant 10 fois les moyens de fixation, un conducteur de la section maximale spécifiée étant en place.*

L'essai doit être répété avec un conducteur de la section minimale spécifiée.

## Annexe F (informative)

### Correspondance avec les unités non SI

Les correspondances avec les unités non SI pour l'essai de court-circuit (voir 9.3) sont données au Tableau F.1.

Tableau F.1 – Correspondance entre les mm<sup>2</sup> et les dimensions américaines (AWG)

| mm <sup>2</sup> | AWG     |
|-----------------|---------|
| 1,5             | 15      |
| 2,5             | 13      |
| 4               | 11      |
| 6               | 9       |
| 10              | 7       |
| 16              | 5       |
| 25              | 3       |
| 35              | 1       |
| 50              | 1/0     |
| 70              | 2/0     |
| 95              | 3/0     |
| 120             | 250 MCM |
| 150             | 350 MCM |
| 240             | 600 MCM |
| 300             | 700 MCM |

## Annexe G (informative)

### Adaptation du réseau d'alimentation pour le mesurage de la valeur efficace vraie du courant d'alimentation

Les valeurs de crête et les valeurs efficaces du courant d'alimentation ( $I_1$ ) peuvent être considérablement affectées par l'impédance du réseau d'alimentation ( $R_s$ ). Pour obtenir des résultats de mesure valables, l'impédance du réseau d'alimentation est inférieure de 4 % au maximum à l'impédance de l'alimentation de la source de courant de soudage:

$$R_s \leq 0,04 \frac{U_1}{I_1} (\Omega) \quad (G.1)$$

où

$R_s$  est l'impédance du réseau d'alimentation en ohms;

$U_1$  est la **tension assignée d'alimentation** en volts;

$I_1$  est le **courant assigné d'alimentation** en ampères.

Pour déterminer l'impédance du réseau d'alimentation, il est chargé par une **charge conventionnelle** qui est capable de réduire la tension d'alimentation d'au moins 1 % sous la valeur non chargée.

NOTE 1 Si la tension assignée de cette **charge conventionnelle** est inférieure à la tension d'alimentation, un transformateur peut être utilisé.

NOTE 2 Les régulateurs automatiques de la tension du réseau d'alimentation sont coupés.

NOTE 3 Si un transformateur est utilisé,  $I_1$  sans charge est le courant à vide de ce transformateur, autrement  $I_1$  sans charge = 0 A.

L'impédance du réseau d'alimentation est calculée à partir de la formule suivante:

$$R_s = \frac{U_{1 \text{ sans charge}} - U_{1 \text{ avec charge}}}{I_{1 \text{ avec charge}} - I_{1 \text{ sans charge}}} (\Omega) \quad (G.2)$$

où

$R_s$  est l'impédance du réseau d'alimentation en ohms;

$U_{1 \text{ avec charge}}$  est la tension d'alimentation en volts lorsque le réseau est chargé par une **charge conventionnelle**;

$U_{1 \text{ sans charge}}$  est la tension d'alimentation en volts lorsque le réseau est sans charge;

$I_{1 \text{ avec charge}}$  est le courant d'alimentation en ampères lorsque le réseau est chargé par une **charge conventionnelle**;

$I_{1 \text{ sans charge}}$  est le courant d'alimentation en ampères sans charge.

Exemple:

Réseau d'alimentation:  $U_1$  sans charge = 230 V  $I_1$  sans charge = 1 A  
 $U_1$  avec charge = 227 V  $I_1$  avec charge = 31 A

$$R_s = \frac{230 - 227}{31 - 1} = 0,10 \, \Omega$$

Source de courant de soudage:  $U_1 = 230 \, V$   $I_{1\max} = 30 \, A$

Avec ces valeurs, la condition conforme à la Formule (G.1) est remplie:

$$R_s = 0,10 \, \Omega \leq 0,04 \frac{230}{30} = 0,31 \, \Omega$$

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annexe H (informative)

### Traçage des caractéristiques statiques

#### H.1 Généralités

En faisant varier la résistance d'une **charge conventionnelle** connectée aux bornes de sortie de la source de courant de soudage, il peut être obtenu un ensemble de valeurs du **courant de soudage** ( $I_2$ ) et de la **tension en charge** ( $U_2$ ) correspondante, pour un réglage donné de sortie de la source de courant de soudage. La **caractéristique statique** est obtenue en reportant ces valeurs sur une courbe avec le **courant de soudage** en abscisse et la **tension en charge** en ordonnée.

La pente de la **caractéristique statique** est donnée par sa tangente au point de fonctionnement.

#### H.2 Méthode

Il convient que le nombre de valeurs mesurées soit suffisant pour permettre de tracer une courbe lisse. Dans tous les cas, il convient d'enregistrer la **tension à vide** et les **valeurs assignées** correspondant à chaque **facteur de marche** indiqué sur la **plaque signalétique**. Pour les sources de courant de soudage à **caractéristique tombante**, il convient aussi d'enregistrer le courant de court-circuit.

Si la source de courant de soudage a un réglage pas à pas, il convient de mesurer les valeurs pour chaque position de la commande. Si une source de courant de soudage est conçue pour plusieurs tensions d'alimentation, il convient de répéter le mesurage pour chacune de ces tensions.

Pour chaque point, il convient d'enregistrer également la tension d'alimentation ( $U_1$ ), le courant d'alimentation ( $I_1$ ), la puissance fournie à la source de courant de soudage ( $P_1$ ).

Pour les sources de courant de soudage sans régulation en boucle (par exemple les transformateurs simples), il convient de multiplier les valeurs de  $U_2$  et  $I_2$  par un facteur de correction ( $U_1/U_1'$ ) si la tension d'alimentation mesurée ( $U_1'$ ) diffère de la **tension assignée d'alimentation** ( $U_1$ ). Il convient de multiplier la puissance ( $P_1$ ) par  $(U_1/U_1')^2$ .

#### H.3 Analyse des résultats

Les séries de courbes obtenues pour les **caractéristiques statiques** d'une source de courant de soudage peuvent être utilisées pour vérifier la conformité aux exigences correspondantes du présent document. Si la pente négative au point de fonctionnement est supérieure ou égale à 7 V pour 100 A, la **caractéristique statique** est considérée comme tombante.



## Annexe I (normative)

### Méthodes d'essai pour un choc de 10 Nm


#### I.1 Marteau pendulaire de choc

La source de courant de soudage est placée contre une surface verticale rigide et l'impact est dirigé contre le côté opposé.

L'angle de rotation  $\theta$  (voir Figure I.1) est ajusté (voir Tableau I.1) pour tenir compte des tolérances du marteau et des bras afin de fournir l'énergie de choc de 10 Nm exigée.

Tableau I.1 – Angle de rotation  $\theta$  pour obtenir un choc de 10 Nm
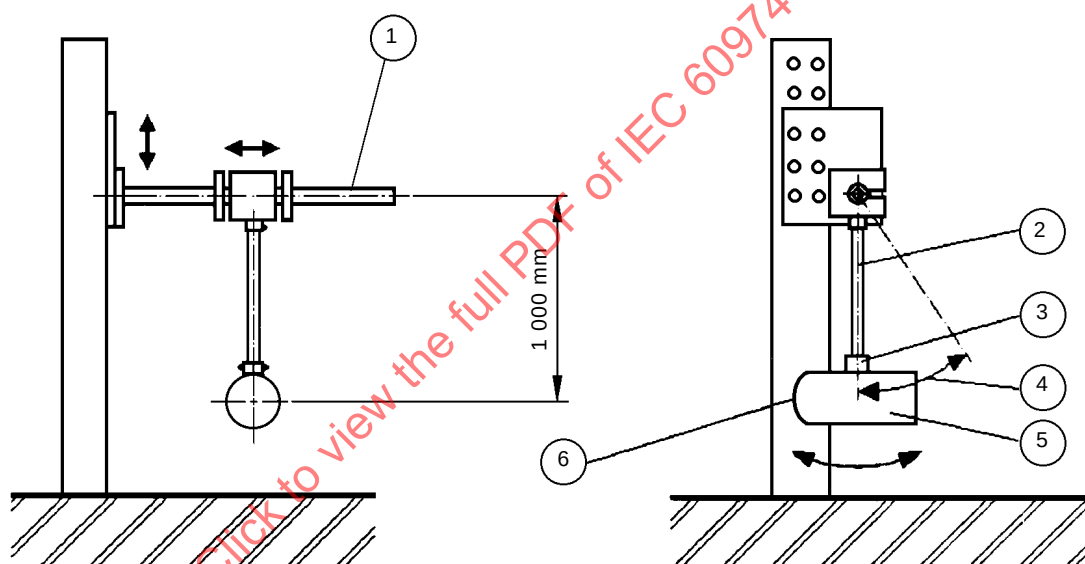
| Masse du marteau (kg)              | 1  | 1,5 | 2  | 2,5 | 3  |
|------------------------------------|----|-----|----|-----|----|
| Angle de rotation $\theta$ (degré) | 90 | 71  | 60 | 53  | 48 |



IEC

#### Légende

- 1 Arbre support (il convient qu'il ne fléchisse pas de plus de 1,5 mm)
- 2 Bras, tube d'acier (sa masse est négligeable)
- 3 Collier de marteau (masse inférieure ou égale à 100 g)
- 4 Angle de rotation  $\theta$
- 5 Marteau de choc en acier
- 6 Rayon ( $50 \pm 2$ ) mm

Figure I.1 – Montage d'essai

## I.2 Corps de chute sphérique en acier

La source de courant de soudage est posée sur une surface rigide horizontale. La masse du corps de chute et la hauteur de chute sont données au Tableau I.2.

**Tableau I.2 – Masse du corps de chute et hauteur de chute**

|                    |      |      |      |      |      |      |      |
|--------------------|------|------|------|------|------|------|------|
| <b>Masse (kg)</b>  | 0,50 | 0,75 | 1,00 | 1,25 | 1,50 | 1,75 | 2,00 |
| <b>Hauteur (m)</b> | 2,04 | 1,36 | 1,02 | 0,82 | 0,68 | 0,58 | 0,51 |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## **Annexe J** (normative)

### **Épaisseur des tôles métalliques pour enveloppes**

L'épaisseur minimale des tôles métalliques pour enveloppes doit être

- a) pour l'acier, conforme au Tableau J.1;
- b) pour l'aluminium, laiton ou cuivre, conforme au Tableau J.2.

Les valeurs d'épaisseur sont basées sur une déflexion uniforme des épaisseurs des tôles métalliques indiquées, si elles sont chargées au centre de leur surface.

L'épaisseur d'une enveloppe peut être inférieure aux épaisseurs indiquées dans les Tableaux J.1 et J.2 si l'enveloppe présente la même déflexion qu'une enveloppe de même dimension ayant l'épaisseur exigée.

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

**Tableau J.1 – Épaisseur minimale des tôles pour les enveloppes en acier**

| Épaisseur minimale de l'acier non revêtu <sup>a</sup><br>mm                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Sans structure de support <sup>b</sup> |                         | Avec structure de support <sup>c</sup> |                         |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|-------------------------|----------------------------------------|-------------------------|
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Largeur maximale<br>mm                 | Longueur maximale<br>mm | Largeur maximale<br>mm                 | Longueur maximale<br>mm |
| 0,50                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 105<br>125                             | Non limitée<br>150      | 160<br>175                             | Non limitée<br>210      |
| 0,65                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 155<br>180                             | Non limitée<br>225      | 245<br>255                             | Non limitée<br>320      |
| 0,80                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 205<br>230                             | Non limitée<br>300      | 305<br>330                             | Non limitée<br>410      |
| 1,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 320<br>360                             | Non limitée<br>460      | 500<br>535                             | Non limitée<br>635      |
| 1,35                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 460<br>510                             | Non limitée<br>635      | 690<br>740                             | Non limitée<br>915      |
| 1,50                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 560<br>635                             | Non limitée<br>790      | 840<br>890                             | Non limitée<br>1 095    |
| 1,70                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 635<br>740                             | Non limitée<br>915      | 995<br>1 045                           | Non limitée<br>1 295    |
| 2,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 840<br>890                             | Non limitée<br>1 200    | 1 295<br>1 375                         | Non limitée<br>1 680    |
| 2,35                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 1 070<br>1 200                         | Non limitée<br>1 500    | 1 630<br>1 730                         | Non limitée<br>2 135    |
| 2,70                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 1 325<br>1 525                         | Non limitée<br>1 880    | 2 035<br>2 135                         | Non limitée<br>2 620    |
| 3,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | 1 600<br>1 860                         | Non limitée<br>2 290    | 2 470<br>2 620                         | Non limitée<br>3 230    |
| <sup>a</sup> 1) Pour l'acier inoxydable, uniquement 80 % des valeurs indiquées sont nécessaires.<br>2) Pour l'acier revêtu de zinc, l'épaisseur doit être réglée pour tenir compte de l'épaisseur du revêtement (normalement 0,05 mm à 0,1 mm).<br><sup>b</sup> Une enveloppe sans structure de support peut être constituée, par exemple:<br>1) d'une seule feuille à bords tombés d'un seul côté;<br>2) d'une seule feuille qui est ondulée ou nervurée;<br>3) d'une surface d'enveloppe qui est fixée avec du jeu à une structure, par exemple par des clips à ressort ou un loquet;<br>4) d'une surface d'enveloppe ayant un bord sans support.<br><sup>c</sup> Ces deux colonnes s'appliquent lorsque l'enveloppe est renforcée par un des moyens suivants:<br>1) une structure de support sous forme de canal structural, angle ou section rigide pliée qui est au moins égale à l'épaisseur de métal de l'enveloppe et qui est fixée de façon rigide à l'enveloppe;<br>2) une structure de support autre que métallique qui a une rigidité de torsion équivalant à une cornière de tôle conformément à 1) ci-dessus, et qui est résistante au feu;<br>3) tous les bords de l'enveloppe sont pliés à un angle de 90° pour former un bord tombé d'un seul côté de largeur minimale de 10 mm. |                                        |                         |                                        |                         |

**Tableau J.2 – Épaisseur minimale des tôles pour enveloppes  
d'aluminium, de laiton ou de cuivre**

| Épaisseur minimale<br>du métal<br>mm | Sans structure de support <sup>a</sup> |                         | Avec structure de support <sup>b</sup> |                         |
|--------------------------------------|----------------------------------------|-------------------------|----------------------------------------|-------------------------|
|                                      | Largeur maximale<br>mm                 | Longueur maximale<br>mm | Largeur maximale<br>mm                 | Longueur maximale<br>mm |
| 0,55                                 | 80<br>90                               | Non limitée<br>110      | 180<br>220                             | Non limitée<br>245      |
| 0,70                                 | 105<br>130                             | Non limitée<br>155      | 260<br>270                             | Non limitée<br>345      |
| 0,90                                 | 155<br>165                             | Non limitée<br>205      | 360<br>385                             | Non limitée<br>460      |
| 1,10                                 | 205<br>245                             | Non limitée<br>295      | 485<br>535                             | Non limitée<br>640      |
| 1,45                                 | 305<br>360                             | Non limitée<br>410      | 715<br>765                             | Non limitée<br>940      |
| 1,90                                 | 460<br>510                             | Non limitée<br>635      | 1 070<br>1 145                         | Non limitée<br>1 400    |
| 2,40                                 | 635<br>740                             | Non limitée<br>915      | 1 525<br>1 630                         | Non limitée<br>1 985    |
| 3,10                                 | 940<br>1 070                           | Non limitée<br>1 350    | 2 210<br>2 365                         | Non limitée<br>2 900    |
| 3,85                                 | 1 325<br>1 525                         | Non limitée<br>1 880    | 3 125<br>3 305                         | Non limitée<br>4 065    |

<sup>a</sup> Une enveloppe sans structure de support peut être constituée, par exemple:

- 1) d'une seule feuille à bords tombés d'un seul côté;
- 2) d'une seule feuille qui est ondulée ou nervurée;
- 3) d'une surface d'enveloppe qui est fixée avec du jeu à une structure, par exemple par des clips à ressort ou un loquet;
- 4) d'une surface d'enveloppe ayant un bord sans support.

<sup>b</sup> Ces deux colonnes s'appliquent lorsque l'enveloppe est renforcée par un des moyens suivants:

- 1) une structure de support sous forme de canal structural, angle, ou section rigide pliée qui est au moins égale à l'épaisseur de métal de l'enveloppe et qui est fixée de façon rigide à l'enveloppe;
- 2) une structure de support autre que métallique qui a une rigidité de torsion équivalant à une cornière de tôle conformément à a) ci-dessus, et qui est résistante au feu;
- 3) tous les bords de l'enveloppe sont pliés à un angle de 90° pour former un bord tombé d'un seul côté de largeur minimale de 10 mm.

## Annexe K (informative)


### Exemples de plaques signalétiques

Les Figures K.1 à K.7 donnent des exemples de plaques signalétiques.

|                                                                                                      |                           |                                         |                                                                                         |            |                                      |  |
|------------------------------------------------------------------------------------------------------|---------------------------|-----------------------------------------|-----------------------------------------------------------------------------------------|------------|--------------------------------------|--|
| a) Identification                                                                                    |                           |                                         |                                                                                         |            |                                      |  |
| 1) Constructeur                                                                                      |                           | Marque commerciale                      |                                                                                         |            |                                      |  |
| Adresse                                                                                              |                           |                                         |                                                                                         |            |                                      |  |
| 2) Type                                                                                              |                           | 3) Numéro de série                      |                                                                                         |            |                                      |  |
| 4)                  |                           | 5) IEC 60974-1<br>IEC 60974-10 Classe A |                                                                                         |            |                                      |  |
| b) Sortie de soudage                                                                                 |                           |                                         |                                                                                         |            |                                      |  |
| 6)                  | 8) ~50 Hz                 | 10) 15 A / 20,6 V à 160 A / 27 V        |                                                                                         |            |                                      |  |
|                                                                                                      |                           | 11) X                                   | 11a) 35 %                                                                               | 11b) 60 %  | 11c) 100 %                           |  |
| 7)                 | 9) $U_0 = 48 \text{ V}$   | 12) $I_2$                               | 12a) 160 A                                                                              | 12b) 130 A | 12c) 100 A                           |  |
|                                                                                                      |                           | 13) $U_2$                               | 13a) 26 V                                                                               | 13b) 25 V  | 13c) 24 V                            |  |
| c) Alimentation en énergie                                                                           |                           |                                         |                                                                                         |            |                                      |  |
| 14) <br>1 ~ 50 Hz | 15) $U_1 = 230 \text{ V}$ |                                         | 16) $I_{1\text{max}} = 37 \text{ A}$                                                    |            | 17) $I_{1\text{eff}} = 22 \text{ A}$ |  |
|                                                                                                      | 22) IP23                  |                                         | 23)  |            |                                      |  |

IEC

Figure K.1 – Transformateur monophasé

|                                                                                       |  |                                   |                                         |                                      |            |            |
|---------------------------------------------------------------------------------------|--|-----------------------------------|-----------------------------------------|--------------------------------------|------------|------------|
| a) Identification                                                                     |  |                                   |                                         |                                      |            |            |
| 1) Constructeur<br>Adresse                                                            |  |                                   | Marque commerciale                      |                                      |            |            |
| 2) Type                                                                               |  |                                   | 3) Numéro de série                      |                                      |            |            |
| 4)   |  |                                   | 5) IEC 60974-1<br>IEC 60974-10 Classe A |                                      |            |            |
| b) Sortie de soudage                                                                  |  |                                   |                                         |                                      |            |            |
| 6)   |  | 8) ~450 Hz                        | 10) 60 A / 22,4 V à 500 A / 40 V        |                                      |            |            |
|                                                                                       |  | 11) X                             | 11a) 35 %                               | 11b) 60 %                            | 11c) 100 % |            |
| 7)                                                                                    |  | 9) $U_0 = 78 \text{ V}$           | 12) $I_2$                               | 12a) 500 A                           | 12b) 400 A | 12c) 320 A |
|                                                                                       |  | 13) $U_2$                         | 13a) 40 V                               | 13b) 36 V                            | 13c) 33 V  |            |
| c) Alimentation en énergie                                                            |  |                                   |                                         |                                      |            |            |
| 14)  |  | 18) $n = 2\,800 \text{ min}^{-1}$ |                                         |                                      |            |            |
| 3 ~ 50 Hz                                                                             |  | 15) $U_1 = 400 \text{ V}$         | 16) $I_{1\text{max}} = 68 \text{ A}$    | 17) $I_{1\text{eff}} = 40 \text{ A}$ |            |            |
| 22) IP23                                                                              |  |                                   | 23)                                     |                                      |            |            |


IEC

Figure K.2 – Convertisseur de fréquence rotatif triphasé

**Plaque concernant le distributeur**

|                   |                    |
|-------------------|--------------------|
| a) Identification |                    |
| 1) Constructeur   | Marque commerciale |
| Adresse           |                    |
| 2) Type           | 3) Numéro de série |


**Plaque concernant le constructeur**

|                                                                                                         |                                                                                         |                                                                          |                                                                          |            |
|---------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|--------------------------------------------------------------------------|--------------------------------------------------------------------------|------------|
| a) Identification                                                                                       |                                                                                         |                                                                          |                                                                          |            |
| 4)                     | 5) IEC 60974-1<br>IEC 60974-10 Classe A                                                 |                                                                          |                                                                          |            |
| b) Sortie de soudage                                                                                    |                                                                                         |                                                                          |                                                                          |            |
| 6)                     | 8)     | 10) 20 A / 20,8 V à 250 A / 30 V                                         |                                                                          |            |
|                                                                                                         |                                                                                         | 11) X                                                                    | 11a) 35 %                                                                | 11b) 60 %  |
|                                                                                                         |                                                                                         |                                                                          | 11c) 100 %                                                               |            |
| 7)                     | 9) $U_0 = 105 \text{ V}$                                                                | 12) $I_2$                                                                | 12a) 250 A                                                               | 12b) 200 A |
|                                                                                                         |                                                                                         |                                                                          | 12c) 160 A                                                               |            |
|                                                                                                         |                                                                                         | 13) $U_2$                                                                | 13a) 30 V                                                                | 13b) 28 V  |
|                                                                                                         |                                                                                         |                                                                          | 13c) 27 V                                                                |            |
| c) Alimentation en énergie                                                                              |                                                                                         |                                                                          |                                                                          |            |
| 14) <br>1(3) ~ 50 Hz | 15) $U_1 = 230 \text{ V}$<br>$U_1 = 400 \text{ V}$                                      | 16) $I_{1\text{max}} = 57 \text{ A}$<br>$I_{1\text{max}} = 34 \text{ A}$ | 17) $I_{1\text{eff}} = 34 \text{ A}$<br>$I_{1\text{eff}} = 20 \text{ A}$ |            |
| 22) IP23                                                                                                | 23)  |                                                                          |                                                                          |            |

IEC


**Figure K.3 – Plaque signalétique subdivisée: transformateur redresseur mono-/triphase**



|                                                                                       |                                                                                      |                                  |                                       |            |            |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|----------------------------------|---------------------------------------|------------|------------|
| a) Identification                                                                     |                                                                                      |                                  |                                       |            |            |
| 1) Constructeur                                                                       |                                                                                      | Marque commerciale               |                                       |            |            |
| Adresse                                                                               |                                                                                      |                                  |                                       |            |            |
| 2) Type                                                                               |                                                                                      | 3) Numéro de série               |                                       |            |            |
| 4)   |                                                                                      | 5) IEC 60974-1                   |                                       |            |            |
| b) Sortie de soudage                                                                  |                                                                                      |                                  |                                       |            |            |
| 6)   | 8)  | 10) 40 A / 21,6 V à 400 A / 36 V |                                       |            |            |
|                                                                                       |                                                                                      | 11) X                            | 11a) 35 %                             | 11b) 60 %  | 11c) 100 % |
| 7)   | 9) $U_0 = 110 \text{ V}$                                                             | 12) $I_2$                        | 12a) 400 A                            | 12b) 320 A | 12c) 255 A |
|                                                                                       |                                                                                      | 13) $U_2$                        | 13a) 36 V                             | 13b) 33 V  | 13c) 30 V  |
| c) Alimentation en énergie                                                            |                                                                                      |                                  |                                       |            |            |
| 14)  | 18) $n = 3\,150 \text{ min}^{-1}$                                                    |                                  |                                       |            |            |
|                                                                                       | 19) $n_0 = 3\,300 \text{ min}^{-1}$                                                  | 20) $n_i = 980 \text{ min}^{-1}$ | 21) $P_{1\text{max}} = 34 \text{ kW}$ |            |            |
| 22) IP23                                                                              | 23)                                                                                  |                                  |                                       |            |            |

IEC

Figure K.4 – Moteur thermique-générateur-redresseur

|                                                                                       |                                                                                      |                                                                                         |                                       |            |            |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|---------------------------------------|------------|------------|
| a) Identification                                                                     |                                                                                      |                                                                                         |                                       |            |            |
| 1) Constructeur                                                                       |                                                                                      | Marque commerciale                                                                      |                                       |            |            |
| Adresse                                                                               |                                                                                      |                                                                                         |                                       |            |            |
| 2) Type                                                                               |                                                                                      | 3) Numéro de série                                                                      |                                       |            |            |
| 4)   |                                                                                      | 5) IEC 60974-1<br>IEC 60974-10 Classe A                                                 |                                       |            |            |
| b) Sortie de soudage                                                                  |                                                                                      |                                                                                         |                                       |            |            |
| 6)   | 8)  | 10) 20 A / 20,8 V à 250 A / 32 V                                                        |                                       |            |            |
|                                                                                       |                                                                                      | 11) X                                                                                   | 11a) 35 %                             | 11b) 60 %  | 11c) 100 % |
| 7)   | 9) $U_0 = 105 \text{ V}$                                                             | 12) $I_2$                                                                               | 12a) 250 A                            | 12b) 200 A | 12c) 160 A |
|                                                                                       |                                                                                      | 13) $U_2$                                                                               | 13a) 30 V                             | 13b) 28 V  | 13c) 27 V  |
| c) Alimentation en énergie                                                            |                                                                                      |                                                                                         |                                       |            |            |
| 14)  | 15) $U_1$<br>230 V<br>400 V                                                          | 16) $I_{1\max}$<br>57 A<br>34 A                                                         | 17) $I_{1\text{eff}}$<br>34 A<br>20 A |            |            |
| 22) IP23S                                                                             |                                                                                      | 23)  |                                       |            |            |

IEC

Figure K.5 – Type d'onduleur mono-/triphase

|                                                                                       |                                                                                      |                                         |                          |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|-----------------------------------------|--------------------------|
| a) Identification                                                                     |                                                                                      |                                         |                          |
| 1) Constructeur<br>Adresse                                                            |                                                                                      | Marque commerciale                      |                          |
| 2) Type                                                                               |                                                                                      | 3) Numéro de série                      |                          |
| 4) Li-ion                                                                             |                                                                                      | 5) IEC 60974-1<br>IEC 60974-10 Classe A |                          |
| b) Sortie de soudage                                                                  |                                                                                      |                                         |                          |
| 6)   | 8)  | 10) 10 A / 20,4 V à 120 A / 24,8 V      |                          |
| 7)   | 9) $U_0 = 58 \text{ V}$                                                              | 12) $I_{2\max} = 120 \text{ A}$         |                          |
|                                                                                       |                                                                                      | 13) $U_2 = 24,8 \text{ V}$              |                          |
| c) Alimentation en énergie                                                            |                                                                                      |                                         |                          |
| 14)  | 15) $U_b = 57,6 \text{ V}$                                                           | 16) $E = 5 \text{ Ah}$                  | 17) $I_b = 10 \text{ A}$ |
|                                                                                       | 19) Pour utilisation uniquement avec chargeur _____                                  |                                         |                          |
| 22) IP23                                                                              |                                                                                      |                                         |                          |

IEC

Figure K.6 – Source de courant de soudage alimentée par batterie incorporée

**Plaque concernant la source de courant de soudage**

|                                                                                       |                                                                                      |                                         |  |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|-----------------------------------------|--|
| a) Identification                                                                     |                                                                                      |                                         |  |
| 1) Constructeur                                                                       |                                                                                      | Marque commerciale                      |  |
| Adresse                                                                               |                                                                                      |                                         |  |
| 2) Type                                                                               |                                                                                      | 3) Numéro de série                      |  |
| 4)                                                                                    |                                                                                      | 5) IEC 60974-1<br>IEC 60974-10 Classe A |  |
| b) Sortie de soudage                                                                  |                                                                                      |                                         |  |
| 6)   | 8)  | 10) 10 A / 20,4 V à 120 A / 24,8 V      |  |
| 7)   | 9) $U_0 = 58 \text{ V}$                                                              | 12) $I_{2\text{max}} = 120 \text{ A}$   |  |
|                                                                                       |                                                                                      | 13) $U_2 = 24,8 \text{ V}$              |  |
| c) Alimentation en énergie                                                            |                                                                                      |                                         |  |
| 14)  | 15) $U_b = 57,6 \text{ V}$                                                           |                                         |  |
|                                                                                       | 19) Pour utilisation uniquement avec batterie _____                                  |                                         |  |
| 22) IP23                                                                              |                                                                                      |                                         |  |

**Plaque concernant la batterie**

|                                                             |                       |
|-------------------------------------------------------------|-----------------------|
| d) Blocs de batteries démontables et amovibles              |                       |
| 1) type (identification) tel que fourni par le constructeur |                       |
| Li-ion                                                      | Année et code de date |
| $U_b = 57,6 \text{ V}$                                      | $E = 5 \text{ Ah}$    |

IEC

**Figure K.7 – Source de courant de soudage alimentée par batterie amovible/démontable**

## Annexe L (informative)

### Symboles graphiques pour le matériel de soudage électrique à l'arc

#### L.1 Généralités

L'Annexe L décrit des symboles qui ne sont pas tous normalisés au niveau international mais d'utilisation pratique dans les applications de soudage. Le comité d'études 26 et le sous-comité 3C de l'IEC ont décidé d'examiner ces symboles en vue de leur possible introduction dans l'IEC 60417. Quand ce travail sera terminé, l'Annexe L sera modifiée en conséquence.

L'Annexe L contient les symboles graphiques destinés aux matériels pour soudage à l'arc et procédés connexes pour identifier les commandes, les indicateurs, les points de connexion, les fonctions et pour sélectionner les procédés.

Les symboles sont destinés à être utilisés sur la face, la **plaque signalétique** et toute documentation pour les matériels de soudage à l'arc et procédés connexes.

L'Annexe L ne couvre pas les symboles graphiques utilisés pour avertir le personnel qui utilise le matériel de dangers personnels immédiats ou potentiels.

NOTE 1 Pour les symboles sur la sécurité, voir l'ISO 3864-1.

NOTE 2 Pour les instructions d'installation, voir l'IEC 60974-9.

#### L.2 Utilisation des symboles

##### L.2.1 Généralités

Il convient de placer ces symboles sur le matériel pour informer sur l'utilisation et le fonctionnement. Des exemples de panneaux de commande sont donnés au L.5.

##### L.2.2 Sélection des symboles

Les symboles indiqués à l'Article L.3 peuvent être utilisés soit seuls soit en combinaison pour atteindre le but recherché. Des exemples de combinaisons sont donnés au L.4.

##### L.2.3 Dimension des symboles

Pour l'utilisation de ces symboles, il peut être nécessaire soit de réduire soit d'agrandir l'original jusqu'à la dimension appropriée. Dans le cas de symboles composés de plusieurs éléments graphiques, ou quand la hauteur est réduite le plus possible, vérifier qu'une identification claire est encore possible et que la lisibilité est suffisante. Il convient aussi de tenir compte de l'éclairage disponible, de l'éloignement de l'utilisateur, et des conditions opératoires possibles en tant que facteurs pour la sélection de la dimension.

La dimension minimale recommandée est de 6 mm.

## L.2.4 Utilisation de la couleur

En général, il convient que la forme graphique d'un symbole reproduite en noir sur blanc ou en blanc sur noir soit suffisante pour son identification.

Pour remplir leur fonction, il est primordial que ces symboles présentent un contraste suffisant avec leur fond. Dans la mesure où le symbole est clairement représenté et complètement lisible, une véritable sélection de couleurs n'est pas obligatoire. Il faut noter que certaines couleurs comme le rouge, l'orange et le jaune sont désignées comme des couleurs d'avertissement sur la sécurité.

## L.3 Symboles

### L.3.1 Généralités

L'Article L.3 présente les symboles avec leur numéro de référence, le mot clé ou une phrase désignant la fonction, l'utilisation et la source.

### L.3.2 Symboles littéraux

Le Tableau L.1 donne une liste de lettres qui peuvent être utilisées comme symboles.

**Tableau L.1 – Lettres utilisées comme symboles**

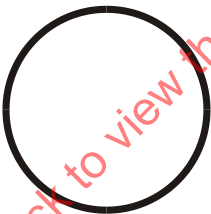
| Fonction, mot clé ou phrase                                                    | Lettre        | Unité             |
|--------------------------------------------------------------------------------|---------------|-------------------|
| Ampérage                                                                       | $I$           | A                 |
| Courant conventionnel de soudage                                               | $I_2$         | A                 |
| Tension conventionnelle de soudage                                             | $U_2$         | V                 |
| Diamètre                                                                       | $\varnothing$ | mm                |
| Cycle de marche; facteur de marche                                             | $X$           | %                 |
| Rendement                                                                      | $\eta$        | %                 |
| Fréquence                                                                      | $f$           | Hz                |
| Puissance en état au ralenti (taux de puissance consommée en état au ralenti)  | $P_i$         | W (W·h/h)         |
| Puissance                                                                      | $P$           | W                 |
| Courant assigné à vide                                                         | $I_0$         | A                 |
| Tension assignée à vide                                                        | $U_0$         | V                 |
| Courant assigné d'alimentation                                                 | $I_1$         | A                 |
| Tension assignée d'alimentation                                                | $U_1$         | V                 |
| Vitesse de rotation                                                            | $n$           | min <sup>-1</sup> |
| Puissance d'alimentation (vitesse de la puissance consommée)                   | $P_1$         | W (W·h/h)         |
| Température (variation)                                                        | $T$           | °C (K)            |
| Temps                                                                          | $t$           | s, min, h         |
| Tension                                                                        | $U$           | V                 |
| Puissance de sortie de soudage (taux d'énergie consommée en sortie de soudage) | $P_2$         | W (W·h/h)         |
| Tension de crête assignée                                                      | $U_p$         | V                 |


### L.3.3 Symboles graphiques

#### L.3.3.1 Symboles pour décrire le bouton ou la commande

| N° | SOURCE                 | SYMBOLE                                                                           | FONCTION, MOT CLÉ OU PHRASE | APPLICATION                                                                                                |
|----|------------------------|-----------------------------------------------------------------------------------|-----------------------------|------------------------------------------------------------------------------------------------------------|
| 1. | IEC 60417-5004:2002-10 |  | Variabilité                 | Pour identifier une augmentation/diminution continue de grandeur<br><br>NOTE Le symbole peut être incurvé. |

#### L.3.3.2 Symboles pour indiquer la position d'un bouton ou d'une commande


| N° | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE                                     | APPLICATION                                                                                                                                                                                                            |
|----|------------------------|-------------------------------------------------------------------------------------|-----------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 2. | IEC 60417-5007:2002-10 |   | Marche (mise sous tension)                                      | Pour identifier la connexion au réseau, au moins pour les interrupteurs primaires et leurs positions, et dans tous les cas où la sécurité est en jeu                                                                   |
| 3. | IEC 60417-5008:2002-10 |  | Arrêt (mise hors tension)                                       | Pour identifier la déconnexion du réseau, au moins pour les interrupteurs primaires et leurs positions, et dans tous les cas où la sécurité est en jeu                                                                 |
| 4. | IEC 60417-5268:2002-10 |  | Position enfoncée d'un bouton-poussoir à deux positions stables | Pour identifier la position enfoncée d'un bouton-poussoir où le poussoir enfoncé est utilisé pour alimenter ou arrêter l'alimentation d'une fonction<br><br>NOTE 1 Ce symbole est utilisé avec un symbole de fonction. |


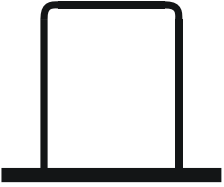
| N° | SOURCE                 | SYMBOLE                                                                            | FONCTION, MOT CLÉ OU PHRASE                                   | APPLICATION                                                                                                                                                                                                           |
|----|------------------------|------------------------------------------------------------------------------------|---------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 5. | IEC 60417-5269:2002-10 |   | Position sortie d'un bouton-poussoir à deux positions stables | Pour identifier la position sortie d'un bouton-poussoir où le poussoir enfoncé est utilisé pour alimenter ou arrêter l'alimentation d'une fonction.<br><br>NOTE 2 Ce symbole est utilisé avec un symbole de fonction. |
| 6. | IEC 60417-5569:2005-08 |   | Fermé                                                         | Pour identifier une fonction ou une commande fermée<br><br>NOTE 3 Ce symbole est utilisé avec un symbole de fonction.                                                                                                 |
| 7. | IEC 60417-5570:2002-10 |  | Ouvert                                                        | Pour identifier une fonction ou une commande ouverte<br><br>NOTE 4 Ce symbole est utilisé avec un symbole de fonction.                                                                                                |

### L.3.3.3 Symboles pour indiquer un bouton ou une commande de fonction




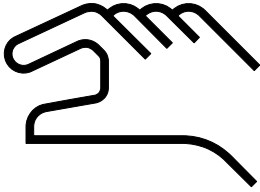
| N° | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE       | APPLICATION                                          |
|----|------------------------|-------------------------------------------------------------------------------------|-----------------------------------|------------------------------------------------------|
| 8. | IEC 60417-6302:2015-01 |  | Soudage continu                   | Pour identifier un soudage continu                   |
| 9. | IEC 60417-6303:2015-01 |  | Soudage intermittent (par points) | Pour identifier un soudage intermittent (par points) |







| N°  | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ<br>OU PHRASE | APPLICATION                                                                       |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------|-----------------------------------------------------------------------------------|
| 10. | ISO 7000-0468:2004-01  |    | Soudage par point à l'arc      | Pour identifier un soudage à l'arc par point                                      |
| 11. | ISO 7000-0096:2004-01  |    | Commande manuelle              | Pour identifier la position du bouton pour la commande manuelle                   |
| 12. | IEC 60417-6318:2015-03 |   | Amorçage de l'arc sans contact | Pour identifier une fonction d'amorçage d'arc TIG qui crée un arc sans contact    |
| 13. | IEC 60417-6319:2015-03 |  | Amorçage de l'arc au contact   | Pour identifier une fonction d'amorçage d'arc TIG qui crée un arc avec un contact |
| 14. |                        |  | Amorçage de l'arc pilote       | Pour identifier un arc pilote partant d'une torche plasma                         |
| 15. | ISO 7000-0474:2004-01  |  | Purge de l'air (par un gaz)    | Pour identifier une purge de l'air par un gaz                                     |

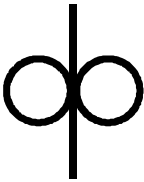
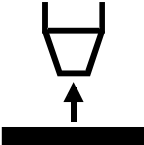
| N°  | SOURCE                | SYMBOLE                                                                             | FONCTION, MOT CLÉ<br>OU PHRASE                                                  | APPLICATION                                                            |
|-----|-----------------------|-------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|------------------------------------------------------------------------|
| 16. | ISO 7000-0823:2004-01 |    | Déroutement du fil                                                              | Pour identifier un dévidoir ou une commande de dévidage de fil         |
| 17. |                       |    | Contrôle de remontée du fil                                                     | Pour identifier une commande de remontée de fil à la fin de la soudure |
| 18. | ISO 7000-0004:2004-01 |   | Sens de mouvement continu de rotation (sens des aiguilles d'une montre)         | Pour identifier la direction d'une rotation continue                   |
| 19. | ISO 7000-0004:2004-01 |  | Sens de mouvement continu de rotation (sens inverse des aiguilles d'une montre) | Pour identifier la direction d'une rotation continue                   |


### L.3.3.4 Symboles pour indiquer une connexion électrique
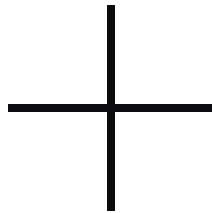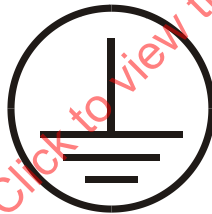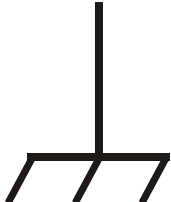
| N°  | SOURCE                     | SYMBOLE                                                                             | FONCTION, MOT CLÉ<br>OU PHRASE | APPLICATION                                                                                                                        |
|-----|----------------------------|-------------------------------------------------------------------------------------|--------------------------------|------------------------------------------------------------------------------------------------------------------------------------|
| 20. | IEC 60417-<br>5005:2002-10 |    | Plus; pôle positif             | Pour identifier une polarité positive                                                                                              |
| 21. | IEC 60417-<br>5006:2002-10 |    | Moins; pôle négatif            | Pour identifier une polarité négative                                                                                              |
| 22. | IEC 60417-<br>5017:2006-08 |   | Terre (sol)                    | Pour identifier la connexion à la terre (sol)<br><br>NOTE 1 N'est pas destiné à une connexion à la terre de protection.            |
| 23. | IEC 60417-<br>5019:2006-08 |  | Terre de protection (sol)      | Pour identifier le point de connexion du matériel à la terre de protection (sol)                                                   |
| 24. | IEC 60417-<br>5020:2002-10 |  | Armature ou châssis            | Pour identifier la connexion de l'armature ou du châssis<br><br>NOTE 2 N'est pas destiné à une connexion à la terre de protection. |
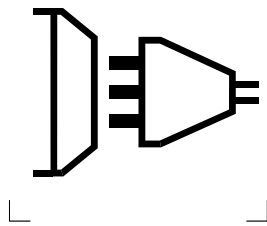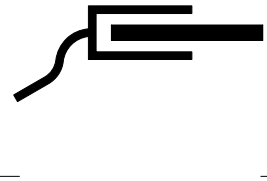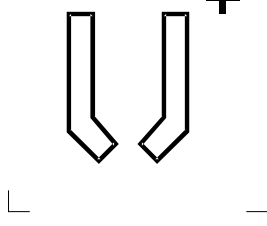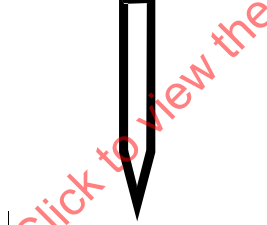
| N°  | SOURCE                     | SYMBOLE                                                                             | FONCTION, MOT CLÉ<br>OU PHRASE                                   | APPLICATION                                                                                                                                                              |
|-----|----------------------------|-------------------------------------------------------------------------------------|------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 25. | IEC 60417-<br>5939:2002-10 |    | Type d'alimentation du<br>dispositif électrique                  | Sur le dispositif ou le matériel<br>par exemple sur le matériel de<br>soudage à l'arc.<br><br>Pour identifier le type<br>d'alimentation, la prise avec<br>trois broches. |
| 26. | ISO 7000-<br>0453:2004-01  |    | Connexion à la pièce à souder                                    | Pour identifier la connexion à<br>la pièce à souder                                                                                                                      |
| 27. | ISO 7000-<br>0483:2004-01  |   | Connexion pour la buse de la<br>torche plasma (pôle positif)     | Pour identifier la connexion à<br>une torche plasma –<br>connexion de la buse au pôle<br>positif                                                                         |
| 28. | ISO 7000-<br>0482:2004-01  |  | Connexion pour l'électrode de<br>la torche plasma (pôle négatif) | Pour identifier la connexion à<br>une torche plasma –<br>connexion de l'électrode au<br>pôle négatif                                                                     |




### L.3.3.5 Symboles pour indiquer la commande ou la connexion à un fluide



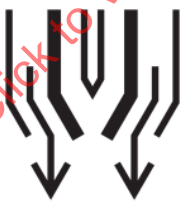
| N°  | SOURCE                     | SYMBOLE                                                                             | FONCTION, MOT CLÉ<br>OU PHRASE      | APPLICATION                                                                                 |
|-----|----------------------------|-------------------------------------------------------------------------------------|-------------------------------------|---------------------------------------------------------------------------------------------|
| 29. | IEC 60417-<br>6315:2015-02 |    | Circulation d'air                   | Pour identifier une circulation d'air                                                       |
| 30. | ISO 7000-<br>0536:2004-01  |    | Liquide                             | Pour indiquer le liquide, par exemple réfrigérant                                           |
| 31. |                            |  | Alimentation en gaz                 | Pour identifier la connexion à une alimentation en gaz ou une commande                      |
| 32. | ISO 7000-<br>0481:2004-01  |  | Gaz de protection du soudage plasma | Pour identifier la connexion à une alimentation au gaz de protection plasma ou une commande |
| 33. | ISO 7000-<br>0480:2004-01  |  | Gaz plasma                          | Pour identifier la connexion au gaz plasma ou une commande                                  |
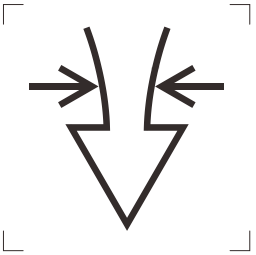
| N°  | SOURCE                     | SYMBOLE                                                                           | FONCTION, MOT CLÉ<br>OU PHRASE | APPLICATION                                                             |
|-----|----------------------------|-----------------------------------------------------------------------------------|--------------------------------|-------------------------------------------------------------------------|
| 34. | IEC 60417-<br>6316:2015-02 |  | Pression d'air                 | Pour identifier une fonction ou<br>une commande de<br>compression d'air |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

**L.3.3.6 Symboles pour indiquer un dispositif, une connexion ou une fonction auxiliaire**
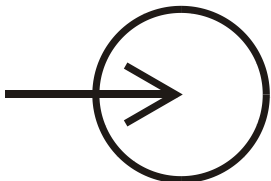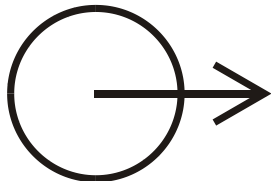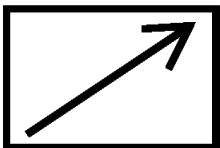
| N°  | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE  | APPLICATION                                                                       |
|-----|------------------------|-------------------------------------------------------------------------------------|------------------------------|-----------------------------------------------------------------------------------|
| 35. | IEC 60417-5034:2014-06 |    | Entrée                       | Pour identifier une connexion ou une commande d'entrée                            |
| 36. | IEC 60417-5035:2014-06 |    | Sortie                       | Pour identifier une connexion ou une commande de sortie                           |
| 37. | ISO 7000-0093:2004-01  |  | Commande à distance          | Pour identifier une commande, une connexion ou une fonction à distance,           |
| 38. |                        |  | Commande à pédale            | Pour identifier un dispositif, une connexion ou une fonction de commande à pédale |
| 39. |                        |  | Commande locale              | Pour identifier une commande ou une fonction locale                               |
| 40. | ISO 7000-0466:2004-01  |  | Réservoir (à poudre, à flux) | Pour identifier un réservoir de flux (poudre)                                     |
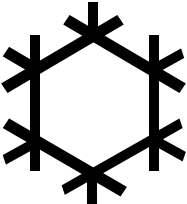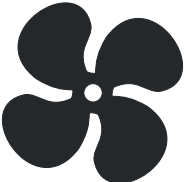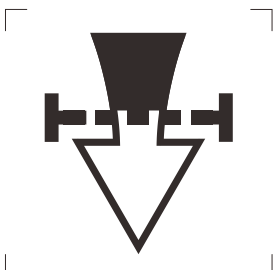
| N°  | SOURCE                 | SYMBOLE                                                                            | FONCTION, MOT CLÉ OU PHRASE                  | APPLICATION                                                                     |
|-----|------------------------|------------------------------------------------------------------------------------|----------------------------------------------|---------------------------------------------------------------------------------|
| 41. | ISO 7000-0027:2004-01  |   | Refroidissement                              | Pour identifier un dispositif, une connexion ou une fonction de refroidissement |
| 42. | ISO 7000-0089:2004-01  |   | Ventilateur soufflant ou à circulation d'air | Pour identifier un ventilateur soufflant ou à circulation d'air                 |
| 43. | IEC 60417-6317:2015-02 |  | Filtre à air                                 | Pour identifier un filtre à air                                                 |



IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV





### L.3.3.7 Symboles pour indiquer une commande de l'ampérage/tension de soudage

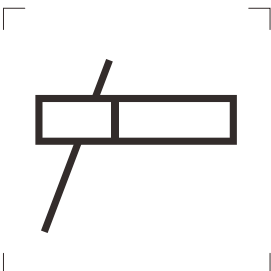
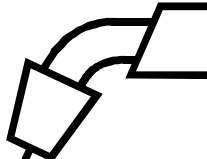
| N°  | SOURCE                 | SYMBOLE | FONCTION, MOT CLÉ OU PHRASE    | APPLICATION                                                                                                                                                                  |
|-----|------------------------|---------|--------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 44. | IEC 60417-6005:2006-12 |         | Valeur de base des impulsions  | Pour indiquer une commande de valeur de base des impulsions<br><br>NOTE 1 La commande est identifiée par une lettre choisie dans le Tableau L.1.                             |
| 45. | IEC 60417-6006:2006-12 |         | Valeur de crête des impulsions | Pour indiquer une commande de valeur de crête des impulsions<br><br>NOTE 2 La commande est identifiée par une lettre choisie dans le Tableau L.1.                            |
| 46. | IEC 60417-6007:2006-12 |         | Départ suractivé               | Pour indiquer une commande ou une fonction pour augmenter l'énergie au début du soudage<br><br>NOTE 3 La commande est identifiée par une lettre choisie dans le Tableau L.1. |
| 47. | IEC 60417-6008:2006-12 |         | Pente (montante)               | Pour indiquer une commande ou une fonction réglant l'augmentation d'une valeur<br><br>NOTE 4 La commande est identifiée par une lettre choisie dans le Tableau L.1.          |
| 48. | IEC 60417-6009:2006-12 |         | Pente (descendante)            | Pour indiquer une commande ou une fonction réglant la diminution d'une valeur<br><br>NOTE 5 La commande est identifiée par une lettre choisie dans le Tableau L.1.           |


### L.3.3.8 Symboles pour indiquer le type de torche

| N°  | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE                                              | APPLICATION                                                                               |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------------------------------------------------|-------------------------------------------------------------------------------------------|
| 49. |                        |    | Porte-électrode pour soudage à l'arc manuel                              | Pour identifier un porte-électrode                                                        |
| 50. | IEC 60417-6313:2015-01 |    | Porte électrode pour gougeage à l'arc au charbon avec jet d'air comprimé | Pour identifier un porte-électrode de gougeage à l'arc au charbon avec jet d'air comprimé |
| 51. |                        |   | Torche MIG/MAG                                                           | Pour identifier une torche MIG/MAG                                                        |
| 52. |                        |  | Torche de soudage avec fil fourré sans gaz                               | Pour identifier une torche pour soudage à l'arc avec fils fourrés sans protection gazeuse |
| 53. |                        |  | Torche TIG                                                               | Pour identifier une torche TIG                                                            |
| 54. |                        |  | Torche pour procédé plasma                                               | Pour identifier une torche plasma de soudage, coupage et/ou gougeage                      |



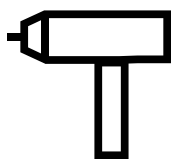
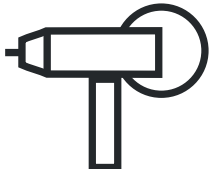
| N°  | SOURCE | SYMBOLE                                                                           | FONCTION, MOT CLÉ OU PHRASE                       | APPLICATION                                                                                                        |
|-----|--------|-----------------------------------------------------------------------------------|---------------------------------------------------|--------------------------------------------------------------------------------------------------------------------|
| 55. |        |  | Pistolet avec système d'entraînement incorporé    | Pour identifier un pistolet incorporant un système de commande du fil                                              |
| 56. |        |  | Pistolet avec dévidoir incorporé                  | Pour identifier un pistolet incorporant un système de commande du fil et incluant un système d'alimentation de fil |
| 57. |        |  | Pistolet pour soudage à l'arc sous flux en poudre | Pour identifier une torche pour le soudage à l'arc sous flux en poudre                                             |

### L.3.3.9 Symboles pour indiquer les procédés
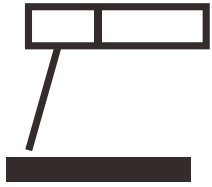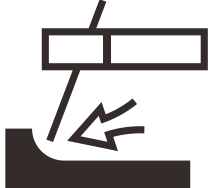
| N°  | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE                         | APPLICATION                                                                  |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------------------------------|------------------------------------------------------------------------------|
| 58. | IEC 60417-6306:2015-01 |    | Soudage à l'électrode enrobée                       | Pour identifier un soudage à l'électrode enrobée                             |
| 59. | IEC 60417-6314:2015-01 |    | Gougeage à l'arc au charbon avec jet d'air comprimé | Pour identifier un gougeage à l'arc au charbon avec jet d'air comprimé       |
| 60. | IEC 60417-6308:2015-01 |   | Soudage MIG/MAG                                     | Pour identifier un soudage MIG/MAG                                           |
| 61. | IEC 60417-6309:2015-01 |  | Soudage avec fil fourré sans gaz                    | Pour identifier un soudage à l'arc avec fil fourré (sans protection gazeuse) |
| 62. | IEC 60417-6307:2015-01 |  | Soudage TIG                                         | Pour identifier un soudage TIG                                               |
| 63. | IEC 60417-6312:2015-01 |  | Soudage plasma                                      | Pour identifier un soudage au plasma                                         |
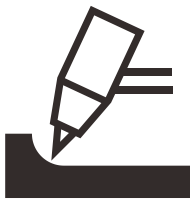
| N°  | SOURCE                 | SYMBOLE                                                                            | FONCTION, MOT CLÉ OU PHRASE         | APPLICATION                                            |
|-----|------------------------|------------------------------------------------------------------------------------|-------------------------------------|--------------------------------------------------------|
| 64. | IEC 60417-6310:2015-01 |   | Coupage par plasma                  | Pour identifier un coupage par plasma                  |
| 65. | IEC 60417-6311:2015-01 |   | Gougeage par plasma                 | Pour identifier un gougeage par plasma                 |
| 66. | IEC 60417-6305:2015-01 |  | Soudage à l'arc sous flux en poudre | Pour identifier un soudage à l'arc sous flux en poudre |





### L.3.3.10 Symboles pour indiquer la commande des caractéristiques de soudage
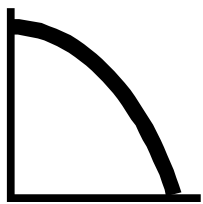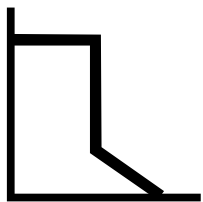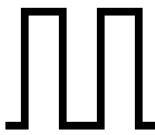
| N°  | SOURCE                | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE     | APPLICATION                                                                                           |
|-----|-----------------------|-------------------------------------------------------------------------------------|---------------------------------|-------------------------------------------------------------------------------------------------------|
| 67. | ISO 7000-0455:2004-01 |    | Caractéristique plate           | Pour identifier une caractéristique de tension fondamentalement constante                             |
| 68. | ISO 7000-0454:2004-01 |    | Caractéristique tombante        | Pour identifier une caractéristique de tension fondamentalement tombante                              |
| 69. |                       |   | Force de l'arc                  | Pour indiquer une commande ou une fonction augmentant le courant quand une tension basse est détectée |
| 70. |                       |  | Pulsé                           | Pour identifier une valeur pulsée                                                                     |
| 71. |                       |  | Inductance variable             | Pour identifier une fonction ou une commande d'inductance variable                                    |
| 72. |                       |  | Inductance élevée ou inductance | Pour identifier une inductance ou utilisé avec d'autres symboles d'inductance ou d'inductance élevée  |
| 73. |                       |  | Inductance moyenne              | Pour identifier une connexion, une fonction ou une commande d'inductance moyenne                      |


| N°  | SOURCE | SYMBOLE                                                                           | FONCTION, MOT CLÉ OU PHRASE | APPLICATION                                                                     |
|-----|--------|-----------------------------------------------------------------------------------|-----------------------------|---------------------------------------------------------------------------------|
| 74. |        |  | Inductance faible           | Pour identifier une connexion, une fonction ou une commande de basse inductance |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV



### L.3.3.11 Symboles pour décrire le type de source d'alimentation
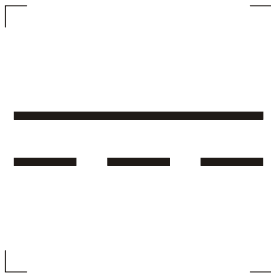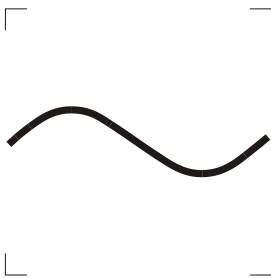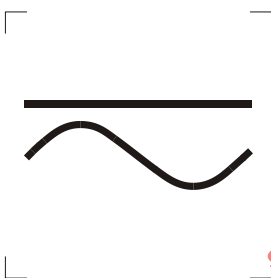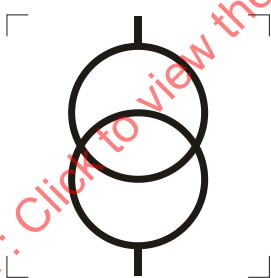
| N°  | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE   | APPLICATION                                                                                                                                                             |
|-----|------------------------|-------------------------------------------------------------------------------------|-------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 75. | IEC 60417-5031:2002-10 |    | Courant continu               | Pour identifier que la source d'alimentation délivre un courant continu                                                                                                 |
| 76. | IEC 60417-5032:2002-10 |    | Courant alternatif            | Pour identifier que la source d'alimentation délivre un courant alternatif<br><br>NOTE Le symbole peut être combiné avec un nombre pour identifier le nombre de phases. |
| 77. | IEC 60417-5033:2002-10 |   | Courant continu et alternatif | Pour identifier que la source d'alimentation délivre à la fois un courant continu et un courant alternatif                                                              |
| 78. | IEC 60417-5156:2003-08 |  | Transformateur                | Pour identifier un transformateur                                                                                                                                       |
| 79. | ISO 7000-1153:2004-01  |  | Générateur                    | Pour identifier un générateur                                                                                                                                           |

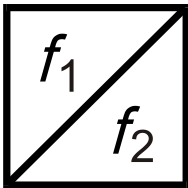


| N°  | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE      | APPLICATION                                                                              |
|-----|------------------------|-------------------------------------------------------------------------------------|----------------------------------|------------------------------------------------------------------------------------------|
| 80. | IEC 60417-6304:2015-01 |    | Moteur thermique                 | Pour identifier un groupe électrogène de soudage                                         |
| 81. | ISO 7000-0147:2004-01  |    | Moteur électrique                | Pour identifier un moteur électrique                                                     |
| 82. | IEC 60417-5970:2003-08 |   | Onduleur                         | Pour identifier une fonction de conversion de fréquence                                  |
| 83. | IEC 60417-5194:2002-10 |  | Convertisseur continu/alternatif | Pour identifier un convertisseur continu/alternatif et ses bornes et commandes associées |

**L.3.3.12 Symboles pour indiquer les composants et la classe de protection**
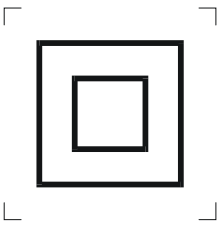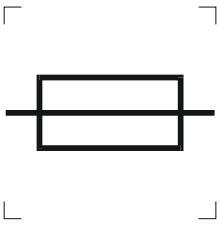
| N°  | SOURCE                 | SYMBOLE                                                                           | FONCTION, MOT CLÉ OU PHRASE                                                     | APPLICATION                                                                                                                       |
|-----|------------------------|-----------------------------------------------------------------------------------|---------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------|
| 84. |                        |  | Approprié au soudage dans un environnement avec risque accru de choc électrique | Pour identifier une source de courant de soudage appropriée au soudage dans un environnement avec risque accru de choc électrique |
| 85. | IEC 60417-5172:2003-02 |  | Matériel de classe II                                                           | Pour identifier un matériel de classe II                                                                                          |
| 86. | IEC 60417-5016:2002-10 |  | Fusible                                                                         | Pour indiquer un fusible                                                                                                          |






IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV


### L.3.3.13 Symboles pour informer les utilisateurs
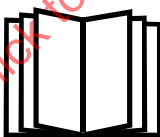
| N°  | SOURCE                 | SYMBOLE                                                                             | FONCTION, MOT CLÉ OU PHRASE   | APPLICATION                                                                                                            |
|-----|------------------------|-------------------------------------------------------------------------------------|-------------------------------|------------------------------------------------------------------------------------------------------------------------|
| 87. | IEC 60417-5036:2002-10 |    | Tension dangereuse            | Pour identifier une tension dangereuse                                                                                 |
| 88. | ISO 7000-0228:2004-01  |    | Perturbation                  | Pour identifier une perturbation du fonctionnement normal                                                              |
| 89. | ISO 7000-0434A:2004-01 |   | Attention                     | Pour rendre l'opérateur attentif à un danger général.                                                                  |
| 90. | IEC 60417-5041:2002-10 |  | Attention, surface chaude     | Pour indiquer que l'élément portant le marquage peut être chaud et qu'il convient de ne pas le toucher sans précaution |
| 91. |                        |  | Lire le manuel d'instructions | Pour identifier qu'il convient de lire le manuel d'instructions                                                        |
| 92. | ISO 7000-0034:2004-01  |  | Indication de température     | Pour donner une indication de température, par exemple un signal lumineux de dépassement de température                |

### L.4 Exemples de combinaisons de symboles

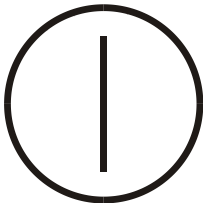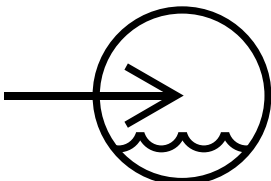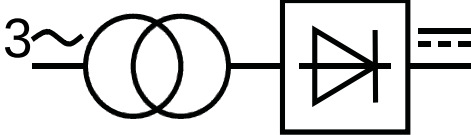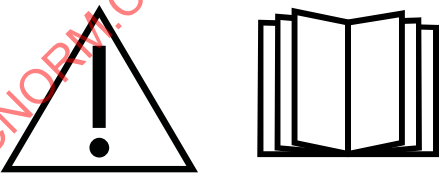
Cet article donne des exemples de combinaisons de symboles qui peuvent être utilisés sur les matériels de soudage à l'arc et procédés connexes.

| SYMBOLE                                                                                                         | FONCTION, MOT CLÉ OU PHRASE                                                       | APPLICATION                                                                                                                                                                                                                         |
|-----------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p>IEC 60417-5010:2002-10</p> | Marche-arrêt (deux positions stables)                                             | Pour identifier une connexion ou une déconnexion du réseau, au moins pour les interrupteurs principaux ou leur position, et tous les cas où la sécurité est mise en jeu. Chaque position, Marche ou Arrêt, est une position stable. |
|  <p>IEC 60417-6024:2009-11</p> | Entrée de liquide                                                                 | Pour identifier une entrée de liquide                                                                                                                                                                                               |
|                               | Transformateur-redresseur triphasé                                                | Pour identifier le symbole de la source de courant de soudage sur la plaque signalétique                                                                                                                                            |
|                              | Source de courant de technologie onduleur délivrant un courant alternatif/continu | Pour identifier le symbole de la source de courant de soudage sur la plaque signalétique                                                                                                                                            |
|                              | Amorçage avec avance fil en vitesse lente                                         | Pour identifier une avance lente du fil vers la pièce à souder au démarrage de la soudure                                                                                                                                           |
|                              | Attention ! Lire le manuel d'instructions                                         | Pour indiquer un danger et signifier qu'il convient de lire le manuel d'instructions                                                                                                                                                |
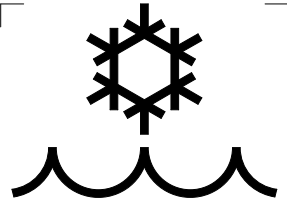
| SYMBOLE                                                                                                              | FONCTION, MOT CLÉ OU PHRASE      | APPLICATION                                                                                                 |
|----------------------------------------------------------------------------------------------------------------------|----------------------------------|-------------------------------------------------------------------------------------------------------------|
| <br>ISO 7000-0544:2004-01           | Eau de refroidissement           |                                                                                                             |
|                                     | Variabilité et mise hors tension | Pour identifier une augmentation/diminution continue de la quantité et une mise hors tension de la commande |
| <br>ISO 7000-0469:2004-01, modifié | Soudage MIG/MAG par point        | Pour identifier un soudage MIG/MAG par point                                                                |
|                                   | Temps de montée                  | Pour identifier une commande de temps de montée                                                             |


## L.5 Exemples de panneaux de commande

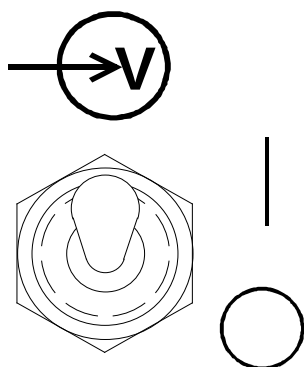Cet article (voir Figures L.1 à L.8) donne des exemples de panneaux de commande pour les matériels de soudage à l'arc et procédés connexes.




IEC

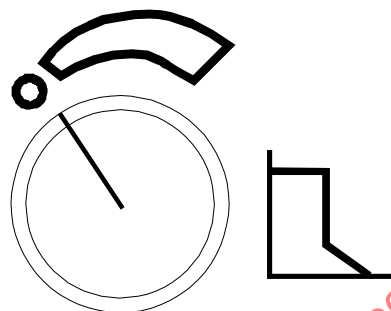Figure L.1 – Bouton d'amenée de tension




IEC

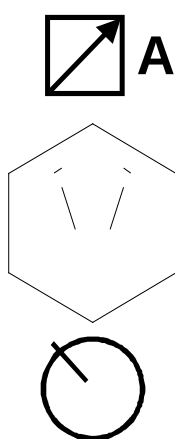
Figure L.2 – Potentiomètre de commande de la force de l'arc



IEC


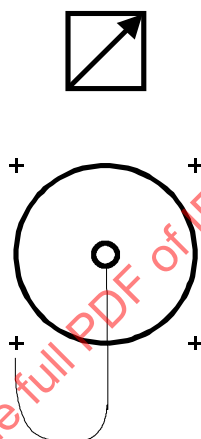


IEC

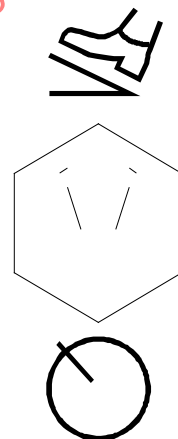


IEC

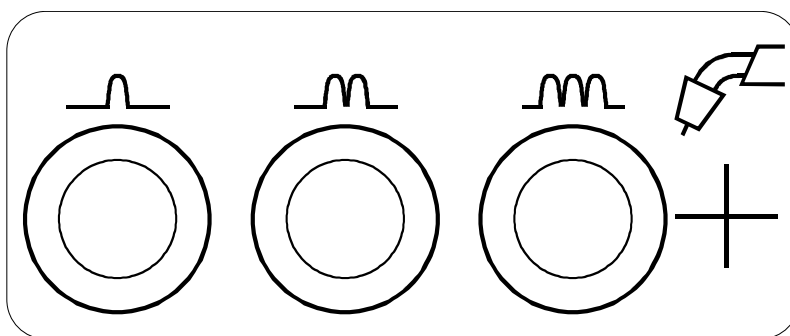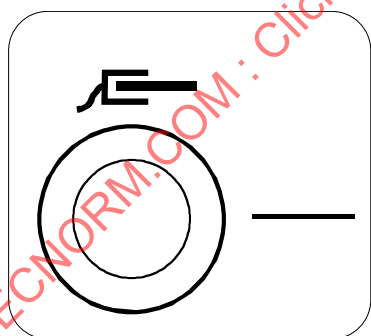Figure L.3 – Prises de commande à distance et boutons de sélection




IEC

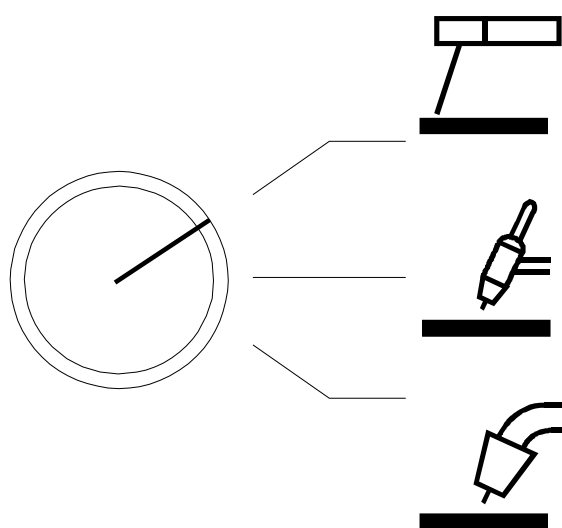Figure L.4 – Bornes avec sélecteurs d'inductance pour le soudage MIG/MAG




IEC

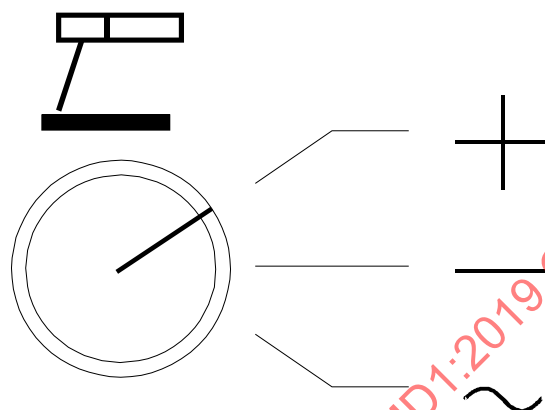Figure L.5 – Bouton de choix de procédé (MMA, TIG, MIG)




IEC

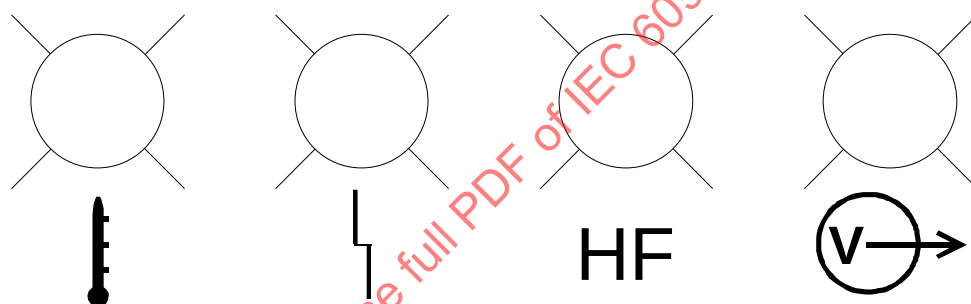Figure L.6 – Bouton de sélection sur matériel à courant alternatif/continu



IEC

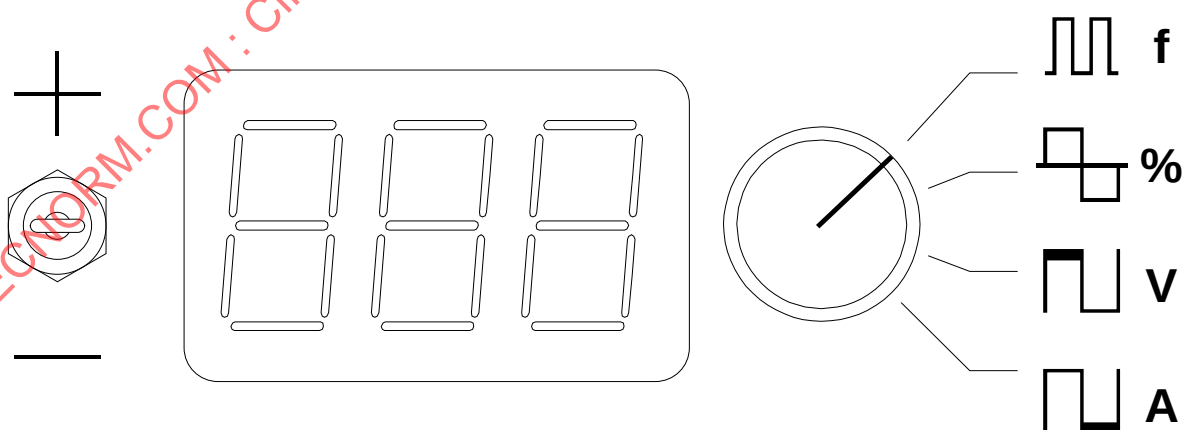Figure L.7 – Voyants lumineux du panneau (surchauffe, défaut, amorçage d'arc, tension de sortie)



IEC

Figure L.8 – Réglage des paramètres de pulsation par affichage numérique

## Annexe M (informative)

### Mesurage du rendement énergétique et de la puissance en état au ralenti

#### M.1 Mesurage du rendement

Pour assurer la répétabilité et l'exactitude des données lors du mesurage du rendement, la procédure suivante doit être utilisée:

- a) Utiliser des wattmètres pour mesurer la puissance d'alimentation et la puissance de sortie de soudage.
- b) Assurer la conformité aux exigences de 5.1 relatives aux conditions d'essai.
- c) S'assurer que l'exactitude du mesurage de la puissance est égale à ou meilleure que  $\pm 0,25\%$ .
- d) Assurer la conformité du réseau d'alimentation à l'Annexe G.
- e) Mesurer la tension d'alimentation de la source de courant de soudage raccordée au réseau d'alimentation au point de couplage de la source de courant de soudage au réseau d'alimentation.
- f) Mesurer la **tension en charge** aux points de connexion du **circuit de soudage** de la source de courant de soudage. Pour les sources de courant de soudage équipées de câbles de soudage qui leur sont raccordés en permanence, mesurer la **tension en charge** au point de sortie de l'enveloppe de la source de courant.
- g) Mesurer le rendement:
  - 1) s'il n'est pas précisé par une réglementation nationale, en utilisant le procédé qui génère la puissance consommée la plus élevée;
  - 2) aux **conditions conventionnelles de soudage** (données en 3.1.17) et aux **tensions conventionnelles en charge** spécifiées en 11.2;
  - 3) à mi-cycle de chargement pour les **facteurs de marche** inférieurs à 100 %;
  - 4) en excluant du mesurage la puissance tirée des dispositifs extérieurs ou des sorties d'alimentations auxiliaires (voir 11.5 et 11.6).
- h) Enregistrer le rendement sous forme de pourcentage arrondi à deux chiffres significatifs.

Rendement:  $\eta = \frac{P_2}{P_1}$

où

$P_2$  est la puissance de sortie de soudage;

$P_1$  est la puissance consommée.

NOTE 1 Ce rapport, compris entre 0 et 1, est exprimé en pourcentage.

NOTE 2 Le rendement peut dépendre de facteurs tels que la charge de sortie, la tension du réseau d'alimentation (pour les matériels avec plusieurs tensions d'alimentation), le mode de fonctionnement et les conditions d'environnement.

#### M.2 Mesurage de la puissance en état au ralenti

Pour assurer la répétabilité et l'exactitude des données lors du mesurage de la puissance consommée en **état au ralenti**, la procédure suivante doit être utilisée:

- 4) S'assurer que la source de courant est dans des conditions d'**équilibre thermique**.
- 5) Mesurer la puissance en **état au ralenti** après



- a) une période de refroidissement de la source de courant (par exemple, après l'arrêt du ventilateur et de la pompe de refroidissement); et
- b) que la source de courant est passée en **état au ralenti** à basse énergie (si elle en est équipée).

Ne pas inclure dans le mesurage la puissance tirée des dispositifs extérieurs ou des sorties d'alimentations auxiliaires (voir 11.5 et 11.6).

La puissance consommée en **état au ralenti** doit être indiquée comme une valeur moyenne.

NOTE Les mesurages de la puissance en **état au ralenti** sont influencés par des variations de puissance instantanée.

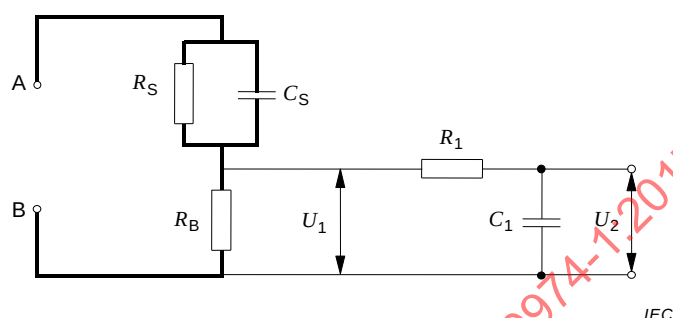
IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annexe N (normative)

### Mesurage du courant de contact en condition de défaut

Pour mesurer le **courant de contact** en condition de défaut, le réseau de mesure conforme à la Figure N.1 ainsi que les configurations appropriées des Figures N.2 et N.3 doivent être utilisés avec un dispositif de mesure approprié.

Attention! Un **expert** doit réaliser cet essai. Le conducteur de protection est désactivé pour cet essai.



#### Légende


|                                                  |                  |                                       |                  |
|--------------------------------------------------|------------------|---------------------------------------|------------------|
| A, B                                             | Bornes d'essai   | $C_S$                                 | 0,22 $\mu$ F     |
| $R_S$                                            | 1 500 $\Omega$   | $R_1$                                 | 10 000 $\Omega$  |
| $R_B$                                            | 500 $\Omega$     | $C_1$                                 | 0,022 $\mu$ F    |
| $U_1$                                            | Tension efficace | $U_2$                                 | Tension de crête |
| Courant de contact pondéré (perception/réaction) |                  | $= \frac{U_2}{500}$ (valeur de crête) |                  |

**Figure N.1 – Réseau de mesure du courant de contact pondéré**


Pour le matériel triphasé, le **courant de contact** en condition de défaut est mesuré en plaçant les commutateurs (I) et (n) en position fermée et le commutateur (e) en position ouverte. Le mesurage est ensuite répété en ouvrant chacun des commutateurs (I) et (n) un par un, les autres commutateurs étant fermés, à l'exception du commutateur (e). Les mesurages sont similaires pour le matériel monophasé, à l'exception du fait qu'ils doivent être répétés pour chaque position du commutateur de polarité (p).

Le constructeur doit identifier la configuration (TN, TT, IT en étoile, etc.) à laquelle son matériel est destiné à être connecté dans son application finale. Le matériel en essai doit être soumis à l'essai selon ces configurations identifiées ou dans la configuration la plus défavorable.

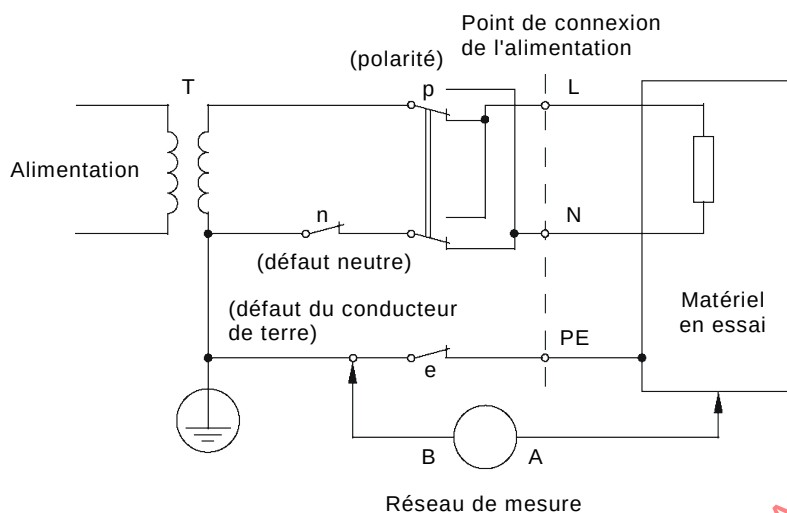
L'utilisation d'un transformateur de séparation (T) est facultative. S'il n'est pas utilisé, des précautions de sécurité doivent être prises afin de protéger l'opérateur d'essai de toute tension dangereuse au niveau de l'enveloppe et d'autres parties conductrices accessibles du matériel.



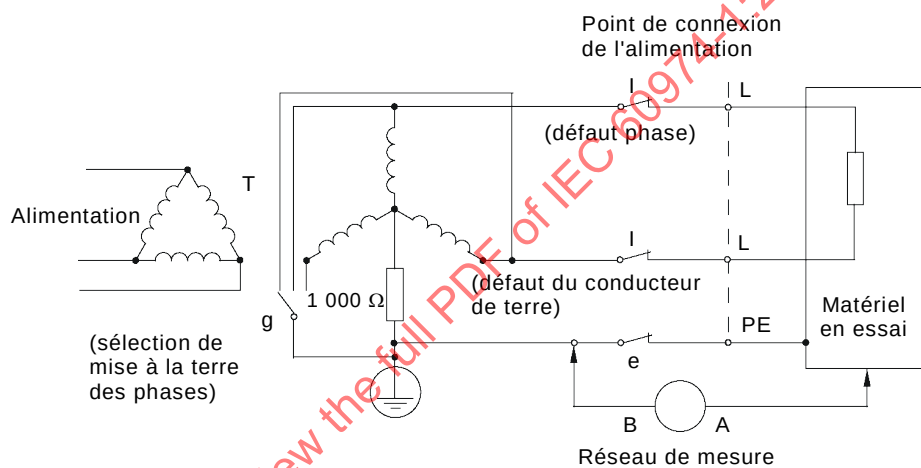a) Matériel monophasé sur un système TT ou TN en étoile




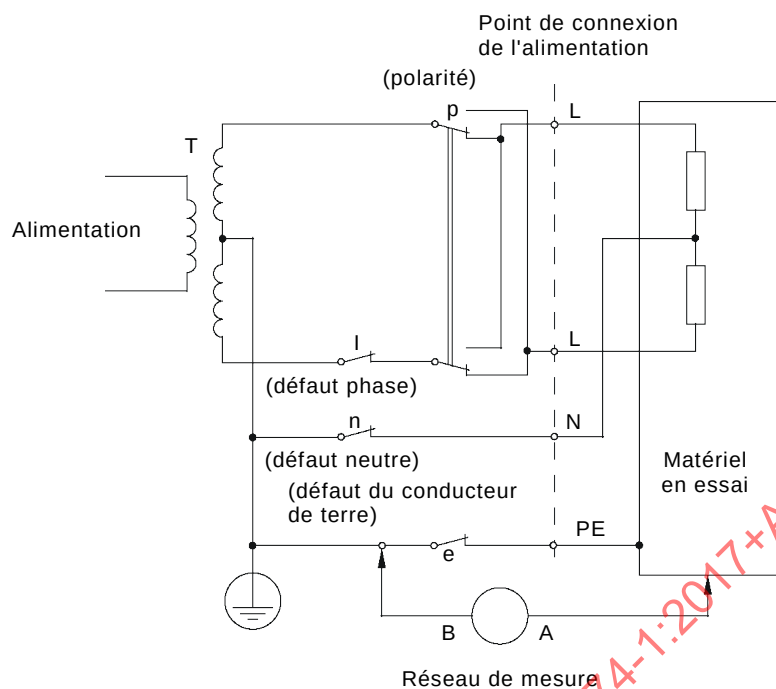b) Matériel monophasé connecté entre phases sur un système TT ou TN en étoile



IEC

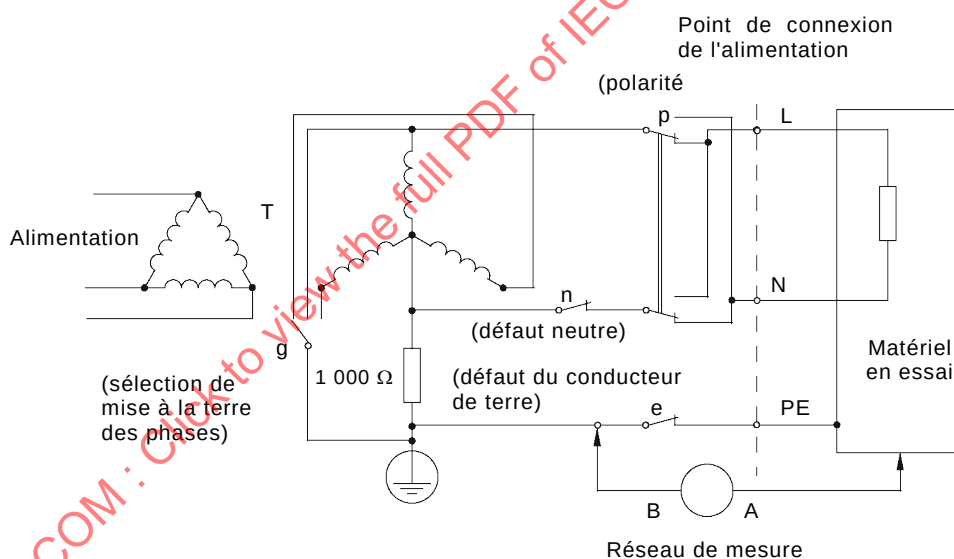
c) Matériel monophasé sur un système TT ou TN centré mis à la terre



IEC


d) Matériel monophasé avec une connexion phase-neutre sur un système IT en étoile

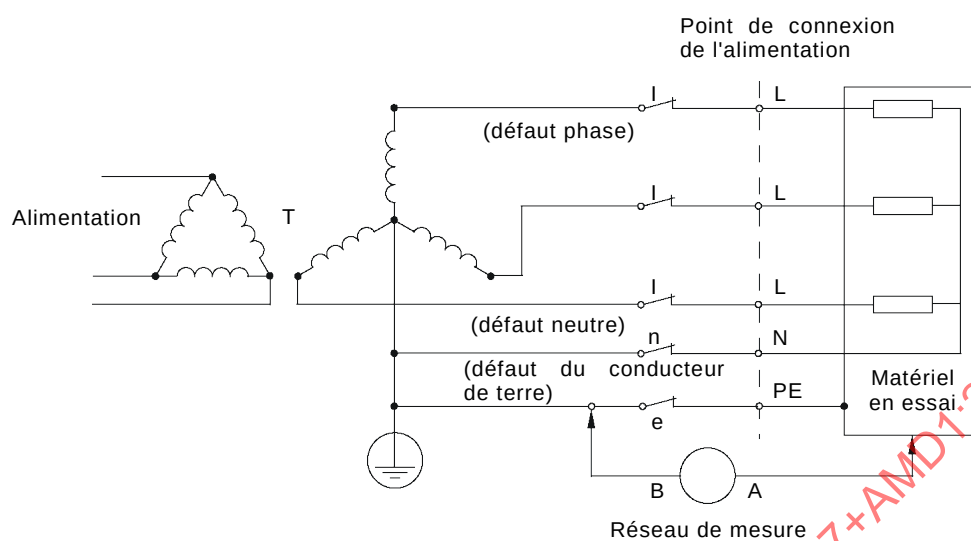Figure N.2 – Diagramme pour le mesurage du courant de contact en condition de défaut à la température de fonctionnement pour une connexion monophasée d'appareils autres que ceux de classe II




IEC

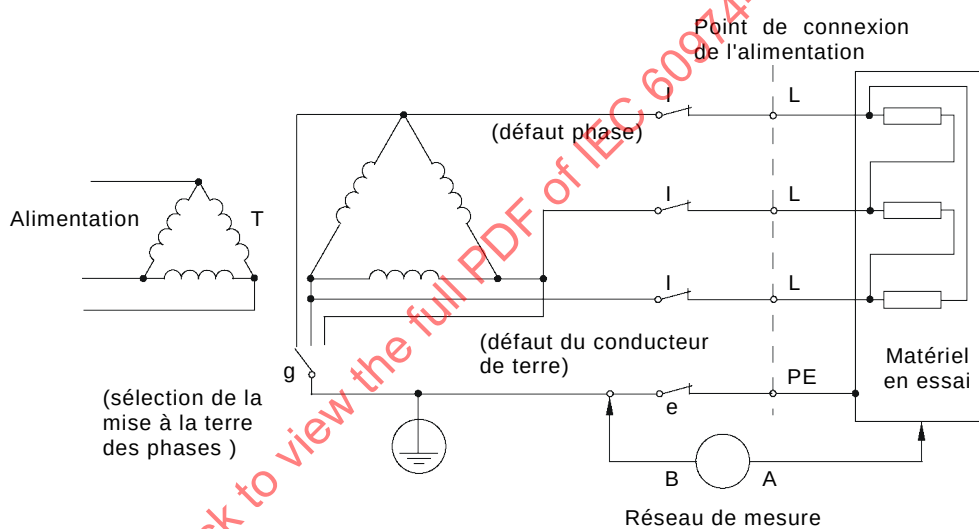a) Matériel triphasé sur système TT ou TN en étoile




IEC

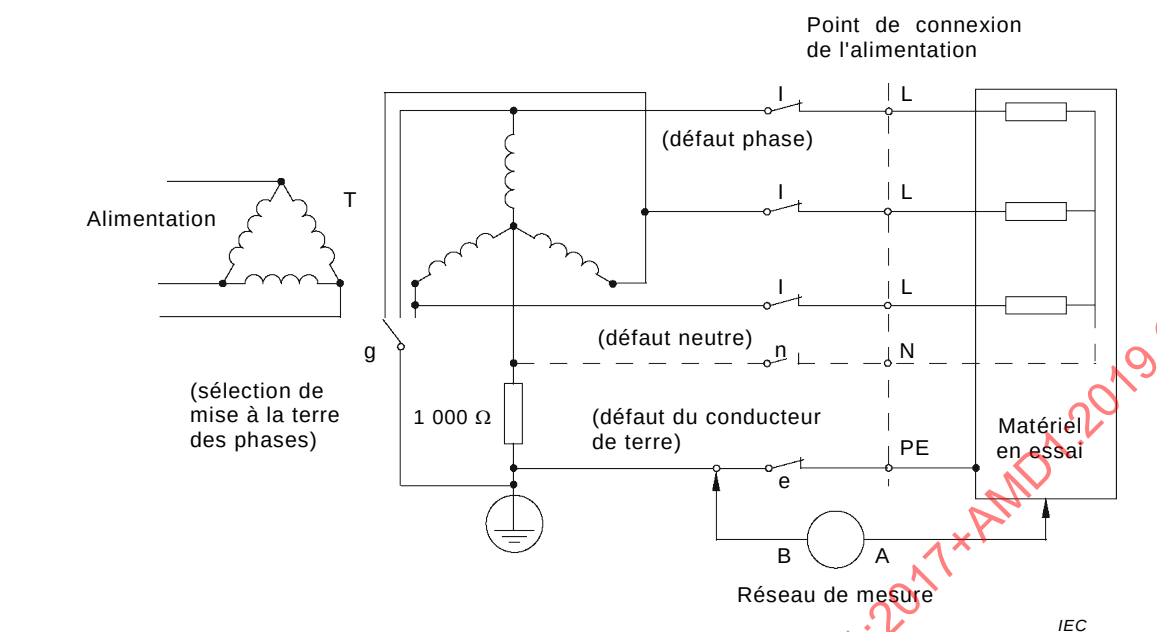b) Matériel triphasé sur système triphasé à trois lignes non relié à la terre



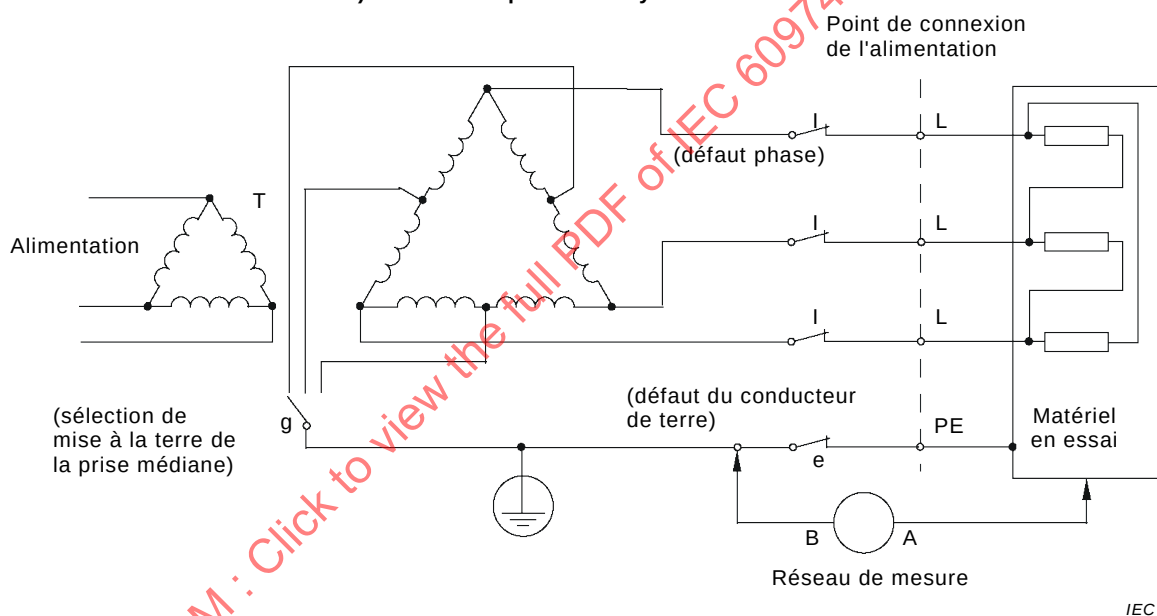c) Matériel triphasé sur système IT en étoile



d) Matériel triphasé sur système triphasé à trois lignes centré et relié à la terre

Figure N.3 – Diagramme pour le mesurage du courant de contact en condition de défaut pour une connexion triphasée à quatre fils d'appareils autres que ceux de classe II

## Annexe O (normative)

### Sources de courant de soudage alimentées par batterie

#### O.1 Généralités

L'Annexe O s'applique aux sources de courant de soudage alimentées par batterie rechargeable pour le soudage à l'arc et procédés connexes et aux blocs de **batteries** destinés à de tels matériels.

**Les sources de courant de soudage alimentées par batterie** sont les sources de courant de soudage alimentées par l'un quelconque des types de batteries suivants:

- **batteries incorporées,**
- **blocs de batteries amovibles,**
- **blocs de batteries démontables.**

Tous les articles du présent document s'appliquent, sauf spécification contraire dans l'Annexe O. S'il est fait référence à un article dans l'Annexe O, les articles numérotés de l'Annexe O remplacent ou modifient les articles numérotés du texte principal du document. Sauf spécification contraire, le contenu des articles et paragraphes de l'Annexe O remplace le contenu des articles et paragraphes correspondants dans le corps principal. Les paragraphes complémentaires sont numérotés O.x.201, O.x.202, etc.

Les sources de courant de soudage alimentées par batterie et les blocs de **batteries** traités dans l'Annexe O peuvent être mis en fonctionnement:

- complètement déconnectés et isolés du réseau d'alimentation;
- connectés au réseau d'alimentation avec le **circuit de soudage** isolé du réseau d'alimentation.

Les exigences de protection contre le risque de choc électrique dépendent de la topologie électrique spécifique.

Si la source de courant de soudage alimentée par batterie peut également être utilisée pendant le chargement, les exigences d'isolation doivent être prises en considération lors de la conception de l'unité de charge.

Dans la mesure où les blocs de **batteries** destinés aux sources de courant de soudage sont soumis à différents modes d'utilisation (tels que, utilisation intense, courants élevés de charge et de décharge) leur sécurité ne peut être évaluée que par l'Annexe O et non par d'autres normes relatives aux blocs de **batteries**, telles que la série IEC 62133, sauf indication contraire dans l'Annexe O. Toutes les exigences applicables de l'IEC 62133-1:— et de l'IEC 62133-2:— sont abordées dans l'Annexe O.

Lors de l'évaluation du risque d'incendie associé aux **blocs de batteries amovibles**, il a été pris en considération le fait que ces blocs de **batteries** sont des sources d'énergie sans surveillance et ont été évalués en tant que tels dans le présent document. Les exigences d'autres normes concernant le risque d'incendie dû au chargement de ces **blocs de batteries amovibles** sont donc considérées comme étant satisfaites.

L'Annexe O traite également des exigences relatives à l'utilisation des **éléments** ion-lithium employés dans les **systèmes de batteries** contenus dans les sources de courant de soudage. Les éléments suivants doivent être pris en considération dans le cadre de ces exigences.

- Ces exigences portent sur la sécurité des batteries pendant leur stockage et leur utilisation, y compris la décharge et la charge, et non sur les dangers possibles liés à la toxicité, ni sur les dangers potentiels associés au transport ou à la mise au rebut.

NOTE 1 L'IEC 62281 couvre les aspects de sécurité des batteries ion-lithium pendant le transport.

- Les **systèmes de batterie** couverts par ces exigences ne sont pas destinés à être entretenus par l'utilisateur final.
- Ces exigences visent à fournir une évaluation complète d'une **batterie**, uniquement si elle est utilisée dans les produits couverts par le présent document.
- Ces exigences portent sur la sécurité des **systèmes de batteries** pendant leur stockage et leur utilisation, y compris la décharge et la charge. Ces exigences sont considérées seulement comme supplémentaires concernant les incendies dus au **chargeur** de batterie et les chocs électriques.
- Ces exigences concernent et exigent des paramètres fournis en référence aux **éléments**, qui établissent les conditions pour une utilisation sûre de ces **éléments**. Ces paramètres constituent la base des critères d'acceptation pour un certain nombre d'essais spécifiés dans le présent document. Le présent document n'évalue pas de façon indépendante la sécurité des **éléments**. Ces paramètres, pris ensemble, constituent la «**région de fonctionnement spécifiée**» d'un **élément**. Il peut y avoir plusieurs ensembles de **régions de fonctionnement spécifiées**.

L'Annexe O ne s'applique pas à la sécurité des **chargeurs** de batterie eux-mêmes. Cependant, l'Annexe O couvre le fonctionnement sûr des **systèmes de batteries**. Le matériel comprenant l'unité de charge, le bloc de **batteries** et la source de courant de soudage doit satisfaire aux exigences de séparation du présent document.

NOTE 2 L'IEC 60335-2-29 traite d'une variété de **chargeurs**.

L'Annexe O ne fournit pas d'informations de sécurité exhaustives concernant le personnel de fabrication, de maintenance et de réparation.

## O.4 Conditions ambiantes

*Ajout à l'Article 4 du présent document:*

Les conditions de la batterie ne doivent pas dépasser la **région de fonctionnement spécifiée** de la batterie. Différentes conditions ambiantes peuvent être nécessaires en fonction de la technologie utilisée, et la source de courant de soudage et/ou le bloc de **batteries** qui en résultent doivent être marqués en conséquence (voir 15.1).

NOTE Voir l'IEC 62133-2:—<sup>3</sup>, Figure A.1 pour plus de détails.

## O.5 Essais

### O.5.1 Conditions d'essai

Des essais successifs effectués sur une **batterie** peuvent produire un cumul de contraintes qui peut causer des dommages irréversibles dans la **batterie** et il convient de les éviter. Des échantillons supplémentaires peuvent être utilisés si nécessaire, à l'exception des **essais de type** pour lesquels un seul échantillon doit être utilisé.

Les essais doivent être effectués sur des sources de courant de soudage neuves, sèches et complètement assemblées.

<sup>3</sup> En préparation.



L'essai d'échauffement défini au O.7.1 et l'essai de **protection thermique** défini au 8.5 doivent être effectués à une température ambiante de 40 °C, voir les tolérances en 7.1.2 e).

D'autres essais doivent être effectués à une température de l'air ambiant indiquée à l'Article 4 a).

*Sauf spécification contraire, les essais doivent être effectués en commençant avec une **batterie complètement chargée**.*

Certains de ces essais peuvent provoquer un incendie ou une explosion. Il convient donc que le personnel soit protégé contre les fragments projetés, la force d'explosion, la libération soudaine de chaleur, les brûlures dues aux produits chimiques, la lumière intense et le bruit assourdissant qui peuvent résulter de ces explosions. Il convient que la zone d'essai soit bien aérée pour protéger le personnel contre d'éventuelles fumées nocives ou d'éventuels gaz nocifs.

*Ajout au 5.1 du présent document:*

**O.5.1.201** Lors du mesurage de la tension, la valeur de crête de toute ondulation superposée supérieure à 10 % de la valeur moyenne doit être incluse. Les tensions transitoires (telles qu'une augmentation temporaire de la tension) sont ignorées, par exemple après le retrait du bloc de **batteries** du chargeur.

**O.5.1.202** Les mesurages de la tension des **éléments** pendant les essais de systèmes ion-lithium doivent être effectués en utilisant un filtre passe-bas résistif-capacitif unipolaire avec une fréquence de coupure de 5 kHz  $\pm$  500 Hz. Si les limites de la tension en charge ont été dépassées, la valeur de crête de la tension mesurée après ce réseau doit être utilisée. Le mesurage doit avoir une tolérance de mesure de  $\pm 1$  % pour le circuit filtrant et le voltmètre pris ensemble.

**O.5.1.203** Sauf spécification contraire, toutes les batteries doivent être entièrement conditionnées comme suit: les **batteries** doivent être **complètement déchargées** et après un repos de deux heures chargées conformément aux instructions du constructeur.

**O.5.1.204** L'emplacement des thermocouples pour les mesurages de la température des **éléments** doit se situer sur la surface extérieure, à mi-chemin le long de la plus grande dimension, de l'**élément** qui génère la température la plus élevée.

**O.5.1.205** Les courants mesurés pendant le chargement de la **batterie** doivent être des courants moyens avec un temps d'établissement de moyenne de 1 s à 5 s. Les limites de courant spécifiées par le constructeur de la batterie ne doivent pas être dépassées.

**O.5.1.206** Sauf spécification contraire, une **batterie complètement chargée** doit être utilisée.

**O.5.1.207** Quand une **batterie** constituée d'un seul **élément** est utilisée, les instructions du présent document qui font référence aux préparations spéciales d'un **élément** dans une configuration en série ne s'appliquent pas.

**O.5.1.208** Pour les types de **batteries** pour lesquels il y a un montage en série de groupes parallèles d'**éléments**, le groupe doit être traité comme un seul **élément** pour les essais qui exigent avant leur démarrage une modification de la quantité de charge sur un seul **élément**.

**O.5.1.209** Sauf spécification contraire du constructeur, les tensions de fin de décharge pour les chimies courantes de l'**élément** sont:

- 0,9 V par élément pour les **batteries** nickel-cadmium ou au nickel-hydrure métallique;
- 1,75 V par élément pour les **batteries** au plomb-acide;
- 2,5 V par élément pour les **batteries** ion-lithium,

### O.5.3 Conformité des composants

*Ajout au 5.3 du présent document:*

Les **éléments** utilisés dans les sources de courant de soudage ou les **éléments** utilisés dans les blocs de **batteries** doivent être conformes à l'IEC 62133-1:— ou à l'IEC 62133-2:—, à l'exception des **batteries** au plomb-acide.

NOTE L'exigence ci-dessus permet d'effectuer des essais conformes à l'IEC 62133-1:— ou à l'IEC 62133-2:— et ne concerne pas le bloc de **batteries** lui-même.

## O.6 Protection contre les chocs électriques

### O.6.1 Isolation

#### O.6.1.1 Généralités

*Ajout au 6.1.1 du présent document:*

La protection contre les chocs électriques causés par les circuits de la **classe de tension de batterie B** doit être constituée de:

- mesures de **protection principale** contre le contact direct avec les parties actives;
- mesures de protection dans des **conditions de défaut simple**.

Les mesures de protection doivent satisfaire aux exigences décrites en a) et b) ou en a) et c).

#### a) Mesures de protection principale

Les personnes doivent être protégées contre le contact direct avec les parties actives des circuits électriques de la **classe de tension de batterie B**. La protection contre le contact direct doit être assurée par l'un des moyens suivants:

- **isolation principale** des parties actives;
- enveloppes, empêchant l'accès aux parties actives.

Les enveloppes peuvent être électriquement conductrices ou non-conductrices.

#### b) Mesures de protection dans des conditions de défaut simple

- Liaison equipotentielle

Les parties conductrices accessibles du matériel électrique de la **classe de tension de batterie B**, y compris les enveloppes conductrices accessibles, doivent être reliées ensemble pour réaliser l'équipotentialité conformément aux exigences en O.10.5.201.

- Résistance d'isolement

Les circuits électriques de la **classe de tension de batterie B**, non destinés à être raccordés de manière conductrice au réseau d'alimentation, doivent avoir une résistance d'isolement suffisante conformément aux exigences en O.6.1.4

Les circuits électriques de la **classe de tension de batterie B**, destinés à être raccordés de manière conductrice au réseau d'alimentation, doivent avoir une résistance d'isolement conforme aux exigences de 6.1.4.

#### c) Autre mesure de protection contre les chocs électriques

En variante à la mesure b), le constructeur du matériel doit effectuer une évaluation appropriée des risques et répertorier un ensemble de mesures qui assurent une protection suffisante contre les chocs électriques dans les **conditions de défaut simple**.

#### O.6.1.4 Résistance d'isolement

*Ajout au 6.1.4 du présent document:*

La résistance d'isolement minimale des circuits de la **classe de tension de batterie B** par rapport aux surfaces accessibles doit être de 100  $\Omega/V$ . La **tension de service** maximale doit être la valeur de référence.

NOTE Le danger de choc électrique survient lorsque des courants électriques en fonction de la valeur et de la durée circulent dans le corps humain. Des effets indésirables peuvent être évités si le courant se trouve dans la zone DC-2 pour le courant continu ou la zone AC-2 pour le courant alternatif, tel que représenté à la Figure 20 et à la Figure 22, respectivement de l'IEC TS 60479-1:2005. La relation entre les courants nuisibles au corps humain et d'autres formes d'ondes et fréquences est décrite dans l'IEC TS 60479-2. L'exigence de résistance d'isolement de 100  $\Omega/V$  pour le courant continu admet des courants de 10 mA pour le corps humain.

Pour permettre à l'ensemble du circuit de satisfaire à l'exigence ci-dessus, il est nécessaire d'avoir une résistance d'isolement supérieure pour chaque composant, en fonction du nombre de composants et de la structure du circuit auquel ils appartiennent.

*La conformité doit être vérifiée par la procédure suivante:*

a) Préconditionnement et conditionnement

Avant le mesurage, le dispositif en essai (DUT) doit être soumis à une période de preconditionnement d'au moins 8 h à  $(5 \pm 2)^\circ\text{C}$ , suivie d'une période de conditionnement de 8 h à une température de  $(23 \pm 5)^\circ\text{C}$ , une humidité de  $90^{+10}_{-5}\%$ , et une pression atmosphérique comprise entre 86 kPa et 106 kPa.

D'autres paramètres de preconditionnement et de conditionnement peuvent être choisis à condition qu'une transition au niveau du point de rosée se produise peu après le début de la période de conditionnement.

La résistance d'isolement doit être mesurée pendant la période de conditionnement à une cadence à partir de laquelle la valeur la plus faible peut être calculée.

b) Mesurages de la résistance d'isolement

La résistance d'isolement des circuits électriques complets de la **classe de tension de batterie B**, raccordés de manière conductrice, peut être mesurée à l'aide de la procédure d'essai utilisée pour le mesurage du système de stockage d'énergie rechargeable (RESS, *rechargeable energy storage system*) donnée dans l'ISO 6469-1:2009, 6.1.3.

Si le système possède plusieurs plages de tensions (du fait par exemple d'un convertisseur rapide) dans un circuit raccordé de manière conductrice, et certains des composants ne peuvent pas supporter la **tension de service** maximale du circuit complet, les résistances d'isolement des composants peuvent être mesurées séparément en utilisant leurs propres **tensions de service** maximales après déconnexion de ces composants.

Les mesurages doivent être effectués à l'aide d'instruments appropriés qui peuvent appliquer une tension continue (par exemple le mégohmmètre), à condition qu'ils débitent la tension d'essai exigée.

#### O.6.1.5 Rigidité diélectrique

*Ajout au 6.1.5 du présent document:*

a) circuits de la **classe de tension de batterie B** non raccordés de manière conductrice au réseau d'alimentation

Pour les circuits de la **classe de tension de batterie B**, la tension d'essai, en courant alternatif ou continu, doit être supérieure à la tension la plus élevée que peut effectivement subir le composant. La tension d'essai doit être dérivée des surtensions correspondantes du circuit électrique auquel le composant est raccordé. Les surtensions transitoires qui peuvent être attendues, y compris les influences d'autres connexions au réseau d'alimentation, le cas échéant, doivent être prises en compte. La tension d'essai et

sa durée doivent être spécifiées, en prenant en compte les parties et sections applicables de l'IEC 60664, par le constructeur.

Cet essai vise à démontrer l'adéquation des mesures de protection pour isoler les parties actives des circuits électriques de la **classe de tension de batterie B**.

- b) circuits de la **classe de tension de batterie B** raccordés de manière conductrice au réseau d'alimentation

Ils doivent être conformes à 6.1.5.

*Ajout au 6.1 du présent document:*

**O.6.1.201** Les **lignes de fuite** (6.1.2) et les **distances d'isolement dans l'air** (6.1.3) ne s'appliquent pas à la construction des **éléments de batteries** ou aux interconnexions entre les **éléments** dans un bloc de **batteries**.

**O.6.1.202** Lors de l'évaluation d'un bloc de **batteries** dans le cadre de la protection contre les chocs électriques, des **lignes de fuite** et des **distances d'isolement dans l'air** ainsi que des distances dans l'isolation, le bloc de **batteries** doit être raccordé au **chargeur**.

## **O.6.2 Protection contre les chocs électriques en service normal**

*Ajout au 6.2 du présent document:*

**O.6.2.201** Les sources de courant de soudage alimentées par batterie et les blocs de **batteries** doivent être construits et enfermés de sorte qu'ils procurent une protection adéquate contre les chocs électriques.

*La conformité doit être vérifiée par examen et par les essais de O.6.2.202 à O.6.2.205, le cas échéant.*

**O.6.2.202** Pour les **blocs de batteries amovibles et démontables**, il ne doit pas être possible d'avoir deux **parties** conductrices simultanément **accessibles** lorsque la tension entre elles dépasse 60 V en courant continu.

**O.6.2.203** Un **système de batteries** doit être protégé contre les courts-circuits par un dispositif de coupure en cas de surintensité. Le dispositif de coupure en cas de surintensité doit être adapté à cette application.

**O.6.2.204** Les batteries ayant une tension supérieure à 113 V en courant continu doivent être isolées conformément à 6.2.4 (Isolation du **circuit de soudage**).

**O.6.2.205** Les circuits de la **classe de tension de batterie B** ayant une tension inférieure ou égale à 113 V en courant continu peuvent être raccordés de manière conductrice au circuit de soudage, à condition que la **tension à vide** ne dépasse pas 60 V en courant continu en **condition de défaut simple**.

NOTE Un dispositif interrupteur-sectionneur conforme à l'IEC 60947-3 et possédant des caractéristiques assignées appropriées est défini comme étant satisfaisant à l'exigence de défaut simple.

## **O.7 Exigences thermiques**

### **O.7.1 Essai d'échauffement**

#### **O.7.1.1 Conditions d'essai**

Lors de la mise en place des dispositifs de mesure, les seuls accès autorisés doivent être les ouvertures équipées de couvercles, portes de visite ou panneaux aisément amovibles prévus par le constructeur. La ventilation dans la zone d'essai et les dispositifs de mesure utilisés ne

doivent pas interférer avec la ventilation normale de la source de courant de soudage ni provoquer des échanges anormaux de chaleur dans un sens ou dans l'autre.

La source de courant de soudage est mise en fonctionnement au courant constant à partir d'une **batterie complètement chargée**:

- a) avec le courant de **soudage assigné maximal** ( $I_{2max}$ ) avec des **cycles de fonctionnement consécutifs**;
- b) avec le **courant de soudage** assigné ( $I_2$ ) qui permet un fonctionnement continu;

jusqu'à ce que la source de courant de soudage ne fonctionne plus en raison de la **batterie** déchargée.

Pour les sources de courant de soudage équipées de **blocs de batteries amovibles** ou de **blocs de batteries démontables**, l'essai est effectué trois fois sur une source de courant de soudage en succession immédiate avec des **blocs de batteries complètement chargés**.

S'il est connu que ni a) ni b) ne donnent l'échauffement maximal, un essai doit alors être effectué au réglage de la plage assignée qui donne l'échauffement maximal.

En outre pour les sources de courant de soudage pour lesquelles il est possible d'effectuer un chargement continu pendant le soudage, un essai d'échauffement tel que spécifié en 7.1 doit être effectué lorsque la charge de la **batterie** est la même à la fin qu'au début de l'essai.

La condition de température ambiante de O.5.1 doit être remplie avant de commencer l'essai et les batteries doivent être conditionnées comme spécifié en O.5.1.203.

NOTE 1 Il est possible que l'échauffement maximal soit obtenu au cours de la marche à vide.

NOTE 2 Le temps de réaction du matériel de soudage varie avec la température de la **batterie**, ce qui peut occasionner des températures de composants plus élevées à des températures ambiantes différentes (par exemple, 20 °C).

### O.7.1.3 Durée de l'essai

L'essai d'échauffement pour le fonctionnement continu doit être effectué au courant de soudage le plus élevé et à la **tension conventionnelle en charge** qui décharge complètement la **batterie** sans interruption (par exemple, protection thermique ou moyens automatiques).

## O.7.2 Mesurage des températures

### O.7.2.1 Conditions de mesure

La température doit être déterminée comme suit:

- a) pour les enroulements, par le mesurage de la résistance ou par des capteurs de température en surface ou incorporés;

NOTE 1 La méthode par capteurs de température en surface n'est pas privilégiée.

NOTE 2 Dans le cas d'enroulements de faible résistance ayant des contacts de commutation en série, le mesurage des résistances peut donner des résultats erronés.

- b) pour les autres parties, par des capteurs de température en surface.

### O.7.4 Essai en charge

Les sources de courant de soudage doivent supporter des cycles de charge répétés sans dommage ou défaillance de fonctionnement. Cet essai peut être effectué sur toute source de courant de soudage qui fonctionne correctement.

*La conformité doit être vérifiée par les essais suivants et en s'assurant qu'aucun dommage ni défaillance de fonctionnement de la source de courant de soudage ne surviennent pendant les essais.*

La source de courant de soudage est chargée, en partant de l'état froid, au **courant de soudage assigné maximal** jusqu'à ce qu'un des phénomènes suivants se produise:

- a) la **protection thermique** fonctionne;
- b) la limite maximale de température des enroulements est atteinte;
- c) la **batterie** est complètement déchargée.

Immédiatement après le réenclenchement de la **protection thermique** dans le cas a), ou après les cas b) ou c), les essais suivants sont effectués.

Immédiatement, tandis que le matériel est encore chaud, celui-ci doit être vérifié conformément à 6.1.5 et à O.6.1.5, s'il y a lieu.

*Ajout à l'Article 7 du présent document:*

#### **O.7.201 Chargement normal des systèmes ion-lithium**

Le chargement d'une **batterie** ion-lithium dans des conditions normales ne doit pas dépasser la **région de fonctionnement spécifiée** pour le **chargement** de l'**élément**.

*La conformité doit être vérifiée par les essais suivants.*

La **batterie** est chargée conformément aux instructions du **système de charge** partant d'une **batterie complètement déchargée**. L'essai est effectué à une température ambiante de  $(40 \pm 5) ^\circ\text{C}$ , et

- s'il est recommandé que la source de courant de soudage soit mise en fonctionnement à une température minimale inférieure à  $4 ^\circ\text{C}$ , l'essai est également effectué à cette température minimale  $0$   $-5 ^\circ\text{C}$ .
- s'il est recommandé que la source de courant de soudage soit mise en fonctionnement à une température maximale supérieure à  $40 ^\circ\text{C}$ , l'essai est également effectué à cette température maximale  $0$   $+5 ^\circ\text{C}$ .

Pour chaque **élément**, la tension, la température mesurée conformément à O.5.1.20 et le courant de charge sont contrôlés pour garantir que le point chaud du bloc de **batteries** ne dépasse pas les limites prévues. Dans le cas des configurations parallèles, une analyse peut être effectuée en vue d'éviter de mesurer les courants des dérivations individuelles. Le résultat de l'analyse ne doit pas dépasser leur **région de fonctionnement spécifiée pour le chargement** (par exemple, les limites de tension et de courant en fonction de la température).

NOTE 1 Exemple de résultat de cette analyse: il n'est pas nécessaire de contrôler le courant de charge pour chaque dérivation d'une connexion parallèle, si le courant maximal que peut débiter le **chargeur** ne dépasse pas le **courant de charge maximal** d'un seul **élément**.

Pour les **batteries** utilisant des configurations en série, l'essai est répété avec une **batterie** délibérément déséquilibrée. Le déséquilibre est introduit dans une **batterie complètement déchargée** par le chargement d'un **élément** à environ 50 % de sa charge pleine.

S'il peut être démontré par des essais et/ou une évaluation de la conception qu'un déséquilibre de moins de 50 % se produirait en **usage normal**, ce déséquilibre inférieur peut donc être utilisé.



NOTE 2 Des exemples sont les conceptions qui utilisent des circuits destinés à maintenir l'équilibre entre les **éléments** dans le bloc de **batteries**. Les systèmes possédant un petit nombre d'**éléments** en série peuvent présenter un déséquilibre limité dans la pratique, si le produit cesse de fonctionner à partir d'une **batterie** préparée avec un déséquilibre initial plus faible.

NOTE 3 Un exemple d'essai est la répétition du chargement et du déchargement d'une **batterie** en conformité avec les instructions du constructeur jusqu'à ce que sa capacité ait diminué à 80 % de la capacité assignée, en utilisant le déséquilibre à la fin de l'essai.

## O.8 Protection thermique

### O.8.1 Exigences générales

Une source de courant de soudage alimentée par batterie doit être équipée d'une **protection thermique**. Cette **protection thermique** doit satisfaire aux exigences de 8.2, 8.3, O.8.4 et 8.5 à 8.7.

*La conformité doit être vérifiée par **examen visuel**.*

### O.8.4 Capacité de fonctionnement

La **protection thermique** doit pouvoir fonctionner 200 fois lorsque la source de courant de soudage débite son **courant de soudage assigné maximal**.

*La conformité doit être vérifiée avec une surcharge appropriée sur un circuit ayant les mêmes caractéristiques électriques, en particulier courant et réactance, que le circuit dans lequel la **protection thermique** est utilisée.*

## O.9 Fonctionnement anormal

### O.9.1 Exigences générales

Les sources de courant de soudage et leurs blocs de batteries ne doivent pas subir de claquage ni accroître le risque de choc électrique ou d'incendie, dans les conditions de fonctionnement de O.9.2 à O.9.207.

*La conformité doit être vérifiée par les essais suivants.*

### O.9.2 Essai de ventilateur bloqué

Une source de courant de soudage disposant d'un ou plusieurs ventilateurs à moteur pour la conformité aux essais de l'Article 7, est mise en fonctionnement avec une **batterie complètement chargée** pendant que le ou les ventilateurs sont bloqués ou mis hors service et la source de courant de soudage est mise en fonctionnement dans les conditions de sortie de O.7.1.

### O.9.3 Essai de courant de court-circuit

La source de courant de soudage alimentée par batterie est court-circuitée par la torche et les câbles de soudage normalement fournis par le constructeur ou, s'ils ne sont pas fournis, par un conducteur de 1,2 m de long et de la section donnée dans le Tableau 8.

NOTE Les sections pour les systèmes non SI sont données dans le Tableau F.1.

La source de courant de soudage alimentée par batterie au réglage de sortie maximal avec une **batterie complètement chargée** ne doit pas faire fonctionner les fusibles ou les disjoncteurs lorsqu'elle est court-circuitée:

a) pendant 15 s dans le cas d'une **caractéristique tombante**;

b) trois fois pendant 1 s, dans une période de 1 min, dans le cas d'une **caractéristique plate**.

Le court-circuit est alors appliqué pendant 2 min ou jusqu'au fonctionnement d'un dispositif de protection.

#### O.9.4 Essai de surcharge

Ce paragraphe n'est pas applicable.

*Ajout à l'Article 9 du présent document:*

##### O.9.201 Source de courant de soudage – conditions anormales

La source de courant de soudage alimentée par batterie, le bloc de **batteries** et les câbles de b) et c), le cas échéant, sont placés sur une couche de coton chirurgical absorbant sec, étendue à 150 mm au-delà de chaque côté. L'essai est effectué jusqu'à la défaillance de l'échantillon d'essai ou jusqu'à ce que l'échantillon d'essai retourne à moins de 5 K de la température ambiante ou, si aucun de ces phénomènes ne se produit, jusqu'à l'écoulement d'une durée de 3 h au moins. Un nouvel échantillon peut être utilisé pour chaque défaut indiqué ci-dessous. Aucune **explosion** ne doit se produire pendant ou après l'essai. Une protection adéquate contre les chocs électriques doit être assurée, telle que définie en O.6.2. Il ne doit en résulter aucune **carbonisation** ou brûlure du coton. L'**échappement de gaz des éléments** est autorisé.

La résistance du court-circuit en a), b) et c) ne doit pas dépasser 10 mΩ. La **carbonisation** ou l'inflammation du coton à partir des dispositifs de mise en court-circuit n'est pas considérée comme une défaillance.

Les fusibles, **coupe-circuits thermiques**, **protecteurs thermiques**, **limiteurs de température**, dispositifs électroniques ou tout composant ou conducteur qui interrompt le courant de décharge peuvent fonctionner pendant les essais ci-dessus. Si ces dispositifs jouent un rôle essentiel pour satisfaire à l'essai, l'essai doit être répété deux fois de plus, en utilisant deux échantillons supplémentaires, et doit permettre d'ouvrir le circuit de la même manière, à moins que l'essai soit, par un autre moyen, effectué avec succès. En variante, l'essai peut être répété avec le dispositif en circuit ouvert ponté.

- a) Les combinaisons des bornes accessibles d'un **bloc de batteries amovibles** sont court-circuitées de manière à produire le résultat le plus défavorable. Les bornes du bloc de **batteries** qui peuvent être touchées en utilisant le calibre d'essai B de l'IEC 61032:1997 ou le calibre d'essai 13 de l'IEC 61032:1997 sont considérées comme accessibles. Les dispositifs de mise en court-circuit doivent être choisis ou positionnés de sorte que la **carbonisation** ou l'inflammation du coton ne soit pas influencée.
- b) Tout câble fixé entre le **bloc de batteries démontables** et la source de courant de soudage alimentée par batterie doit être court-circuité au point susceptible de produire les effets les plus indésirables.
- c) Tout câble fixé entre le bloc de **batteries** ou la source de courant de soudage alimentée par batterie et le **chargeur** doit être court-circuité au point susceptible de produire les effets les plus indésirables.

##### O.9.202 Composants du circuit de soudage – conditions anormales

Les conditions de défaut suivantes sont examinées pour la voie du circuit d'alimentation de la source de courant de soudage et, si nécessaire, sont appliquées une à la fois, les défauts résultants étant pris en considération:

- a) circuit ouvert au niveau de la borne d'un composant;
- b) court-circuit de condensateurs, à moins qu'ils soient conformes à l'IEC 60384-14;



- c) court-circuit de deux bornes quelconques d'un **composant électronique**, autre qu'un circuit intégré monolithique. Ce défaut n'est pas appliqué entre les deux circuits d'un optocoupleur;
- d) défaillance des triacs dans le mode des diodes;
- e) défaillance d'un circuit intégré monolithique ou d'autres circuits qui ne peut pas être évaluée par les conditions de défaut a) à d). Dans ce cas, les situations dangereuses possibles de la source de courant de soudage sont évaluées pour assurer que la sécurité ne repose pas sur le bon fonctionnement d'un tel composant. Tous les signaux de sortie possibles sont définis comme étant en condition de défaut à l'intérieur du circuit intégré. S'il peut être démontré qu'il est peu probable qu'un signal de sortie particulier se produise, alors le défaut correspondant n'est pas pris en considération.

Les composants tels que les thyristors et les triacs ne sont pas soumis à la condition de défaut e).

Les résistances à coefficient de température positif (CTP) ne sont pas court-circuitées si elles sont utilisées dans les limites de leur spécification déclarée par le constructeur.

Pour la simulation des conditions, la source de courant de soudage est mise en fonctionnement en condition à vide ajustée au réglage de sortie maximal.

L'essai est effectué jusqu'à la défaillance ou jusqu'à ce qu'un des phénomènes suivants se produise:

- l'équilibre thermique est atteint; ou
- les échantillons d'essai retournent au moins à 5 K de la température ambiante; ou
- une période d'essai de 3 h s'est écoulée.

NOTE L'examen de la source de courant de soudage et de son schéma de circuit révèle les conditions de défaut qui doivent être simulées par l'analyse du circuit, de sorte que l'essai puisse être limité aux cas qui peuvent donner le résultat le plus défavorable.

### O.9.203 Systèmes de charge ion-lithium – conditions anormales

Ce paragraphe s'applique uniquement aux **batteries** ion-lithium.

Le **système de charge** et la **batterie** d'un système ion-lithium doivent être conçus de sorte que le risque d'incendie et d'**explosion** par suite d'un fonctionnement anormal pendant le chargement soit évité dans toute la mesure du possible.

*La conformité doit être vérifiée par l'essai suivant.*

*Un échantillon contenant la **batterie** et les assemblages associés du **système de charge** sont placés sur une couche de coton chirurgical absorbant sec, étendue à 150 mm au-delà de chaque côté. Le **système de batteries** est mis en fonctionnement comme spécifié en O.17.1 t) 1) avec l'ensemble des catégories de conditions anormales énumérées ci-dessous de a) à d).*

- a) Les composants du **système de charge** sont mis en condition d'état de défaut comme prévu en O.9.202 a) à e), un à la fois, si le résultat d'un tel défaut est incertain sur la base d'une analyse. Pour chaque condition de défaut introduite, l'état de la batterie avant chargement est comme suit:
  - une **batterie** configurée en série doit avoir un déséquilibre délibéré. Le déséquilibre est introduit dans une **batterie complètement déchargée** par le chargement d'un **élément** à environ 50% de sa pleine charge; ou
  - si l'essai de O.7.201 est effectué avec un déséquilibre de moins de 50 %, une **batterie** configurée en série doit avoir un déséquilibre délibéré comme établi en O.7.201; ou

- un seul **élément** ou une **batterie** uniquement configurée en parallèle doit être **complètement déchargée**.
- b) Si l'essai de O.7.201 est effectué avec un déséquilibre de moins de 50 % en raison du ou des circuits de fonction, et s'il est démontré qu'un défaut simple d'un composant à l'intérieur de ce/ces circuit(s) entraîne la perte de cette fonction, alors une **batterie** configurée en série doit être chargée avec un déséquilibre délibéré. Le déséquilibre est introduit dans une **batterie complètement déchargée** par le chargement d'un **élément** à environ 50 % de sa pleine charge.
- c) Pour une **batterie** avec une configuration en série, tous les **éléments** sont à environ 50 % de charge, à l'exception de celui qui est court-circuité. La batterie est alors chargée.
- d) Avec une **batterie complètement chargée** connectée au **chargeur**, un court-circuit est introduit dans le **système de charge** aux bornes d'un composant ou entre les voies de PCB (cartes de circuit imprimé) adjacentes à un emplacement prévu pour produire les résultats les plus défavorables en vue d'évaluer l'effet de réalimentation de la **batterie**. Pour un **chargeur** avec un câble de raccordement à la **batterie**, le court-circuit doit être introduit au point susceptible de produire les effets les plus indésirables. La résistance du court-circuit ne doit pas dépasser 10 mΩ.

Pendant les essais, la tension de chaque **élément** est surveillée en permanence pour déterminer si elle a dépassé la condition limite. L'**échappement de gaz** des **éléments** est autorisé.

L'essai est effectué jusqu'à ce que l'échantillon en essai connaisse une défaillance, retourne à moins de 5 K de la température ambiante ou, si aucun de ces phénomènes ne survient, jusqu'à l'écoulement d'au moins 7 h ou du double de la période de charge normale, la durée la plus longue étant prise en compte.

Les essais sont considérés comme étant satisfaisants si toutes les conditions suivantes sont remplies:

- *Il n'y a eu aucune **explosion** pendant l'essai.*
- *Aucune **carbonisation** ou brûlure du coton ne s'est produite. La **carbonisation** ou l'inflammation du coton par des dispositifs de mise en court-circuit n'est pas considérée comme une défaillance.*
- *Les **éléments** ne doivent pas avoir dépassé la **tension en charge maximale** de plus de 150 mV ou, s'ils l'ont dépassé, alors le **système de charge** doit de façon permanente être désactivé du rechargement de la **batterie**. Afin de déterminer si le rechargement est désactivé, la **batterie** doit être déchargée à l'aide de la source de courant de soudage soumise à l'essai (dans le cas d'un système incorporé) ou en utilisant un nouvel échantillon de la source de courant de soudage (dans le cas d'un **système de batteries amovibles**) à environ 50 % de charge, suivi d'une tentative de rechargement normal de la **batterie**. Il ne doit pas y avoir de courant de charge après 10 min ou après que 25 % de la capacité nominale ont été débités, la première éventualité étant prise en compte.*
- *Il ne doit y avoir aucune présence de dommages à l'évent de l'**élément** susceptibles de compromettre la conformité au O.14.204.*

#### **O.9.204 Court-circuit des batteries ion-lithium**

Ce paragraphe s'applique uniquement aux **batteries** ion-lithium.

Il ne doit y avoir aucun risque d'incendie ou d'**explosion** lorsque les principales connexions de décharge d'une **batterie incorporée** configurée en série, d'un **bloc de batteries amovibles** ou d'un **bloc de batteries démontables** sont court-circuitées dans des conditions d'extrême déséquilibre.

*La conformité doit être vérifiée par l'essai suivant.*

L'essai est effectué avec tous les **éléments** de la **batterie complètement chargée** et un **élément complètement déchargé**.

Un **bloc de batteries amovibles** ou un **bloc de batteries démontables** est placé sur une couche de coton chirurgical absorbant sec, étendue à 150 mm au-delà de chaque côté.

Une source de courant de soudage contenant une **batterie incorporée** est placée sur une couche de coton chirurgical absorbant sec, étendue à 150 mm au-delà de chaque côté.

Les principales connexions de décharge de la **batterie** sont court-circuitées avec une résistance inférieure ou égale à 10 mΩ. L'essai est effectué jusqu'à la défaillance de l'échantillon d'essai ou jusqu'à ce que l'échantillon d'essai retourne à moins de 5 K de la température ambiante. Aucune **explosion** ne doit se produire pendant ou après l'essai. Il ne doit résulter de l'essai aucune **carbonisation** ou brûlure du coton. L'**échappement de gaz** des **éléments** est admis.

La **carbonisation** ou l'inflammation du coton à partir des dispositifs de mise en court-circuit n'est pas considérée comme une défaillance.

Les fusibles, **coupe-circuits thermiques**, **protecteurs thermiques**, **limiteurs de température**, dispositifs électroniques ou tout composant ou conducteur qui interrompt le courant de décharge peuvent fonctionner pendant les essais ci-dessus. Si ces dispositifs jouent un rôle essentiel pour satisfaire à l'essai, l'essai doit être répété deux fois de plus, en utilisant deux échantillons supplémentaires, et doit permettre d'ouvrir le circuit de la même manière, à moins que l'essai soit, par un autre moyen, effectué avec succès. En variante, l'essai peut être répété avec le dispositif en circuit ouvert ponté.

#### O.9.205 Batteries autres que les batteries ion-lithium – surcharge

Les **batteries** composées d'**éléments** autres que le lithium-ion doivent supporter une surcharge défavorable sans risque d'incendie ou d'**explosion**.

La conformité doit être vérifiée par l'essai suivant.

La **batterie** est placée sur une couche de coton chirurgical absorbant sec, étendue à 150 mm au-delà de chaque côté et chargée à une cadence de 10 fois le **régime C<sub>5</sub>** de la **batterie** pendant 85 min. Il ne doit y avoir aucune **explosion** ni aucune **carbonisation** ou brûlure du coton. L'**échappement de gaz** des **éléments** est admis.

#### O.9.206 Déconnexion du bloc de batteries

Les prises, connecteurs et interrupteurs contenus dans la voie de courant électrique des blocs de **batteries** doivent être adaptés à cette application et doivent être capables de déconnecter le bloc de **batteries** des sources de courant de soudage alimentées par batterie sans risque d'incendie ni de choc électrique.

Cet article ne s'applique pas à une source de courant de soudage alimentée par une **batterie incorporée**.

La conformité doit être vérifiée par **examen visuel** selon O.6.1.202 et après les essais suivants.

Le bloc de **batteries complètement chargées**, faisant fonctionner la source de courant de soudage alimentée par batterie dont la sortie est raccordée à une **charge conventionnelle** et réglée pour produire le **courant de soudage assigné maximal**, est déconnecté 10 fois.

### O.9.207 Batteries à usage général

Pour les batteries à **usage général** remplaçables par l'utilisateur, il convient que le constructeur effectue une analyse supplémentaire des risques.

## O.10 Raccordement au réseau d'alimentation

L'Article 10 s'applique uniquement aux circuits de la **classe de tension de batterie B** raccordés de manière conductrice au réseau d'alimentation, avec les exceptions suivantes:

### O.10.5 Circuit de protection

*Ajout à 10.5 du présent document:*

#### O.10.5.201 Essai de continuité pour la liaison équipotentielle des circuits de la classe de tension de batterie B

Tous les composants formant la voie de courant de liaison équipotentielle (conducteurs, connexions) doivent supporter le courant maximal dans une situation de défaut simple.

La résistance de la voie de liaison équipotentielle entre deux parties conductrices accessibles quelconques du circuit électrique de la **classe de tension de batterie B**, qui peuvent être touchées simultanément par une personne, ne doit pas dépasser 0,1  $\Omega$ .

Les résistances de la liaison équipotentielle doivent être soumises à l'essai en injectant un courant d'au moins 10 A à 50 Hz ou 60 Hz provenant d'une source TBTS, qui doit passer à travers la voie de courant potentiel entre deux parties conductrices accessibles quelconques pendant au moins 5 s. Cette voie doit être isolée d'autres voies potentielles non destinées au mesurage. Ces parties conductrices doivent comprendre les boîtiers de composant de la **classe de tension de batterie B**, les connexions à la source de courant de soudage alimentée par batterie et les enveloppes.

La chute de tension entre deux parties conductrices accessibles à une distance allant jusqu'à 2,5 m doit être mesurée et la résistance calculée à partir du courant et de cette chute de tension.

NOTE 2,5 m est la distance habituelle qu'une personne peut atteindre.

### O.10.8 Dispositif de commutation marche/arrêt sur le circuit d'alimentation

*Ajout au 10.8 du présent document:*

Lorsqu'un dispositif de commutation marche/arrêt intégré sur le circuit de la **batterie** (par exemple un interrupteur, un contacteur ou un disjoncteur) est fourni, il doit:

- a) indiquer clairement si le circuit est ouvert ou fermé, et
- b) avoir les caractéristiques assignées suivantes:
  - tension: pas inférieure à la tension assignée de la **batterie**,
  - courant: pas inférieur au courant de la **batterie** à la condition conventionnelle de soudage avec le courant de soudage assigné maximal,ou
- c) convenir pour cette application.

La conformité doit être vérifiée **par examen visuel** pour b) conformément à d'autres normes applicables, et pour c) par les essais suivants.

Surcharge: La sortie de la source de courant de soudage alimentée par une batterie **complètement chargée** est court-circuitée conformément à O.9.3. Le dispositif de commutation est mis en fonctionnement pendant 100 cycles à la cadence de 6 à 10 cycles par minute avec une durée de marche minimale de 1 s.

Endurance: La sortie est reliée à une **charge conventionnelle** et réglée pour produire le **courant de soudage assigné maximal**. Le dispositif de commutation est mis en fonctionnement pendant 1 000 cycles à une cadence de 6 à 10 cycles par minute avec une durée de marche minimale de 1 s.

*Ajout à l'Article 10 du présent document:*

**O.10.201** Pour les sources de courant de soudage alimentées par batterie avec **des blocs de batteries démontables**, le câble souple externe doit avoir des ancrages de sorte que les conducteurs soient libérés des contraintes, y compris la torsion, lorsqu'ils sont connectés à l'intérieur de la source de courant de soudage, et soient protégés contre l'abrasion.

*La conformité doit être vérifiée par essai conformément à 10.6.*

## **O.14 Dispositions mécaniques**

### **O.14.1 Exigences générales**

*Ajout au 14.1 du présent document:*

Après l'essai, la source de courant de soudage alimentée par batterie et le bloc de **batteries** ne doivent pas prendre feu ni exploser.

En outre, les exigences suivantes s'appliquent aux **batteries** ion-lithium après l'essai de O.14.2.2 et O.14.4:

- la tension en circuit ouvert de la **batterie** ne doit pas être inférieure à 90 % de la tension mesurée immédiatement avant l'essai;
- la **batterie** doit démontrer après l'essai l'aptitude au déchargement normal et au rechargement normal;
- il ne doit y avoir aucun dommage à l'événement de l'**élément** qui compromet la conformité au O.14.204.

### **O.14.2 Enveloppe**

#### **O.14.2.2 Résistance de l'enveloppe**

*Ajout au 14.2.2 du présent document:*

Les **blocs de batteries amovibles** doivent être installés pendant l'essai de résistance de l'enveloppe.

Pour les **blocs de batteries amovibles** ou les **blocs de batteries démontables** dont la masse est supérieure ou égale à 3 kg, l'essai est répété sur les blocs de **batteries** séparément.

#### **O.14.4 Essai de chute**

Un matériel auquel est fixé un **bloc de batteries amovibles** doit être capable de supporter l'essai de chute. Pour cet essai, le matériel doit inclure tous les accessoires, le liquide de refroidissement et le fil d'apport (à l'exception des bouteilles de gaz, traîneaux séparés,

chariots et châssis à roues, sauf s'ils font partie du matériel normal et sont fixés de façon permanente) qu'il est recommandé d'installer.

Pour l'essai de chute, les hauteurs doivent être les suivantes:

- a) le matériel d'une masse inférieure ou égale à 25 kg doit supporter une chute de 250 mm;
- b) le matériel d'une masse supérieure à 25 kg doit supporter une chute de 100 mm.

NOTE 1 La masse du matériel comprend la masse des accessoires, du liquide de refroidissement et du fil d'apport.

*La conformité doit être vérifiée en faisant tomber le matériel trois fois sur une surface dure et rigide. Cet essai est effectué de sorte qu'un bord inférieur différent du matériel reçoive le choc à chaque fois qu'il tombe.*

NOTE 2 En pratique, un coin touche la surface d'impact en premier.

*De plus, pour les **blocs de batteries amovibles** ou les **blocs de batteries démontables** dont la masse est inférieure à 3 kg, l'essai est répété sur les blocs de **batteries** séparément trois fois à partir de 1 m de hauteur. L'échantillon doit être positionné de façon à varier le point d'impact.*

*Ajout à l'Article 14 du présent document:*

**O.14.201** Il ne doit pas être possible d'installer un **bloc de batteries amovibles** ou un **bloc de batteries démontables** en polarité inverse.

*La conformité doit être vérifiée par examen.*

**O.14.202** Essai de pression de l'enveloppe des **batteries** ion-lithium

Ce paragraphe s'applique uniquement aux **batteries** ion-lithium.

L'enveloppe des **batteries** ion-lithium doit être conçue de sorte qu'elle libère en toute sécurité des gaz qui peuvent être émis par suite d'un **échappement de gaz**.

*La conformité doit être vérifiée par mesurage dans le cas de a) ou par l'essai de b):*

- a) la surface totale des ouvertures dans l'enveloppe permettant de laisser passer des gaz sans obstruction doit être supérieure ou égale à 20 mm<sup>2</sup>; ou
- b) l'enveloppe doit être soumise à l'essai comme suit:

*Un total de  $(21 \pm 2,1)$  ml d'air doit être fourni, à une pression initiale de  $(2\,070 \pm 207)$  kPa  $\pm 10\%$  à travers un orifice de  $(2,87 \pm 0,05)$  mm de diamètre, à l'enveloppe d'une source de courant de soudage avec **batterie incorporée** ou à l'enveloppe d'un **bloc de batteries amovibles** ou d'un **bloc de batteries démontables**. La pression interne de l'enveloppe doit descendre en dessous de 70 kPa en 30 s. Il ne doit pas y avoir de rupture qui empêcherait l'enveloppe de satisfaire aux exigences du présent document. Il est admis d'ajouter un volume supplémentaire, ne devant pas dépasser 3 ml, au volume de l'enveloppe, tel qu'il peut être exigé pour les accessoires d'essai.*

**O.14.203** Le constructeur doit informer l'utilisateur que seules les **batteries à usage général** spécifiées par le constructeur doivent être utilisées comme source d'énergie primaire pour les sources de courant de soudage alimentées par batterie.

*La conformité doit être vérifiée par examen.*



**O.14.204** Les événements des **éléments** de batterie ne doivent pas être obstrués de manière à compromettre leur bon fonctionnement si la sécurité repose sur **l'échappement de gaz**.

*La conformité doit être vérifiée par examen ou, en cas de doute, par examen des **éléments** à l'issue des essais anormaux de O.9.201 a), b) et c) pour assurer que les **éléments** n'ont pas été ventilés par des moyens autres que l'évent.*

**O.14.205** Les interfaces utilisateur accessibles entre les éléments d'un **système de batterie** ne doivent pas employer les types de connecteurs suivants:

- connecteurs d'entrée secteur, sauf pour les connexions à l'alimentation secteur;
- des connecteurs à cylindre d'un diamètre extérieur de 6,5 mm ou moins;
- des fiches téléphoniques d'un diamètre de 3,5 mm ou moins.

*La conformité doit être vérifiée par examen.*

### O.15 Plaque signalétique

### 0.15.3 Contenu

a) Identification

Case 4 Symbole de la source de courant de soudage, si applicable (facultatif) et type de **batterie incorporée**, par exemple:

NiCd **batteries** nickel-cadmium

NiMH **batteries** au nickel-hydrure métallique

Li-ion **batteries** ion-lithium

b) Sortie de soudage

Case 12  $I_{2\max} = \dots$  A Symbole et valeur du courant de soudage assigné maximal

**Case 13**     $U_2 = \dots \text{ V}$     Symbole et valeur de la tension conventionnelle en charge

Cases 11a, 11b, 11c Non applicable.

12a, 12b, 12c Non applicable.

13a, 13b, 13c Non applicable.

En variante, pour les sources de courant de soudage pour lesquelles le chargement continu pendant le soudage est possible conformément à O.7.1.1, le **facteur de marche** tel que spécifié en 15.3 b) peut être appliqué.

c) Alimentation en énergie

Case 14 Symbole pour l'alimentation, par exemple:

~~NO~~ Courant continu

| Case                                                                   | Sources de courant de soudage avec batterie incorporée |                                                                                          | Case | Sources de courant de soudage avec batterie amovible ou démontable |                                        |
|------------------------------------------------------------------------|--------------------------------------------------------|------------------------------------------------------------------------------------------|------|--------------------------------------------------------------------|----------------------------------------|
| 15                                                                     | $U_b \dots V$                                          | Tension assignée de la batterie                                                          | 15   | $U_b \dots V$                                                      | Tension assignée de la batterie        |
| 16                                                                     | $E \dots W \cdot h$                                    | Capacité assignée de la batterie, basée sur la capacité assignée des éléments déterminés |      |                                                                    |                                        |
| 17                                                                     | $I_b \dots A$                                          | Courant de charge assigné                                                                |      |                                                                    |                                        |
| 19                                                                     | Chargeur                                               | Chargeur spécifié par le constructeur                                                    | 19   | Batterie                                                           | Batterie spécifiée par le constructeur |
| Les cases 15 à 17 forment un tableau avec les valeurs correspondantes. |                                                        |                                                                                          |      |                                                                    |                                        |

*Ajout au 15.3 du présent document:*

- d) Les blocs de batteries démontables et amovibles doivent également être marqués avec les informations supplémentaires suivantes:
- le type (identification) donné par le constructeur;
  - l'année de fabrication et un code de date indiquant au moins le mois de fabrication;
  - la tension assignée de la **batterie**;
  - la capacité attribuée par le constructeur en W·h, basée sur la capacité assignée des **éléments** déterminés;
  - le type de **batterie** tel que Li-Ion, NiCd et NiMH (pour les **batteries** alcalines et autres **batteries** à électrolyte non acide).

NOTE Au Canada et aux États-Unis d'Amérique, les exigences supplémentaires suivantes s'appliquent.

Une source de courant de soudage alimentée par batterie équipée d'un **bloc de batteries amovibles** ou d'un **bloc de batteries démontables** doit être marquée avec la mention: «À utiliser uniquement avec batterie \_\_\_\_», ou mention équivalente, dans laquelle l'espace souligné est complété par le nom ou la marque commerciale du constructeur, un numéro de catalogue, une identification de la série, ou mention équivalente, du bloc de **batteries**. En variante, la mention «Voir manuel d'instructions pour autres blocs de batteries», ou mention équivalente, peut être utilisée en plus d'au moins un bloc de **batteries** référencé par le numéro de catalogue.

Un **bloc de batteries amovibles**, un **bloc de batteries démontables** ou une source de courant de soudage alimentée par batterie équipée d'une **batterie incorporée** doit être marquée avec la mention: «À utiliser uniquement avec chargeur\_\_\_\_», ou mention équivalente, dans laquelle l'espace souligné est complété par le nom ou la marque commerciale du constructeur, un numéro de catalogue, une identification de la série, ou mention équivalente, du **chargeur**. En variante, la mention «Voir manuel d'instructions pour autres chargeurs», ou mention équivalente, peut être utilisée en plus d'au moins un **chargeur** référencé par le numéro de catalogue.

## O.17 Instructions et marquages

### O.17.1 Instructions

*Ajout au 17.1 du présent document:*

- t) Pour les sources de courant de soudage alimentées par batterie:
- 1) Instructions relatives au chargement de la **batterie**, informations relatives à la plage de températures ambiantes pour la source de courant de soudage, l'utilisation ainsi que le stockage de la **batterie**, et informations relatives à la plage de températures ambiantes recommandée pour le **système de charge** pendant le chargement;
  - 2) Pour une source de courant de soudage alimentée par batterie destinée à être utilisée avec un **bloc de batteries amovibles** ou un **bloc de batteries démontables**: indications des blocs de **batteries** appropriés à l'utilisation, telles que numéro de catalogue, identification de la série ou mention équivalente;
  - 3) Indications du **chargeur** approprié à l'utilisation, telles que numéro de catalogue, identification de la série ou mention équivalente;
  - 4) Informations sur la durabilité et la durée de vie de la batterie, plage typique de soudage pour une **batterie complètement chargée** et temps typiques de charge;
  - 5) Avertissements concernant les sources de courant de soudage alimentées par batterie:
    - Recharger uniquement avec le chargeur spécifié par le constructeur. Un chargeur approprié pour un type de bloc de batteries peut créer un risque d'incendie lorsqu'il est utilisé avec un autre bloc de batteries.
    - Utiliser les sources de courant de soudage uniquement avec les blocs de batteries explicitement désignés. L'utilisation d'autres blocs de batteries peut créer un risque de blessure et d'incendie.
    - Lorsque le bloc de batteries n'est pas utilisé, le tenir éloigné des autres objets métalliques, comme les trombones, pièces de monnaie, clés, clous, vis ou autres petits objets métalliques qui peuvent établir une connexion d'une borne à une



autre. La mise en court-circuit des bornes de batterie ensemble peut causer des brûlures ou un incendie.

- Dans des conditions défavorables, du liquide peut être éjecté de la batterie; éviter tout contact. En cas de contact accidentel, rincer avec de l'eau. Si le liquide touche les yeux, prendre conseil en plus auprès d'un ophtalmologue. Le liquide éjecté de la batterie peut causer des irritations ou des brûlures.
- Ne pas utiliser un bloc de batteries ou une source de courant de soudage qui est endommagé(e) ou modifié(e). Les batteries endommagées ou modifiées peuvent présenter un comportement imprévisible qui provoque un incendie, une explosion ou un risque de blessure.
- Ne pas exposer un bloc de batteries ou une source de courant de soudage au feu ou à une température excessive. L'exposition au feu ou à une température supérieure à 130 °C peut causer une explosion.

NOTE 1 La température «130 °C» peut être remplacée par la température «265 °F».

- Suivre toutes les instructions de charge et ne pas charger le bloc de batteries ou la source de courant de soudage hors de la plage de températures spécifiée dans le manuel d'instructions. *Le chargement impropre ou à des températures hors de plage spécifiée peut endommager la batterie et augmenter le risque d'incendie.*

NOTE 2 En Europe (EN 62841-1), l'exigence supplémentaire suivante s'applique:

Pour les sources de courant de soudage alimentées par batterie équipées d'une **batterie incorporée**: instruction sur la façon dont **la batterie incorporée** peut être retirée en toute sécurité de la source de courant de soudage après expiration de la durée de vie de cette source, et informations sur le type de **batterie** comme Li-Ion, NiCd et NiMH.

## O.17.2 Marquages

Ajout au 17.2 du présent document:

Marquage des composants électriques de la **classe de tension de batterie B**:

Le symbole W012 conforme à l'ISO 7010:2011 et représenté à la Figure O.1 doit figurer sur (de préférence) ou à proximité des sources d'énergie électrique de la **classe de tension de batterie B**.



IEC

Figure O.1 – Marquage des composants électriques  
de la classe de tension de batterie B

## Annexe P (normative)

### Conformité des composants

Les composants et sous-ensembles qui, en cas de défaillance, peuvent provoquer un danger, tels que des sorties d'alimentations et des matériels de traitement de l'information intégrés, doivent être utilisés selon leurs caractéristiques assignées spécifiées, à moins qu'une exception spécifique ne soit formulée. Ils doivent être conformes à l'un des éléments suivants:

- a) les exigences de sécurité applicables d'une norme IEC appropriée. La conformité à d'autres exigences de la norme de composant n'est pas exigée. Si nécessaire pour l'application, les composants doivent être soumis aux essais du présent document, sauf lorsque ces essais sont identiques ou équivalents aux essais exigés pour vérifier la conformité à la norme de composant appropriée;

Par exemple, si les composants satisfont aux exigences de sécurité de l'IEC 60950-1 mais sont assignés pour un environnement moins sévère que l'environnement applicable de l'Article 4 et de 6.1.1, ils doivent également satisfaire aux exigences supplémentaires correspondantes du présent document.

- b) les exigences de la présente norme et, si nécessaire pour l'application, toutes les exigences de sécurité applicables supplémentaires de la norme de composant IEC appropriée;
- c) en l'absence de norme IEC appropriée, les exigences du présent document;
- d) les exigences de sécurité applicables d'une norme non établie par l'IEC qui sont au moins aussi sévères que les exigences de la norme IEC appropriée, à condition que la conformité du composant à une norme non établie par l'IEC ait été certifiée par un organisme d'essai reconnu.

NOTE Il n'est pas nécessaire de répéter les essais réalisés par un organisme d'essai reconnu, qui confirment la conformité aux exigences de sécurité applicables, même si les essais ont été réalisés à l'aide d'une norme non établie par l'IEC.

La Figure P.1 est un diagramme présentant les méthodes de vérification de la conformité.

*La conformité est vérifiée par examen et, si nécessaire, par un essai.*

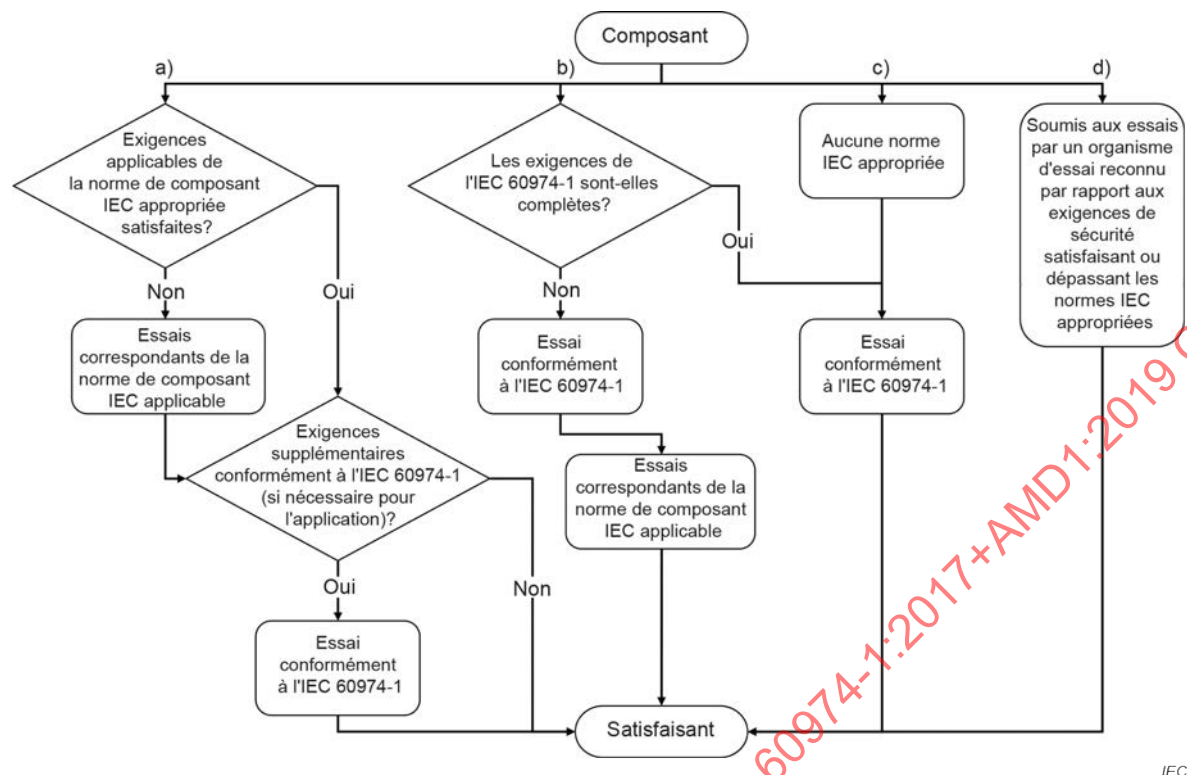


Figure P.1 – Diagramme pour les méthodes de conformité de l'Annexe P

## Bibliographie

IEC 60038:2009, *Tensions normales de l'IEC*

IEC 60050-195:1998, *Vocabulaire Électrotechnique International – Partie 195: Mise à la terre et protection contre les chocs électriques*  
IEC 60050-195:1998/AMD1:2001

IEC 60050-811:1991, *Vocabulaire Électrotechnique International – Chapitre 811: Traction électrique*

IEC 60050-826:2004, *Vocabulaire Électrotechnique International – Partie 826: Installations électriques*

IEC 60076-12, *Transformateurs de puissance – Partie 12: Guide de charge pour transformateurs de puissance de type sec*

IEC 60085, *Isolation électrique – Évaluation et désignation thermiques*

IEC 60204-1, *Sécurité des machines – Équipement électrique des machines – Partie 1: Règles générales*

IEC 60309-1, *Prises de courant pour usages industriels – Partie 1: Règles générales*

IEC 60335-2-29, *Appareils électrodomestiques et analogues – Sécurité – Partie 2-29: Exigences particulières pour les chargeurs de batterie*

IEC 60384-14, *Condensateurs fixes utilisés dans les équipements électroniques – Partie 14: Spécification intermédiaire – Condensateurs fixes d'antiparasitage et raccordement à l'alimentation*

IEC TS 60479-1:2005, *Effets du courant sur l'homme et les animaux domestiques – Partie 1: Aspects généraux*

IEC TS 60479-2, *Effets du courant sur l'homme et les animaux domestiques – Partie 2: Aspects particuliers*

IEC TR 60755:2008, *Exigences générales pour les dispositifs de protection à courant différentiel résiduel*

IEC 60950-1, *Matériels de traitement de l'information – Sécurité – Partie 1: Exigences générales*

IEC 60974-3, *Matériel de soudage à l'arc – Partie 3: Dispositifs d'amorçage et de stabilisation de l'arc*

IEC 60974-4, *Matériel de soudage à l'arc – Partie 4: Inspection et essais périodiques*

IEC 60974-6, *Matériel de soudage à l'arc – Partie 6: Matériel à service limité*

IEC 60974-9, *Matériel de soudage à l'arc – Partie 9: Installation et utilisation*

IEC 60974-10, *Matériel de soudage à l'arc – Partie 10: Exigences de compatibilité électromagnétique (CEM)*

IEC 60974-12, *Matériel de soudage à l'arc – Partie 12: Dispositifs de connexion pour câbles de soudage*

IEC 61032:1997, *Protection des personnes et des matériels par les enveloppes – Calibres d'essai pour la vérification*

IEC 61558-1, *Sécurité des transformateurs, alimentations, bobines d'inductance et produits analogues – Partie 1: Exigences générales et essais*

IEC 62281, *Sécurité des piles et des accumulateurs au lithium pendant le transport*

ISO 3864-1, *Symboles graphiques – Couleurs de sécurité et signaux de sécurité – Partie 1: Principes de conception pour les signaux de sécurité et les marquages de sécurité*

ISO 6469-1:2009, *Véhicules routiers électriques – Spécifications de sécurité – Partie 1: Système de stockage d'énergie rechargeable à bord du véhicule (RESS)*

ISO 6469-3, *Véhicules routiers électriques – Spécifications de sécurité – Partie 3: Protection des personnes contre les chocs électriques*

ISO 7000, *Symboles graphiques utilisables sur le matériel* (disponible sous: <http://www.graphical-symbols.info/equipment>)

ISO 13732-1, *Ergonomie des ambiances thermiques – Méthodes d'évaluation de la réponse humaine au contact avec des surfaces – Partie 1: Surfaces chaudes*

ISO 17846, *Soudage et techniques connexes – Hygiène et sécurité – Étiquettes de prévention muettes pour les produits de soudage à l'arc et de coupage*

CSA C22.1, *Canadian electrical code*

EN 50525-1, *Câbles électriques – Câbles d'énergie basse tension de tension assignée au plus égale à 450/750 V ( $U_0/U$ ) – Partie 1: Exigences générales*

EN 50525-2-21, *Câbles électriques – Câbles d'énergie basse tension de tension assignée au plus égale à 450/750 V ( $U_0/U$ ) – Partie 2-21: Câbles pour applications générales – Câbles souples isolés en matériau élastomère réticulé*

EN 50525-2-81, *Câbles électriques – Câbles d'énergie basse tension de tension assignée au plus égale à 450/750 V ( $U_0/U$ ) – Partie 2-81: Câbles pour applications générales – Câbles pour soudage à l'arc isolés en matériau élastomère réticulé*

EN 62841-1, *Outils électroportatifs à moteur, outils portables et machines pour jardins et pelouses – Sécurité – Partie 1: Règles générales*

NFPA 70, *National Electrical code*

US Code of Federal Regulations, Title 16: *Commercial Practices – Parts 1407: Portable Generators: Requirements to provide performance and technical data by labelling*

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

**FINAL VERSION****VERSION FINALE**

**Arc welding equipment –  
Part 1: Welding power sources**

**Matériel de soudage à l'arc –  
Partie 1: Sources de courant de soudage**

## CONTENTS

|                                                                                             |    |
|---------------------------------------------------------------------------------------------|----|
| FOREWORD .....                                                                              | 9  |
| 1 Scope .....                                                                               | 11 |
| 2 Normative references .....                                                                | 11 |
| 3 Terms and definitions .....                                                               | 12 |
| 3.1 General terms .....                                                                     | 12 |
| 3.2 Terms related to battery systems .....                                                  | 21 |
| 4 Environmental conditions .....                                                            | 24 |
| 5 Tests .....                                                                               | 25 |
| 5.1 Test conditions .....                                                                   | 25 |
| 5.2 Measuring instruments .....                                                             | 25 |
| 5.3 Conformity of components .....                                                          | 25 |
| 5.4 Type tests .....                                                                        | 25 |
| 5.5 Routine tests .....                                                                     | 26 |
| 6 Protection against electric shock .....                                                   | 26 |
| 6.1 Insulation .....                                                                        | 26 |
| 6.1.1 General .....                                                                         | 26 |
| 6.1.2 Clearances .....                                                                      | 27 |
| 6.1.3 Creepage distances .....                                                              | 29 |
| 6.1.4 Insulation resistance .....                                                           | 31 |
| 6.1.5 Dielectric strength .....                                                             | 31 |
| 6.2 Protection against electric shock in normal service (direct contact) .....              | 33 |
| 6.2.1 Protection provided by the enclosure .....                                            | 33 |
| 6.2.2 Capacitors .....                                                                      | 33 |
| 6.2.3 Automatic discharge of supply circuit capacitors .....                                | 34 |
| 6.2.4 Isolation of the welding circuit .....                                                | 34 |
| 6.2.5 Welding circuit touch current .....                                                   | 34 |
| 6.2.6 Touch current in normal condition .....                                               | 35 |
| 6.3 Protection against electric shock in case of a fault condition (indirect contact) ..... | 36 |
| 6.3.1 Protective provisions .....                                                           | 36 |
| 6.3.2 Isolation between windings of the supply circuit and the welding circuit .....        | 36 |
| 6.3.3 Internal conductors and connections .....                                             | 36 |
| 6.3.4 Additional requirements for plasma cutting systems .....                              | 37 |
| 6.3.5 Movable coils and cores .....                                                         | 37 |
| 6.3.6 Touch current in fault condition .....                                                | 37 |
| 7 Thermal requirements .....                                                                | 38 |
| 7.1 Heating test .....                                                                      | 38 |
| 7.1.1 Test conditions .....                                                                 | 38 |
| 7.1.2 Tolerances of the test parameters .....                                               | 38 |
| 7.1.3 Duration of test .....                                                                | 39 |
| 7.2 Temperature measurement .....                                                           | 39 |
| 7.2.1 Measurement conditions .....                                                          | 39 |
| 7.2.2 Surface temperature sensor .....                                                      | 39 |
| 7.2.3 Resistance .....                                                                      | 39 |
| 7.2.4 Embedded temperature sensor .....                                                     | 40 |



|        |                                                                                                                   |    |
|--------|-------------------------------------------------------------------------------------------------------------------|----|
| 7.2.5  | Determination of the ambient air temperature .....                                                                | 40 |
| 7.2.6  | Recording of temperatures .....                                                                                   | 40 |
| 7.3    | Limits of temperature rise .....                                                                                  | 40 |
| 7.3.1  | Windings, commutators and slip-rings.....                                                                         | 40 |
| 7.3.2  | External surfaces.....                                                                                            | 41 |
| 7.3.3  | Other components .....                                                                                            | 42 |
| 7.4    | Loading test.....                                                                                                 | 42 |
| 7.5    | Commutators and slip-rings .....                                                                                  | 43 |
| 8      | Thermal protection.....                                                                                           | 43 |
| 8.1    | General requirements .....                                                                                        | 43 |
| 8.2    | Construction .....                                                                                                | 43 |
| 8.3    | Location.....                                                                                                     | 43 |
| 8.4    | Operating capacity.....                                                                                           | 43 |
| 8.5    | Operation.....                                                                                                    | 44 |
| 8.6    | Resetting .....                                                                                                   | 44 |
| 8.7    | Indication .....                                                                                                  | 44 |
| 9      | Abnormal operation .....                                                                                          | 44 |
| 9.1    | General requirements .....                                                                                        | 44 |
| 9.2    | Stalled fan test.....                                                                                             | 45 |
| 9.3    | Short circuit test.....                                                                                           | 45 |
| 9.4    | Overload test .....                                                                                               | 46 |
| 10     | Connection to the supply network .....                                                                            | 46 |
| 10.1   | Supply voltage .....                                                                                              | 46 |
| 10.2   | Multi-supply voltage .....                                                                                        | 46 |
| 10.3   | Means of connection to the supply circuit.....                                                                    | 46 |
| 10.4   | Marking of terminals .....                                                                                        | 47 |
| 10.5   | Protective circuit .....                                                                                          | 47 |
| 10.5.1 | Continuity requirement.....                                                                                       | 47 |
| 10.5.2 | Type test .....                                                                                                   | 48 |
| 10.5.3 | Routine test.....                                                                                                 | 48 |
| 10.6   | Cable anchorage.....                                                                                              | 49 |
| 10.7   | Inlet openings .....                                                                                              | 50 |
| 10.8   | Supply circuit on/off switching device.....                                                                       | 50 |
| 10.9   | Supply cables .....                                                                                               | 51 |
| 10.10  | Supply coupling device (attachment plug) .....                                                                    | 51 |
| 11     | Output .....                                                                                                      | 52 |
| 11.1   | Rated no-load voltage .....                                                                                       | 52 |
| 11.1.1 | Rated no-load voltage for use in environments with increased risk of electric shock .....                         | 52 |
| 11.1.2 | Rated no-load voltage for use in environments without increased risk of electric shock .....                      | 52 |
| 11.1.3 | Rated no-load voltage for the use with mechanically held torches with increased protection for the operator ..... | 52 |
| 11.1.4 | Rated no-load voltage for special processes for example plasma cutting .....                                      | 52 |
| 11.1.5 | Additional requirements .....                                                                                     | 53 |
| 11.1.6 | Measuring circuits .....                                                                                          | 54 |
| 11.2   | Type test values of the conventional load voltage .....                                                           | 55 |
| 11.2.1 | Manual metal arc welding with covered electrodes.....                                                             | 55 |
| 11.2.2 | Tungsten inert gas.....                                                                                           | 55 |

|        |                                                                         |    |
|--------|-------------------------------------------------------------------------|----|
| 11.2.3 | Metal inert/active gas and flux cored arc welding .....                 | 55 |
| 11.2.4 | Submerged arc welding .....                                             | 55 |
| 11.2.5 | Plasma cutting .....                                                    | 55 |
| 11.2.6 | Plasma welding .....                                                    | 55 |
| 11.2.7 | Plasma gouging .....                                                    | 55 |
| 11.2.8 | Additional requirements .....                                           | 55 |
| 11.3   | Mechanical switching devices used to adjust output .....                | 56 |
| 11.4   | Welding circuit connections .....                                       | 56 |
| 11.4.1 | Protection against unintentional contact .....                          | 56 |
| 11.4.2 | Location of coupling devices .....                                      | 56 |
| 11.4.3 | Outlet openings .....                                                   | 56 |
| 11.4.4 | Three-phase multi-operator welding transformer .....                    | 56 |
| 11.4.5 | Marking .....                                                           | 57 |
| 11.4.6 | Connections for plasma cutting torches .....                            | 57 |
| 11.5   | Power supply to external devices connected to the welding circuit ..... | 57 |
| 11.6   | Auxiliary power supply .....                                            | 57 |
| 11.7   | Welding cables .....                                                    | 58 |
| 12     | Control circuits .....                                                  | 58 |
| 12.1   | General requirement .....                                               | 58 |
| 12.2   | Isolation of control circuits .....                                     | 58 |
| 12.3   | Working voltages of remote control circuits .....                       | 58 |
| 13     | Hazard reducing device .....                                            | 59 |
| 13.1   | General requirements .....                                              | 59 |
| 13.2   | Types of hazard reducing devices .....                                  | 59 |
| 13.2.1 | Voltage reducing device .....                                           | 59 |
| 13.2.2 | Switching device for AC to DC .....                                     | 59 |
| 13.3   | Requirements for hazard reducing devices .....                          | 59 |
| 13.3.1 | Disabling the hazard reducing device .....                              | 59 |
| 13.3.2 | Interference with operation of a hazard reducing device .....           | 60 |
| 13.3.3 | Indication of satisfactory operation .....                              | 60 |
| 13.3.4 | Fail to a safe condition .....                                          | 60 |
| 14     | Mechanical provisions .....                                             | 60 |
| 14.1   | General requirements .....                                              | 60 |
| 14.2   | Enclosure .....                                                         | 60 |
| 14.2.1 | Enclosure materials .....                                               | 60 |
| 14.2.2 | Enclosure strength .....                                                | 61 |
| 14.3   | Handling means .....                                                    | 61 |
| 14.3.1 | Mechanised handling .....                                               | 61 |
| 14.3.2 | Manual handling .....                                                   | 61 |
| 14.4   | Drop withstand .....                                                    | 62 |
| 14.5   | Tilting stability .....                                                 | 62 |
| 15     | Rating plate .....                                                      | 62 |
| 15.1   | General requirements .....                                              | 62 |
| 15.2   | Description .....                                                       | 63 |
| 15.3   | Contents .....                                                          | 64 |
| 15.4   | Tolerances .....                                                        | 67 |
| 15.5   | Direction of rotation .....                                             | 67 |
| 16     | Adjustment of the output .....                                          | 67 |

|                       |                                                                                                        |     |
|-----------------------|--------------------------------------------------------------------------------------------------------|-----|
| 16.1                  | Type of adjustment .....                                                                               | 67  |
| 16.2                  | Marking of the adjusting device .....                                                                  | 68  |
| 16.3                  | Indication of current or voltage control .....                                                         | 68  |
| 17                    | Instructions and markings .....                                                                        | 69  |
| 17.1                  | Instructions .....                                                                                     | 69  |
| 17.2                  | Markings .....                                                                                         | 70  |
| Annex A (informative) | Nominal voltages of supply networks .....                                                              | 71  |
| Annex B (informative) | Example of a combined dielectric test .....                                                            | 72  |
| Annex C (normative)   | Unbalanced load in case of AC tungsten inert-gas welding power sources .....                           | 73  |
| C.1                   | General .....                                                                                          | 73  |
| C.2                   | Unbalanced load .....                                                                                  | 73  |
| C.3                   | Example for an unbalanced load .....                                                                   | 74  |
| Annex D (informative) | Extrapolation of temperature to time of shutdown .....                                                 | 75  |
| Annex E (normative)   | Construction of supply circuit terminals .....                                                         | 76  |
| E.1                   | Size of terminals .....                                                                                | 76  |
| E.2                   | Connections at the terminals .....                                                                     | 76  |
| E.3                   | Construction of the terminals .....                                                                    | 77  |
| E.4                   | Fixing of the terminals .....                                                                          | 77  |
| Annex F (informative) | Cross-reference to non-SI units .....                                                                  | 78  |
| Annex G (informative) | Suitability of supply network for the measurement of the true r.m.s. value of the supply current ..... | 79  |
| Annex H (informative) | Plotting of static characteristics .....                                                               | 80  |
| H.1                   | General .....                                                                                          | 80  |
| H.2                   | Method .....                                                                                           | 80  |
| H.3                   | Analysis of the results .....                                                                          | 80  |
| Annex I (normative)   | Test methods for a 10 Nm impact .....                                                                  | 81  |
| I.1                   | Pendulum impact hammer .....                                                                           | 81  |
| I.2                   | Free fall spherical steel weight .....                                                                 | 82  |
| Annex J (normative)   | Thickness of sheet metal for enclosures .....                                                          | 83  |
| Annex K (informative) | Examples of rating plates .....                                                                        | 86  |
| Annex L (informative) | Graphical symbols for arc welding equipment .....                                                      | 93  |
| L.1                   | General .....                                                                                          | 93  |
| L.2                   | Use of symbols .....                                                                                   | 93  |
| L.2.1                 | General .....                                                                                          | 93  |
| L.2.2                 | Selection of symbols .....                                                                             | 93  |
| L.2.3                 | Size of symbols .....                                                                                  | 93  |
| L.2.4                 | Use of colour .....                                                                                    | 93  |
| L.3                   | Symbols .....                                                                                          | 94  |
| L.3.1                 | General .....                                                                                          | 94  |
| L.3.2                 | Letter symbols .....                                                                                   | 94  |
| L.3.3                 | Graphical symbols .....                                                                                | 95  |
| L.4                   | Examples of combinations of symbols .....                                                              | 115 |
| L.5                   | Examples of control panels .....                                                                       | 117 |
| Annex M (informative) | Efficiency and idle state power measurement .....                                                      | 120 |
| M.1                   | Measuring efficiency .....                                                                             | 120 |
| M.2                   | Measuring idle state power .....                                                                       | 120 |

|                                                                        |     |
|------------------------------------------------------------------------|-----|
| Annex N (normative) Touch current measurement in fault condition ..... | 122 |
| Annex O (normative) Battery-powered welding power sources .....        | 127 |
| O.1 General.....                                                       | 127 |
| O.4 Environmental conditions .....                                     | 128 |
| O.5 Tests .....                                                        | 128 |
| O.5.1 Test conditions .....                                            | 128 |
| O.5.3 Conformity of components .....                                   | 129 |
| O.6 Protection against electric shock.....                             | 130 |
| O.6.1 Insulation.....                                                  | 130 |
| O.6.2 Protection against electric shock in normal service .....        | 131 |
| O.7 Thermal requirements .....                                         | 132 |
| O.7.1 Heating test .....                                               | 132 |
| O.7.2 Temperature measurement.....                                     | 133 |
| O.7.4 Loading test.....                                                | 133 |
| O.7.201 Normal charging of lithium-ion systems.....                    | 133 |
| O.8 Thermal protection.....                                            | 134 |
| O.8.1 General requirements .....                                       | 134 |
| O.8.4 Operating capacity.....                                          | 134 |
| O.9 Abnormal operation.....                                            | 134 |
| O.9.1 General requirements .....                                       | 134 |
| O.9.2 Stalled fan test .....                                           | 135 |
| O.9.3 Short circuit test .....                                         | 135 |
| O.9.4 Overload test.....                                               | 135 |
| O.9.201 Welding power source – abnormal conditions .....               | 135 |
| O.9.202 Welding circuit components – abnormal conditions .....         | 136 |
| O.9.203 Lithium-ion charging systems – abnormal conditions .....       | 136 |
| O.9.204 Lithium-ion battery short circuit.....                         | 137 |
| O.9.205 Batteries other than lithium-ion – overcharging .....          | 138 |
| O.9.206 Battery pack disconnection .....                               | 138 |
| O.9.207 General purpose batteries .....                                | 138 |
| O.10 Connection to the supply network .....                            | 138 |
| O.10.5 Protective circuit.....                                         | 139 |
| O.10.8 Supply circuit on/off switching device.....                     | 139 |
| O.14 Mechanical provisions.....                                        | 140 |
| O.14.1 General requirements .....                                      | 140 |
| O.14.2 Enclosure .....                                                 | 140 |
| O.14.4 Drop withstand .....                                            | 140 |
| O.15 Rating plate .....                                                | 141 |
| O.15.3 Contents.....                                                   | 141 |
| O.17 Instructions and markings .....                                   | 143 |
| O.17.1 Instructions.....                                               | 143 |
| O.17.2 Markings.....                                                   | 144 |
| Annex P (normative) Conformity of components.....                      | 145 |
| Bibliography.....                                                      | 147 |

|                                                                            |    |
|----------------------------------------------------------------------------|----|
| Figure 1 – Example of insulation configuration for Class I equipment ..... | 27 |
|----------------------------------------------------------------------------|----|

|                                                              |    |
|--------------------------------------------------------------|----|
| Figure 2 – Measurement of welding circuit touch current..... | 35 |
|--------------------------------------------------------------|----|

|                                                                   |    |
|-------------------------------------------------------------------|----|
| Figure 3 – Measurement of touch current in normal condition ..... | 35 |
|-------------------------------------------------------------------|----|

|                                                                                                                                                                             |     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----|
| Figure 4 – Measurement of r.m.s. values .....                                                                                                                               | 54  |
| Figure 5 – Measurement of peak values .....                                                                                                                                 | 54  |
| Figure 6 – Principle of the rating plate .....                                                                                                                              | 63  |
| Figure B.1 – Combined high-voltage transformers .....                                                                                                                       | 72  |
| Figure C.1 – Voltage and current during AC tungsten inert-gas welding .....                                                                                                 | 73  |
| Figure C.2 – Unbalanced voltage during AC tungsten inert-gas welding .....                                                                                                  | 74  |
| Figure C.3 – AC welding power source with unbalanced load .....                                                                                                             | 74  |
| Figure I.1 – Test set-up .....                                                                                                                                              | 81  |
| Figure K.1 – Single-phase transformer .....                                                                                                                                 | 86  |
| Figure K.2 – Three-phase rotating frequency converter .....                                                                                                                 | 87  |
| Figure K.3 – Subdivided rating plate: single-/three-phase transformer rectifier .....                                                                                       | 88  |
| Figure K.4 – Engine-generator-rectifier .....                                                                                                                               | 89  |
| Figure K.5 – Single-/three-phase inverter type .....                                                                                                                        | 90  |
| Figure K.6 – Battery powered welding power source with integral battery .....                                                                                               | 91  |
| Figure K.7 – Battery powered welding power source with detachable / separable battery .....                                                                                 | 92  |
| Figure L.1 – Input voltage power switch .....                                                                                                                               | 118 |
| Figure L.2 – Arc force control potentiometer .....                                                                                                                          | 118 |
| Figure L.3 – Remote receptacle and selector switches .....                                                                                                                  | 118 |
| Figure L.4 – Terminals with inductance selector for MIG/MAG welding .....                                                                                                   | 118 |
| Figure L.5 – Process switch (MMA, TIG, MIG) .....                                                                                                                           | 119 |
| Figure L.6 – Selector switch on AC/DC equipment .....                                                                                                                       | 119 |
| Figure L.7 – Panel indicator lights (overheat, fault, arc striking, output voltage) .....                                                                                   | 119 |
| Figure L.8 – Setting pulsing parameters using digital display .....                                                                                                         | 119 |
| Figure N.1 – Measuring network for weighted touch current .....                                                                                                             | 122 |
| Figure N.2 – Diagram for touch current measurement on fault condition at operating temperature for single-phase connection of appliances other than those of class II ..... | 124 |
| Figure N.3 – Diagram for touch current measurement on fault condition for three-phase four-wire system connection of appliances other than those of class II .....          | 126 |
| Figure O.1 – Marking of battery voltage class B electric components .....                                                                                                   | 144 |
| Figure P.1 – Flow chart for conformity methods of Annex P .....                                                                                                             | 146 |
| Table 1 – Minimum clearances for overvoltage category III .....                                                                                                             | 28  |
| Table 2 – Minimum creepage distances .....                                                                                                                                  | 30  |
| Table 3 – Insulation resistance .....                                                                                                                                       | 31  |
| Table 4 – Dielectric test voltages .....                                                                                                                                    | 32  |
| Table 5 – Minimum distance through insulation .....                                                                                                                         | 36  |
| Table 6 – Temperature limits for windings, commutators and slip-rings .....                                                                                                 | 41  |
| Table 7 – Temperature limits for external surfaces .....                                                                                                                    | 42  |
| Table 8 – Cross-section of the output short-circuit conductor .....                                                                                                         | 45  |
| Table 9 – Current and time requirements for protective circuits .....                                                                                                       | 48  |
| Table 10 – Minimum cross-sectional area of the external protective copper conductor .....                                                                                   | 48  |
| Table 11 – Verification of continuity of the protective circuit .....                                                                                                       | 49  |
| Table 12 – Pull .....                                                                                                                                                       | 50  |

|                                                                                                 |    |
|-------------------------------------------------------------------------------------------------|----|
| Table 13 – Summary of allowable rated no-load voltages.....                                     | 53 |
| Table 14 – Hazard reducing device requirements.....                                             | 59 |
| Table E.1 – Range of conductor dimensions to be accepted by the supply circuit terminals.....   | 76 |
| Table F.1 – Cross-reference for mm <sup>2</sup> to American wire gauge (AWG).....               | 78 |
| Table I.1 – Angle of rotation $\theta$ to obtain 10 Nm impact .....                             | 81 |
| Table I.2 – Mass of the free fall weight and height of the free fall .....                      | 82 |
| Table J.1 – Minimum thickness of sheet metal for steel enclosures.....                          | 84 |
| Table J.2 – Minimum thickness of sheet metal for enclosures of aluminium, brass or copper ..... | 85 |
| Table L.1 – Letters used as symbols .....                                                       | 94 |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## INTERNATIONAL ELECTROTECHNICAL COMMISSION

### ARC WELDING EQUIPMENT –

#### Part 1: Welding power sources

#### FOREWORD

- 1) The International Electrotechnical Commission (IEC) is a worldwide organization for standardization comprising all national electrotechnical committees (IEC National Committees). The object of IEC is to promote international co-operation on all questions concerning standardization in the electrical and electronic fields. To this end and in addition to other activities, IEC publishes International Standards, Technical Specifications, Technical Reports, Publicly Available Specifications (PAS) and Guides (hereafter referred to as "IEC Publication(s)"). Their preparation is entrusted to technical committees; any IEC National Committee interested in the subject dealt with may participate in this preparatory work. International, governmental and non-governmental organizations liaising with the IEC also participate in this preparation. IEC collaborates closely with the International Organization for Standardization (ISO) in accordance with conditions determined by agreement between the two organizations.
- 2) The formal decisions or agreements of IEC on technical matters express, as nearly as possible, an international consensus of opinion on the relevant subjects since each technical committee has representation from all interested IEC National Committees.
- 3) IEC Publications have the form of recommendations for international use and are accepted by IEC National Committees in that sense. While all reasonable efforts are made to ensure that the technical content of IEC Publications is accurate, IEC cannot be held responsible for the way in which they are used or for any misinterpretation by any end user.
- 4) In order to promote international uniformity, IEC National Committees undertake to apply IEC Publications transparently to the maximum extent possible in their national and regional publications. Any divergence between any IEC Publication and the corresponding national or regional publication shall be clearly indicated in the latter.
- 5) IEC itself does not provide any attestation of conformity. Independent certification bodies provide conformity assessment services and, in some areas, access to IEC marks of conformity. IEC is not responsible for any services carried out by independent certification bodies.
- 6) All users should ensure that they have the latest edition of this publication.
- 7) No liability shall attach to IEC or its directors, employees, servants or agents including individual experts and members of its technical committees and IEC National Committees for any personal injury, property damage or other damage of any nature whatsoever, whether direct or indirect, or for costs (including legal fees) and expenses arising out of the publication, use of, or reliance upon, this IEC Publication or any other IEC Publications.
- 8) Attention is drawn to the Normative references cited in this publication. Use of the referenced publications is indispensable for the correct application of this publication.
- 9) Attention is drawn to the possibility that some of the elements of this IEC Publication may be the subject of patent rights. IEC shall not be held responsible for identifying any or all such patent rights.

**This consolidated version of the official IEC Standard and its amendment has been prepared for user convenience.**

**IEC 60974-1 edition 5.1 contains the fifth edition (2017-02) [documents 26/610/FDIS and 26/613/RVD] and its amendment 1 (2019-01) [documents 26/653/CDV and 26/669/RVC].**

**This Final version does not show where the technical content is modified by amendment 1. A separate Redline version with all changes highlighted is available in this publication.**

International Standard IEC 60974-1 has been prepared by IEC technical committee 26: Electric welding.

This fifth edition constitutes a technical revision.

The significant changes with respect to the previous edition are the following:

- improvement of Figure 1 (6.1.1);
- modification of Table 3 (6.1.4);
- description of energy efficiency measurements in Annex M;
- inclusion of battery supplied welding power sources in the scope. Requirements therefore are described in Annex O.

This publication has been drafted in accordance with the ISO/IEC Directives, Part 2.

In this standard, the following print types are used:

- conformity statements: in *italic* type.
- terms defined in Clause 3: in **bold** type.

A list of all parts of the IEC 60974 series can be found, under the general title *Arc welding equipment*, on the IEC website.

The committee has decided that the contents of the base publication and its amendment will remain unchanged until the stability date indicated on the IEC web site under "<http://webstore.iec.ch>" in the data related to the specific publication. At this date, the publication will be

- reconfirmed,
- withdrawn,
- replaced by a revised edition, or
- amended.

**IMPORTANT – The 'colour inside' logo on the cover page of this publication indicates that it contains colours which are considered to be useful for the correct understanding of its contents. Users should therefore print this document using a colour printer.**



## ARC WELDING EQUIPMENT –

### Part 1: Welding power sources

#### 1 Scope

This part of IEC 60974 is applicable to power sources for arc welding and allied processes designed for **industrial and professional use**, and supplied by a voltage not exceeding 1 000 V, battery supplied or driven by mechanical means.

This document specifies safety and performance requirements of welding power sources and **plasma cutting systems**.

This document is not applicable to limited duty arc welding and cutting power sources which are designed mainly for use by laymen and designed in accordance with IEC 60974-6.

This document includes requirements for battery-powered welding power sources and battery packs, which are given in Annex O.

This document is not applicable to testing of power sources during periodic maintenance or after repair.

NOTE 1 Typical allied processes are electric arc cutting and arc spraying.

NOTE 2 AC systems having a nominal voltage between 100 V and 1 000 V are given in Table 1 of IEC 60038:2009.

NOTE 3 This document does not include electromagnetic compatibility (EMC) requirements.

#### 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

IEC 60050-151, *International Electrotechnical Vocabulary – Part 151: Electrical and magnetic devices* (available at: <http://www.electropedia.org>)

IEC 60050-851, *International Electrotechnical Vocabulary – Part 851: Electric welding* (available at: <http://www.electropedia.org>)

IEC 60245-6, *Rubber insulated cables – Rated voltages up to and including 450/750 V – Part 6: Arc welding electrode cables*

IEC 60417, *Graphical symbols for use on equipment* (available at: <http://www.graphical-symbols.info/equipment>)

IEC 60445, *Basic and safety principles for man-machine interface, marking and identification – Identification of equipment terminals, conductor terminations and conductors*

IEC 60529, *Degrees of protection provided by enclosures (IP Code)*

IEC 60664-1:2007, *Insulation coordination for equipment within low-voltage systems – Part 1: Principles, requirements and tests*

IEC 60664-3, *Insulation coordination for equipment within low-voltage systems – Part 3: Use of coating, potting or moulding for protection against pollution*

IEC 60695-11-10, *Fire hazard testing – Part 11-10: Test flames – 50 W horizontal and vertical flame test methods*

IEC 60974-7, *Arc welding equipment – Part 7: Torches*

IEC 61140, *Protection against electric shock – Common aspects for installation and equipment*

IEC 61558-2-4, *Safety of transformers, reactors, power supply units and similar products for supply voltages up to 1 100 V – Part 2-4: Particular requirements and tests for isolating transformers and power supply units incorporating isolating transformers*

IEC 61558-2-6, *Safety of transformers, reactors, power supply units and similar products for supply voltages up to 1 100 V – Part 2-6: Particular requirements and tests for safety isolating transformers and power supply units incorporating safety isolating transformers*

IEC 62133-1:— 1, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary cells, and for batteries made from them, for use in portable applications – Part 1: Nickel systems*

IEC 62133-2:— 2, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary cells, and for batteries made from them, for use in portable applications – Part 2: Lithium systems*

ISO 7010:2011, *Graphical symbols – Safety colours and safety signs – Registered safety signs*

### 3 Terms and definitions

For the purposes of this document, the terms and definitions given in IEC 60050-151, IEC 60050-851, IEC 60664-1 and the following apply.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- IEC Electropedia: available at <http://www.electropedia.org/>
- ISO Online browsing platform: available at <http://www.iso.org/obp>

#### 3.1 General terms

##### 3.1.1 welding power source

##### arc welding power source

equipment for supplying current and voltage and having the required characteristics suitable for arc welding and allied processes

Note 1 to entry: A **welding power source** can also supply services to other equipment and auxiliaries for example auxiliary power, cooling liquid, consumable arc welding electrode and gas to shield the arc and the welding area.

Note 2 to entry: This entry revises IEC 851-13-01, which will be updated.

<sup>1</sup> Under preparation. Stage at the time of publication: IEC CDV 62133-1:2015.

<sup>2</sup> Under preparation. Stage at the time of publication: IEC CDV 62133-2:2015.

### 3.1.2

#### **industrial and professional use**

use intended only for **experts** or **instructed persons**

[SOURCE: IEC 60050-851:2008, 851-11-12]

### 3.1.3

#### **expert**

#### **competent person**

#### **skilled person**

person who can judge the work assigned and recognize possible hazards on the basis of professional training, knowledge, experience and knowledge of the relevant equipment

Note 1 to entry: Several years of practice in the relevant technical field can be taken into consideration in assessment of professional training.

[SOURCE: IEC 60050-851:2008, 851-11-10]

### 3.1.4

#### **instructed person**

person informed about the tasks assigned and about the possible hazards involved in neglectful behaviour

Note 1 to entry: If necessary, the person has undergone some training

[SOURCE: IEC 60050-851:2008, 851-11-13]

### 3.1.5

#### **type test**

test of one or more devices made to a given design to check if these devices comply with the requirements of the standard concerned

[SOURCE: IEC 60050-851:2008, 851-12-05]

### 3.1.6

#### **routine test**

test made on each individual device during or after manufacture to check if it complies with the requirements of the standard concerned or the criteria specified

[SOURCE: IEC 60050-851:2008, 851-12-06]

### 3.1.7

#### **visual inspection**

inspection by eye to verify that there are no apparent discrepancies with respect to provisions of the standard concerned

[SOURCE: IEC 60050-851:2008, 851-11-11]

### 3.1.8

#### **drooping characteristic**

external **static characteristic** of a welding power source which, in its normal welding range, is such that the negative slope is greater than or equal to 7 V/100 A

Note 1 to entry: This entry revises IEC 851-12-34, which will be updated.

### 3.1.9

#### flat characteristic

external **static characteristic** of a welding power source which, in its normal welding range, is such that, as the current increases, the voltage either decreases by less than 7 V/100 A or increases by less than 10 V/100 A

[SOURCE: IEC 60050-851:2008, 851-12-35]

### 3.1.10

#### static characteristic

relationship between the voltage and the current at the output terminals of a welding power source when connected to a **conventional load**

Note 1 to entry: This entry revises IEC 851-12-32, which will be updated.

### 3.1.11

#### welding circuit

conductive material through which the **welding current** is intended to flow

Note 1 to entry: In arc welding, the arc is a part of the **welding circuit**.

Note 2 to entry: In certain arc welding processes, the welding arc can be established between two electrodes. In such a case, the workpiece is not necessarily a part of the **welding circuit**.

[SOURCE: IEC 60050-851:2008, 851-14-10]

### 3.1.12

#### control circuit

internal or external circuit for the operational control of the equipment or for protection of the power circuits, or both

EXAMPLE 1 **Control circuits** intended for interface between the welding power source and external equipment designed by the manufacturer.

EXAMPLE 2 **Control circuits** intended for interface between the welding power source and other types of ancillary equipment.

Note 1 to entry: This entry revises IEC 851-14-11, which will be updated.

### 3.1.13

#### welding current

current delivered by a welding power source during welding

### 3.1.14

#### load voltage

voltage between the output terminals when the welding power source is delivering **welding current**

[SOURCE: IEC 60050-851:2008, 851-12-04]

### 3.1.15

#### no-load voltage

voltage, exclusive of any arc striking or arc stabilizing voltage, between the accessible output terminals of a welding power source when the **welding circuit** is open but energized

Note 1 to entry: This entry revises IEC 851-12-24, which will be updated.

### 3.1.16

#### conventional value

standardized value that is used as a measure of a parameter for the purposes of comparison, calibration, testing, etc.

Note 1 to entry: **Conventional values** do not necessarily apply during the actual welding process.

[SOURCE: IEC 60050-851:2008, 851-12-07]

### 3.1.17

#### **conventional welding condition**

condition of the welding power source in the energized and thermally stabilized state defined by a **conventional welding current** driven by the corresponding **conventional load voltage** through a **conventional load** at **rated supply voltage** and frequency or speed of rotation

[SOURCE: IEC 60050-851:2008, 851-12-26]

### 3.1.18

#### **conventional load**

practically non-inductive constant resistive load having a power factor not less than 0,99

[SOURCE: IEC 60050-851:2008, 851-12-27]

### 3.1.19

#### **conventional welding current**

$I_2$   
current delivered by a welding power source to a **conventional load** at the corresponding **conventional load voltage**

Note 1 to entry: The values of  $I_2$  are given as r.m.s. values for AC and arithmetic mean values for DC.

### 3.1.20

#### **conventional load voltage**

$U_2$   
**load voltage** of a welding power source having a specified linear relationship to the **conventional welding current**

Note 1 to entry: The values for  $U_2$  are given as r.m.s. values for AC and arithmetic mean values for DC.

Note 2 to entry: The specified linear relationship varies in accordance with the process (see 11.2).

Note 3 to entry: This entry revises IEC 851-12-30, which will be updated.

### 3.1.21

#### **rated value**

assigned value, generally by the manufacturer, for a specified operating condition of a component, device or equipment

### 3.1.22

#### **rating plate name plate**

plate permanently affixed on an electric device, which indelibly states the rating and other information as required by the relevant standard

[SOURCE: IEC 60050-151:2001, 151-16-12]

### 3.1.23

#### **rated output**

**rated values** of the output of the equipment

Note 1 to entry: This entry revises IEC 851-12-17, which will be updated.

### 3.1.24 rated maximum welding current

$I_{2\max}$   
maximum value of the **conventional welding current** that can be obtained at the **conventional welding condition** from a welding power source at its maximum setting

[SOURCE: IEC 60050-851:2008, 851-12-14]

### 3.1.25 rated minimum welding current

$I_{2\min}$   
minimum value of the **conventional welding current** that can be obtained at the **conventional welding condition** from a welding power source at its minimum setting

[SOURCE: IEC 60050-851:2008, 851-12-15]

### 3.1.26 rated no-load voltage

$U_0$   
**no-load voltage** at **rated supply voltage** and frequency or **rated no-load speed** of rotation

Note 1 to entry: If a welding power source is fitted with a **hazard reducing device**, this is the voltage measured before the **hazard reducing device** has performed its function.

### 3.1.27 rated reduced no-load voltage

$U_r$   
**no-load voltage** of a welding power source, fitted with a voltage reducing device immediately after the device acts to effect a reduction in the voltage

### 3.1.28 rated switched no-load voltage

$U_s$   
DC **no-load voltage** of a welding power source, fitted with an AC to DC switching device

### 3.1.29 rated supply voltage

$U_1$   
r.m.s. value of supply voltage for which the equipment is designed

### 3.1.30 rated supply current

$I_1$   
r.m.s. value of supply current to the welding power source at a rated **conventional welding condition**

### 3.1.31 rated no-load supply current

$I_0$   
r.m.s. value of supply current to the welding power source at **rated no-load voltage**

### 3.1.32 rated maximum supply current

$I_{1\max}$   
maximum value of the **rated supply current**

Note 1 to entry: This entry revises IEC 851-12-13, which will be updated.

**3.1.33**  
**maximum effective supply current**

$I_{1\text{eff}}$   
maximum value of the effective supply current, calculated from the **rated supply current** ( $I_1$ ), the corresponding **duty cycle** ( $X$ ) and the supply current at no-load ( $I_0$ ) by the formula:

$$I_{1\text{eff}} = \sqrt{I_1^2 \times X + I_0^2 \times (1 - X)}$$

Note 1 to entry: The maximum effective supply current is not always at the duty cycle corresponding to the rated maximum supply current.

[SOURCE: IEC 60050-851:2008, 851-12-39]

**3.1.34**  
**rated load speed**

$n$   
speed of rotation of an engine-driven welding power source when operating at **rated maximum welding current**

Note 1 to entry: This entry revises IEC 851-12-12, which will be updated.

**3.1.35**  
**rated no-load speed**

$n_0$   
speed of rotation of an engine-driven welding power source when the external **welding circuit** is open

Note 1 to entry: If an engine is fitted with a device to reduce the speed when not welding,  $n_0$  will be measured before the speed reduction device has operated.

Note 2 to entry: This entry revises IEC 851-12-16, which will be updated.

**3.1.36**  
**rated idle speed**

$n_i$   
reduced no-load speed of an engine-driven welding power source

[SOURCE: IEC 60050-851:2008, 851-12-18]

**3.1.37**  
**duty cycle**

$X$   
**SUPERSEDED:** duty factor  
ratio, for a given time interval, of the uninterrupted on-load duration to the total time

Note 1 to entry: This ratio, lying between 0 and 1, is expressed as a percentage.

Note 2 to entry: For the purposes of this document, the time period of one complete cycle is 10 min. For example, in the case of a 60 % **duty cycle**, a continuous 6 min load period is followed by a no-load period of 4 min.

**3.1.38**  
**clearance**

shortest distance in air between two conductive parts

[SOURCE: IEC 60664-1:2007, 3.2]

**3.1.39**  
**creepage distance**

shortest distance along the surface of a solid insulating material between two conductive parts

[SOURCE: IEC 60664-1:2007, 3.3]

### 3.1.40

#### **pollution degree**

numeral characterizing the expected pollution of the **micro-environment**

Note 1 to entry: For the purpose of evaluating **creepage distances** and **clearances**, the following four **pollution degrees** in the **micro-environment** are established in 4.6.2 of IEC 60664-1:2007.

- a) **Pollution degree 1:** No pollution or only dry, non-conductive pollution occurs. The pollution has no influence.
- b) **Pollution degree 2:** Only non-conductive pollution occurs except that occasionally a temporary conductivity caused by condensation is to be expected.
- c) **Pollution degree 3:** Conductive pollution occurs, or dry, non-conductive pollution occurs which becomes conductive due to condensation which is to be expected.
- d) **Pollution degree 4:** The pollution generates persistent conductivity caused by conductive dust or by rain or snow.

[SOURCE: IEC 60664-1:2007, 3.13, modified – Modification of the Note to entry.]

### 3.1.41

#### **micro-environment**

immediate environment of the insulation which particularly influences the dimensioning of the **creepage distances**

[SOURCE: IEC 60664-1:2007, 3.12.2]

### 3.1.42

#### **material group**

materials separated into four groups by their comparative tracking index (CTI) values in accordance with IEC 60664-1

Note 1 to entry: The following four groups are defined in IEC 60664-1:

- Material group I  $600 \leq \text{CTI}$
- Material group II  $400 \leq \text{CTI} < 600$
- Material group IIIa  $175 \leq \text{CTI} < 400$
- Material group IIIb  $100 \leq \text{CTI} < 175$

### 3.1.43

#### **temperature rise**

difference between the temperature of a part of the equipment and that of the ambient air

### 3.1.44

#### **thermal equilibrium**

state reached when the observed **temperature rise** of any part of the equipment does not exceed 2 K/h

### 3.1.45

#### **thermal protection**

system intended to ensure the protection of a part, and hence the whole, of the equipment against excessive temperatures resulting from certain conditions of thermal overload

Note 1 to entry: It is capable of being reset (either manually or automatically) when the temperature falls to the reset value.

Note 2 to entry: This entry revises IEC 851-15-03, which will be updated.



**3.1.46****environment with increased risk of electric shock**

environment where the probability of electric shock by arc welding is increased in relation to normal arc welding conditions

Note 1 to entry: Such environments are found, for example:

- a) in locations in which freedom of movement is restricted, so that the operator is forced to perform the welding in a cramped (for example kneeling, sitting, lying) position with physical contact with conductive parts;
- b) in locations which are fully or partially limited by conductive elements, and in which there is a high probability of unavoidable or accidental contact by the operator;
- c) in wet or damp or hot locations where humidity or perspiration considerably reduces the skin resistance of the human body and the insulating properties of accessories.

**3.1.47****hazard reducing device**

device designed to reduce the hazard of electric shock that may originate from the **no-load voltage**

[SOURCE: IEC 60050-851:2008, 851-15-01]

**3.1.48****class I equipment**

equipment with **basic insulation** as provision for basic protection and protective bonding as provision for fault protection

[SOURCE: IEC 60050-851:2008, 851-15-10]

**3.1.49****class II equipment**

equipment with **basic insulation** as provision for basic protection, and **supplementary insulation** as provision for fault protection, or in which basic and fault protection are provided by **reinforced insulation**

[SOURCE: IEC 60050-851:2008, 851-15-11]

**3.1.50****basic insulation**

insulation of hazardous-live-parts which provides basic protection

[SOURCE: IEC 60050-851:2008, 851-15-04]

**3.1.51****supplementary insulation**

independent insulation applied in addition to **basic insulation** for fault protection

[SOURCE: IEC 60050-851:2008, 851-15-05]

**3.1.52****double insulation**

insulation comprising both **basic insulation** and **supplementary insulation**

[SOURCE: IEC 60050-851:2008, 851-15-06]

**3.1.53****reinforced insulation**

insulation of hazardous-live-parts which provides a degree of protection against electric shock equivalent to **double insulation**

Note 1 to entry: **Reinforced insulation** may comprise several layers which cannot be tested singly as **basic insulation** or **supplementary insulation**.

[SOURCE: IEC 60050-851:2008, 851-15-07]

### 3.1.54

#### **plasma cutting system**

combination of power source, torch, and associated safety devices for plasma cutting/gouging

[SOURCE: IEC 60050-851:2008, 851-13-03]

### 3.1.55

#### **plasma cutting power source**

equipment for supplying current and voltage and having the required characteristics suitable for plasma cutting/gouging and which may supply gas and cooling liquid

Note 1 to entry: A **plasma cutting power source** can also supply services to other equipment and auxiliaries, for example auxiliary power, cooling liquid and gas.

[SOURCE: IEC 60050-851:2008, 851-13-04]

### 3.1.56

#### **safety extra-low voltage**

##### **SELV**

voltage which does not exceed 50 V AC or 120 V ripple free DC between conductors, or between any conductor and earth, in a circuit which is isolated from the supply mains by such means as a safety isolating transformer

Note 1 to entry: Maximum voltage lower than 50 V AC or 120 V ripple free DC is specified in particular requirements, especially when direct contact with live parts is allowed.

Note 2 to entry: The voltage limit is not exceeded at any load between full load and no-load when the source is a safety isolating transformer.

Note 3 to entry: "Ripple-free" is conventionally an r.m.s. ripple voltage not more than 10 % of the DC component; the maximum peak value does not exceed 140 V for a nominal 120 V ripple-free DC system and 70 V for a nominal 60 V ripple-free DC system.

Note 4 to entry: This entry revises IEC 851-15-08, which will be updated.

### 3.1.57

#### **supply circuit**

input circuit

conductive material in the equipment through which the supply current is intended to flow

### 3.1.58

#### **working voltage**

highest r.m.s. value of the AC or DC voltage across any particular insulation which can occur when the equipment is supplied at rated voltage

Note 1 to entry: Transients are disregarded.

Note 2 to entry: Both open circuit conditions and normal operating conditions are taken into account.

[SOURCE: IEC 60050-851:2008, 851-12-31]

### 3.1.59

#### **touch current**

electric current passing through a human body or through an animal body when it touches one or more accessible parts of an installation or of equipment

Note 1 to entry: **Touch current** is measured by using a measuring network that simulates the impedance of the human body.

[SOURCE: IEC 60050-195:1998/AMD1:2001, 195-05-21, modified – Addition of a note to entry.]

### 3.1.60

#### **remote control**

device or circuit external to the equipment used for monitoring or operational control

### 3.1.61

#### **single-fault condition**

condition in which one means for protection against hazard is defective

Note 1 to entry: If a **single-fault condition** results unavoidably in another **single-fault condition**, the two failures are considered as one **single-fault condition**.

### 3.1.62

#### **fixed installation**

particular combination of several types of apparatus and, where applicable, other devices, which are assembled, installed and intended to be used permanently at a predefined location

### 3.1.63

#### **protective circuit**

circuit intended to be bonded to protective earth to protect against electric shock

### 3.1.64

#### **class of insulation**

standard classification applied to an insulating material for use in electrical apparatus and machines and specifying the nature of the material and a recommended limiting temperature

[SOURCE: IEC 60050-811:1991, 811-13-33]

### 3.1.65

#### **functional insulation**

insulation between conductive parts, necessary for the proper functioning of the equipment

[SOURCE: IEC 60050-195:1998, 195-02-41]

### 3.1.66

#### **idle state**

operating state in which the power is switched on and the **welding circuit** is not energized

Note 1 to entry: For some types of equipment there is no **idle state**, but a welding state preceding arc striking.

Note 2 to entry: For a power source in a mechanised system, the configuration to achieve **idle state** is defined by the manufacturer.

Note 3 to entry: An **idle state** can include a low energy state in which a welding process cannot be started without automatic or manual reactivation.

## 3.2 Terms related to battery systems

### 3.2.1

#### **battery**

assembly of one or more **cells** intended to provide electrical current to the welding power source

### 3.2.2

#### **integral battery**

**battery** which is contained within the battery-powered welding power source and is not removed from the welding power source for charging purposes

Note 1 to entry: A **battery** that is to be removed from the battery-powered welding power source for disposal or recycling purposes only is considered to be an **integral battery**.

### 3.2.3

#### **detachable battery pack**

**battery** which is contained in a separate enclosure from the battery-powered welding power source and is intended to be removed from the welding power source for charging purposes

### 3.2.4

#### **separable battery pack**

**battery** which is contained in a separate enclosure from the battery-powered welding power source and is connected to the battery-powered welding power source by a cable

### 3.2.5

#### **battery system**

combination of a **battery**, the **charging system**, the welding power source and the interfaces between them as existing during operation of the welding power source or during charging

### 3.2.6

#### **C<sub>5</sub> rate**

current, in amperes, at which a **cell** or **battery** can be discharged for 5 h to the voltage cut-off point specified by the **cell** manufacturer

### 3.2.7

#### **cell**

basic functional unit consisting of an assembly of electrodes, electrolyte, container, terminals, and usually separators, that is a source of electric energy obtained by direct conversion of chemical energy

[SOURCE: IEC 60050-482:2004 482-01-01]

### 3.2.8

#### **charger**

part or all of the **charging system** contained in a separate enclosure

Note 1 to entry: As a minimum, the **charger** includes some of the power conversion circuitry. Not all **charging systems** include a separate **charger** as in the case where a welding power source may be charged utilizing a mains supply cable or may incorporate a plug for attachment to a mains receptacle.

### 3.2.9

#### **charging system**

combination of circuitry intended to charge, balance and/or maintain the state of charge of the **battery**

### 3.2.10

#### **fully charged cell**

#### **fully charged battery**

**cell** or **battery** charged to the maximum state of charge permitted by the **battery charging system** intended for use with the welding power source

### 3.2.11

#### **fully discharged cell**

#### **fully discharged battery**

**battery** or **cell** discharged until one of the following conditions occurs: discharge terminates due to protective circuitry or the **battery** (or **cell**) reaches a total voltage with an average voltage per **cell** equal to the end-of-discharge voltage for the **cell** chemistry being used unless a different end-of-discharge voltage is specified by the manufacturer of **battery/cell**

Note 1 to entry: The end-of-discharge voltages for common **cell** chemistries are provided in O.5.210.

### 3.2.12

#### **general purpose batteries**

#### **general purpose cells**

**batteries** and **cells** available from a variety of manufacturers, through a variety of outlets intended for a variety of different manufacturers' products

Note 1 to entry: 12 V automotive **batteries** and AA, C and D alkaline **cells** are examples of **general purpose**.

### 3.2.13

#### **maximum charging current**

highest current that a **cell** is permitted to pass during charging for a specified range of temperatures as specified by the **cell** manufacturer and evaluated in accordance with IEC 62133-1:— or IEC 62133-2:—

### 3.2.14

#### **specified operating region**

range of permissible operation of **cells**, expressed by **cell** parameter limits

#### 3.2.14.1

##### **specified operating region for charging**

conditions for voltage and current during charging in which the **cell** is permitted to operate as specified by the **cell** manufacturer and evaluated in accordance with IEC 62133-1:— or IEC 62133-2:—

### 3.2.15

#### **upper limit charging voltage**

highest voltage that a **cell** is permitted to attain during normal charging for a specified range of temperatures as specified by the **cell** manufacturer and evaluated in accordance with IEC 62133-1:— or IEC 62133-2:—

### 3.2.16

#### **venting**

condition that occurs, when a **cell** releases excessive internal pressure intended by design to preclude **explosion**

### 3.2.17

#### **electronic component**

part in which conduction is achieved principally by electrons moving through a vacuum, gas or semiconductor, with the exclusion of neon indicators

Note 1 to entry: Examples of **electronic components** are diodes, transistors, triacs and monolithic integrated circuits. Resistors, capacitors and inductors are not considered **electronic components**.

### 3.2.18

#### **basic protection**

protection against electric shock under fault-free conditions

[SOURCE: IEC 60050-195:1998, 195-06-01]

### 3.2.19

#### **battery voltage class A**

classification of an electric component or circuit with a maximum battery **working voltage** of 60 V DC

### 3.2.20

#### **battery voltage class B**

classification of an electric component or circuit with a maximum battery **working voltage** between 60 V DC and 1 500 V DC

### 3.2.21

#### **charring**

blackening of the cotton caused by combustion

Note 1 to entry: Discolouration of the cotton caused by smoke is acceptable.

### 3.2.22

#### **consecutive operating cycle**

immediate on cycle after the thermal control device resets

### 3.2.23

#### **explosion**

<of an explosive atmosphere> sudden increase of pressure and temperature, due to oxidation or other exothermic reaction

[SOURCE: IEC 60050-426:2008, 426-02-13]

## **4 Environmental conditions**

Welding power sources shall be capable of delivering **rated outputs** at rated **duty cycles** when the following environmental conditions prevail:

- a) range of ambient air temperature:  
during operation: –10 °C to +40 °C;
- b) relative humidity of the air:  
up to 50 % at 40 °C;  
up to 90 % at 20 °C;
- c) ambient air, free from abnormal amounts of dust, acids, corrosive gases or substances, etc. other than those generated by the welding process;
- d) altitude above sea level up to 1 000 m;
- e) base of the welding power source inclined up to 10°.

Welding power sources shall withstand storage and transport at an ambient air temperature of –20 °C to +55 °C without any damage to function and performance.

NOTE Different environmental conditions can be agreed upon between the manufacturer and the purchaser and the resulting welding power source is marked accordingly (see 15.1). Examples of these conditions are: high humidity, unusually corrosive fumes, steam, excessive oil vapour, abnormal vibration or shock, excessive dust, severe weather conditions, unusual coastal or shipboard conditions, vermin infestation and atmospheres conducive to the growth of mould.

## 5 Tests

### 5.1 Test conditions

Tests shall be carried out on new, dry and completely assembled welding power sources.

The heating test defined in 7.1 and the **thermal protection** test defined in 8.5 shall be carried out at ambient temperature of 40 °C, see to lerances in 7.1.2 e), with the exception of engine-driven power sources and **fixed installation** equipment, which shall be tested in accordance with the manufacturer's specification.

Other tests shall be carried out at an ambient air temperature given in Clause 4 a).

Liquid-cooled welding power sources shall be tested with liquid conditions as specified by the manufacturer.

Unless otherwise specified, the equipment shall be supplied by a **rated supply voltage** with a tolerance of  $\pm 5$  %.

### 5.2 Measuring instruments

The accuracy of measuring instruments shall be:

- a) electrical measuring instruments: class I ( $\pm 1$  % of full-scale reading), except for the measurement of insulation resistance and dielectric strength where the accuracy of the instruments is not specified, but shall be taken into account for the measurement;
- b) thermometer:  $\pm 2$  K;
- c) tachometer:  $\pm 1$  % of full-scale reading.

### 5.3 Conformity of components

Refer to Annex P for conformity of components.

### 5.4 Type tests

Unless otherwise specified, the tests in this document are **type tests**.

The welding power source shall be tested with any ancillary equipment fitted that could affect the test results.

All **type tests** shall be carried out on the same welding power source except where it is specified that a test may be carried out on another welding power source.

As a condition of conformity, the **type tests** given below shall be carried out in the following sequence with no drying time between f), g) and h):

- a) general **visual inspection**, see 3.1.7;
- b) insulation resistance, see 6.1.4 (preliminary check);
- c) enclosure, see 14.2;
- d) handling means, see 14.3;
- e) drop withstand, see 14.4;
- f) protection provided by the enclosure, see 6.2.1;
- g) insulation resistance, see 6.1.4;
- h) dielectric strength, see 6.1.5;

- i) general **visual inspection**, see 3.1.7.

The other tests included in this document and not listed here shall be carried out, but may be completed in any convenient sequence.

## 5.5 Routine tests

All **routine tests** shall be carried out on each welding power source. The following sequence is recommended:

- a) **visual inspection** in accordance with manufacturer's specification;
- b) continuity of the **protective circuit**, see 10.5.1;
- c) dielectric strength, see 6.1.5;
- d) **no-load voltage**:
  - 1) **rated no-load voltage**, see 11.1 by measurement only; or
  - 2) if applicable, **rated reduced no-load voltage**, see 13.2; or
  - 3) if applicable, **rated switched no-load voltage**, see 13.3;
- e) test to ensure rated minimum and maximum output values in accordance with 15.4 b) and 15.4 c). The manufacturer may select **conventional load**, short circuit load or other test conditions.

NOTE 1 In short circuit and other test conditions, the output values can differ from **conventional load** values.

NOTE 2 If justified by the design, measured values can be compensated due to variations of the supply network.

## 6 Protection against electric shock

### 6.1 Insulation

#### 6.1.1 General

The majority of welding power sources fall within the overvoltage category III in accordance with IEC 60664-1; mechanically powered welding power sources fall within overvoltage category II. All welding power sources shall be designed for use in environmental conditions of **pollution degree 3** as a minimum.

Components or subassemblies with **clearances** or **creepage distances** corresponding to **pollution degree 2** are permitted if the **micro-environment** of the component or subassembly is improved (by means such as filtering, coating, potting, moulding) so that only non-conductive pollution or occasional temporary conductivity caused by condensation occurs.

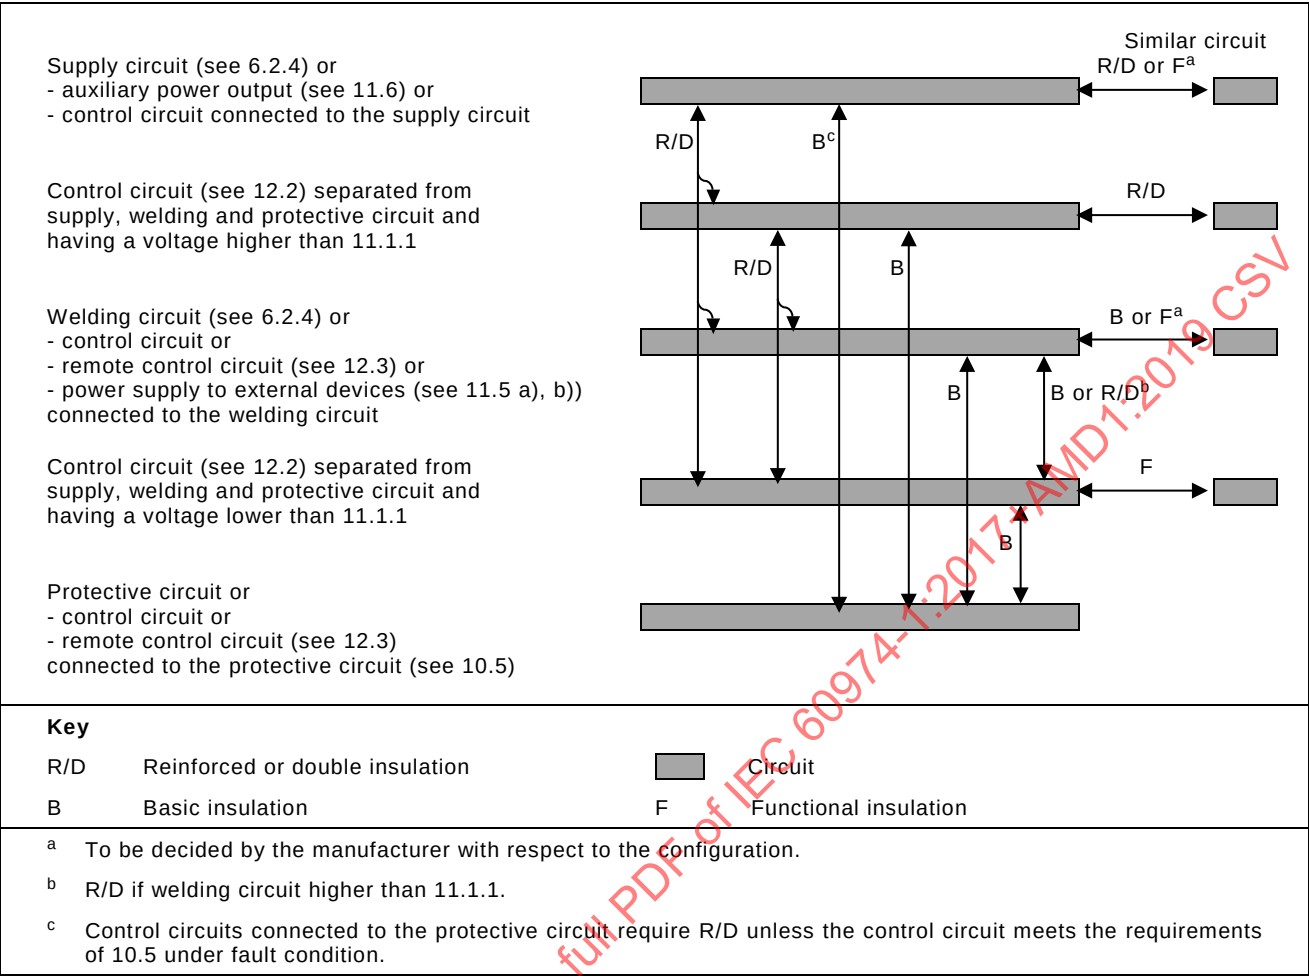
Components or subassemblies with **clearances** or **creepage distances** corresponding to **pollution degree 1** are permitted, if they are completely coated, potted or moulded in accordance with IEC 60664-3.

See Table 2 for printed wiring material **creepage distances**.

**Class I equipment** intended to be connected to an earthed three-phase three-wire system shall be designed with insulation based on line to line voltage values. **Class I equipment** designed with insulation based on line to neutral voltage values shall be provided with a caution that such equipment shall only be used on a supply network that is either a three-phase, four-wire system with an earthed neutral or a single-phase, three-wire, system with an earthed neutral.

The application of insulation in many configurations is illustrated in Figure 1, but other configurations and solutions are possible. If a particular configuration is not represented in Figure 1, the required insulation shall be determined by considering the effect of a single fault.





IEC

Figure 1 – Example of insulation configuration for Class I equipment

6.1.2 Clearances

For basic or **supplementary insulation**, and **reinforced insulation**, minimum **clearances** shall be in accordance with Table 1 for overvoltage category III. For other overvoltage categories, minimum **clearances** shall be in accordance with IEC 60664-1.

**Table 1 – Minimum clearances for overvoltage category III**

| Voltage line to neutral derived from nominal voltages AC or DC up to and including <sup>a</sup><br><br>V r.m.s.                                                 | Basic or supplementary insulation        |                                 |                     |     |     | Reinforced insulation                    |                                 |                     |     |     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|---------------------------------|---------------------|-----|-----|------------------------------------------|---------------------------------|---------------------|-----|-----|
|                                                                                                                                                                 | Rated impulse Test voltage<br><br>peak V | AC test voltage<br><br>V r.m.s. | Pollution degree    |     |     | Rated impulse test voltage<br><br>peak V | AC test voltage<br><br>V r.m.s. | Pollution degree    |     |     |
|                                                                                                                                                                 |                                          |                                 | 2                   | 3   | 4   |                                          |                                 | 2                   | 3   | 4   |
|                                                                                                                                                                 |                                          |                                 | Clearance<br><br>mm |     |     |                                          |                                 | Clearance<br><br>mm |     |     |
| 50                                                                                                                                                              | 800                                      | 566                             | 0,2                 | 0,8 | 1,6 | 1 500                                    | 1 061                           | 0,5                 | 0,8 | 1,6 |
| 100                                                                                                                                                             | 1 500                                    | 1 061                           | 0,5                 |     |     | 2 500                                    | 1 768                           | 1,5                 |     |     |
| 150                                                                                                                                                             | 2 500                                    | 1 768                           | 1,5                 |     |     | 4 000                                    | 2 828                           | 3                   |     |     |
| 300                                                                                                                                                             | 4 000                                    | 2 828                           | 3                   |     |     | 6 000                                    | 4 243                           | 5,5                 |     |     |
| 600                                                                                                                                                             | 6 000                                    | 4 243                           | 5,5                 |     |     | 8 000                                    | 5 657                           | 8                   |     |     |
| 1 000                                                                                                                                                           | 8 000                                    | 5 657                           | 8                   |     |     | 12 000                                   | 8 485                           | 14                  |     |     |
| NOTE 1 Values based on Tables F.1 and F.2 of IEC 60664-1:2007.                                                                                                  |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |
| NOTE 2 For other pollution degrees and overvoltage categories, see IEC 60664-1.                                                                                 |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |
| NOTE 3 If an autotransformer is connected to the supply circuit and provided as a part of a welding power source, the supply voltage determines the clearances. |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |
| <sup>a</sup> See Annex A.                                                                                                                                       |                                          |                                 |                     |     |     |                                          |                                 |                     |     |     |

For determining **clearances** as to accessible non-conductive surfaces, such surfaces shall be considered to be covered by metal foil wherever they can be touched by the standard test finger in accordance with IEC 60529.

**Clearances** shall not be interpolated.

For **supply circuit** terminals, see E.2.

**Clearances** between parts of the welding power source (for example electronic circuits or components) which are protected by an overvoltage limiting device (for example metal oxide varistor) may be rated in accordance with overvoltage category I (see IEC 60664-1).

The values of Table 1 shall also apply to the **welding circuit** within the welding power source and to **control circuits** when separated from the **supply circuit**, for example by a transformer.

If the **control circuit** is directly connected to the **supply circuit**, the values for the supply voltage shall apply.

*Conformity shall be checked by measurement in accordance with 6.2 of IEC 60664-1:2007 or where this is not possible, by submitting the welding power source to an impulse test using the voltages given in Table 1.*

For the impulse test, a minimum of three impulses of each polarity at the voltage given in Table 1 are applied with an interval of at least 1 s between impulses using a generator with an output waveform of 1,2/50 µs and an output impedance of less than 500 Ω.

Alternatively, either an AC test voltage as given in Table 1 may be applied for three cycles or a ripple free DC voltage, the value of which is equal to the impulse voltage, may be applied three times for 10 ms, for each polarity.

### 6.1.3 Creepage distances

**Creepage distances** for basic or **supplementary insulation**, shall be in accordance with Table 2.

**Creepage distances** for **double insulation** shall be the sum of the values for basic and **supplementary insulation** which form the **double insulation**.

**Creepage distances** for **reinforced insulation** shall be twice those determined for **basic insulation**.

For the purpose of dimensioning **creepage distances** to accessible non-conductive surfaces, such surfaces shall be considered to be covered by metal foil wherever they can be touched by the standard test finger in accordance with IEC 60529.

**Creepage distances** are given for the highest rated voltage of each line of Table 2. In the case of a lower rated voltage, interpolation is allowed.

For **supply circuit** terminals, see E.2.

The values of Table 2 shall also be applicable to the **welding circuit** within the welding power source and to **control circuits** when separated from the **supply circuit** by, for example, a transformer.

A **creepage distance** cannot be less than the associated **clearance**, so the shortest possible **creepage distance** is equal to the required **clearance**.

If the **control circuit** is connected directly to the **supply circuit**, the values for the supply voltage shall apply.

*Conformity shall be checked by linear measurement in accordance with 6.2 of IEC 60664-1:2007.*

**Table 2 – Minimum creepage distances**

| Working voltage | Creepage distances in millimetres |       |                  |                |      |      |                |      |      |
|-----------------|-----------------------------------|-------|------------------|----------------|------|------|----------------|------|------|
|                 | Basic or supplementary insulation |       |                  |                |      |      |                |      |      |
|                 | Printed wiring material           |       | Pollution degree |                |      |      |                |      |      |
|                 | Pollution degree                  |       |                  |                |      |      |                |      |      |
| V r.m.s         | 1                                 | 2     | 1                | 2              |      |      | 3              |      |      |
|                 | a                                 | b     | a                | Material group |      |      | Material group |      |      |
|                 | mm                                | mm    | mm               | I              | II   | III  | I              | II   | III  |
|                 |                                   |       |                  | mm             | mm   | mm   | mm             | mm   | mm   |
| 10              | 0,025                             | 0,04  | 0,08             | 0,4            | 0,4  | 0,4  | 1              | 1    | 1    |
| 12,5            | 0,025                             | 0,04  | 0,09             | 0,42           | 0,42 | 0,42 | 1,05           | 1,05 | 1,05 |
| 16              | 0,025                             | 0,04  | 0,1              | 0,45           | 0,45 | 0,45 | 1,1            | 1,1  | 1,1  |
| 20              | 0,025                             | 0,04  | 0,11             | 0,48           | 0,48 | 0,48 | 1,2            | 1,2  | 1,2  |
| 25              | 0,025                             | 0,04  | 0,125            | 0,5            | 0,5  | 0,5  | 1,25           | 1,25 | 1,25 |
| 32              | 0,025                             | 0,04  | 0,14             | 0,53           | 0,53 | 0,53 | 1,3            | 1,3  | 1,3  |
| 40              | 0,025                             | 0,04  | 0,16             | 0,56           | 0,8  | 1,1  | 1,4            | 1,6  | 1,8  |
| 50              | 0,025                             | 0,04  | 0,18             | 0,6            | 0,85 | 1,2  | 1,5            | 1,7  | 1,9  |
| 63              | 0,04                              | 0,063 | 0,2              | 0,63           | 0,9  | 1,25 | 1,6            | 1,8  | 2    |
| 80              | 0,063                             | 0,1   | 0,22             | 0,67           | 0,95 | 1,3  | 1,7            | 1,9  | 2,1  |
| 100             | 0,1                               | 0,16  | 0,25             | 0,71           | 1    | 1,4  | 1,8            | 2    | 2,2  |
| 125             | 0,16                              | 0,25  | 0,28             | 0,75           | 1,05 | 1,5  | 1,9            | 2,1  | 2,4  |
| 160             | 0,25                              | 0,4   | 0,32             | 0,8            | 1,1  | 1,6  | 2              | 2,2  | 2,5  |
| 200             | 0,4                               | 0,63  | 0,42             | 1              | 1,4  | 2    | 2,5            | 2,8  | 3,2  |
| 250             | 0,56                              | 1     | 0,56             | 1,25           | 1,8  | 2,5  | 3,2            | 3,6  | 4    |
| 320             | 0,75                              | 1,6   | 0,75             | 1,6            | 2,2  | 3,2  | 4              | 4,5  | 5    |
| 400             | 1                                 | 2     | 1                | 2              | 2,8  | 4    | 5              | 5,6  | 6,3  |
| 500             | 1,3                               | 2,5   | 1,3              | 2,5            | 3,6  | 5    | 6,3            | 7,1  | 8    |
| 630             | 1,8                               | 3,2   | 1,8              | 3,2            | 4,5  | 6,3  | 8              | 9    | 10   |
| 800             | 2,4                               | 4     | 2,4              | 4              | 5,6  | 8    | 10             | 11   | 12,5 |
| 1 000           | 3,2                               | 5     | 3,2              | 5              | 7,1  | 10   | 12,5           | 14   | 16   |
| 1 250           |                                   |       | 4,2              | 6,3            | 9    | 12,5 | 16             | 18   | 20   |
| 1 600           |                                   |       | 5,6              | 8              | 11   | 16   | 20             | 22   | 25   |
| 2 000           |                                   |       | 7,5              | 10             | 14   | 20   | 25             | 28   | 32   |
| 2 500           |                                   |       | 10               | 12,5           | 18   | 25   | 32             | 36   | 40   |
| 3 200           |                                   |       | 12,5             | 16             | 22   | 32   | 40             | 45   | 50   |
| 4 000           |                                   |       | 16               | 20             | 28   | 40   | 50             | 56   | 63   |
| 5 000           |                                   |       | 20               | 25             | 36   | 50   | 63             | 71   | 80   |
| 6 300           |                                   |       | 25               | 32             | 45   | 63   | 80             | 90   | 100  |
| 8 000           |                                   |       | 32               | 40             | 56   | 80   | 100            | 110  | 125  |
| 10 000          |                                   |       | 40               | 50             | 71   | 100  | 125            | 140  | 160  |

<sup>a</sup> Material group I, II, IIIa and IIIb.

<sup>b</sup> Material group I, II and IIIa.

NOTE In accordance with IEC 60664-1, the dimensions for creepage distance cannot be specified where permanently conductive pollution is present (Pollution degree 4).

#### 6.1.4 Insulation resistance

The insulation resistance shall be not less than the values given in Table 3.

**Table 3 – Insulation resistance**

| Measurement <sup>a</sup>                                                                                                                                                                                                                                                                                                                                                   |    |                                  | Resistance | Insulation           |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----|----------------------------------|------------|----------------------|
| Supply circuit                                                                                                                                                                                                                                                                                                                                                             | to | welding circuit                  | 5,0 MΩ     | Double or reinforced |
| Welding circuit                                                                                                                                                                                                                                                                                                                                                            | to | protective circuit               | 2,5 MΩ     | Basic                |
| Supply circuit                                                                                                                                                                                                                                                                                                                                                             | to | protective circuit               | 2,5 MΩ     | Basic                |
| Supply circuit of Class II equipment                                                                                                                                                                                                                                                                                                                                       | to | accessible surfaces <sup>b</sup> | 5,0 MΩ     | Double or reinforced |
| <sup>a</sup> Control circuits are tested together with the circuit to which they are galvanically connected. Accessible control circuits separated from all other circuits are tested according to the manufacturer's specification.<br><sup>b</sup> For measurement to accessible non-conductive surfaces, such surfaces shall be considered to be covered by metal foil. |    |                                  |            |                      |

Any control or auxiliary circuit connected to the protective conductor terminal shall be considered as an exposed conductive part for the purpose of this test.

*Conformity shall be checked by the stabilized measurement of the insulation resistance by application of a DC voltage of 500 V at room temperature.*

During the measurement, torches shall be disconnected, solid-state electronic components and their protective devices may be short-circuited and liquid cooling units shall be tested without liquid.

#### 6.1.5 Dielectric strength

The insulation shall withstand the following test voltages without any flashover or breakdown:

- first test of a welding power source: test voltages given in Table 4;
- repetition of the test of the same welding power source: test voltage 80 % of the values given in Table 4.

**Table 4 – Dielectric test voltages**

| Maximum rated voltage <sup>a</sup><br>V r.m.s.                                                                                                                                                                                        | AC dielectric test voltage<br>V r.m.s.                                                              |                    |                                                       |                                   |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------|--------------------|-------------------------------------------------------|-----------------------------------|
|                                                                                                                                                                                                                                       | All circuits to exposed conductive parts, supply circuit to all circuits except the welding circuit |                    | All circuits except supply circuit to welding circuit | Supply circuit to welding circuit |
| Supply <sup>a</sup> , welding <sup>b</sup> or control <sup>b</sup> circuits                                                                                                                                                           | Class I equipment                                                                                   | Class II equipment |                                                       |                                   |
| Up to 50                                                                                                                                                                                                                              | 500                                                                                                 | 1 000              | 500                                                   | 1 000                             |
| 220                                                                                                                                                                                                                                   | 1 100                                                                                               | 2 200              | 1 100                                                 | 2 200                             |
| 450                                                                                                                                                                                                                                   | 1 875                                                                                               | 3 750              | 1 875                                                 | 3 750                             |
| 700                                                                                                                                                                                                                                   | 2 500                                                                                               | 5 000              | 2 500                                                 | 5 000                             |
| 1 000                                                                                                                                                                                                                                 | 2 750                                                                                               | 5 500              | 2 750                                                 | 5 500                             |
| NOTE 1 The maximum rated voltage is valid for earthed and unearthed systems.                                                                                                                                                          |                                                                                                     |                    |                                                       |                                   |
| NOTE 2 In this document, the dielectric strength test of control circuits is limited to any circuit that enters or exits the enclosure apart from the supply circuit and the welding circuit.                                         |                                                                                                     |                    |                                                       |                                   |
| a For intermediate values, interpolation is allowed on all supply networks (supply circuit) operating outside the range of 220 V to 450 V and on all three-phase, three-wire earthed systems without voltage exemption (see Annex A). |                                                                                                     |                    |                                                       |                                   |
| b For intermediate values, interpolation is allowed on welding and control circuits.                                                                                                                                                  |                                                                                                     |                    |                                                       |                                   |

The AC test voltage shall be of an approximate sine wave-form with a peak value not exceeding 1,45 times the r.m.s. value, having a frequency of approximately 50 Hz or 60 Hz.

The maximum permissible setting of the tripping current shall be 100 mA. The high voltage transformer shall deliver the prescribed voltage up to the tripping current. Tripping is regarded as a flashover or a breakdown.

NOTE For the operator's safety, the lowest setting of the tripping current (less than or equal to 10 mA) is typical.

**Alternative test:** A DC test voltage of 1,4 times the r.m.s. test voltage may be used.

Components or subassemblies shall not be disconnected or short-circuited unless the conditions of a), b) or c) below are met:

- The components or subassemblies are designed and tested to relevant standards that specify a voltage lower than the test voltage level of this document. These components or subassemblies are not connected between supply and **welding circuits** and their disconnection or short-circuiting does not prevent a part of that circuit from being tested. Example: fan motors and pump motors.
- The components or subassemblies are completely incorporated within either the supply or the **welding circuit** and their disconnection does not prevent a part of that circuit from being tested. Example: electronic circuits.
- Interference suppression networks or protection capacitors between the supply or **welding circuit** and any exposed conductive part conform to the relevant standards.

**Control circuits** connected to the protective conductor terminal shall not be disconnected during testing and they are then tested as exposed conductive parts.

At the discretion of the manufacturer, the test voltage may be slowly raised to the full value.

The test voltages between the **supply circuit**, the exposed conductive parts and the **welding circuit** may be applied simultaneously. An example is given in Annex B.

Engine-driven welding power sources shall undergo the same test.

*Conformity shall be checked by application of the test voltage for*

- a) 60 s (**type test**);
- b) 5 s (**routine test**);
- or
- c) 1 s (**routine test with the test voltage increased by 20 %**).

## **6.2 Protection against electric shock in normal service (direct contact)**

### **6.2.1 Protection provided by the enclosure**

Welding power sources specifically designed for indoor use shall have a minimum degree of protection of IP21S using IEC 60529 test procedures and conditions.

Welding power sources specifically designed for outdoor use shall have a minimum degree of protection of IP23S using IEC 60529 test procedures and conditions.

Welding power sources with degree of protection IP23S may be stored, but are not intended to be used outside during precipitation unless sheltered.

Adequate drainage shall be provided by the enclosure. Retained water shall not interfere with the operation of the equipment or impair safety. The quantity of water that may enter the enclosure is not limited.

**Welding circuit** connections shall be protected as specified in 11.4.1.

**Remote controls** for welding power sources shall have a minimum degree of protection of IP2X using IEC 60529 test procedures and conditions.

*Conformity shall be checked by the following test:*

A welding power source shall be subjected to the appropriate water test without being energized. Immediately after the test, the welding power source shall be moved to a safe environment and subjected to the insulation resistance test, listed in 5.4 g) and dielectric strength test, listed in 5.4 h).

### **6.2.2 Capacitors**

Each capacitor provided as part of a welding power source and connected either across a **supply circuit** or across a winding of a transformer providing **welding current** shall

- a) not contain more than 1 l of flammable liquid;
- b) be designed not to leak during normal service;
- c) be contained within the welding power source enclosure or other enclosure which conforms to the relevant requirements of this document.

*Conformity shall be checked by **visual inspection**.*

Capacitors shall not cause the welding power source to exhibit hazardous electrical breakdown or present risk of fire in event of a failure.

*Conformity shall be checked by the following test:*

The welding power source is operated at no-load at its **rated supply voltage** and with a supply fuse or circuit-breaker rated up to but not more than 200 % of the **rated maximum supply current** with all or any of the capacitors shorted until:

- 1) any fuse or over-current device in the welding power source has operated; or
- 2) the **supply circuit** fuse or circuit-breaker has cleared; or
- 3) the **supply circuit** components of the welding power source reach a steady state temperature, not higher than that allowed in 7.3.

If any undue heating or melting becomes apparent, the welding power source shall conform to the requirements of items a), c) and d) of 9.1.

There shall be no leakage of liquid during any of the **type tests** required by this document.

For interference suppression capacitors or capacitors having internal fusing or a circuit-breaker, this test is not required.

### 6.2.3 Automatic discharge of supply circuit capacitors

Each capacitor shall be provided with a means of automatic discharge which shall reduce the voltage across the capacitor to 60 V or less within the time necessary to give access to any current carrying part connected to the capacitor or an appropriate warning label shall be used. For any plug which has a voltage due to a capacitor, the access time is considered to be 1 s.

Capacitors having a rated capacitance not exceeding 0,1 µF are not considered to present a risk of electric shock.

*Conformity shall be checked by **visual inspection** and by the following test.*

The welding power source is operated at the highest **rated supply voltage**. The welding power source is then disconnected from the supply network and the voltages are measured with instruments that do not significantly affect the values being measured.

### 6.2.4 Isolation of the welding circuit

The **welding circuit** shall be isolated from the **supply circuit** and from all other circuits having a voltage higher than the allowable **no-load voltage** in accordance with 11.1.1 (for example auxiliary power **supply circuits**) by reinforced or **double insulation** or equivalent means that meet the requirements of 6.1. If another circuit is connected to the **welding circuit**, the power of the other circuit shall be supplied by an isolating transformer or equivalent means.

The **welding circuit** shall not be connected internally to the connecting means for the external protective conductor, the enclosure, frame or core of the welding power source, except, if necessary, by an interference suppression network or protection capacitor.

*Conformity shall be checked by tests given in 6.1.*

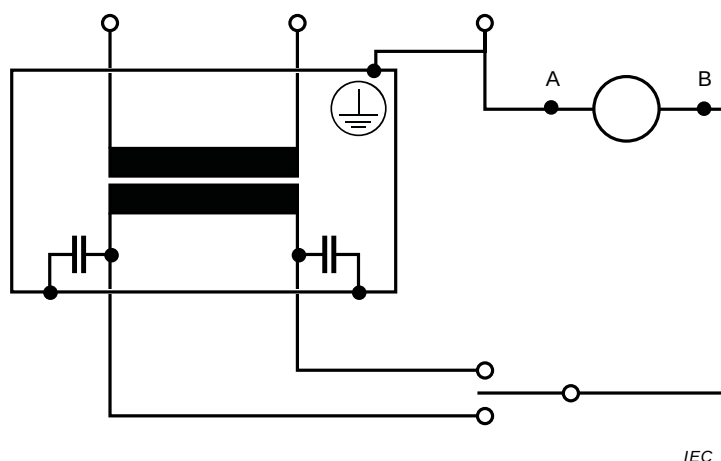
### 6.2.5 Welding circuit touch current

The **touch current** between the **welding circuit** connections and the protective conductor terminal shall not exceed 14,1 mA peak.

*Conformity shall be checked by **visual inspection** and measurement of the **touch current** with a circuit as shown in Figure 2 at the **rated supply voltage(s)** and no-load condition.*

The measuring network specified in Figure N.1 shall be connected as shown in Figure 2.





**Key**

A, B Measuring network connections

NOTE For class II equipment, use the PE-terminal of earthed supply network.

**Figure 2 – Measurement of welding circuit touch current**

**6.2.6 Touch current in normal condition**

The **touch current** for accessible conductive surfaces, not connected to the **protective circuit**, shall not exceed 0,7 mA peak under normal conditions.

Conformity shall be checked by measurement of the **touch current** with a circuit as shown in Figure 3, without simulating any fault and under the following conditions:

- the welding power source is:
  - isolated from the ground plane;
  - supplied by the highest **rated supply voltage**;
- the **welding circuit** is in the no-load condition;
- interference suppression capacitors are not disconnected.

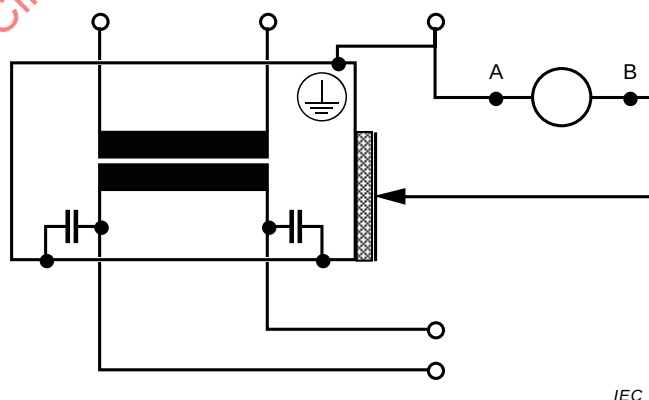


**Figure 3 – Measurement of touch current in normal condition**

### 6.3 Protection against electric shock in case of a fault condition (indirect contact)

#### 6.3.1 Protective provisions

Welding power sources shall be **class I** or **class II equipment** in accordance with IEC 61140, with the exception of the **welding circuit**.

#### 6.3.2 Isolation between windings of the supply circuit and the welding circuit

Windings of the **supply circuit** and the **welding circuit** shall be isolated by

- a) reinforced or **double insulation**
- or
- b) **basic insulation** to a metal screen between them which is connected to the protective conductor.

Between the windings of the **supply circuit** and the **welding circuit**, there shall be insulation which conforms to the values given in Table 5. Alternatively, other means specified in IEC 61558-1 may be used provided that the complete requirements of IEC 61558-1 are satisfied.

**Table 5 – Minimum distance through insulation**

| Rated supply voltage<br>V r.m.s. | Minimum distance through insulation<br>mm |                                        |
|----------------------------------|-------------------------------------------|----------------------------------------|
|                                  | Single layer                              | Total of three or more separate layers |
| up to 440                        | 1,3                                       | 0,35                                   |
| 441 to 690                       | 1,5                                       | 0,4                                    |
| 691 to 1 000                     | 2,0                                       | 0,5                                    |

Where there is a metal screen between the windings, the thickness of the insulation between each winding and the screen shall be at least half the values given in Table 5.

Conformity shall be checked by **visual inspection** and by measurement.

#### 6.3.3 Internal conductors and connections

Internal conductors and connections shall be secured or positioned to prevent accidental loosening, which could cause electrical connection between

- a) the **supply circuit** or any other circuit and the **welding circuit** so that the output voltage could become higher than the allowable **no-load voltage**;
- b) the protective conductor, enclosure, frame or core and the **welding circuit**.

Where insulated conductors pass through metallic parts, they shall be provided with bushings of insulating material or the openings shall be smoothly rounded with a radius of at least 1,5 mm.

Bare conductors shall be so fixed that the **clearance** and **creepage distance** from each other and from conductive parts is maintained (see 6.1.2 and 6.3.2).

Conductors of different circuits may be laid side by side, may occupy the same duct (for example conduit, cable trunking system), or may be in the same multiconductor cable provided that the arrangement does not impair the proper functioning of the respective circuits. Where those circuits operate at different voltages, the conductors shall be separated

by suitable barriers or shall be insulated for the highest voltage to which any conductor within the same duct can be subjected.

*Conformity shall be checked by **visual inspection** and by measurement.*

#### 6.3.4 Additional requirements for plasma cutting systems

The plasma cutting torch, parts (e.g. parts typically replaced due to wear) and **plasma cutting power source**, recommended by the manufacturer, shall form a safe system.

Plasma tips, which for technical reasons cannot be protected against direct contact, shall be considered sufficiently protected for normal use and **single-fault condition** if the following requirements are fulfilled:

a) when no arc current is present:

the voltage between the plasma tip and the workpiece and/or earth is not higher than the values given in 11.1.1,

or

the **plasma cutting power source** is fitted with a **hazard reducing device** in accordance with Clause 13,

and

b) for manual systems, when an arc current is present:

the sides of a plasma tip cannot be touched by the standard test finger in accordance with IEC 60529 when it is placed on a flat surface with its centre line perpendicular to it,

or

the DC **load voltage** between the plasma tip and the workpiece and/or earth is not higher than values given in 11.1.1.

NOTE A single-fault is an abnormal condition resulting from the electrode being in contact with the plasma tip because of missing insulators, sticking of the plasma tip to the electrode, conductive material between plasma tip and electrode, wrong parts, loose parts, electrode abrasion, parts inserted incorrectly, excessive load or incorrect gas flow.

*Conformity shall be tested in accordance with 11.1 and by simulating a torch fault and testing in accordance with Clause 13. The torch shall be tested in accordance with IEC 60974-7.*

#### 6.3.5 Movable coils and cores

If movable coils or cores are used to adjust the **welding current**, the construction shall be such that the prescribed **clearances** and **creepage distances** are maintained, taking into account electrical and mechanical stresses.

*Conformity shall be checked by operating the mechanism 500 times over its complete movement between minimum and maximum at the rate specified by the manufacturer and by **visual inspection**.*

#### 6.3.6 Touch current in fault condition

For class I equipment, the weighted **touch current** in the case of an external protective conductor failure or disconnection shall not exceed 14,1 mA peak except for equipment with permanent connection by a reinforced protective conductor in accordance with IEC 61140.

Equipment for permanent connection with a reinforced protective conductor may have a leakage current up to 5 % of the **rated supply current** per phase.

*Conformity shall be checked using the configurations as shown in Annex N under the following conditions:*

- 1) the welding power source is:
  - isolated from the ground plane;
  - supplied by the highest **rated supply voltage**;
  - not connected to the protective earth except through measurement components;
- 2) the **welding circuit** is in the no-load condition;
- 3) interference suppression capacitors shall not be disconnected.

## 7 Thermal requirements

### 7.1 Heating test

#### 7.1.1 Test conditions

When placing the measuring devices, the only access permitted shall be through openings with cover plates, inspection doors or easily removable panels provided by the manufacturer. The ventilation in the test area and the measuring devices used shall not interfere with the normal ventilation of the welding power source or cause abnormal transfer of heat to or from it.

The welding power source is operated at **rated supply voltage**, with constant current, at a cycle time of  $(10 \pm 0,2)$  min:

- a) with the rated **welding current** ( $I_2$ ) at 60 % and/or 100 % **duty cycle** as appropriate;
- b) with the **rated maximum welding current** ( $I_{2max}$ ) at the corresponding **duty cycle**.

If it is known that neither a) nor b) gives maximum heating, then a test shall be made at the setting within the rated range which gives the maximum heating.

In the case of a welding power source rated for AC tungsten inert-gas welding, an unbalanced load could cause maximum heating. In this case, a test shall be carried out as given in Annex C.

The ambient temperature condition of 5.1 shall be fulfilled.

NOTE 1 This maximum heating is possible at the no-load condition.

NOTE 2 The tests, if relevant, follow each other without having the welding power source returned to the ambient air temperature.

#### 7.1.2 Tolerances of the test parameters

During the last 60 min of the heating test in accordance with 7.1.3, the following tolerances shall be met:

- a) **load voltage**:  $\begin{matrix} +10 \\ -2 \end{matrix}$  % of the appropriate **conventional load voltage**;
- b) **welding current**:  $\begin{matrix} +10 \\ -2 \end{matrix}$  % of the appropriate **conventional welding current**;
- c) **supply voltage**:  $\pm 5$  % of the appropriate **rated supply voltage**;
- d) **engine speed**:  $\pm 5$  % of the appropriate rated speed;
- e) **temperature**:  $\begin{matrix} +10 \\ -2 \end{matrix}$  K of the ambient temperature.

### 7.1.3 Duration of test

The heating test shall be carried out until the rate of the **temperature rise** does not exceed 2 K/h on any component for a period not less than 60 min.

## 7.2 Temperature measurement

### 7.2.1 Measurement conditions

The temperature shall be determined at the midpoint of the load time of the last cycle as follows:

- a) for windings, by measurement of the resistance, or by surface or embedded temperature sensors;

NOTE 1 The surface temperature sensor method is not preferred.

NOTE 2 In the case of windings of low resistance having switch contacts in series with them, the resistance measurement can give misleading results.

- b) for other parts, by surface temperature sensors.

### 7.2.2 Surface temperature sensor

The temperature is measured by a temperature sensor applied to accessible surfaces of windings or other parts in accordance with the conditions stipulated below.

NOTE 1 Typical temperature sensors are thermocouples, resistance thermometers, etc.

Bulb thermometers shall not be used for measuring temperatures of windings and surfaces.

Temperature sensors are placed at accessible spots where the maximum temperature is likely to occur. It is advisable to locate the predictable hot spots by means of a preliminary check.

NOTE 2 The size and spread of hot spots in windings depend on the design of the welding power source.

Efficient heat transmission between the point of measurement and the temperature sensor shall be ensured, and protection shall be provided for the temperature sensor against the effect of air currents and radiation.

### 7.2.3 Resistance

The **temperature rise** of windings is determined by the increase in their resistance and is obtained for copper by the following formula:

$$t_2 - t_a = \frac{(235 + t_1)(R_2 - R_1)}{R_1} + (t_1 - t_a)$$

where

$t_1$  is the temperature of the winding at the moment when  $R_1$  is measured (°C);

$t_2$  is the calculated temperature of the winding at the end of the test (°C);

$t_a$  is the ambient air temperature at the end of the test (°C);

$R_1$  is the initial resistance of the winding (Ω);

$R_2$  is the resistance of the winding at the end of the test (Ω).

For aluminium, the number 235 in the above formula is replaced by the number 225.

The temperature  $t_1$  shall be within  $\pm 3$  K of the ambient air temperature.

#### 7.2.4 Embedded temperature sensor

The temperature is measured by thermocouples or other suitable temperature measuring instruments of comparable size embedded at the hottest parts.

Thermocouples shall be applied directly to windings and coils. Any integrally applied insulation on the conductors themselves is not required to be removed.

A thermocouple applied to the hottest point of a single layer winding is considered as embedded.

#### 7.2.5 Determination of the ambient air temperature

The ambient air temperature is determined by at least three measuring devices. These are spaced uniformly around the welding power source, at approximately one-half of its height and 1 m to 2 m from its surface. They are protected from draughts and abnormal heating. The mean value of the temperature readings is adopted as the temperature of the ambient air.

In the case of forced air-cooled welding power sources, a single measuring device is placed where the air enters the cooling system. The mean of the readings taken at equal intervals of time during the last quarter of the duration of the test is adopted as the ambient air temperature.

#### 7.2.6 Recording of temperatures

Where possible, temperatures are recorded while the equipment is in operation and after shutdown. On those parts where the recording of temperature is not possible while the equipment is in operation, temperatures are taken after shutdown as described below.

Whenever a sufficient time has elapsed between the instant of shutdown and the time of final temperature measurement to permit the temperature to fall, suitable corrections are applied to obtain as nearly as practicable the temperature at the instant of shutdown. This may be done by plotting a curve in accordance with Annex D. A minimum of four temperature readings is taken within 5 min from shutdown. In cases where successive measurements show an increasing temperature after shutdown, the highest value is taken.

To maintain the temperature during the stopping period, precautions shall be taken to shorten the stopping period of an engine-driven welding power source.

### 7.3 Limits of temperature rise

#### 7.3.1 Windings, commutators and slip-rings

The **temperature rise** for windings, commutators and slip-rings shall not exceed the values given in Table 6, regardless of the method of temperature measurement used.

**Table 6 – Temperature limits for windings, commutators and slip-rings**

| Class of insulation<br><br>°C | Maximum temperature<br><br>°C | Maximum temperature rise<br>K |            |                             |                                  |
|-------------------------------|-------------------------------|-------------------------------|------------|-----------------------------|----------------------------------|
|                               |                               | Windings                      |            |                             | Commutators<br>and<br>slip-rings |
|                               |                               | Surface temperature sensor    | Resistance | Embedded temperature sensor |                                  |
| 105 (A)                       | 150                           | 55                            | 60         | 65                          | 60                               |
| 120 (E)                       | 165                           | 70                            | 75         | 80                          | 70                               |
| 130 (B)                       | 175                           | 75                            | 80         | 90                          | 80                               |
| 155 (F)                       | 190                           | 95                            | 105        | 115                         | 90                               |
| 180 (H)                       | 210                           | 115                           | 125        | 140                         | 100                              |
| 200 (N)                       | 230                           | 130                           | 145        | 160                         | Not determined                   |
| 220 (R)                       | 250                           | 150                           | 160        | 180                         |                                  |

NOTE 1 Surface temperature sensor means that the temperature is measured with non-embedded sensors at the hottest accessible spot of the outer surface of the windings.

NOTE 2 Normally, the temperature at the surface is the lowest. The temperature determined by resistance measurement gives the average between all temperatures occurring in a winding. The highest temperature occurring in the windings (hot spot) can be measured by embedded temperature sensors.

NOTE 3 Other classes of insulation having higher values than those given in Table 6 are available (see IEC 60085).

No part shall be allowed to reach any temperature that will damage another part even though that part might conform to the requirements in Table 6.

Furthermore, for tests at other than 100 % **duty cycle**, the temperature occurring during any full cycle shall not exceed the maximum temperatures given in Table 6.

*Conformity shall be checked by measurement in accordance with 7.2.*

### 7.3.2 External surfaces

The **temperature rise** for external surfaces shall not exceed the values given in Table 7. Limits of **temperature rise** are given for:

- an unintentional contact period of 1 s for enclosures,
- a contact period of 4 s for buttons and
- a contact period of 60 s for handles.

**Table 7 – Temperature limits for external surfaces**

| External surface                                                | Maximum temperature rise<br>K | Burn threshold for contact<br>period <sup>a</sup><br>s |
|-----------------------------------------------------------------|-------------------------------|--------------------------------------------------------|
| Uncoated metal enclosures                                       | 25                            | 1                                                      |
| Painted metal enclosures                                        | 35                            | 1                                                      |
| Plastic enclosures                                              | 45                            | 1                                                      |
| Uncoated metal buttons                                          | 18                            | 4                                                      |
| Painted metal buttons                                           | 22                            | 4                                                      |
| Plastic buttons                                                 | 35                            | 4                                                      |
| Metal handles                                                   | 10                            | 60                                                     |
| Plastic handles                                                 | 20                            | 60                                                     |
| <sup>a</sup> Informative values in accordance with ISO 13732-1. |                               |                                                        |

For engine-driven welding power sources, the limits of Table 7 may be exceeded for surfaces that are:

- a) recognizable by appearance or function; or
- b) marked with the symbol IEC 60417-5041:2002-10; or
- c) located or guarded to prevent unintentional contact during normal operation.

NOTE Surfaces that are recognizable by appearance or function include parts such as exhaust parts, silencers, spark arrestors, or cylinder heads.

*Conformity shall be checked by measurement in accordance with 7.2 and **visual inspection**.*

### 7.3.3 Other components

The maximum temperature of other components shall not exceed their rated maximum temperature, in accordance with the relevant standard.

## 7.4 Loading test

Welding power sources shall withstand repeated load cycles without damage or functional failure. This test may be conducted on any welding power source that functions correctly.

*Conformity shall be checked by the following tests and by establishing that no damage or functional failure to the welding power source occur during the tests.*

Starting from the cold state, the welding power source is loaded at the **rated maximum welding current** until one of the following occurs:

- a) the **thermal protection** is actuated;
- b) the maximum temperature limit of the windings is reached;
- c) a period of 10 min is reached.

Immediately after reset of the **thermal protection** in a), or after b) or c), one of the following tests is carried out.

- 1) In the case of a **drooping characteristic** welding power source, the controls are set to provide **rated maximum welding current**. It is then loaded 60 times with a short circuit having an external resistance between 8 mΩ and 10 mΩ for 2 s, followed by a pause of 3 s.



- 2) In the case of a **flat characteristic** welding power source, it is loaded once with 1,5 times the **rated maximum welding current** at maximum available **load voltage** for 15 s. For welding power sources fitted with a protection device, which limits the **welding current** to a value lower than 1,5 times the **rated maximum welding current**, the test is carried out at the maximum **welding current** available at corresponding **load voltage**.

Immediately after test 1) or 2) is carried out, while equipment is still hot, the equipment shall be checked in accordance with 6.1.5.

## 7.5 Commutators and slip-rings

Commutators, slip-rings and their brushes shall show no evidence of injurious sparking or damage throughout the range of the engine-driven welding power source.

*Conformity shall be checked by **visual inspection** during*

- a) *the heating test in accordance with 7.1*  
*and*
- b) *the loading test in accordance with item 1) or 2) of 7.4.*

## 8 Thermal protection

### 8.1 General requirements

An electrically powered welding power source shall be fitted with **thermal protection** if the **duty cycle** at **rated maximum welding current** is lower than

- a) 35 % in the case of a **drooping characteristic**  
or
- b) 60 % in the case of a **flat characteristic**.

NOTE A **drooping characteristic** is generally used for manual metal arc welding and tungsten inert gas welding, while a **flat characteristic** is generally used for metal inert/active gas welding.

If a welding power source is fitted with **thermal protection**, the **thermal protection** shall meet the requirements of 8.2 to 8.7.

*Conformity shall be checked by **visual inspection**.*

### 8.2 Construction

The **thermal protection** shall be designed to prevent alteration of the temperature setting or operation.

*Conformity shall be checked by **visual inspection**.*

### 8.3 Location

The **thermal protection** shall be permanently located within the welding power source to ensure that the heat transfer is reliable.

*Conformity shall be checked by **visual inspection**.*

### 8.4 Operating capacity

The **thermal protection** shall be able to operate, when the welding power source delivers its **rated maximum welding current**:

- a) 100 times, in the case of a **duty cycle** of 35 % or higher  
or
- b) 200 times, in the case of a **duty cycle** lower than 35 %.

*Conformity shall be checked with a suitable overload producing the required number of consecutive interruptions of a circuit having the same electrical characteristics, especially current and reactance, as the circuit in which the **thermal protection** is used.*

After this test, the requirements of 8.5 and 8.6 shall be met.

## 8.5 Operation

The **thermal protection** shall prevent the welding power source windings from exceeding the maximum temperature limits given in Table 6.

The **thermal protection** shall not operate when the welding power source is loaded with the **rated maximum welding current** at the corresponding rated **duty cycle** indicated on the rating plate.

*Conformity shall be checked during operation in accordance with 7.1, at **rated maximum welding current**, at ambient temperature condition of 5.1 and without operation of the **thermal protection**. After that, the welding power source is overloaded in accordance with 9.4. Additionally, if the temperature condition of 5.1 does not give the maximum heating of windings, the test shall be carried out at ambient temperature that gives the maximum heating of windings.*

## 8.6 Resetting

The **thermal protection** shall not reset automatically or manually until the temperature has dropped below that of the **class of insulation** given in Table 6.

*Conformity shall be checked by operation and temperature measurement.*

## 8.7 Indication

Welding power sources fitted with **thermal protection** shall indicate that the **thermal protection** has reduced or disconnected the welding power source output. When the **thermal protection** has an automatic reset, the indicator shall be either a yellow light (or yellow flag within an aperture), or an alphanumeric display showing symbols or words whose meanings are given in the instruction manual.

*Conformity shall be checked by **visual inspection**.*

# 9 Abnormal operation

## 9.1 General requirements

A welding power source shall not breakdown and increases the risk of electric shock or fire, under the conditions of operation of 9.2 to 9.4. These tests are conducted without regard to temperature attained on any part, or the continued proper functioning of the welding power source. The only criterion is that the welding power source does not become unsafe. These tests may be conducted on any welding power sources that function correctly.

Welding power sources, protected internally by, for example, circuit-breaker or **thermal protection**, meet this requirement if the protection device operates before an unsafe condition occurs.

*Conformity shall be checked by the following tests:*

- A layer of dry absorbent surgical type cotton is placed under the welding power source, extending beyond each side for a distance of 150 mm.
- Starting from the cold state, the welding power source is operated in accordance with 9.2 to 9.4.
- During the test, the welding power source shall not emit flames, molten metal or other materials that ignite the cotton indicator.
- Following the test and not more than 5 min after the test, the welding power source shall be capable of withstanding a dielectric test in accordance with 6.1.5 b).

## 9.2 Stalled fan test

A welding power source, which relies on motor-driven fan(s) for conformity with the tests of Clause 7, is operated at **rated supply voltage** or **rated load speed** for a period of 4 h while the fan motor(s) is(are) mechanically stalled and the welding power source operated at the output condition of 7.1.

NOTE The intention of this test is to run the welding power source with the fan stationary to check the safety of both the fan and the welding power source.

## 9.3 Short circuit test

The welding power source is short circuited with the torch and the welding cables normally supplied by the manufacturer, or, if none are supplied, by a conductor 1,2 m in length and of the cross-section given in Table 8.

NOTE Cross sections for non-SI system are given in Table F.1

The welding power source at the maximum output setting is connected to that **rated supply voltage** that produces the highest **rated supply current** at **rated maximum welding current**. The **supply circuit** is protected by external fuses or a circuit-breaker with the rating and type as specified by the manufacturer.

**Table 8 – Cross-section of the output short-circuit conductor**

| Rated maximum welding current<br>A | Minimum cross-section <sup>a</sup><br>mm <sup>2</sup> |
|------------------------------------|-------------------------------------------------------|
| Up to 199                          | 25                                                    |
| 200 to 299                         | 35                                                    |
| 300 to 499                         | 50                                                    |
| 500 and above                      | 70                                                    |
| <sup>a</sup> See Annex F.          |                                                       |

The welding power source shall not clear the supply fuse or circuit-breaker when short circuited:

- for 15 s in the case of a **drooping characteristic**;
- three times for 1 s, within a period of 1 min, in the case of a **flat characteristic**.

The short circuit is then applied for 2 min or until the supply fuse or circuit-breaker clears.

The supply voltage shall not decrease by more than 10 % during this test.

Mechanically driven welding power sources are short circuited for 2 min at maximum output setting and set for operation at **rated load speed**.

## 9.4 Overload test

The welding power source is operated for 4 h in accordance with 7.1.1 b) at 1,5 times the corresponding **duty cycle**.

If the welding power source is rated for more than 67 % **duty cycle**, this test is conducted at 100 % **duty cycle**.

If the welding power source is provided with output regulating taps, those taps producing the highest supply current shall be used.

If the **duty cycle** at the **rated maximum welding current** is 100 %, the welding power source need not be tested.

## 10 Connection to the supply network

### 10.1 Supply voltage

Welding power sources shall be capable of operating at the **rated supply voltage**  $\pm 10$  %. This may give deviations from the **rated values**.

*Conformity shall be checked by the following test:*

The welding power source is connected to a **conventional load** and adjusted to minimum and maximum output. Each setting is tested at **rated supply voltage**  $\pm 10$  %. Verify presence of stable current flow in the **welding circuit** under these four conditions.

### 10.2 Multi-supply voltage

Welding power sources which are designed to operate from different supply voltages shall be fitted with one of the following:

- an internal voltage selection panel where the adjustment for the supply voltage is made by links. A marking shall indicate the arrangement of links for each supply voltage;
- an internal terminal box or panel in which the terminals are clearly marked with the supply voltages;
- a switch for tap selection which shall be fitted with an interlocking system which prevents the switch being moved to an incorrect position. The interlocking system shall be adjusted only by the use of a tool;
- two supply cables, each fitted with a different plug, and a selector switch which ensures that the pins of the plug not in use cannot become live;
- a system to automatically configure the welding power source in accordance with the supply voltage.

NOTE Welding power sources can be fitted with an external indication of the supply voltage selected.

*Conformity shall be checked by **visual inspection** and the following tests.*

In the case d), a selector switch is additionally tested in accordance with 10.8.

### 10.3 Means of connection to the supply circuit

Acceptable means of connection to the **supply circuit** are one of the following:

- terminals intended for the permanent connection of flexible supply cables;
- terminals intended for the connection of supply cables to a permanent installation;

c) appliance inlets fitted to the welding power source.

NOTE This requirement can also be met by using terminals on a device such as a switch, contactor, etc.

The means of connection to the **supply circuit** shall be chosen in accordance with the **maximum effective supply current**  $I_{1\text{eff}}$  and the maximum supply voltage and meet the requirements of the relevant standards or be designed in accordance with Annex E.

*Conformity shall be checked by **visual inspection**.*

#### 10.4 Marking of terminals

The terminal for the external protective conductor shall be marked with the symbol (IEC 60417-5019:2006-08).



Optionally the following may be added:

- a) the letters: **PE**  
or
- b) the twin colours: **green and yellow**.

Additionally, three-phase equipment terminals shall be clearly marked in accordance with IEC 60445 or other relevant component standards. The identifying marking notation shall be located on or adjacent to the corresponding terminal.

*Conformity shall be checked by **visual inspection**.*

#### 10.5 Protective circuit

##### 10.5.1 Continuity requirement

The internal **protective circuit** shall be capable of withstanding currents likely to be encountered in the case of a fault.

**Class I** welding power sources shall have a suitable terminal, adjacent to the phase-conductor terminals, dimensioned in accordance with Annex E and Table E.1, for the connection of the external protective conductor. This terminal shall not be used for any other purpose (such as for clamping two parts of the casing together).

On and inside the welding power source, if there is a neutral-conductor terminal, this shall not be in electrical contact with the terminal for the connection of the protective conductor.

Both inside and outside the welding power source, insulated protective conductors shall have the twin colours green and yellow. If the welding power source is supplied with a flexible multi-conductor supply cable, this shall have the protective conductor with the twin colours green and yellow.

In some countries, the single colour green is also used to identify the protective conductor and the protective conductor terminal.

If the welding power source is fitted with a protective conductor, it shall be connected in such a way that if the cable is pulled away from the terminals, the phase conductors break before the protective conductor.

*Conformity shall be checked by **visual inspection** and the tests given in 10.5.2 and 10.5.3.*

The method of securing conductive parts to the **protective circuits**, for example paint-piercing washers, paint-piercing screws or non-painted surfaces shall be considered during **visual inspection**.

### 10.5.2 Type test

A current of 200 % of the **maximum effective supply current** as given on the **rating plate** is applied from an enclosure part, that is likely to become live, through the external protective conductor terminal for a period of time given in Table 9, using the smallest external protective conductor size given in Table 10.

NOTE The waveform of the test current is not defined as long as the effective value is used for comparison.

**Table 9 – Current and time requirements for protective circuits**

| Current<br>A | Time<br>min |
|--------------|-------------|
| Up to 30     | 2           |
| 31 to 60     | 4           |
| 61 to 100    | 6           |
| 101 to 200   | 8           |
| Above 200    | 10          |

**Table 10 – Minimum cross-sectional area of the external protective copper conductor**

| Cross-sectional area of phase conductors supplying the equipment<br>$S$<br>mm <sup>2</sup> | Minimum cross-sectional area of the external protective copper conductor<br>$S_p$<br>mm <sup>2</sup> |
|--------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------|
| $S \leq 16$                                                                                | $S$                                                                                                  |
| $16 < S \leq 35$                                                                           | 16                                                                                                   |
| $S > 35$                                                                                   | $S/2$                                                                                                |

During the test there shall be no melting of any metal, deterioration of the bond to the welding power source, nor heating likely to cause a fire, nor shall the measured voltage drop from the enclosure part to the terminal exceed 4 V r.m.s.

### 10.5.3 Routine test

The test is to verify the continuity of the **protective circuit** by injecting a current of at least 10 A at 50 Hz or 60 Hz derived from a SELV source. The tests are to be made between the PE terminal and relevant points that are part of the **protective circuit**. The test time is 1 s.

The measured voltage between the PE terminal and the points of test shall not exceed the values given in Table 11:

**Table 11 – Verification of continuity of the protective circuit**

| Minimum effective protective conductor cross-sectional area of the branch under test<br>mm <sup>2</sup> | Maximum measured voltage drop<br>(values are given for a test current of 10 A)<br>V |
|---------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| 1,0                                                                                                     | 3,3                                                                                 |
| 1,5                                                                                                     | 2,6                                                                                 |
| 2,5                                                                                                     | 1,9                                                                                 |
| 4,0                                                                                                     | 1,4                                                                                 |
| > 6,0                                                                                                   | 1,0                                                                                 |

## 10.6 Cable anchorage

Welding power sources fitted with terminals for the connection of flexible supply cables shall be provided with a cable anchorage that relieves the electrical connection from strain.

The cable anchorage shall be so constructed that

- it is dimensioned for flexible cables having the range of cross-sectional area of conductor as specified in Table E.1;
- the method of anchorage can be easily recognized;
- the cable can be easily replaced;
- the cable cannot come into contact with conductive clamping screws of the cable anchorage if these screws are accessible or in electrical contact with exposed conductive parts;
- the cable is not retained by a metal screw which bears directly on it;
- at least one part of the cable anchorage is securely fixed to the welding power source;
- any screws that need to be loosened or tightened during cable replacement do not serve to fix any other component;
- when fitted to a **class II** welding power source, it shall be made of insulating material or so insulated that, if there is a cable insulation fault, no exposed conductive parts shall become live.

Conformity shall be checked by **visual inspection** and by the following test.

A flexible supply cable, which has the minimum cross-sectional area of the conductor specified, is connected at the point of connection to the equipment. The cable anchorage is fitted to the cable and tightened.

It shall then not be possible to push the cable so far into the welding power source that either the cable itself or internal parts of the welding power source are likely to be damaged.

The cable anchorage is then loosened and retightened 10 times.

The cable is then subjected for 1 min to a pull as specified in Table 12 without jerking.

**Table 12 – Pull**

| Nominal cross-sectional<br>area of the conductor<br>mm <sup>2</sup> | Pull<br>N |
|---------------------------------------------------------------------|-----------|
| 1,5                                                                 | 150       |
| 2,5                                                                 | 220       |
| 4,0                                                                 | 330       |
| 6 and above                                                         | 440       |

At the end of the test, the cable shall not have been displaced by more than 2 mm and the ends of the conductors shall not have been noticeably displaced in the terminals. To measure the displacement, prior to the test, a mark is provided at a distance of 20 mm from the cable anchorage on the cable with the cable in the stressed condition.

After the test, the displacement of this mark in relation to the cable anchorage is measured, with the cable in the stressed condition.

During the test, no visible damage (for example nicks, cuts or tears in the sheath) shall be caused to the cable.

The test is then repeated with the maximum cross-sectional area of the conductor specified.

### 10.7 Inlet openings

Where the supply cable passes through metallic parts, it shall be provided with a bushing of insulating material, or the openings shall be smoothly rounded with a radius of at least 1,5 mm.

Conformity shall be checked by **visual inspection**.

### 10.8 Supply circuit on/off switching device

Where a built-in **supply circuit** on/off switching device (for example switch, contactor or circuit-breaker) is provided, this shall:

- switch all ungrounded mains conductors, and
- plainly indicate whether the circuit is open or closed, and either
- be rated as follows:
  - voltage: not less than the values given on the **rating plate**,
  - current: not less than the highest effective supply current as given on the **rating plate**,
  - or
- be suitable for this application.

Conformity shall be checked by **visual inspection**; for c) in accordance with other relevant standards, and for d) by the following tests.

For the tests, the **supply circuit** on/off switching devices may be mounted external to the power source.

A welding power source is connected for the **rated supply voltage** that corresponds to the **rated maximum supply current** and, in addition for **class I equipment**, a fuse of 10 A to 20 A is placed



- in the case of an earthed **supply circuit**, in the protective earth connection;
- in the case of an unearthed **supply circuit**, between a phase conductor and the **protective circuit**.

During the tests, the supply voltage shall be maintained at not less than at the **rated value**.

Overload: The output of the welding power source is short-circuited in accordance with 9.3. The switching device is operated for 100 cycles at the rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

A switching device need not be tested if its **rated value** exceeds twice the **rated maximum supply current** of the welding power source.

Endurance: The output is connected to a **conventional load** and adjusted to produce the rated **welding current** at 100 % **duty cycle**. The switching device is operated for 1 000 cycles at a rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

A welding power source with more than one **rated supply voltage** is also tested at the rated maximum supply voltage.

There shall be no electrical or mechanical failure and, in addition for **class I equipment**, no clearing of the fuse.

NOTE A component having demonstrated that it passes these tests can be used in other similar applications if the other requirements are equal or less.

## 10.9 Supply cables

When supply cables are attached to the welding power source, they shall:

- a) be suitable for the application and meet national and local regulations;
- b) be dimensioned in accordance with the **maximum effective supply current**  $I_{1\text{eff}}$ ; and
- c) have a length of at least 2 m as measured from the exit point of the enclosure.

*Conformity shall be checked by **visual inspection**.*

NOTE Examples of local regulations are given in the Bibliography, e.g. EN 50525-2-21, Electrical code NFPA 70 (SE, SO, ST, STO or other extra hard usage cable) or CSA C22.1. PVC insulation has been proven not suitable for the application.

## 10.10 Supply coupling device (attachment plug)

If a supply coupling device is provided as a part of the arc welding equipment, its **rated values** shall be not less than:

- a) the rated current of the fuse required to comply with the tests specified in 9.3 regardless of whether or not an **supply circuit** switch is incorporated;
- b) the **maximum effective supply current**  $I_{1\text{eff}}$ .

For supply networks up to 125 V, the rated current shall, additionally, not be less than either c) or d):

- c) 70 % of the **rated maximum supply current** for equipment incorporating a supply switch;
- d) 70 % of the supply current measured with the output short-circuited at maximum setting for equipment not incorporating a supply switch.

Furthermore, the coupling device shall be suitable for industrial purposes.

NOTE Example of coupling devices suitable for industrial purposes can be found in IEC 60309-1.

*Conformity shall be checked by **visual inspection**, measurement and calculation.*

## 11 Output

### 11.1 Rated no-load voltage

#### 11.1.1 Rated no-load voltage for use in environments with increased risk of electric shock

If the welding power source is not fitted with a **hazard reducing device** in accordance with Clause 13, the **rated no-load voltage** shall not exceed:

- a) DC 113 V peak;
- b) AC 68 V peak and 48 V r.m.s.

Such welding power sources may be marked with S.

*Conformity shall be checked by measurement and by analysis of the circuit and/or by failure simulation in accordance with 11.1.5.*

#### 11.1.2 Rated no-load voltage for use in environments without increased risk of electric shock

If the welding power source is not fitted with a **hazard reducing device** in accordance with Clause 13, the **rated no-load voltage** shall not exceed

- a) DC 113 V peak;
- b) AC 113 V peak and 80 V r.m.s.

*Conformity shall be checked by measurement in accordance with 11.1.5.*

#### 11.1.3 Rated no-load voltage for the use with mechanically held torches with increased protection for the operator

The **rated no-load voltage** shall not exceed

- a) DC 141 V peak;
- b) AC 141 V peak and 100 V r.m.s.

These values may only be used if the following requirements are fulfilled:

- 1) the torch shall not be hand-held;
- 2) the **no-load voltage** shall be switched off automatically when the welding is stopped;  
and
- 3) the protection against direct contact with live parts shall be given by:
  - a minimum degree of protection of IP2X,
  - or
  - a **hazard reducing device** (see Clause 13).

*Conformity shall be checked by measurement in accordance with 11.1.5, by operation and by **visual inspection**.*

#### 11.1.4 Rated no-load voltage for special processes for example plasma cutting

The **rated no-load voltage** shall not exceed 500 V peak DC.

*Conformity shall be checked by measurement in accordance with 11.1.5, by operation and by **visual inspection**, except that the series combination of the 200  $\Omega$  fixed and 5 k $\Omega$  variable resistors may be replaced by a fixed resistance of 5 k $\Omega$ .*

A **rated no-load voltage** exceeding 113 V peak DC may only be used if the following requirements are fulfilled.

- a) These **plasma cutting power sources** with their corresponding torches shall prevent the output of **no-load voltage** if the torch is disassembled or disconnected from the **plasma cutting power source**.
- b) The **no-load voltage** shall be less than 68 V peak not later than 2 s after the **control circuit** (for example start switch) is opened.
- c) The voltage between the tip of the torch and the workpiece or earth shall be less than 68 V peak not later than 2 s after both pilot and main arcs are extinguished.

The conditions for complying with these requirements shall be given in the instructions.

Such **plasma cutting power sources** may be marked with the symbol 84 of Annex L.

*Conformity shall be checked by measurement by meter or oscilloscope in parallel with 5 k $\Omega$  minimum resistance.*

#### 11.1.5 Additional requirements

The **rated no-load voltage** at all possible output settings shall not exceed the values given in 11.1.1 to 11.1.4, summarized in Table 13.

During measurement, the actual supply voltage shall not vary from the **rated supply voltage** by greater than  $\pm 6\%$ . If the **no-load voltage** varies with supply voltage, then for a variation of supply voltage greater than  $\pm 1\%$ , the **no-load voltage** shall be linearly corrected in accordance with the actual supply voltage.

**Table 13 – Summary of allowable rated no-load voltages**

| Subclause | Working conditions                                                   | Rated no-load voltage                             |
|-----------|----------------------------------------------------------------------|---------------------------------------------------|
| 11.1.1    | Environment with increased risk of electric shock                    | DC 113 V peak<br>AC. 68 V peak and 48 V r.m.s.    |
| 11.1.2    | Environment without increased risk of electric shock                 | DC 113 V peak<br>AC. 113 V peak and 80 V r.m.s.   |
| 11.1.3    | Mechanically held torches with increased protection for the operator | DC. 141 V peak<br>AC. 141 V peak and 100 V r.m.s. |
| 11.1.4    | Plasma cutting                                                       | DC 500 V peak                                     |

Welding power sources shall be

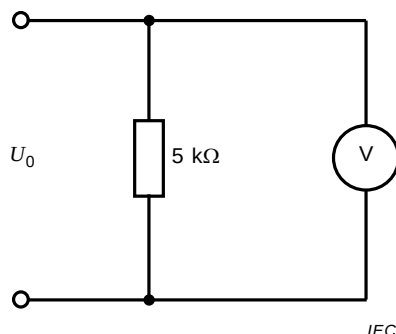
- a) designed to ensure that the output voltages given in Table 13 are not exceeded in the event of failure of any component (for example, open circuit or short circuit failure)  
or
- b) fitted with a protection system, which switches off the voltage at the output terminals within 0,3 s and shall not be reset automatically.

These values are not applicable to voltages for arc striking or arc stabilizing that could be superimposed.

*Conformity shall be checked by measurement and by analysis of the circuit and/or by failure simulation.*

### 11.1.6 Measuring circuits

For measuring r.m.s. values, a true r.m.s. meter shall be used together with a resistor of  $(5 \pm 0,25) \text{ k}\Omega$ , connected across the **welding circuit** terminals as shown in Figure 4.




**Key**

|       |                       |
|-------|-----------------------|
| $U_0$ | No-load voltage       |
| V     | True r.m.s. voltmeter |

**Figure 4 – Measurement of r.m.s. values**

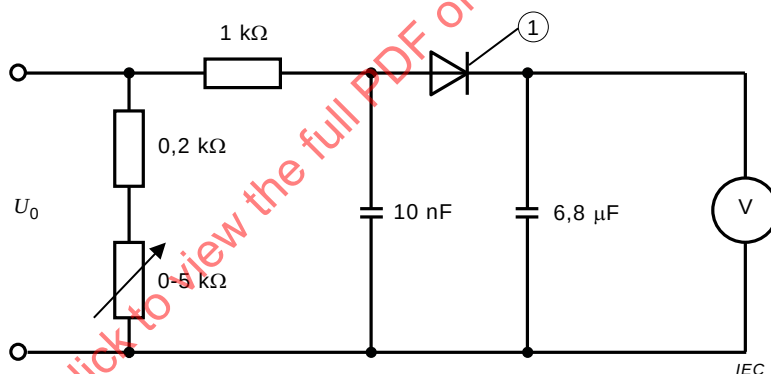To obtain reproducible measurements of peak values, omitting impulses which are not dangerous, a circuit as shown in Figure 5 shall be used.



**Key**

|       |                         |
|-------|-------------------------|
| $U_0$ | No-load voltage         |
| V     | Voltmeter               |
| 1     | Diode 1N4007 or similar |

**Figure 5 – Measurement of peak values**

The voltmeter shall indicate mean values. The measurement range chosen shall be as near as possible to the actual value of the **no-load voltage**. The voltmeter shall have an internal resistance of at least  $1 \text{ M}\Omega$ .

The tolerance of the component values in the measurement circuit shall not exceed  $\pm 5 \%$ .

For the **type test**, the rheostat is varied from  $0 \Omega$  to  $5 \text{ k}\Omega$  in order to obtain the highest peak value of the voltage measured with these loads of  $200 \Omega$  to  $5,2 \text{ k}\Omega$ . This measurement is repeated with the two connections to the measuring apparatus reversed.

The rheostat resistance and connection that produces the highest value of the voltage may be determined during the **type test**. This resistance and lead polarity may be used for the **routine test**.

## 11.2 Type test values of the conventional load voltage

### 11.2.1 Manual metal arc welding with covered electrodes

$$I_2 \text{ up to 600 A: } U_2 = (20 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 44 \text{ V}$$

### 11.2.2 Tungsten inert gas

$$I_2 \text{ up to 600 A: } U_2 = (10 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 34 \text{ V}$$

### 11.2.3 Metal inert/active gas and flux cored arc welding

$$I_2 \text{ up to 600 A: } U_2 = (14 + 0,05 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 44 \text{ V}$$

### 11.2.4 Submerged arc welding

$$I_2 \text{ up to 600 A: } U_2 = (20 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 44 \text{ V}$$

### 11.2.5 Plasma cutting

$$I_2 \text{ up to 170 A: } U_2 = (80 + 0,4 I_2) \text{ V}$$

$$I_2 \text{ between 170 A and 500 A: } U_2 = (131 + 0,1 I_2) \text{ V}$$

$$I_2 \text{ above 500 A: } U_2 = 181 \text{ V}$$

For plasma cutting, the manufacturer may specify additional **load voltages** as determined under typical cutting conditions.

NOTE The manufacturer-specified **load voltage** is used due to the nature of the plasma process. Factors that can influence the voltage at which satisfactory performance occurs include the interaction of the plasma torch design, recommended plasma gas, and standoff distance.

### 11.2.6 Plasma welding

$$I_2 \text{ up to 600 A: } U_2 = (25 + 0,04 I_2) \text{ V}$$

$$I_2 \text{ over 600 A: } U_2 = 49 \text{ V}$$

### 11.2.7 Plasma gouging

$$I_2 \text{ up to 300 A: } U_2 = (100 + 0,4 I_2) \text{ V}$$

$$I_2 \text{ over 300 A: } U_2 = 220 \text{ V}$$

For plasma gouging, the manufacturer may specify additional **load voltages** as determined under typical gouging conditions.

NOTE The manufacturer-specified **load voltage** is used due to the nature of the plasma process. Factors that can influence the voltage at which satisfactory performance occurs include the interaction of the plasma torch design, recommended plasma gas, and standoff distance.

### 11.2.8 Additional requirements

Throughout its range of adjustment, the electrically powered welding power sources shall be capable of delivering **conventional welding currents** ( $I_2$ ) at **conventional load voltages** ( $U_2$ ) in accordance with 11.2.1 to 11.2.7.

*Conformity shall be checked by sufficient measurements (see Annex H).*

### 11.3 Mechanical switching devices used to adjust output

A switch, contactor, circuit-breaker or other control device used to adjust or control the level of output from the welding power source shall have an endurance suitable for the application.

*Conformity shall be checked by the following test.*

The device is installed in a test welding power source and subjected to 6 000 cycles of operation over the complete range of mechanical movement with the output at the no-load condition. If the device is in the **supply circuit**, the welding power source is operated at the highest **rated supply voltage**. Check that no electrical or mechanical failure of the device or damage to the welding power source occurs.

NOTE A component having demonstrated that it passes these tests can be used in other similar applications, if the other requirements are equal or less.

### 11.4 Welding circuit connections

#### 11.4.1 Protection against unintentional contact

**Welding circuit** connections, with or without welding cables connected, shall be protected against unintentional contact by persons or by metal objects, for example vehicles, crane hooks, etc.

Examples of how such protection can be afforded.

- a) Any live part of a coupling device is recessed behind the plane of the access opening. Devices complying with IEC 60974-12 meet the requirement.
- b) A hinged cover or a protective guard is provided.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.2 Location of coupling devices

Uncovered coupling devices shall be located so that their openings are not tilted upwards.

NOTE Coupling devices fitted with an automatic closing device can have their openings tilted upwards.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.3 Outlet openings

Where welding cables pass through metallic parts, the edges of the opening shall be smoothly rounded with a radius of at least 1,5 mm.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.4 Three-phase multi-operator welding transformer

All welding output connections intended to be connected to the workpiece shall have a common interconnection within the welding power source.

Welding output connections of the same phase shall all be marked in the same way as each other.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.5 Marking

Connections designed specifically for attachment to the workpiece or to the electrode shall be so identified.

For DC welding power sources, the polarity shall be clearly marked, either on the welding output connections or on the polarity selector. This requirement is not relevant for **plasma cutting power sources**.

*Conformity shall be checked by **visual inspection**.*

#### 11.4.6 Connections for plasma cutting torches

The torch shall be connected to and disconnected from the **plasma cutting power source**:

- a) within the **plasma cutting power source**, by use of a tool, by screws or coupling devices;  
or
- b) on the **plasma cutting power source**, by a coupling device which is:
  - 1) designed to avoid connection of incompatible torches  
or
  - 2) operated by use of a tool.

When the coupling device is disconnected, no voltage higher than the limits of SELV accessible to the operator shall be present.

*Conformity shall be checked by **visual inspection** and measurement.*

#### 11.5 Power supply to external devices connected to the welding circuit

When a welding power source supplies electrical power to an external device including a connection to the **welding circuit**, such power shall be supplied by one of the following:

- a) the **welding circuit**;
- b) a safety isolating transformer in accordance with IEC 61558-2-6 or equivalent means incorporated in the welding power source;
- c) an isolating transformer in accordance with IEC 61558-2-4 with a rated secondary voltage up to 120 V r.m.s. if all exposed conductive parts of the external device, as recommended by the manufacturer, are connected to the protective earth conductor that is protected against the **welding current**, for example by a current sensing relay or by insulation of the relevant metal parts, for example by an enclosure.

External devices include wire feed units, arc striking and stabilizing devices, torches, seam trackers or other devices containing a connection to the **welding circuit**.

*Conformity shall be checked by **visual inspection** and fault simulation.*

#### 11.6 Auxiliary power supply

In the case of welding power sources designed to supply electrical power to external devices which are not a part of the **welding circuit** (for example for lighting, external cooling system or electric tools), these auxiliary circuits and accessories shall comply with the standards and regulations relating to the use of these external devices.

The **welding circuit** shall be isolated from such **supply circuits** in accordance with 6.2.4 and 6.3.2.

Near the socket-outlet of the auxiliary power supply, the available current, voltage, **duty cycle** if less than 100 %, AC or DC and the status of the neutral (for example earthed or unearthed) as appropriate, shall be clearly and indelibly marked.

*Conformity shall be checked by **visual inspection** during the tests in accordance with 6.1.4, 6.1.5, 6.2.4 and 6.3.2 and by rubbing the marking in accordance with 15.1.*

## 11.7 Welding cables

If a welding power source is supplied with welding cables, they shall meet the requirements of IEC 60245-6 or meet national and local regulations.

If a **plasma cutting power source** is supplied with welding cables, they shall meet the current and **no-load voltage** ratings suitable for the application and meet national and local regulations.

NOTE 1 Example or local regulations are given in Bibliography, e.g. EN 50525-2-81:2011. Additional information about the current carrying capability of welding cables can be found in EN 50565-1:2014.

NOTE 2 PVC insulation has been proved not suitable for the application and is not recognised in welding cable product standards of IEC or CENELEC.

NOTE 3 The rated voltage of welding cables complying with IEC 60245-6 is typically not suitable for plasma cutting applications.

## 12 Control circuits

### 12.1 General requirement

All inputs and outputs of **control circuits** shall be tested at the maximum load as specified by the manufacturer. **Remote control** circuits may be tested without connection to the power source, provided that the power source can be simulated.

*Conformity shall be checked by measurement or analysis, as appropriate.*

### 12.2 Isolation of control circuits

A **control circuit** that leaves the enclosure that has a voltage lower than the allowable **no-load voltage** in accordance with 11.1.1, and that is separated from the **welding circuit** and **supply circuit** shall be:

- insulated from the **supply circuit** by double or **reinforced insulation**,
- insulated from all other circuits having a voltage higher than the allowable **no-load voltage** in accordance with 11.1.1 (e.g. auxiliary power **supply circuits**, plasma cutting circuit) by double or **reinforced insulation** and
- insulated from the **welding circuit** having a voltage lower than the allowable **no-load voltage** in accordance with 11.1.1 by **basic insulation**.

NOTE Example of insulation configuration for **Class I equipment** is given in 6.1.1.

*Conformity shall be checked by measurement or analysis, as appropriate.*

### 12.3 Working voltages of remote control circuits

The **working voltages** in **remote control** circuits that are designed to be handheld shall not exceed 50 V AC or 120 V ripple free DC between conductors, or between any conductor and **protective circuit**, under normal operating conditions and after a single fault.

NOTE **Working voltage** requirements for local or wide area computer networks are contained in IEC 60950-1.



*Conformity shall be checked by measurement or analysis, as appropriate.*

## 13 Hazard reducing device

### 13.1 General requirements

A **hazard reducing device** shall reduce the severity of the electric shock that can originate from **no-load voltages** exceeding the allowable **rated no-load voltage** for a given environment. Types of **hazard reducing devices** are given in 13.2.

Requirements are given in Table 14.

**Table 14 – Hazard reducing device requirements**

| Unreduced no-load voltage in accordance with subclause                           | Reduced no-load voltage in accordance with subclause | Operating time<br>s |
|----------------------------------------------------------------------------------|------------------------------------------------------|---------------------|
| Between 11.1.3 and 11.1.2                                                        | 11.1.1                                               | 0,3                 |
| Between 11.1.2 and 11.1.1                                                        | 11.1.1                                               | 2                   |
| For DC welding power source above 113 V, an operating time of 0,3 s is required. |                                                      |                     |

### 13.2 Types of hazard reducing devices

#### 13.2.1 Voltage reducing device

A voltage reducing device shall have automatically reduced the **rated no-load voltage** to a level not exceeding the values of 11.1.1 at the moment the resistance of the external **welding circuit** exceeds 200 Ω. The operating time is specified in Table 14.

Such welding power sources may be marked with the symbol 84 of Annex L.

*Conformity shall be checked by connecting a variable load resistor across the welding output connections of the welding power source. Voltage measurements and operating time are taken while the resistance is being increased.*

#### 13.2.2 Switching device for AC to DC

A switching device for AC to DC shall have automatically switched the rated AC **no-load voltage** to a rated DC **no-load voltage** not exceeding the values given in 11.1.1 at the moment the resistance of the external **welding circuit** exceeds 200 Ω. The operating time is specified in Table 14.

Such welding power sources may be marked with the symbol 84 of Annex L.

*Conformity shall be checked in accordance with 13.2.1.*

### 13.3 Requirements for hazard reducing devices

#### 13.3.1 Disabling the hazard reducing device

The design shall be such that the operator cannot disable or by-pass the **hazard reducing device** without the use of a tool.

*Conformity shall be checked by **visual inspection**.*

### 13.3.2 Interference with operation of a hazard reducing device

**Remote controls**, as specified by the manufacturer, and arc striking or arc stabilizing devices of the welding power source shall not interfere with the proper functioning of the **hazard reducing device**, i.e. **no-load voltage** limits shall not be exceeded.

*Conformity shall be checked by repeating the tests of 13.2.1 with any of the devices that could interfere with the operation of the **hazard reducing device**.*

### 13.3.3 Indication of satisfactory operation

A reliable device, for example a signal lamp, shall be provided which indicates that the **hazard reducing device** is operating satisfactorily. Where a signal lamp is used, it shall light when the voltage has been reduced or changed to DC.

*Conformity shall be checked by **visual inspection** during the test in accordance with 13.1.*

### 13.3.4 Fail to a safe condition

If the **hazard reducing device** fails to operate in accordance with 13.1, the voltage at the output terminals shall be reduced to a level not exceeding 11.1.1 in accordance with Table 14 and shall not be reset automatically.

*Conformity shall be checked by simulating a fault of the **hazard reducing device** and measuring the time to reach a safe condition after failure of the **hazard reducing device**.*

## 14 Mechanical provisions

### 14.1 General requirements

Equipment shall be constructed and assembled so that it has the strength and rigidity necessary to withstand the normal service to which it is likely to be subjected, without increasing the risk of electric shock or other hazards whilst maintaining the minimum **clearances** required. Equipment shall be provided with a case or cabinet that encloses all live and hazardous moving parts (such as pulleys, belts, fans, gears etc.) except that the following need not be fully enclosed:

- a) supply, control and welding cables;
- b) output terminals for the connection of welding cables.

After the tests in accordance with 14.2 to 14.5, the equipment shall comply with the provisions of this document. Some deformation of the structural parts or enclosure is permitted provided this does not reduce the level of safety protection.

Accessible parts shall have no sharp edges, rough surfaces or protruding parts likely to cause injury.

*Conformity shall be checked by **visual inspection** after meeting the requirements of 14.2 to 14.5.*

### 14.2 Enclosure

#### 14.2.1 Enclosure materials

Non-metallic materials intended to protect from contact with live parts, except welding and SELV circuits, shall have a flammability classification of V-1 or better in accordance with IEC 60695-11-10.

*Conformity is checked by inspection of non-metallic materials specification.*

#### **14.2.2 Enclosure strength**

The enclosure, including air louvers, shall withstand an impact energy of 10 Nm in accordance with Annex I.

Handles, push buttons, adjustment dials etc. shall not be tested with the pendulum hammer.

Alternatively, the enclosure may be constructed of sheet metal with a minimum thickness in accordance with Annex J.

*Conformity shall be checked in accordance with a) or b) below.*

- a) By an impact test using a pendulum impact hammer in accordance with I.1 or using a free fall weight in accordance with I.2 or equivalent means as follows:
  - 1) one sample is tested;
  - 2) the welding power source is not energized during the test;
  - 3) select one impact point on each side, where risk of electrical shock or malfunction is highest;
  - 4) apply three impacts to selected impact points.
- b) By measurement of the thickness of the sheet metal.

#### **14.3 Handling means**

##### **14.3.1 Mechanised handling**

If means for mechanical handling are provided (for example eyelet or lug) for the purpose of lifting an assembled equipment, these shall be capable of withstanding the mechanical stress of a static pull with a force calculated from the mass of the assembled equipment as follows.

- a) For equipment with a mass of up to 150 kg, a force calculated from 10 times the mass shall be used.
- b) For equipment with a mass of greater than 150 kg, a force calculated from four times the mass or at least 15 kN shall be used.

If only a single lifting means is provided, it shall be designed so that a torque applied during lifting cannot cause it to be loosened.

*Conformity shall be checked by **visual inspection** and by the following test.*

The equipment is fitted with all the associated attachments, (excluding gas cylinders, separate trailers, carts and wheel undercarriages) that are likely to be installed and, in the case of engine-driven welding power sources, completely serviced and ready for operation. The equipment is anchored rigidly at its base and a chain or cable is attached to its lifting means, as recommended by the manufacturer, and an upward force is then exerted continuously for 10 s.

If two or more lifting means are provided, the chains or cables are arranged so that the force is equally shared between them and is applied at an angle not greater than 15° to the vertical.

##### **14.3.2 Manual handling**

If means for manual handling are provided for lifting or carrying (for example handles, straps), these shall be capable of withstanding the mechanical stress of a static pull with a force calculated from the mass of the assembled equipment as follows.

A force calculated from four times the mass or at least 600 N shall be used.

*Conformity shall be checked by **visual inspection** and by the following test.*

The equipment is fitted with all the associated attachments, (excluding gas cylinders, separate trailers, carts and wheel undercarriages) that are likely to be installed. The equipment is anchored rigidly at its base and a chain or cable is attached to its handles or strap, as recommended by the manufacturer, and an upward force is then exerted continuously for 10 s.

#### 14.4 Drop withstand

Equipment shall be capable of withstanding a drop test. For this test, the equipment shall be equipped with all the associated attachments, cooling liquid and filler wire (excluding gas cylinders, separate trailers, carts and wheel undercarriages, unless these items are standard equipment and permanently affixed) that are recommended to be installed.

The heights for the drop test shall be as follows:

- a) equipment with a mass of up to 25 kg shall withstand a drop of  $250^{+10}_0$  mm;
- b) equipment with a mass of greater than 25 kg shall withstand a drop of  $100^{+10}_0$  mm.

NOTE 1 Mass of equipment includes mass of associated attachments, cooling liquid and filler wire.

*Conformity shall be checked by dropping the equipment three times on a hard and rigid surface. This test is so arranged that a different bottom edge of the equipment is struck each time it drops.*

NOTE 2 In practice, one corner will touch the impact surface first.

Engine-driven welding power sources shall be filled up and be ready for immediate use.

#### 14.5 Tilting stability

Equipment in its most unstable position shall not topple over when tilted up to 10°. Auxiliary items as specified by the manufacturer in accordance with the type of the equipment such as gas cylinders, wire feed unit or cooling device could affect the stability, and these shall be taken into account.

If the manufacturer specifies other auxiliary items, so that the requirement of this subclause cannot be met, then instructions shall be provided for anchorage or other means as necessary.

*Conformity shall be checked by the following test.*

The equipment is placed on a plane and tilted from the horizontal level.

### 15 Rating plate

#### 15.1 General requirements

A clearly and indelibly marked **rating plate** shall be fixed securely to or printed on each welding power source.

NOTE The purpose of the **rating plate** is to indicate to the user the electrical characteristics, which enables the comparison and correct selection of welding power sources.

Conformity shall be checked by **visual inspection** and by rubbing the marking by hand for 15 s with a piece of cloth soaked with water and again for 15 s with a piece of cloth soaked with petroleum spirit.

After this test, the marking shall be easily legible. It shall not be easy to remove the **rating plate** and it shall show no curling.

## 15.2 Description

The **rating plate** shall be divided into sections containing information and data for the

- a) identification;
- b) welding output;
- c) energy supply.

The arrangement and sequence of the data shall comply with the principle shown in Figure 6 (for examples, see Annex K).

The dimensions of the **rating plate** are not specified and may be chosen freely.

It is permissible to separate the above sections from each other and affix them at locations more accessible or convenient for the user.

For welding power sources to be used for several welding processes or for rotating welding power sources, either one combined or several separate **rating plate(s)** may be used.

NOTE Additional information can be given. Further useful information, for example **class of insulation**, **pollution degree** or power factor, can be given in technical literature supplied by the manufacturer (see 17.1).

|                   |            |        |               |      |
|-------------------|------------|--------|---------------|------|
| a) Identification |            |        |               |      |
| 1)                |            |        |               |      |
| 2)                |            | 3)     |               |      |
| 4) Optional       |            | 5)     |               |      |
| b) Welding output |            |        |               |      |
| 6)                | 8)         | 10)    |               |      |
|                   |            | 11)    | 11a)          | 11b) |
|                   |            |        |               | 11c) |
| 7)                | 9)         | 12)    | 12a)          | 12b) |
|                   |            |        |               | 12c) |
|                   |            | 13)    | 13a)          | 13b) |
|                   |            |        |               | 13c) |
| c) Energy supply  |            |        |               |      |
| 14)               | 15) or 18) | 16)    | 17)           |      |
|                   | or 19)     | or 20) | If applicable |      |
|                   |            |        | or 21)        |      |
| 22)               | Optional   | 23)    | If applicable |      |

IEC

Figure 6 – Principle of the rating plate

### 15.3 Contents


The following explanations refer to the numbered boxes shown in Figure 6.

#### a) Identification

- Box 1 Name and address of the manufacturer or distributor or importer and, optionally, a trade mark and the country of origin, if required.
- Box 2 Type (identification) as given by the manufacturer.
- Box 3 Traceability of design and manufacturing data, for example serial number.
- Box 4 Welding power source symbol (optional) for example:




Single-phase transformer




Three-phase transformer-rectifier




Single- or three-phase static frequency converter-transformer-rectifier




Inverter power source with AC and DC output




Three-phase motor-generator



Three-phase motor-generator-rectifier




Three-phase rotating frequency converter



Single-phase combined AC and DC power source



Engine-AC generator



Engine-generator-rectifier

- Box 5 Reference to the standards confirming that the welding power source complies with their requirements.

#### b) Welding output

- Box 6 Welding process symbol for example:



Manual metal arc welding with covered electrodes



Tungsten inert-gas welding



Metal inert and active gas welding including the use of flux cored wire



Self shielded flux cored arc welding



Submerged arc welding



Plasma cutting



Plasma gouging



Plasma welding

Box 7



Mark for welding power sources which are suitable for supplying power to welding operations carried out in an environment with increased risk of electric shock (if applicable).

NOTE 1 In addition, this symbol, of a suitable size, can be displayed on the front of the welding power source.

Box 8

Welding current symbol for example:



Direct current



Alternating current, and additionally the rated frequency in hertz for example: ~50 Hz



Direct and alternating current at the same output, and additionally the rated frequency in hertz

Box 9

$U_0$ ... V Rated no-load voltage

- 1) peak value in case of direct current;
- 2) r.m.s. value in case of alternating current.

NOTE 2 If a welding power source is fitted with a **hazard reducing device**, this is the voltage measured before the **hazard reducing device** has performed its function.

If several **no-load voltages** are adjustable, their range shall be given by the rated minimum and maximum **no-load voltage**.

Additionally, the following shall be given.

- 3)  $U_r$ ... V reduced rated no-load voltage in case of a voltage reducing device;  
 4)  $U_s$ ... V switched rated no-load voltage in case of an AC to DC switching device.

Box 10 ... A/... V to... A/... V Range of output, minimum welding current and its corresponding conventional load voltage or less, maximum welding current and its corresponding conventional load voltage or greater.

Box 11 X Duty cycle symbol.

Box 12  $I_2$  Rated welding current symbol.

Box 13  $U_2$  Conventional load voltage symbol.

Boxes 11a, 11b, 11c ... % Values of the duty cycle at an ambient temperature of 40 °C.

12a, 12b, 12c ... A Values of the rated welding current.

13a, 13b, 13c ... V Values of the conventional load voltage.

These boxes form a table with corresponding values of the three settings:


- 1) ... % duty cycle at the rated maximum welding current;
- 2) 60 % duty cycle;  
and
- 3) 100 % duty cycle as far as relevant.

Column a) need not be used if the duty cycle for the rated maximum welding current is 60 % or 100 %.

Column b) need not be used if the duty cycle at the rated maximum welding current is 100 %.

### c) Energy supply

Box 14 Energy supply symbol, for example:



Supply circuit, number of phases (for example 1 or 3), symbol for alternating current and the rated frequency (for example 50 Hz or 60 Hz)



Engine



Motor



Belt drive



| Box                                                    | Electrically powered welding power sources |                                  | Box | Mechanically powered welding power sources |                                          |
|--------------------------------------------------------|--------------------------------------------|----------------------------------|-----|--------------------------------------------|------------------------------------------|
| 15                                                     | $U_1 \dots$ V                              | Rated supply voltage             | 18  | $n \dots$ min <sup>-1</sup>                | Rated load speed                         |
| 16                                                     | $I_{1max} \dots$ A                         | Rated maximum supply current     | 19  | $n_0 \dots$ min <sup>-1</sup>              | Rated no-load speed                      |
| 17                                                     | $I_{1eff} \dots$ A                         | Maximum effective supply current | 20  | $n_i \dots$ min <sup>-1</sup>              | Rated idle speed, if applicable          |
| Boxes 15 to 17 form a table with corresponding values. |                                            |                                  | 21  | $P_{1max} \dots$ kW                        | Maximum power consumption, if applicable |

Box 22 IP.. Degree of protection, for example IP21 or IP23.

Box 23  Symbol for class II equipment, if applicable.

Conformity shall be checked by **visual inspection** and by checking of complete data.

## 15.4 Tolerances

Manufacturers shall meet **rating plate** values within the following tolerances by controlling component and manufacturing tolerances:

- $U_0$  rated no-load voltage in V  $\pm 5$  % measured in accordance with 11.1, but in no case shall the values summarized in Table 13 be exceeded;
- $I_{2min}$  rated minimum welding current in A;  
 $U_{2min}$  minimum conventional load voltage in V;  
The values of b) shall not be greater than those stated on the rating plate.
- $I_{2max}$  rated maximum welding current in A;  
 $U_{2max}$  maximum conventional load voltage in V;  
The values of c) shall not be less than those stated on the rating plate.
- $n_0$  rated no-load speed of rotation in min<sup>-1</sup>  $\pm 5$  %;
- $P_{1max}$  maximum power consumption in kW  $^{+10}_0$  %;
- $I_{1max}$  rated maximum supply current in A  $\pm 10$  %.
- The efficiency measured on any equipment connected to the supply network shall not be less than the reported value. **Idle state** power consumption shall not be greater than the reported value.

Conformity shall be checked by measuring under **conventional welding conditions** (see 3.17).

## 15.5 Direction of rotation

If necessary, the direction of rotation shall be indicated on rotating welding power sources.

Conformity shall be checked by **visual inspection**.

## 16 Adjustment of the output

### 16.1 Type of adjustment

If the welding power source has a means to adjust the output current, output voltage or both, the adjustment may be continuous, step-by-step, or both.

In the case of a continuous adjustment with several ranges, there shall be no gap between the ranges.

*Conformity shall be checked by measuring.*

## 16.2 Marking of the adjusting device

The output of the welding power source corresponding to different control settings shall be clearly and indelibly marked either on or by the controls, or displayed digitally.

With the exception of welding power sources that are set or adjusted with or by means of a digital read-out, the following shall apply.

- a) The setting indications on the scales or control tables shall take into account the relationship between the **conventional load voltage** and the **conventional welding current**.
- b) Each position in the case of a step-by-step adjustment or each major graduation in the case of a continuous adjustment shall be clearly marked with
  - 1) a numerical indication of the controllable parameters;  
or, where this is not possible,
  - 2) an alphanumeric marking.In case 2), a table on the apparatus or in the instructions shall indicate, for each control position, the nominal value of the (control) parameter.
- c) In the case of multiple range adjustment, maximum and minimum values for each range shall be given.
- d) Welding power sources designed for use with more than one process, for which the **conventional load voltage** differs, shall be marked with a separate control scale for each process. If this is not possible, alphanumeric marks as given in b) shall be used.
- e) Where the welding power source is designed so that it can be supplied at several **rated supply voltages** and where, for the same control position, the numerical values of the welding parameters are not the same, separate scales or a separate series of alphanumeric markings shall be fitted.

*Conformity shall be checked by **visual inspection**.*

## 16.3 Indication of current or voltage control

Where there is a voltage or current control, the output setting shall be indicated in volts, amperes or an arbitrary reference scale.

The accuracy of voltage or current indication shall be

- a) between 100 % and 25 % of the maximum setting  $\pm 10$  % of the true value;
- b) below 25 % of the maximum setting  $\pm 2,5$  % of the maximum setting.

If the manufacturer provides an ammeter or a voltmeter on the equipment, this shall be of class 2,5 and be properly damped.

*Conformity shall be checked by measurement and **visual inspection**.*

## 17 Instructions and markings

### 17.1 Instructions

Each welding power source shall be delivered with instructions which shall include the following (as applicable):

- a) general description;
- b) mass of the welding power source and its various parts and correct methods of handling them, for example by fork-lift or crane, and precautions to be taken with gas cylinders, wire feeders, etc.;
- c) the meaning of indications, markings and graphical symbols;
- d) information for selection and connection to the supply network (for example suitable supply cables, connection devices or attachment plugs, including the type and rated values for RCD, fuse or circuit-breaker, see also caution of 6.1.1) by qualified personnel in accordance with relevant national and local regulations;

NOTE Some national and local regulations require use of RCDs. Types of RCDs and their use are given in Annex B of IEC TR 60755:2008. Only Type B" RCDs provide protection where **supply circuit** DC fault currents are likely to occur.

- e) correct operational use relating to the welding power sources (for example cooling requirements, location, control device, indicators, fuel type);
- f) welding capability, **static characteristic** (drooping and/or flat), **duty cycle** (duty factor) limitations and explanation of **thermal protection** if relevant;
- g) limitations of use relating to the degree of protection provided, for example welding power sources are not suitable for use in rain or snow;
- h) basic guidelines regarding protection against personal hazards for operators and persons in the work area (for example electric shock, fumes, gases, arc rays, hot metal, sparks, noise, back injury during manual handling);
- i) conditions under which extra precautions are to be observed when welding or cutting (for example environment with increased risk of electric shock, flammable surroundings, flammable products, closed containers, elevated working positions, etc.);
- j) how to maintain the welding power source, such as recommended cycles for partial and complete test and other operation (for example cleaning);
- k) a list of parts typically replaced due to wear;
- l) information on supply of electrical power to external devices, for example for lighting or electric tools;
- m) precautions against toppling over, if the welding power source shall be placed on tilted plane;
- n) warning against the use of a welding power source for pipe thawing;
- o) type (identification) of plasma cutting torches that are specified for use with the **plasma cutting power source**;
- p) pressure, flow rate and type of plasma gas and if relevant, of cooling gas or cooling liquid;
- q) steps or range of the output current and the corresponding plasma gas as a set of values;
- r) EMC classification in accordance with IEC 60974-10;
- s) for an engine-driven welding power source, warning against the carbon monoxide component of engine exhaust (example of National Labelling Regulation is given in *US Code of Federal Regulations, Title 16, Parts 1407*).

Other useful information may also be given, for example **class of insulation**, **pollution degree**, efficiency (see Annex M), etc.

*Conformity shall be checked by reading the instructions.*

## 17.2 Markings

Each welding power source shall be clearly and indelibly marked on or near the front panel or near the ON/OFF switching device with the following combination of symbols to signify “Caution! Read instruction manual”:



This marking shall also be used near the torch connector of plasma cutting power sources indicating that the operator should read the instruction manual before selecting and connecting a torch. A single marking readily visible within operator line of sight to the front panel, ON/OFF switching device and torch connector is permitted.

The following equivalent wording may be used:

**Warning:** Read instruction manuals before operating and servicing this equipment.

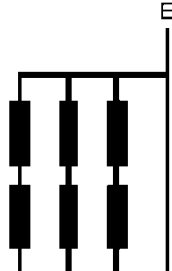
For other additional markings, see Annex L.

NOTE Precautionary labels appearing on power sources can consist of text only, text and symbols, or symbols only. Symbols-only precautionary labels are specified in ISO 17846.

*Conformity shall be checked by **visual inspection** and by testing in accordance with the durability test in 15.1.*

## Annex A (informative)

### Nominal voltages of supply networks


| Voltage line-to-neutral derived from nominal voltages AC or DC up to and including | Nominal voltages presently used in the world                                      |                                                                                   |                                                                                    |                                                                                     |
|------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
|                                                                                    | Three-phase four-wire systems with earthed neutral                                | Three-phase three-wire systems earthed or unearthed (E)                           | Single-phase two-wire systems AC or DC                                             | Single-phase three-wire systems AC or DC                                            |
| V                                                                                  |  |  |  |  |
| 50                                                                                 |                                                                                   |                                                                                   | 12,5<br>25<br>42                                                                   | 24<br>30<br>48                                                                      |
| 100                                                                                | 66/115                                                                            | 66                                                                                | 60                                                                                 |                                                                                     |
| 150                                                                                | 120/208 <sup>a</sup> ,<br>127/220                                                 | 115, 120, 127                                                                     | 100 <sup>b</sup> ,<br>110, 120                                                     | 100-200 <sup>b</sup> ,<br>110-220,<br>120-240                                       |
| 300                                                                                | 220/380, 230/400,<br>240/415, 260/440,<br>277/480                                 | 200 <sup>b</sup> , 220,<br>230, 240,<br>260, 277                                  | 220                                                                                | 220-440                                                                             |
| 600                                                                                | 347/600, 380/660,<br>400/690, 417/720,<br>480/830                                 | 347, 380, 400,<br>415, 440, 480<br>500, 577, 600                                  | 480                                                                                | 480-960                                                                             |
| 1 000                                                                              |                                                                                   | 660,<br>690, 720,<br>830, 1 000                                                   | 1 000                                                                              |                                                                                     |
| NOTE 1 Values taken from Table B.2 of IEC 60664-1:2007.                            |                                                                                   |                                                                                   |                                                                                    |                                                                                     |
| NOTE 2 "E" means "earthed".                                                        |                                                                                   |                                                                                   |                                                                                    |                                                                                     |
| <sup>a</sup> Common practice of the United States of America and Canada.           |                                                                                   |                                                                                   |                                                                                    |                                                                                     |
| <sup>b</sup> Common practice of Japan.                                             |                                                                                   |                                                                                   |                                                                                    |                                                                                     |

## Annex B (informative)
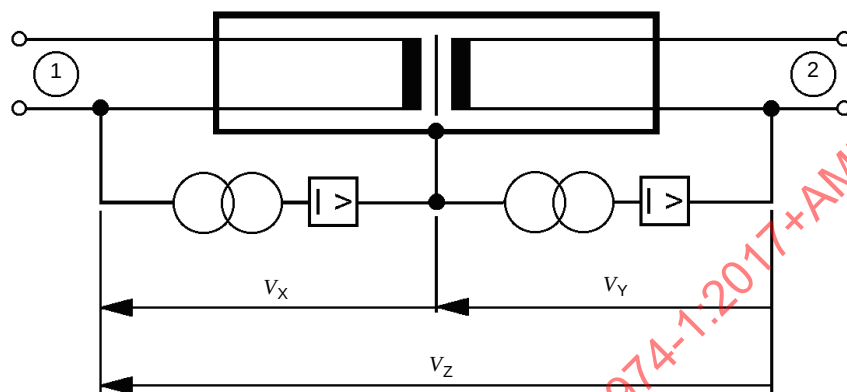
### Example of a combined dielectric test

Two high voltage transformers may be connected in series, correctly phased.

The common connection is to exposed conductive parts (see Figure B.1).



IEC

#### Key



Current sensing tripping device



Supply circuit



Welding circuit

$V_x$  Supply circuit to exposed conductive parts

$V_y$  Welding circuit to exposed conductive parts

$V_z$  Supply circuit to welding circuit

Figure B.1 – Combined high-voltage transformers

## Annex C (normative)

### Unbalanced load in case of AC tungsten inert-gas welding power sources

#### C.1 General

The difference in emissivity between the electrode and the workpiece in AC tungsten inert-gas welding causes an unbalanced welding voltage and a corresponding unbalance in the **welding current**.

This unbalance is called the DC component, and can cause saturation of the transformer of a transformer type welding power source. Such saturation will cause an abnormally high supply current that could cause severe over-heating.

Figure C.1 shows that the **welding current** has a DC component  $\bar{I}_2$  that may overheat the winding of the welding power source.


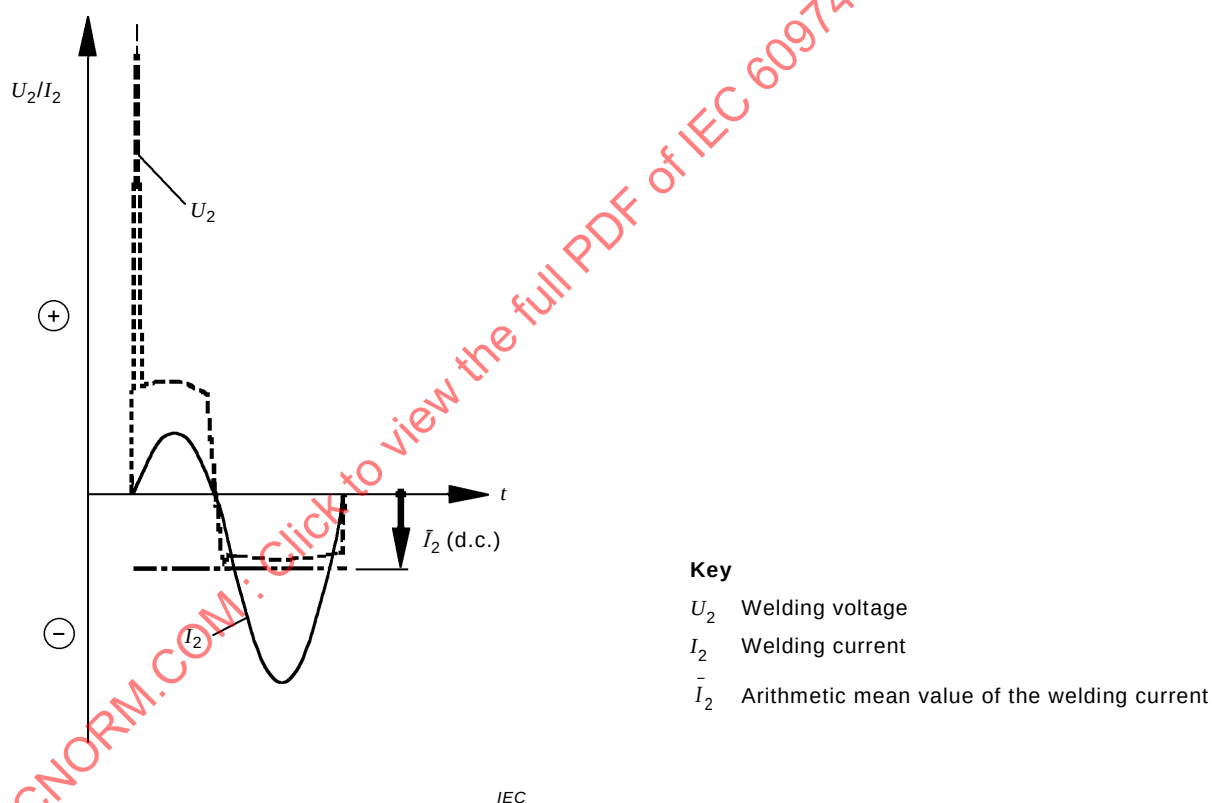


Figure C.1 – Voltage and current during AC tungsten inert-gas welding

#### C.2 Unbalanced load

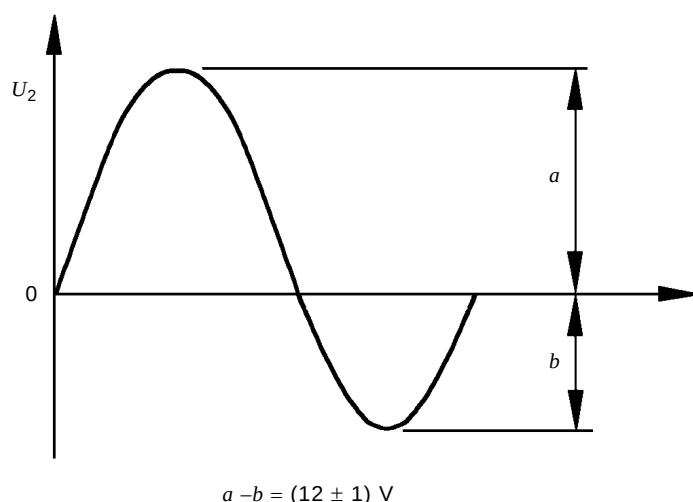To simulate the required **welding currents** for the heating test, a **conventional load** shall be used with a partial rectifying characteristic, so that if the polarity of the electrode is negative, the half-cycle voltage shall be  $(12 \pm 1)$  V less than the half-cycle voltage if the polarity of the electrode is positive (see Figure C.2).



#### Key

- $a$  peak voltage value when electrode is positive
- $b$  peak voltage value when electrode is negative

**Figure C.2 – Unbalanced voltage during AC tungsten inert-gas welding**

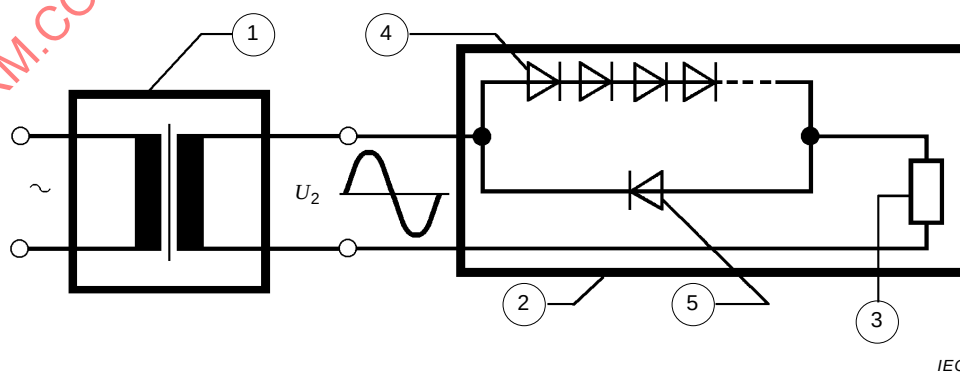
This difference of the half-cycle welding voltages is determined by passing a DC test current through the unbalanced load in both directions and measuring the DC **load voltage**.

Welding power sources that incorporate a balance control are tested with a **conventional load**, but with the balance control set to the condition producing the maximum unbalance, but not higher than 12 V.

### C.3 Example for an unbalanced load

The rectifying characteristic of the load is achieved by a circuit of diodes in accordance with Figure C.3.

The required voltage difference between the half-cycle voltages is adjusted by the numbers of diodes in the string.



#### Key

- |                   |                     |                |
|-------------------|---------------------|----------------|
| 1 Transformer     | 3 Conventional load | 5 Single diode |
| 2 Unbalanced load | 4 Series of diodes  |                |

**Figure C.3 – AC welding power source with unbalanced load**



## **Annex D** (informative)

### **Extrapolation of temperature to time of shutdown**

When the temperature at the instant of shutdown cannot be recorded, it is necessary to use an extrapolation to obtain this temperature. The procedure for such extrapolation is as follows:

- a) the time is marked at the instant of shutdown;
- b) successive temperature readings are taken, and the elapsed time from shutdown noted for each;
- c) a minimum of four readings is taken for each temperature to be extrapolated;
- d) using logarithmic/linear graph paper, the readings are plotted so that the temperature is against the logarithmic scale, and the time from shutdown against the linear scale. A straight line extending back to  $t = 0$  will give the extrapolated temperature at shutdown.

Alternative: A mathematical regression analysis can be used as an alternative to the graphical method. If a linear regression is chosen, then the logarithms of the temperatures are used with the linear values of the reading times from the instant of shutdown. The regression analysis is solved for the time  $t = 0$  and the antilogarithm taken to find the true temperature.

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annex E (normative)

### Construction of supply circuit terminals

#### E.1 Size of terminals

The terminals shall be dimensioned in accordance with the **maximum effective supply current**  $I_{1\text{eff}}$  and it shall be possible to connect flexible conductors with cross-sectional areas as given in Table E.1. These values are based on wire rated at 60 °C.

**Table E.1 – Range of conductor dimensions to be accepted by the supply circuit terminals**

| Maximum effective supply current<br>A | Range of cross-sectional area of the conductor<br>mm <sup>2</sup> |
|---------------------------------------|-------------------------------------------------------------------|
| 10                                    | 1,5 to 2,5                                                        |
| 16                                    | 1,5 to 4                                                          |
| 25                                    | 2,5 to 6                                                          |
| 35                                    | 4 to 10                                                           |
| 50                                    | 6 to 16                                                           |
| 63                                    | 10 to 25                                                          |
| 80                                    | 16 to 35                                                          |
| 100                                   | 25 to 50                                                          |
| 125                                   | 35 to 70                                                          |
| 160                                   | 50 to 95                                                          |
| 200                                   | 70 to 120                                                         |
| 250                                   | 95 to 150                                                         |
| 315                                   | 120 to 240                                                        |
| 400                                   | 150 to 300                                                        |

Alternative cross-section ranges are permitted if the manufacturer indicates in the instructions the type and size of wire to be used.

*Conformity shall be checked by calculation and measurement.*

#### E.2 Connections at the terminals

Connections at the terminals shall be made by means of screws, nuts or other equivalent means and shall comply with the requirement given in 5.3.

NOTE Electrical quick-connect terminals are considered equivalent when fitted with two independent fixings, one clamping the insulation and the other clamping the conductor.

The terminal screws or nuts shall not be used to secure other parts or to connect other conductors.

*Conformity shall be checked by **visual inspection**.*

### E.3 Construction of the terminals

Conductors or their lugs shall be clamped between metallic parts and shall not be able to escape when the clamping means are tightened.

Live parts that can turn and reduce the **clearance** shall not rely on friction between mounting surfaces to prevent turning. A suitable lock washer, properly applied, shall be acceptable. Leads or busbars that are secured by other means need not have a lock washer.

Iron or steel, plain or plated, shall not be used for current carrying parts.

*Conformity shall be checked by **visual inspection** and by the temporary connection of conductors with the minimum and maximum cross-sectional area specified.*

### E.4 Fixing of the terminals

The terminals shall be securely fixed so that they cannot work loose when the clamping means are tightened or loosened. Furthermore, if friction alone is relied on to prevent turning or shifting of the terminals on the supporting surface, the **clearances** shall not be reduced below the values of Table 1 by shifting or turning. A pressure terminal connector need not be prevented from turning provided no **clearances** less than those required result when the terminals are turned 30° towards each other, or towards other uninsulated parts of opposite polarity, or towards grounded metal parts.

*Conformity shall be checked by **visual inspection** and by tightening and loosening 10 times the clamping means holding a conductor of the maximum cross-sectional area specified.*

The test shall be repeated using a conductor of the minimum cross-sectional area specified.

**Annex F**  
(informative)**Cross-reference to non-SI units**

Cross references to non-SI units for short-circuit test (see 9.3) are given in Table F.1.

**Table F.1 – Cross-reference for mm<sup>2</sup> to American wire gauge (AWG)**

| mm <sup>2</sup> | AWG     |
|-----------------|---------|
| 1,5             | 15      |
| 2,5             | 13      |
| 4               | 11      |
| 6               | 9       |
| 10              | 7       |
| 16              | 5       |
| 25              | 3       |
| 35              | 1       |
| 50              | 1/0     |
| 70              | 2/0     |
| 95              | 3/0     |
| 120             | 250 MCM |
| 150             | 350 MCM |
| 240             | 600 MCM |
| 300             | 700 MCM |

## Annex G (informative)

### Suitability of supply network for the measurement of the true r.m.s. value of the supply current

The peak and r.m.s. values of the supply current ( $I_1$ ) can be substantially affected by the supply network impedance ( $R_s$ ). To obtain valid measurements, the supply network impedance is 4 % or less than the input impedance of the welding power source:

$$R_s \leq 0,04 \frac{U_1}{I_1} (\Omega) \quad (G.1)$$

where

$R_s$  is the impedance of the supply network in ohms;

$U_1$  is the **rated supply voltage** in volts;

$I_1$  is the **rated supply current** in amperes.

To determine the impedance of the supply network, it is loaded by a **conventional load** that is able to reduce the supply voltage at least 1 % below the unloaded value.

NOTE 1 If the rated voltage of this **conventional load** is lower than the supply voltage, a transformer can be used.

NOTE 2 Automatic supply network voltage regulators are turned off.

NOTE 3 If a transformer is used  $I_{1 \text{ unloaded}}$  is the no-load current of that transformer, otherwise  $I_{1 \text{ unloaded}} = 0 \text{ A}$ .

The impedance of the supply network is calculated by the following formula:

$$R_s = \frac{U_{1 \text{ unloaded}} - U_{1 \text{ loaded}}}{I_{1 \text{ loaded}} - I_{1 \text{ unloaded}}} (\Omega) \quad (G.2)$$

where

$R_s$  is the impedance of the supply network in ohms;

$U_{1 \text{ loaded}}$  is the supply voltage in volts when loaded by a **conventional load**;

$U_{1 \text{ unloaded}}$  is the supply voltage in volts when unloaded;

$I_{1 \text{ loaded}}$  is the supply current in amperes when loaded by a **conventional load**;

$I_{1 \text{ unloaded}}$  is the supply current in amperes when unloaded.

Example:

|                 |                                          |                                        |
|-----------------|------------------------------------------|----------------------------------------|
| Supply network: | $U_{1 \text{ unloaded}} = 230 \text{ V}$ | $I_{1 \text{ unloaded}} = 1 \text{ A}$ |
|                 | $U_{1 \text{ loaded}} = 227 \text{ V}$   | $I_{1 \text{ loaded}} = 31 \text{ A}$  |

$$R_s = \frac{230 - 227}{31 - 1} = 0,10 \Omega$$

Welding power source:  $U_1 = 230 \text{ V}$   $I_{1 \text{ max}} = 30 \text{ A}$

With these values, the condition in accordance with Formula (G.1) is fulfilled:

$$R_s = 0,10 \Omega \leq 0,04 \frac{230}{30} = 0,31 \Omega$$

## Annex H (informative)

### Plotting of static characteristics

#### H.1 General

By varying the resistance of a **conventional load** connected to the output terminals of the welding power source, a set of values of **welding current** ( $I_2$ ) and corresponding **load voltage** ( $U_2$ ) may be obtained for a given output setting of the welding power source. The **static characteristic** is obtained by plotting these values on a graph with the **welding current** on the horizontal and the **load voltage** on the vertical axis.

The slope of the **static characteristic** is given by its tangent at the operating point.

#### H.2 Method

The number of values measured should be sufficient to enable a smooth curve to be plotted. In all cases, the **no-load voltage** and the **rated values** corresponding to each **duty cycle** (duty factor) stated on the **rating plate** should be recorded. For **drooping characteristic** welding power sources, the short-circuit current should also be recorded.

If the welding power source has a step-by-step setting, values should be measured at each position of the control. If a welding power source is designed for several supply voltages, the measurement should be repeated at each supply voltage.

For each point, the following should also be recorded: supply voltage ( $U_1$ ), supply current ( $I_1$ ), power delivered to the welding power source ( $P_1$ ).

For welding power sources with no feedback circuitry (for example simple transformers), the values of  $U_2$  and  $I_2$  should be multiplied by a correction factor of  $(U_1/U_1')$  if the measured supply voltage ( $U_1'$ ) differs from the **rated supply voltage** ( $U_1$ ). The power ( $P_1$ ) should be multiplied by  $(U_1/U_1')^2$ .

#### H.3 Analysis of the results

The series of curves obtained for the **static characteristics** of a welding power source may be used to confirm conformity to the relevant requirements of this document. If the negative slope at the operating point is greater than or equal to 7 V per 100 A, the **static characteristic** is considered to be drooping.

Annex I  
(normative)

Test methods for a 10 Nm impact


I.1 Pendulum impact hammer

The welding power source is placed against a rigid vertical surface and the impact is directed against the opposite side.

The angle of rotation  $\theta$  (see Figure I.1) is adjusted (see Table I.1) to account for hammer and swing arm tolerances with the objective of delivering the required impact energy of 10 Nm.

Table I.1 – Angle of rotation  $\theta$  to obtain 10 Nm impact
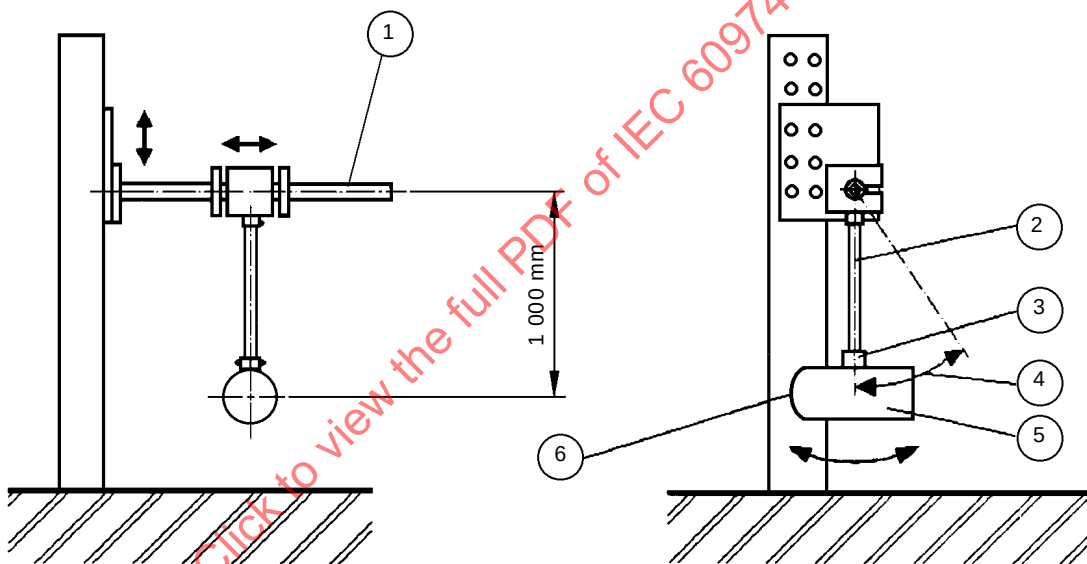
| Hammer mass (kg)                    | 1  | 1,5 | 2  | 2,5 | 3  |
|-------------------------------------|----|-----|----|-----|----|
| Angle of rotation $\theta$ (degree) | 90 | 71  | 60 | 53  | 48 |



IEC

Key

- 1 Support shaft (should not deflect more than 1,5 mm)
- 2 Swing arm, steel tubing (its mass is negligible)
- 3 Hammer collar (mass up to 100 g)
- 4 Angle of rotation  $\theta$
- 5 Steel hammer
- 6 Radius ( $50 \pm 2$ ) mm

Figure I.1 – Test set-up

## I.2 Free fall spherical steel weight

The welding power source is laid on a rigid horizontal surface. The mass of the free fall weight and the height of the free fall are given in Table I.2.

**Table I.2 – Mass of the free fall weight and height of the free fall**

|                   |      |      |      |      |      |      |      |
|-------------------|------|------|------|------|------|------|------|
| <b>Mass (kg)</b>  | 0,50 | 0,75 | 1,00 | 1,25 | 1,50 | 1,75 | 2,00 |
| <b>Height (m)</b> | 2,04 | 1,36 | 1,02 | 0,82 | 0,68 | 0,58 | 0,51 |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV



## **Annex J** **(normative)**

### **Thickness of sheet metal for enclosures**

The minimum thickness of sheet metal for enclosures shall be

- a) for steel, in accordance with Table J.1;
- b) for aluminium, brass or copper, in accordance with Table J.2.

The thickness values are based on a uniform deflection of the indicated sheet metal sizes, if loaded at the centre of their surface.

The thickness of an enclosure may be less than that given in Tables J.1 and J.2, if the enclosure shows the same deflection as an enclosure of the same size having the required thickness.

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

**Table J.1 – Minimum thickness of sheet metal for steel enclosures**

| Minimum thickness of uncoated steel <sup>a</sup><br>mm                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Without supporting frame <sup>b</sup> |                      | With supporting frame <sup>c</sup> |                      |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------|----------------------|------------------------------------|----------------------|
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Maximum width<br>mm                   | Maximum length<br>mm | Maximum width<br>mm                | Maximum length<br>mm |
| 0,50                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 105<br>125                            | Not limited<br>150   | 160<br>175                         | Not limited<br>210   |
| 0,65                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 155<br>180                            | Not limited<br>225   | 245<br>255                         | Not limited<br>320   |
| 0,80                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 205<br>230                            | Not limited<br>300   | 305<br>330                         | Not limited<br>410   |
| 1,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 320<br>360                            | Not limited<br>460   | 500<br>535                         | Not limited<br>635   |
| 1,35                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 460<br>510                            | Not limited<br>635   | 690<br>740                         | Not limited<br>915   |
| 1,50                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 560<br>635                            | Not limited<br>790   | 840<br>890                         | Not limited<br>1 095 |
| 1,70                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 635<br>740                            | Not limited<br>915   | 995<br>1 045                       | Not limited<br>1 295 |
| 2,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 840<br>890                            | Not limited<br>1 200 | 1 295<br>1 375                     | Not limited<br>1 680 |
| 2,35                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 1 070<br>1 200                        | Not limited<br>1 500 | 1 630<br>1 730                     | Not limited<br>2 135 |
| 2,70                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 1 325<br>1 525                        | Not limited<br>1 880 | 2 035<br>2 135                     | Not limited<br>2 620 |
| 3,00                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | 1 600<br>1 860                        | Not limited<br>2 290 | 2 470<br>2 620                     | Not limited<br>3 230 |
| <sup>a</sup> 1) For stainless steel, only 80 % of the given values are necessary.<br>2) For zinc-coated steel, the thickness shall be adjusted to take into account the coating thickness (usually 0,05 mm to 0,1 mm).<br><sup>b</sup> Constructions considered to be without a supporting frame are for example:<br>1) a single sheet with single formed flanges;<br>2) a single sheet that is corrugated or ribbed;<br>3) an enclosure surface loosely attached to a frame, for example with spring clips or latch;<br>4) an enclosure surface having an unsupported edge.<br><sup>c</sup> These two columns apply when the enclosure is strengthened by one of the following means:<br>1) a supporting frame that is a structural channel, angle, or folded rigid section that is at least equal to the metal thickness of the enclosure, and is rigidly attached to the enclosure;<br>2) a supporting frame other than metal that has an equivalent torsional rigidity to a sheet steel angle in accordance with 1) above, and is fire resistant;<br>3) all of the edges of the enclosure are turned through a 90° angle to produce a formed flange with a minimum width of 10 mm. |                                       |                      |                                    |                      |


**Table J.2 – Minimum thickness of sheet metal for enclosures  
of aluminium, brass or copper**

| Minimum thickness<br>of metal<br>mm                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Without supporting frame <sup>a</sup> |                      | With supporting frame <sup>b</sup> |                      |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------|----------------------|------------------------------------|----------------------|
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Maximum width<br>mm                   | Maximum length<br>mm | Maximum width<br>mm                | Maximum length<br>mm |
| 0,55                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 80<br>90                              | Not limited<br>110   | 180<br>220                         | Not limited<br>245   |
| 0,70                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 105<br>130                            | Not limited<br>155   | 260<br>270                         | Not limited<br>345   |
| 0,90                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 155<br>165                            | Not limited<br>205   | 360<br>385                         | Not limited<br>460   |
| 1,10                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 205<br>245                            | Not limited<br>295   | 485<br>535                         | Not limited<br>640   |
| 1,45                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 305<br>360                            | Not limited<br>410   | 715<br>765                         | Not limited<br>940   |
| 1,90                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 460<br>510                            | Not limited<br>635   | 1 070<br>1 145                     | Not limited<br>1 400 |
| 2,40                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 635<br>740                            | Not limited<br>915   | 1 525<br>1 630                     | Not limited<br>1 985 |
| 3,10                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 940<br>1 070                          | Not limited<br>1 350 | 2 210<br>2 365                     | Not limited<br>2 900 |
| 3,85                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 1 325<br>1 525                        | Not limited<br>1 880 | 3 125<br>3 305                     | Not limited<br>4 065 |
| <sup>a</sup> Constructions considered to be without a supporting frame are for example: <ol style="list-style-type: none"> <li>1) a single sheet with single formed flanges;</li> <li>2) a single sheet that is corrugated or ribbed;</li> <li>3) an enclosure surface loosely attached to a frame, for example with spring clips or latch;</li> <li>4) an enclosure surface having an unsupported edge.</li> </ol> <sup>b</sup> These two columns apply when the enclosure is strengthened by one of the following means: <ol style="list-style-type: none"> <li>1) a supporting frame that is a structural channel, angle, or folded rigid section that is at least equal to the metal thickness of the enclosure, and is rigidly attached to the enclosure;</li> <li>2) a supporting frame other than metal that has an equivalent torsional rigidity to a sheet steel angle in accordance with a) above, and is fire resistant;</li> <li>3) all of the edges of the enclosure are turned through a 90° angle to produce a formed flange with a minimum width of 10 mm.</li> </ol> |                                       |                      |                                    |                      |

## Annex K (informative)


### Examples of rating plates

Examples of rating plates are given in Figures K.1 to K.7

|                                                                                                      |                           |                                        |                                                                                         |            |                                      |
|------------------------------------------------------------------------------------------------------|---------------------------|----------------------------------------|-----------------------------------------------------------------------------------------|------------|--------------------------------------|
| a) Identification                                                                                    |                           |                                        |                                                                                         |            |                                      |
| 1) Manufacturer                                                                                      |                           | Trademark                              |                                                                                         |            |                                      |
| Address                                                                                              |                           |                                        |                                                                                         |            |                                      |
| 2) Type                                                                                              |                           | 3) Serial number                       |                                                                                         |            |                                      |
| 4)                  |                           | 5) IEC 60974-1<br>IEC 60974-10 Class A |                                                                                         |            |                                      |
| b) Welding output                                                                                    |                           |                                        |                                                                                         |            |                                      |
| 6)                  | 8) ~50 Hz                 | 10) 15 A / 20,6 V to 160 A / 27 V      |                                                                                         |            |                                      |
|                                                                                                      |                           | 11) X                                  | 11a) 35 %                                                                               | 11b) 60 %  | 11c) 100 %                           |
| 7)                 | 9) $U_0 = 48 \text{ V}$   | 12) $I_2$                              | 12a) 160 A                                                                              | 12b) 130 A | 12c) 100 A                           |
|                                                                                                      |                           | 13) $U_2$                              | 13a) 26 V                                                                               | 13b) 25 V  | 13c) 24 V                            |
| c) Energy supply                                                                                     |                           |                                        |                                                                                         |            |                                      |
| 14) <br>1 ~ 50 Hz | 15) $U_1 = 230 \text{ V}$ |                                        | 16) $I_{1\max} = 37 \text{ A}$                                                          |            | 17) $I_{1\text{eff}} = 22 \text{ A}$ |
|                                                                                                      | 22) IP23                  |                                        | 23)  |            |                                      |

IEC

Figure K.1 – Single-phase transformer

|                                                                                       |                                   |                                        |                                      |                                      |            |  |
|---------------------------------------------------------------------------------------|-----------------------------------|----------------------------------------|--------------------------------------|--------------------------------------|------------|--|
| a) Identification                                                                     |                                   |                                        |                                      |                                      |            |  |
| 1) Manufacturer<br>Address                                                            |                                   | Trademark                              |                                      |                                      |            |  |
| 2) Type                                                                               |                                   | 3) Serial number                       |                                      |                                      |            |  |
| 4)   |                                   | 5) IEC 60974-1<br>IEC 60974-10 Class A |                                      |                                      |            |  |
| b) Welding output                                                                     |                                   |                                        |                                      |                                      |            |  |
| 6)   | 8) ~450 Hz                        | 10) 60 A / 22,4 V to 500 A / 40 V      |                                      |                                      |            |  |
|                                                                                       |                                   | 11) X                                  | 11a) 35 %                            | 11b) 60 %                            | 11c) 100 % |  |
| 7)                                                                                    | 9) $U_0 = 78 \text{ V}$           | 12) $I_2$                              | 12a) 500 A                           | 12b) 400 A                           | 12c) 320 A |  |
|                                                                                       |                                   | 13) $U_2$                              | 13a) 40 V                            | 13b) 36 V                            | 13c) 33 V  |  |
| c) Energy supply                                                                      |                                   |                                        |                                      |                                      |            |  |
| 14)  | 18) $n = 2\,800 \text{ min}^{-1}$ |                                        |                                      |                                      |            |  |
|                                                                                       | 3 ~ 50 Hz                         | 15) $U_1 = 400 \text{ V}$              | 16) $I_{1\text{max}} = 68 \text{ A}$ | 17) $I_{1\text{eff}} = 40 \text{ A}$ |            |  |
| 22) IP23                                                                              |                                   | 23)                                    |                                      |                                      |            |  |


IEC

Figure K.2 – Three-phase rotating frequency converter

### Distributor-related plate

|                            |                  |
|----------------------------|------------------|
| a) Identification          |                  |
| 1) Manufacturer<br>Address | Trademark        |
| 2) Type                    | 3) Serial number |

### Manufacturer-related plate

|                                                                                                         |                                                                                         |
|---------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|
| a) Identification                                                                                       |                                                                                         |
| 4)                     | 5) IEC 60974-1<br>IEC 60974-10 Class A                                                  |
| b) Welding output                                                                                       |                                                                                         |
| 6)                     | 8)     |
| 10) 20 A / 20,8 V to 250 A / 30 V                                                                       |                                                                                         |
| 11) X                                                                                                   | 11a) 35 %<br>11b) 60 %<br>11c) 100 %                                                    |
| 7)                     | 9) $U_0 = 105 \text{ V}$                                                                |
| 12) $I_2$                                                                                               | 12a) 250 A<br>12b) 200 A<br>12c) 160 A                                                  |
| 13) $U_2$                                                                                               | 13a) 30 V<br>13b) 28 V<br>13c) 27 V                                                     |
| c) Energy supply                                                                                        |                                                                                         |
| 14) <br>1(3) ~ 50 Hz | 15) $U_1 = 230 \text{ V}$<br>$U_1 = 400 \text{ V}$                                      |
| 16) $I_{1\max} = 57 \text{ A}$<br>$I_{1\max} = 34 \text{ A}$                                            | 17) $I_{1\text{eff}} = 34 \text{ A}$<br>$I_{1\text{eff}} = 20 \text{ A}$                |
| 22) IP23                                                                                                | 23)  |


IEC

Figure K.3 – Subdivided rating plate: single-/three-phase transformer rectifier

|                                                                                       |                                                                                      |                                   |                                       |            |            |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|-----------------------------------|---------------------------------------|------------|------------|
| a) Identification                                                                     |                                                                                      |                                   |                                       |            |            |
| 1) Manufacturer<br>Address                                                            |                                                                                      |                                   | Trademark                             |            |            |
| 2) Type                                                                               |                                                                                      |                                   | 3) Serial number                      |            |            |
| 4)   |                                                                                      |                                   | 5) IEC 60974-1                        |            |            |
| b) Welding output                                                                     |                                                                                      |                                   |                                       |            |            |
| 6)   | 8)  | 10) 40 A / 21,6 V to 400 A / 36 V |                                       |            |            |
|                                                                                       |                                                                                      | 11) $X$                           | 11a) 35 %                             | 11b) 60 %  | 11c) 100 % |
| 7)   | 9) $U_0 = 110 \text{ V}$                                                             | 12) $I_2$                         | 12a) 400 A                            | 12b) 320 A | 12c) 255 A |
|                                                                                       |                                                                                      | 13) $U_2$                         | 13a) 36 V                             | 13b) 33 V  | 13c) 30 V  |
| c) Energy supply                                                                      |                                                                                      |                                   |                                       |            |            |
| 14)  | 18) $n = 3\,150 \text{ min}^{-1}$                                                    |                                   |                                       |            |            |
|                                                                                       | 19) $n_0 = 3\,300 \text{ min}^{-1}$                                                  | 20) $n_i = 980 \text{ min}^{-1}$  | 21) $P_{1\text{max}} = 34 \text{ kW}$ |            |            |
| 22) IP23                                                                              |                                                                                      | 23)                               |                                       |            |            |

IEC

Figure K.4 – Engine-generator-rectifier

|                                                                                                       |                                                                                         |                                        |                                       |            |            |
|-------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|----------------------------------------|---------------------------------------|------------|------------|
| a) Identification                                                                                     |                                                                                         |                                        |                                       |            |            |
| 1) Manufacturer<br>Address                                                                            |                                                                                         | Trademark                              |                                       |            |            |
| 2) Type                                                                                               |                                                                                         | 3) Serial number                       |                                       |            |            |
| 4)                   |                                                                                         | 5) IEC 60974-1<br>IEC 60974-10 Class A |                                       |            |            |
| b) Welding output                                                                                     |                                                                                         |                                        |                                       |            |            |
| 6)                   | 8)     | 10) 20 A / 20,8 V to 250 A / 32 V      |                                       |            |            |
| 7)                   | 9) $U_0 = 105 \text{ V}$                                                                | 11) $X$                                | 11a) 35 %                             | 11b) 60 %  | 11c) 100 % |
|                                                                                                       |                                                                                         | 12) $I_2$                              | 12a) 250 A                            | 12b) 200 A | 12c) 160 A |
|                                                                                                       |                                                                                         | 13) $U_2$                              | 13a) 30 V                             | 13b) 28 V  | 13c) 27 V  |
| c) Energy supply                                                                                      |                                                                                         |                                        |                                       |            |            |
| 14) <br>1(3) ~ 50 Hz | 15) $U_1$<br>230 V<br>400 V                                                             | 16) $I_{1\max}$<br>57 A<br>34 A        | 17) $I_{1\text{eff}}$<br>34 A<br>20 A |            |            |
| 22) IP23S                                                                                             | 23)  |                                        |                                       |            |            |

IEC

Figure K.5 – Single-/three-phase inverter type



|                                                                                       |                                                                                      |                                        |                          |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|----------------------------------------|--------------------------|
| a) Identification                                                                     |                                                                                      |                                        |                          |
| 1) Manufacturer<br>Address                                                            |                                                                                      | Trademark                              |                          |
| 2) Type                                                                               |                                                                                      | 3) Serial number                       |                          |
| 4) Li-ion                                                                             |                                                                                      | 5) IEC 60974-1<br>IEC 60974-10 Class A |                          |
| b) Welding output                                                                     |                                                                                      |                                        |                          |
| 6)   | 8)  | 10) 10 A / 20,4 V to 120 A / 24,8 V    |                          |
| 7)   | 9) $U_0 = 58 \text{ V}$                                                              | 12) $I_{2\max} = 120 \text{ A}$        |                          |
|                                                                                       |                                                                                      | 13) $U_2 = 24,8 \text{ V}$             |                          |
| c) Energy supply                                                                      |                                                                                      |                                        |                          |
| 14)  | 15) $U_b = 57,6 \text{ V}$                                                           | 16) $E = 5 \text{ Ah}$                 | 17) $I_b = 10 \text{ A}$ |
|                                                                                       | 19) For use only with _____ charger                                                  |                                        |                          |
| 22) IP23                                                                              |                                                                                      |                                        |                          |

IEC

Figure K.6 – Battery powered welding power source with integral battery

### Welding power source related plate

|                                                                                       |                                                                                      |                                        |  |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|----------------------------------------|--|
| a) Identification                                                                     |                                                                                      |                                        |  |
| 1) Manufacturer<br>Address                                                            |                                                                                      | Trademark                              |  |
| 2) Type                                                                               |                                                                                      | 3) Serial number                       |  |
| 4)                                                                                    |                                                                                      | 5) IEC 60974-1<br>IEC 60974-10 Class A |  |
| b) Welding output                                                                     |                                                                                      |                                        |  |
| 6)   | 8)  | 10) 10 A / 20,4 V to 120 A / 24,8 V    |  |
| 7)   | 9) $U_0 = 58 \text{ V}$                                                              | 12) $I_{2\max} = 120 \text{ A}$        |  |
|                                                                                       |                                                                                      | 13) $U_2 = 24,8 \text{ V}$             |  |
| c) Energy supply                                                                      |                                                                                      |                                        |  |
| 14)  | 15) $U_b = 57,6 \text{ V}$                                                           |                                        |  |
|                                                                                       | 19) For use only with _____ battery                                                  |                                        |  |
| 22) IP23                                                                              |                                                                                      |                                        |  |

### Battery related plate

|                                                       |                    |
|-------------------------------------------------------|--------------------|
| d) Separable and detachable battery packs             |                    |
| 1) type (identification) as given by the manufacturer |                    |
| Li-ion                                                | year and date code |
| $U_b = 57,6 \text{ V}$                                | $E = 5 \text{ Ah}$ |

IEC

Figure K.7 – Battery powered welding power source with detachable / separable battery

## **Annex L** (informative)

### **Graphical symbols for arc welding equipment**

#### **L.1 General**

Annex L describes symbols, which are not all internationally standardized, but of practical use in welding applications. IEC technical committee 26 and subcommittee 3C have decided to consider those symbols for a future possible inclusion in IEC 60417. When this process will be terminated, Annex L will be modified accordingly.

Annex L contains graphic symbols for arc welding and allied processes equipment to identify controls, indicators, connection points, functions, and to select processes.

The symbols are for use on the panel, the **rating plate** and any documentation for arc welding and allied processes equipment.

Annex L does not cover graphic symbols used to alert personnel of immediate or potential personal hazards in the use of the equipment.

NOTE 1 For safety symbols, see ISO 3864-1.

NOTE 2 For installation instructions, see IEC 60974-9.

#### **L.2 Use of symbols**

##### **L.2.1 General**

Symbols should be placed on equipment to instruct on use and operation. Examples of control panel are given in L.5.

##### **L.2.2 Selection of symbols**

Symbols specified in Clause L.3 can be used either as a single item or in combination to fit the intended application. Examples of combinations are given in L.4.

##### **L.2.3 Size of symbols**

For the application of these symbols, it may be necessary either to reduce or to enlarge the original to a suitable size. In the case of symbols composed of several graphic elements, or when reducing to minimum height, check that clear identification is still possible and legibility is adequate. Available light, user distance, and possible operating conditions as factors during size selection should also be considered.

Recommended minimum symbol size is 6 mm.

##### **L.2.4 Use of colour**

In general, the graphic form of a symbol reproduced in black on white or white on black should be sufficient for its identification.

For the purposes of these symbols, adequate contrast between symbol and background is most important. As long as the symbol is clearly delineated and fully legible, actual colour selection is not mandatory. Be aware that certain colours, such as red, orange, and yellow are designated as safety-alerting colours.

## L.3 Symbols

### L.3.1 General

Clause L.3 presents the symbols along with their reference number, function keyword or phrase, application and source.

### L.3.2 Letter symbols

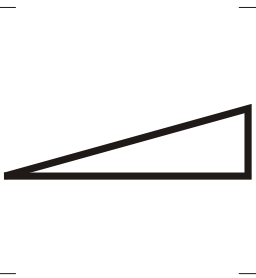
Table L.1 gives a list of letters, which may be used in a symbol.

**Table L.1 – Letters used as symbols**

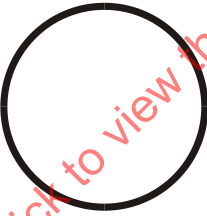
| Function, keyword or phrase                           | Letter        | Unit              |
|-------------------------------------------------------|---------------|-------------------|
| Amperage                                              | $I$           | A                 |
| Conventional welding current                          | $I_2$         | A                 |
| Conventional welding voltage                          | $U_2$         | V                 |
| Diameter                                              | $\varnothing$ | mm                |
| Duty cycle; duty factor                               | $X$           | %                 |
| Efficiency                                            | $\eta$        | %                 |
| Frequency                                             | $f$           | Hz                |
| Idle state power (idle state energy consumption rate) | $P_i$         | W (W·h/h)         |
| Power                                                 | $P$           | W                 |
| Rated no load current                                 | $I_0$         | A                 |
| Rated no load voltage                                 | $U_0$         | V                 |
| Rated supply current                                  | $I_1$         | A                 |
| Rated supply voltage                                  | $U_1$         | V                 |
| Speed of rotation                                     | $n$           | min <sup>-1</sup> |
| Supply power (supply energy consumption rate)         | $P_1$         | W (W·h/h)         |
| Temperature (change)                                  | $T$           | °C (K)            |
| Time                                                  | $t$           | s, min, h         |
| Voltage                                               | $U$           | V                 |
| Welding output power (welding output energy rate)     | $P_2$         | W (W·h/h)         |
| Rated peak voltage                                    | $U_p$         | V                 |



### L.3.3 Graphical symbols

#### L.3.3.1 Symbols to describe the switch or control

| N° | SOURCE                 | SYMBOL                                                                            | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                                   |
|----|------------------------|-----------------------------------------------------------------------------------|-----------------------------|-----------------------------------------------------------------------------------------------|
| 1. | IEC 60417-5004:2002-10 |  | Variability                 | To identify an increase/decrease of a quantity continuously<br><br>NOTE Symbol can be curved. |


#### L.3.3.2 Symbols to indicate switch or control position



| N° | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE             | APPLICATION                                                                                                                                                                          |
|----|------------------------|-------------------------------------------------------------------------------------|-----------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 2. | IEC 60417-5007:2002-10 |   | On (power)                              | To indicate connection to the mains, at least for mains switches or their positions, and all those cases where safety is involved                                                    |
| 3. | IEC 60417-5008:2002-10 |  | Off (power)                             | To indicate disconnection from the mains, at least for mains switches or their positions, and all those cases where safety is involved                                               |
| 4. | IEC 60417-5268:2002-10 |  | IN-position of a bi-stable push control | To identify the IN-position of a push control where the push control is used to energize or deenergize a function<br><br>NOTE 1 This symbol is used together with a function symbol. |
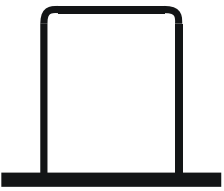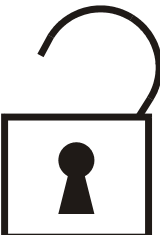
| N° | SOURCE                 | SYMBOL                                                                             | FUNCTION, KEYWORD OR PHRASE              | APPLICATION                                                                                                                                                                            |
|----|------------------------|------------------------------------------------------------------------------------|------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 5. | IEC 60417-5269:2002-10 |   | OUT-position of a bi-stable push control | To identify the OUT-position of a push control where the push control is used to energize or de-energize a function<br><br>NOTE 2 This symbol is used together with a function symbol. |
| 6. | IEC 60417-5569:2005-08 |   | Locked                                   | To identify a locked function or control<br><br>NOTE 3 This symbol is used together with a function symbol.                                                                            |
| 7. | IEC 60417-5570:2002-10 |  | Unlocked                                 | To identify an unlocked function or control<br><br>NOTE 4 This symbol is used together with a function symbol.                                                                         |

### L.3.3.3 Symbols to indicate switch or control function



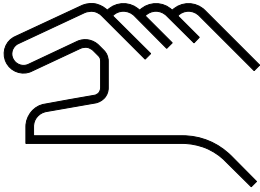
| N° | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE   | APPLICATION                                  |
|----|------------------------|-------------------------------------------------------------------------------------|-------------------------------|----------------------------------------------|
| 8. | IEC 60417-6302:2015-01 |  | Continuous welding            | To identify a continuous welding             |
| 9. | IEC 60417-6303:2015-01 |  | Intermittent (stitch) welding | To identify an intermittent (stitch) welding |





| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE  | APPLICATION                                                                    |
|-----|------------------------|-------------------------------------------------------------------------------------|------------------------------|--------------------------------------------------------------------------------|
| 10. | ISO 7000-0468:2004-01  |    | Arc spot welding             | To identify an arc spot welding                                                |
| 11. | ISO 7000-0096:2004-01  |    | Manual control               | To identify the switch position for manual control                             |
| 12. | IEC 60417-6318:2015-03 |   | Arc striking without contact | To identify a TIG arc striking function which initiates an arc without contact |
| 13. | IEC 60417-6319:2015-03 |  | Arc striking with contact    | To identify a TIG arc striking function which initiates an arc with contact    |
| 14. |                        |  | Pilot arc starting           | To identify pilot arc starting of a plasma torch                               |
| 15. | ISO 7000-0474:2004-01  |  | Purging of air (by gas)      | To identify purging of the air by gas                                          |
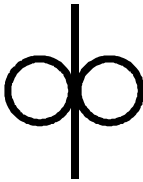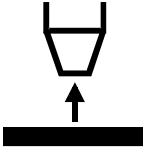
| N°  | SOURCE                | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE                       | APPLICATION                                         |
|-----|-----------------------|-------------------------------------------------------------------------------------|---------------------------------------------------|-----------------------------------------------------|
| 16. | ISO 7000-0823:2004-01 |    | Wire feed drive                                   | To identify a wire feeder or wire feed control      |
| 17. |                       |    | Wire burnback control                             | To identify burnback control at the end of the weld |
| 18. | ISO 7000-0004:2004-01 |   | Direction of continuous rotation (clockwise)      | To identify a direction of continuous rotation      |
| 19. | ISO 7000-0004:2004-01 |  | Direction of continuous rotation (anti clockwise) | To identify a direction of continuous rotation      |








### L.3.3.4 Symbols to indicate electrical connection
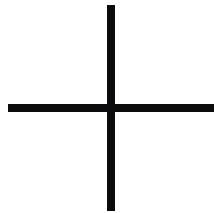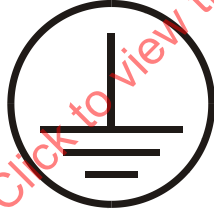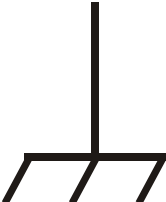
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                                      |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|--------------------------------------------------------------------------------------------------|
| 20. | IEC 60417-5005:2002-10 |    | Plus; plus pole             | To identify positive polarity                                                                    |
| 21. | IEC 60417-5006:2002-10 |    | Minus; minus pole           | To identify negative polarity                                                                    |
| 22. | IEC 60417-5017:2006-08 |   | Earth (ground)              | To identify the earth (ground) connection<br><br>NOTE 1 Not for a protective earth connection.   |
| 23. | IEC 60417-5019:2006-08 |  | Protective earth (ground)   | To identify the equipment connection point for the protective earth (ground)                     |
| 24. | IEC 60417-5020:2002-10 |  | Frame or chassis            | To identify the frame or chassis connection<br><br>NOTE 2 Not for a protective earth connection. |
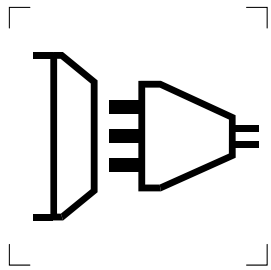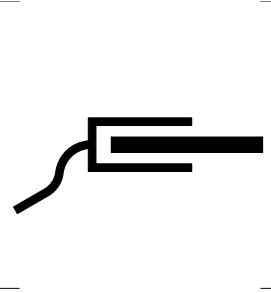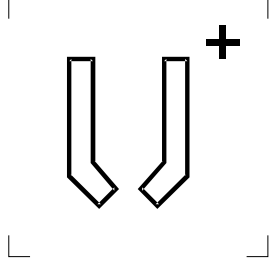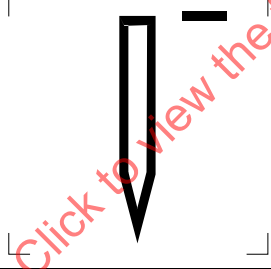
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE                                       | APPLICATION                                                                                                                       |
|-----|------------------------|-------------------------------------------------------------------------------------|-------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------|
| 25. | IEC 60417-5939:2002-10 |    | Power supply type of electric device                              | On device or equipment for example on arc welding equipment.<br>To identify the type of power supply, socket-outlet with 3-poles. |
| 26. | ISO 7000-0453:2004-01  |    | Workpiece connection                                              | To identify a workpiece connection                                                                                                |
| 27. | ISO 7000-0483:2004-01  |   | Connection to the nozzle of a plasma torch (positive terminal)    | To identify a plasma torch connection – nozzle connection to positive terminal                                                    |
| 28. | ISO 7000-0482:2004-01  |  | Connection to the electrode of a plasma torch (negative terminal) | To identify a plasma torch connection – electrode connection to negative terminal                                                 |




### L.3.3.5 Symbols to indicate fluid connection or control

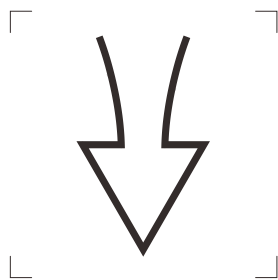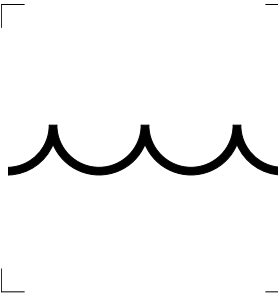
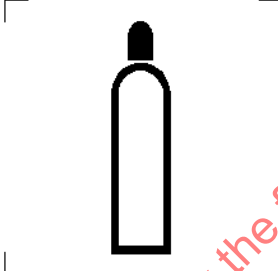
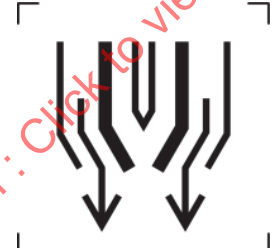
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                            |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|--------------------------------------------------------|
| 29. | IEC 60417-6315:2015-02 |    | Air flow                    | To indicate air flow                                   |
| 30. | ISO 7000-0536:2004-01  |    | Liquid                      | To indicate liquid, e.g coolant                        |
| 31. |                        |  | Gas supply                  | To identify a gas supply connection or control         |
| 32. | ISO 7000-0481:2004-01  |  | Plasma shielding gas        | To identify plasma shielding gas connection or control |
| 33. | ISO 7000-0480:2004-01  |  | Plasma gas                  | To identify plasma gas connection or control           |
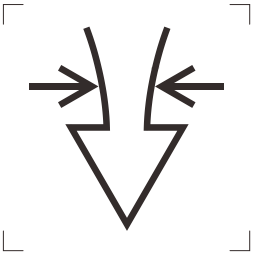
| N°  | SOURCE                 | SYMBOL                                                                            | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                  |
|-----|------------------------|-----------------------------------------------------------------------------------|-----------------------------|----------------------------------------------|
| 34. | IEC 60417-6316:2015-02 |  | Air pressure                | To identify air pressure function or control |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV






**L.3.3.6 Symbols to indicate auxiliary device, connection or function**
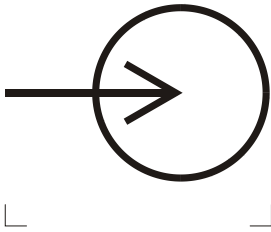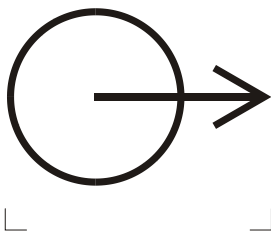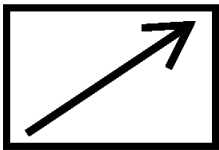
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                               |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-----------------------------------------------------------|
| 35. | IEC 60417-5034:2014-06 |    | Input                       | To identify input connection or control                   |
| 36. | IEC 60417-5035:2014-06 |    | Output                      | To identify output connection or control                  |
| 37. | ISO 7000-0093:2004-01  |  | Remote                      | To identify a remote control, connection or function      |
| 38. |                        |  | Foot control                | To identify a foot control device, connection or function |
| 39. |                        |  | Panel / Local               | To identify a panel/local function or control             |
| 40. | ISO 7000-0466:2004-01  |  | Hopper (powder, flux)       | To identify a flux (powder) hopper                        |


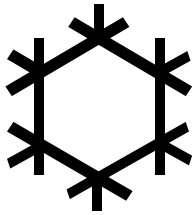
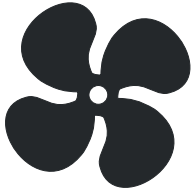
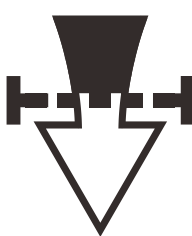
| N°  | SOURCE                 | SYMBOL                                                                             | FUNCTION, KEYWORD OR PHRASE        | APPLICATION                                         |
|-----|------------------------|------------------------------------------------------------------------------------|------------------------------------|-----------------------------------------------------|
| 41. | ISO 7000-0027:2004-01  |   | Cooling                            | To identify a cooling device, connection or control |
| 42. | ISO 7000-0089:2004-01  |   | Ventilating or air circulating fan | To identify a ventilating or air circulating fan    |
| 43. | IEC 60417-6317:2015-02 |  | Air filter                         | To identify an air filter                           |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV



### L.3.3.7 Symbols to indicate control of the welding amperage/voltage
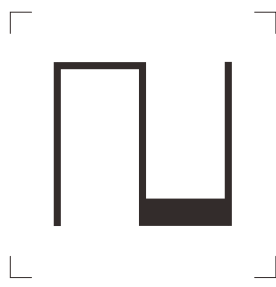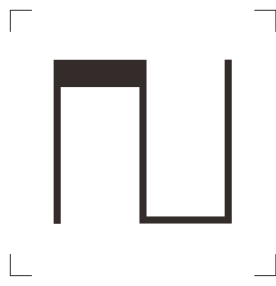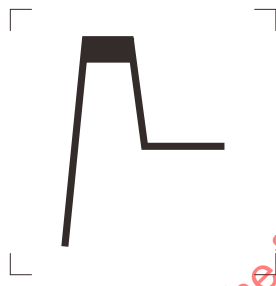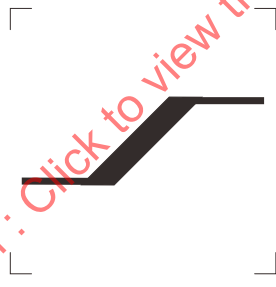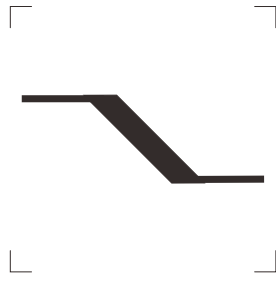
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                                                                                                 |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 44. | IEC 60417-6005:2006-12 |    | Pulse background            | To indicate a control of pulse background<br><br>NOTE 1 Control is identified by one letter chosen in Table L.1.                                            |
| 45. | IEC 60417-6006:2006-12 |    | Pulse peak                  | To indicate a control of pulse peak<br><br>NOTE 2 Control is identified by one letter chosen in Table L.1.                                                  |
| 46. | IEC 60417-6007:2006-12 |   | Hot start                   | To indicate a control or function increasing the energy at the beginning of the weld<br><br>NOTE 3 Control is identified by one letter chosen in Table L.1. |
| 47. | IEC 60417-6008:2006-12 |  | Slope (increasing)          | To indicate a control or function regulating the increase of a value<br><br>NOTE 4 Control is identified by one letter chosen in Table L.1.                 |
| 48. | IEC 60417-6009:2006-12 |  | Slope (decreasing)          | To indicate a control or function regulating the decrease of a value<br><br>NOTE 5 Control is identified by one letter chosen in Table L.1.                 |

### L.3.3.8 Symbols to indicate type of torch


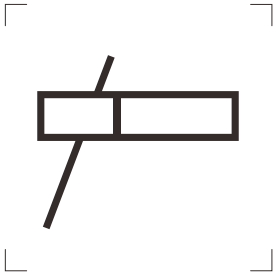
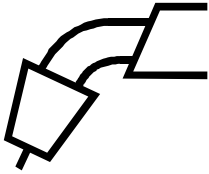
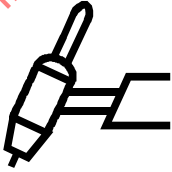
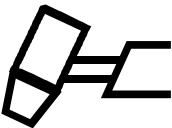
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE                | APPLICATION                                                                    |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------------------|--------------------------------------------------------------------------------|
| 49. |                        |    | Manual metal arc welding electrode holder  | To identify an electrode holder                                                |
| 50. | IEC 60417-6313:2015-01 |    | Air carbon arc gouging electrode holder    | To identify an air carbon arc gouging electrode holder                         |
| 51. |                        |   | MIG/MAG Torch                              | To identify a MIG/MAG torch                                                    |
| 52. |                        |  | Self shielded flux cored arc welding torch | To identify a self shielded flux cored arc welding torch without gas shielding |
| 53. |                        |  | TIG Torch                                  | To identify a TIG torch                                                        |
| 54. |                        |  | Plasma torch                               | To identify plasma torch for welding, cutting and/or gouging                   |


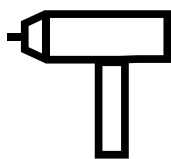
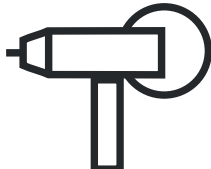


| N°  | SOURCE | SYMBOL                                                                             | FUNCTION, KEYWORD<br>OR PHRASE        | APPLICATION                                                                            |
|-----|--------|------------------------------------------------------------------------------------|---------------------------------------|----------------------------------------------------------------------------------------|
| 55. |        |   | Motorised gun                         | To identify a gun incorporating a wire drive system                                    |
| 56. |        |   | Motorised gun with filler wire supply | To identify a gun incorporating a wire drive system and including a filler wire supply |
| 57. |        |  | Submerged arc torch                   | To identify a torch for submerged arc welding                                          |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV




### L.3.3.9 Symbols to indicate processes
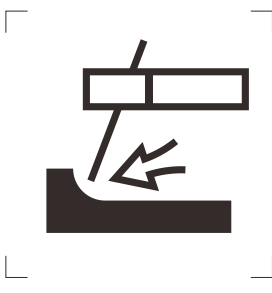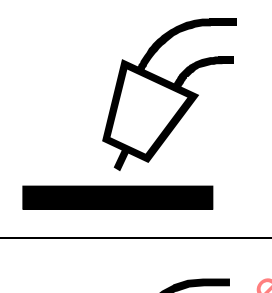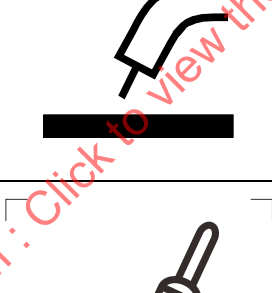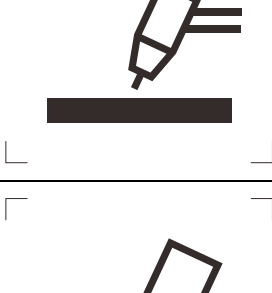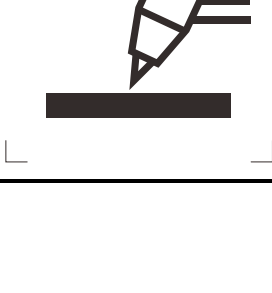
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE          | APPLICATION                                                              |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------------|--------------------------------------------------------------------------|
| 58. | IEC 60417-6306:2015-01 |    | MMA welding                          | To identify MMA welding                                                  |
| 59. | IEC 60417-6314:2015-01 |    | Air carbon arc gouging               | To identify air carbon arc gouging                                       |
| 60. | IEC 60417-6308:2015-01 |   | MIG/MAG welding                      | To identify MIG/MAG welding                                              |
| 61. | IEC 60417-6309:2015-01 |  | Flux cored self shielded arc welding | To identify flux cored self shielded arc welding (without gas shielding) |
| 62. | IEC 60417-6307:2015-01 |  | TIG welding                          | To identify TIG welding                                                  |
| 63. | IEC 60417-6312:2015-01 |  | Plasma welding                       | To identify plasma arc welding                                           |
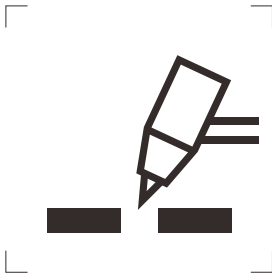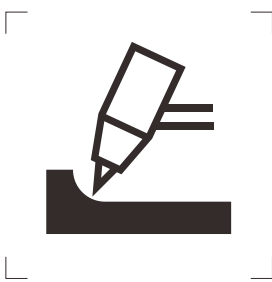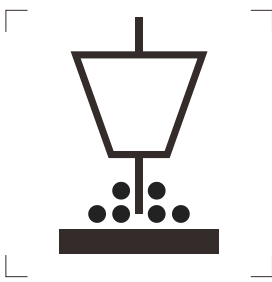
| N°  | SOURCE                 | SYMBOL                                                                             | FUNCTION, KEYWORD OR PHRASE | APPLICATION                       |
|-----|------------------------|------------------------------------------------------------------------------------|-----------------------------|-----------------------------------|
| 64. | IEC 60417-6310:2015-01 |   | Plasma cutting              | To identify plasma arc cutting    |
| 65. | IEC 60417-6311:2015-01 |   | Plasma gouging              | To identify plasma gouging        |
| 66. | IEC 60417-6305:2015-01 |  | Submerged arc welding       | To identify submerged arc welding |

IECNORM.COM :: Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV





### L.3.3.10 Symbols to indicate control of welding characteristics

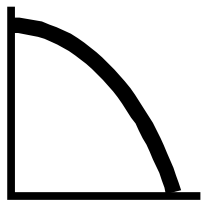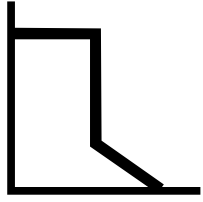
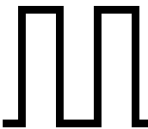
| N°  | SOURCE                | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE   | APPLICATION                                                                           |
|-----|-----------------------|-------------------------------------------------------------------------------------|-------------------------------|---------------------------------------------------------------------------------------|
| 67. | ISO 7000-0455:2004-01 |    | Flat characteristic           | To identify a substantially constant voltage characteristic                           |
| 68. | ISO 7000-0454:2004-01 |    | Drooping characteristic       | To identify a substantially drooping current characteristic                           |
| 69. |                       |   | Arc force                     | To indicate a control or function increasing current when low arc voltage is detected |
| 70. |                       |  | Pulsed                        | To identify a pulse value                                                             |
| 71. |                       |  | Variable inductance           | To identify a variable inductance function or control                                 |
| 72. |                       |  | High inductance or inductance | To identify inductance or used with other inductance symbols, high inductance         |
| 73. |                       |  | Medium inductance             | To identify medium inductance connection, function or control                         |

| N°  | SOURCE | SYMBOL                                                                            | FUNCTION, KEYWORD<br>OR PHRASE | APPLICATION                                                   |
|-----|--------|-----------------------------------------------------------------------------------|--------------------------------|---------------------------------------------------------------|
| 74. |        |  | Low inductance                 | To identify low inductance<br>connection, function or control |



IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

### L.3.3.11 Symbols to describe the type of power source
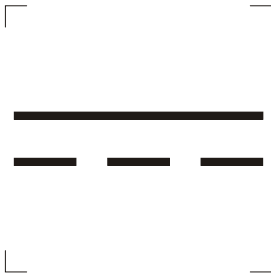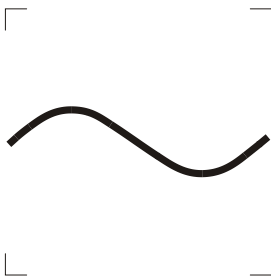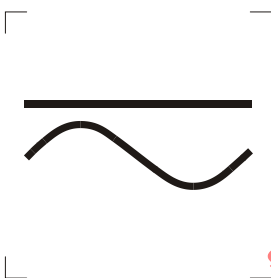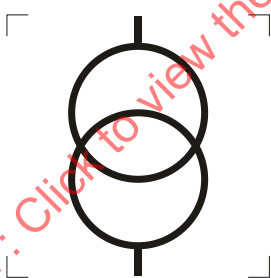
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE    | APPLICATION                                                                                                                                |
|-----|------------------------|-------------------------------------------------------------------------------------|--------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------|
| 75. | IEC 60417-5031:2002-10 |    | Direct current (DC)            | To identify that power source delivers direct current                                                                                      |
| 76. | IEC 60417-5032:2002-10 |    | Alternating current (AC)       | To identify that power source delivers alternating current<br><br>NOTE Symbol can be mixed with a number to indicate the number of phases. |
| 77. | IEC 60417-5033:2002-10 |   | Direct and alternating current | To identify that the power source delivers both direct and alternating current                                                             |
| 78. | IEC 60417-5156:2003-08 |  | Transformer                    | To identify a transformer                                                                                                                  |
| 79. | ISO 7000-1153:2004-01  |  | Generator                      | To identify a generator                                                                                                                    |
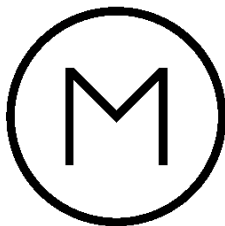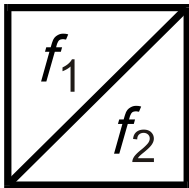
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                             |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-------------------------------------------------------------------------|
| 80. | IEC 60417-6304:2015-01 |    | Engine                      | To identify an engine driven power source                               |
| 81. | ISO 7000-0147:2004-01  |    | Electric motor              | To identify an electric motor                                           |
| 82. | IEC 60417-5970:2003-08 |   | Inverter                    | To identify a frequency conversion stage function                       |
| 83. | IEC 60417-5194:2002-10 |  | DC/AC-converter             | To identify a DC/AC-converter and its associated terminals and controls |


**L.3.3.12 Symbols to indicate protective component and class of protection**
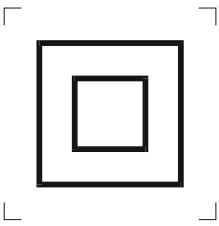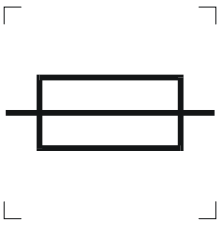
| N°  | SOURCE                 | SYMBOL                                                                            | FUNCTION, KEYWORD OR PHRASE                                                  | APPLICATION                                                                                                     |
|-----|------------------------|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------|
| 84. |                        |  | Suitable for welding in an environment with increased risk of electric shock | To identify a welding power source suitable for welding in an environment with increased risk of electric shock |
| 85. | IEC 60417-5172:2003-02 |  | Class II equipment                                                           | To identify class II equipment                                                                                  |
| 86. | IEC 60417-5016:2002-10 |  | Fuse                                                                         | To indicate a fuse                                                                                              |

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV









### L.3.3.13 Symbols to inform users
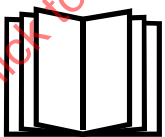
| N°  | SOURCE                 | SYMBOL                                                                              | FUNCTION, KEYWORD OR PHRASE | APPLICATION                                                                               |
|-----|------------------------|-------------------------------------------------------------------------------------|-----------------------------|-------------------------------------------------------------------------------------------|
| 87. | IEC 60417-5036:2002-10 |    | Dangerous voltage           | To identify a dangerous voltage                                                           |
| 88. | ISO 7000-0228:2004-01  |    | Disturbance                 | To identify a disturbance of the correct operation                                        |
| 89. | ISO 7000-0434A:2004-01 |   | Caution                     | To make operator aware of general hazard.                                                 |
| 90. | IEC 60417-5041:2002-10 |  | Caution hot surface         | To indicate that the marked item can be hot and should not be touched without taking care |
| 91. |                        |  | Read instruction manual     | To identify that the instruction manual should be read                                    |
| 92. | ISO 7000-0034:2004-01  |  | Temperature indication      | To identify the temperature indication for example excess temperature warning light       |

### L.4 Examples of combinations of symbols

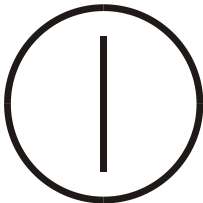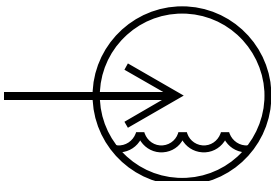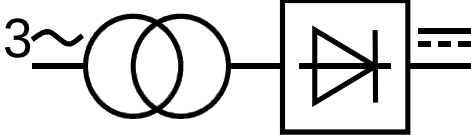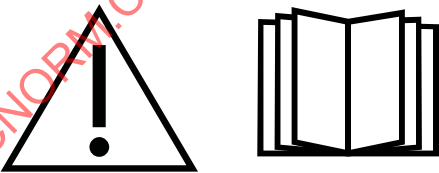
This clause gives examples of combination of symbols which can be used on arc welding and allied processes equipment.

| SYMBOL                                                                                                          | FUNCTION, KEYWORD OR PHRASE           | APPLICATION                                                                                                                                                                                             |
|-----------------------------------------------------------------------------------------------------------------|---------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p>IEC 60417-5010:2002-10</p> | On/off (push-push)                    | To indicate connection to or disconnection from the mains, at least for mains switches or their position, and all those cases where safety is involved. Each position, ON or OFF, is a stable position. |
|  <p>IEC 60417-6024:2009-11</p> | Input of liquid                       | To identify input of liquid                                                                                                                                                                             |
|                               | Three-phase transformer-rectifier     | To indicate welding power source symbol on the rating plate                                                                                                                                             |
|                              | Inverter power source AC/DC           | To indicate welding power source symbol on the rating plate                                                                                                                                             |
|                              | Slow wire feed start                  | To identify the slow advance of wire towards the workpiece at the start of the weld                                                                                                                     |
|                              | Caution ! Read the instruction manual | To indicate a hazard and identify that the instruction manual should be read                                                                                                                            |
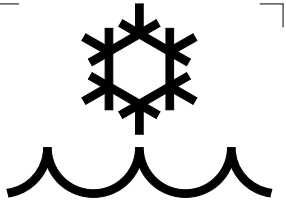
| SYMBOL                                                                                                                | FUNCTION, KEYWORD OR PHRASE  | APPLICATION                                                                               |
|-----------------------------------------------------------------------------------------------------------------------|------------------------------|-------------------------------------------------------------------------------------------|
| <br>ISO 7000-0544:2004-01            | Cooling water                |                                                                                           |
|                                      | Variability and OFF position | To identify a continuous increase/decrease of a quantity and an off position of a control |
| <br>ISO 7000-0469:2004-01, modified | MIG/MAG spot welding         | To identify MIG/MAG spot welding                                                          |
|                                    | Upslope time                 | To indicate a control of upslope time                                                     |


## L.5 Examples of control panels

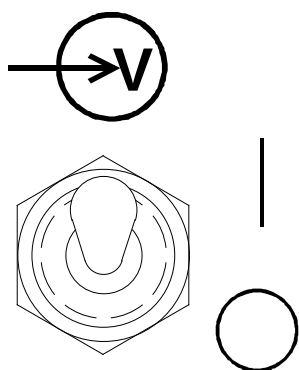This clause (see Figures L.1 to L.8) gives examples of control panels for arc welding and allied processes equipment.




IEC

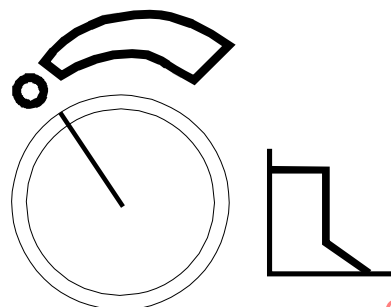Figure L.1 – Input voltage power switch




IEC

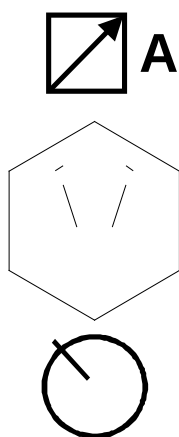
Figure L.2 – Arc force control potentiometer



IEC


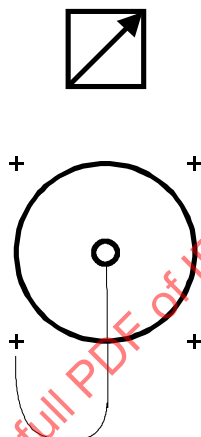


IEC

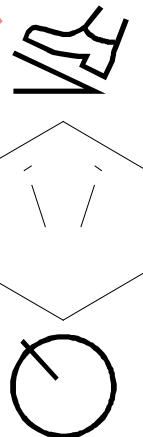


IEC

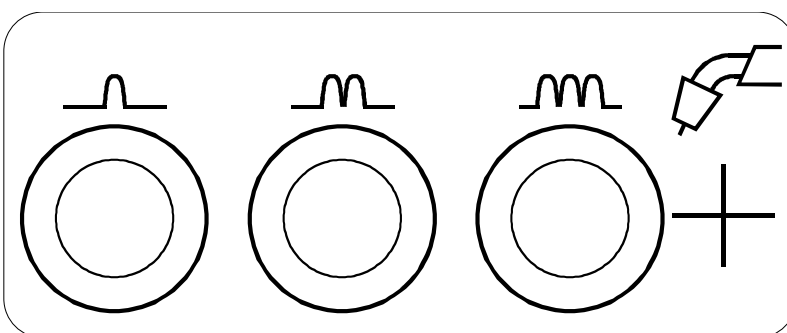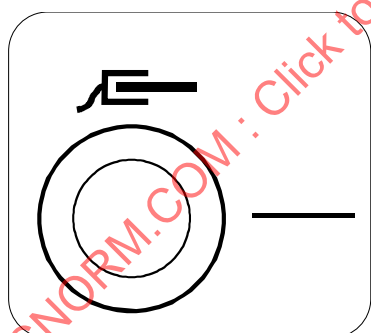Figure L.3 – Remote receptacle and selector switches




IEC

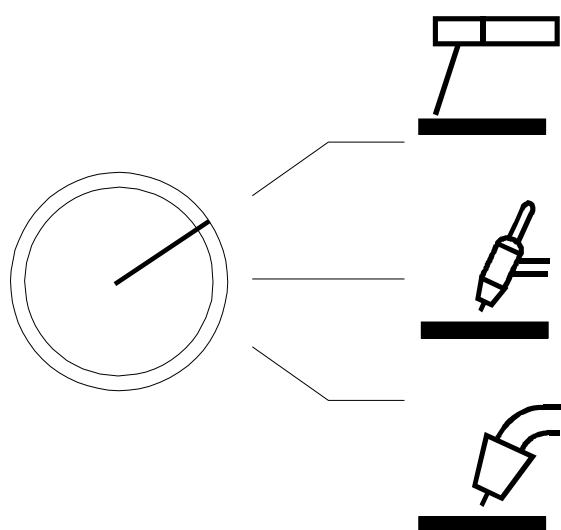Figure L.4 – Terminals with inductance selector for MIG/MAG welding




IEC

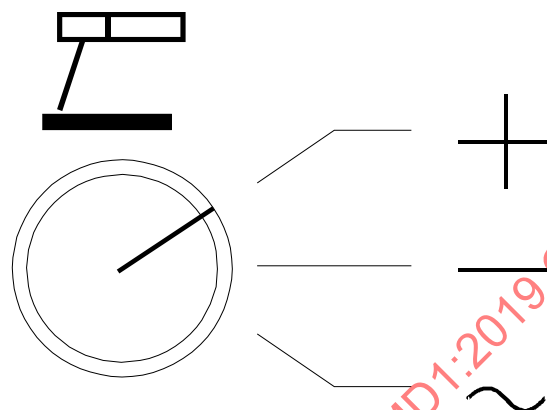Figure L.5 – Process switch  
(MMA, TIG, MIG)




IEC

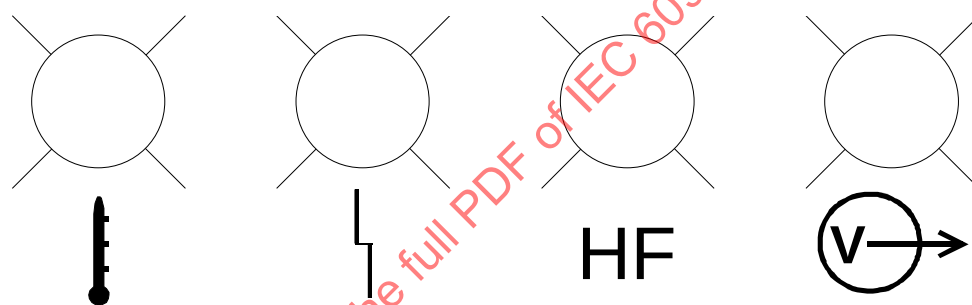Figure L.6 – Selector switch  
on AC/DC equipment



IEC

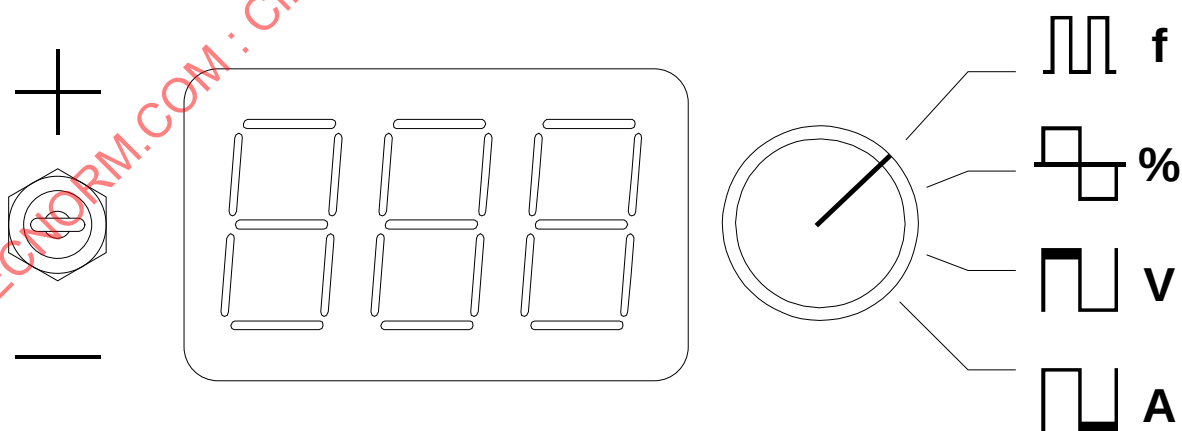Figure L.7 – Panel indicator lights (overheat, fault,  
arc striking, output voltage)



IEC

Figure L.8 – Setting pulsing parameters using digital display

## Annex M (informative)

### Efficiency and idle state power measurement

#### M.1 Measuring efficiency

To ensure repeatability and data accuracy in measuring efficiency, the following procedure shall be used:

- a) Use power meters to measure supply power and welding output power.
- b) Ensure conformance to 5.1 for test conditions.
- c) Ensure accuracy of power measurement is equal to or better than  $\pm 0,25\%$ .
- d) Ensure conformance of the supply network to Annex G.
- e) Measure the supply voltage of the supply-network-connected welding power source at the point of coupling of the welding power source to the supply network.
- f) Measure the **load voltage** at the welding power source **welding circuit** connections. For welding power sources that are provided with permanently connected welding cables, measure the **load voltage** at the exit point of the power source enclosure.
- g) Measure efficiency:
  - 1) if not stated in national regulation, using the process which results in the highest power consumption;
  - 2) at **conventional welding conditions** (given in 3.1.17) and **conventional load voltages** as specified in 11.2;
  - 3) halfway into the load cycle for **duty cycles** less than 100 %;
  - 4) excluding the power draw from external devices or auxiliary power supplies in the measurement (see 11.5 and 11.6).
- h) Record efficiency as a percentage rounded to two significant figures.

Efficiency:  $\eta = \frac{P_2}{P_1}$

where

$P_2$  is the welding output power;

$P_1$  is the supply power consumption.

NOTE 1 This ratio, lying between 0 and 1, is expressed as a percentage.

NOTE 2 Efficiency can depend on factors such as output load, supply network voltage (for equipment with multiple input voltages), operating modes, and environmental conditions.

#### M.2 Measuring idle state power

To ensure repeatability and data accuracy in measuring **idle state** power consumption, the following procedure shall be used:

- 1) Ensure the power source is at **thermal equilibrium**.
- 2) Measure **idle state** power after
  - a) any cool-down period of the power source (e.g. after the fan and cooling pump has stopped); and

- b) the power source has switched into a low energy **idle state** (if equipped).

Do not include the power draw from external devices or auxiliary power supplies in the measurement (see 11.5 and 11.6).

The idle state power consumption shall be stated as an average value.

NOTE Idle state power measurements are influenced by variations in instantaneous power.

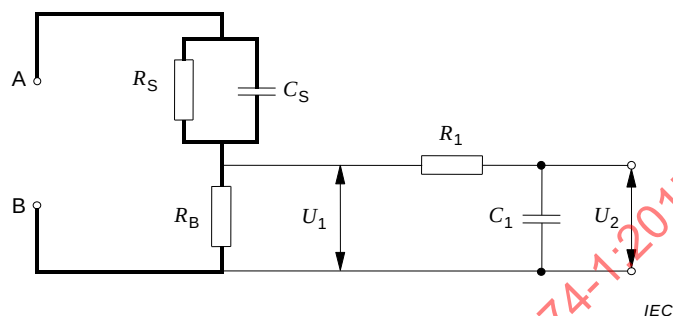
IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## Annex N (normative)

### Touch current measurement in fault condition

For measuring the **touch current** in fault condition, the measuring network in accordance with Figure N.1 and the appropriate configurations in Figures N.2 and N.3 shall be used with an appropriate measuring device.

Caution! An **expert** shall perform this test. The protective conductor is disabled for this test.



#### Key

|                                              |                |                                  |                     |
|----------------------------------------------|----------------|----------------------------------|---------------------|
| A, B                                         | Test terminals | $C_S$                            | 0,22 $\mu\text{F}$  |
| $R_S$                                        | 1 500 $\Omega$ | $R_1$                            | 10 000 $\Omega$     |
| $R_B$                                        | 500 $\Omega$   | $C_1$                            | 0,022 $\mu\text{F}$ |
| $U_1$                                        | r.m.s. voltage | $U_2$                            | peak voltage        |
| Weighted touch current (perception/reaction) |                | $= \frac{U_2}{500}$ (peak value) |                     |


**Figure N.1 – Measuring network for weighted touch current**

For three-phase equipment, **touch current** in fault condition is measured with the switches (I) and (n) in the closed position and switch (e) in the open position. The measurement is then repeated with each of the switches (I) and (n) opened one by one, with the other switches closed, except switch (e). The measurements are similar for single-phase equipment, except that they shall be repeated for each position of the polarity switch (p).


The manufacturer shall identify the configuration (TN, TT, star IT, etc.) to which its equipment is intended to be connected in its final application. The equipment under test shall be tested to those identified configurations or the worst-case configuration.

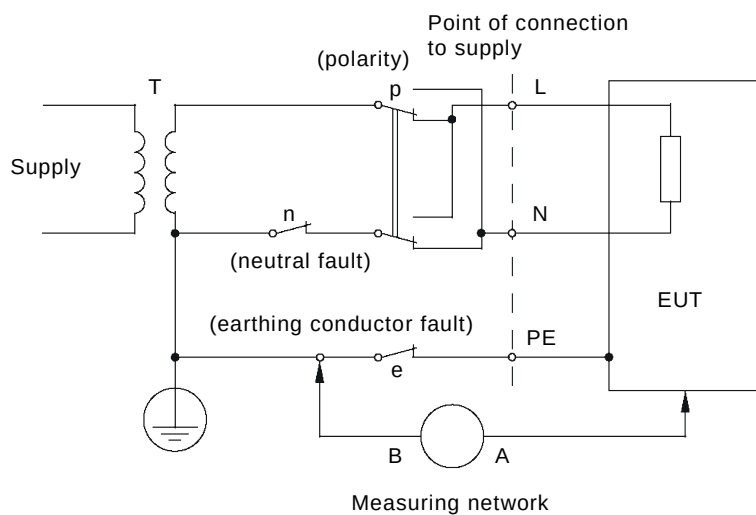The use of isolating transformer (T) is optional. When not used, safety precautions shall be taken to protect the test operator from any hazardous voltage on the enclosure and other accessible conductive parts of the equipment.






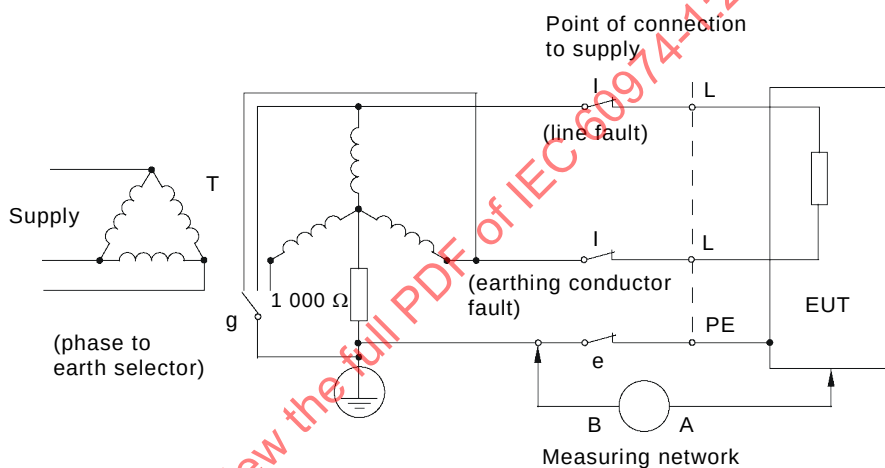
a) Single-phase equipment on star TN or TT system



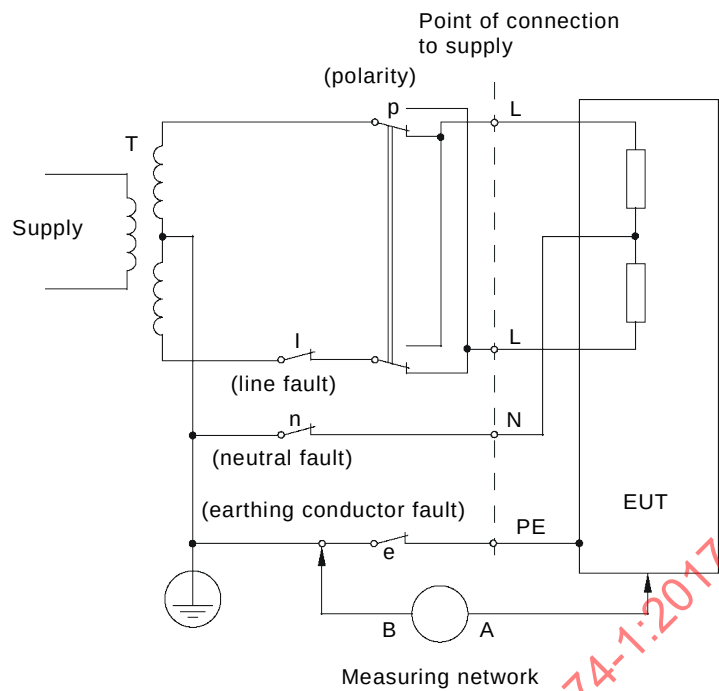b) Single-phase equipment connected line-to-line on star TN or TT system




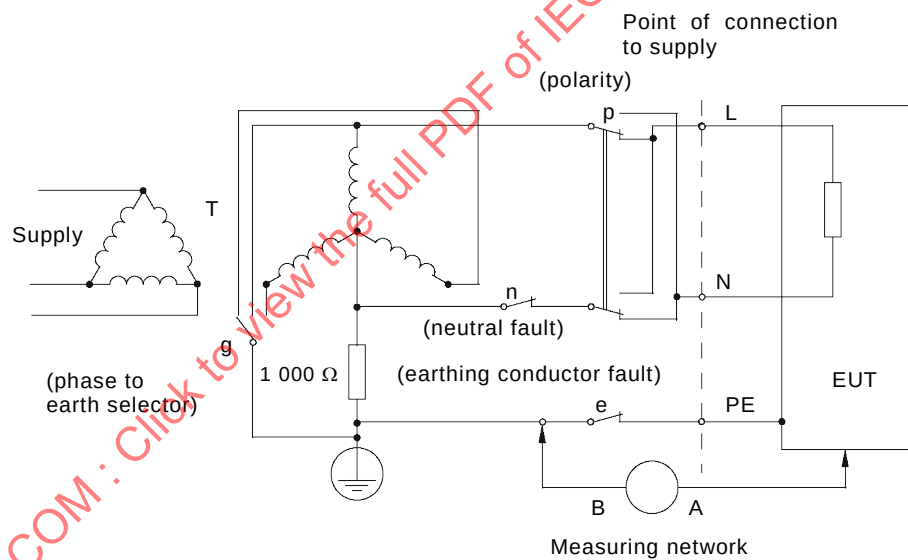c) Single-phase equipment on centre-earthed TN or TT system




d) Single-phase equipment connected line-to-neutral on star IT system

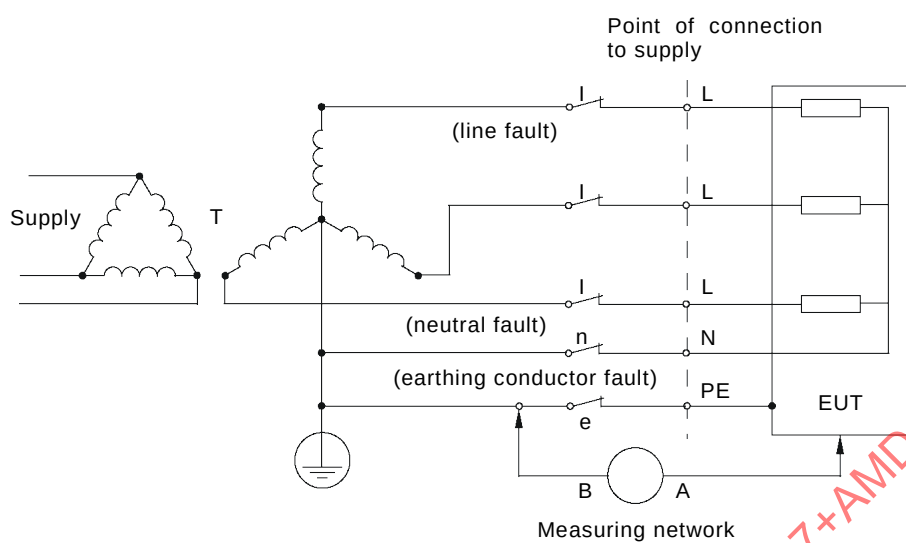Figure N.2 – Diagram for touch current measurement on fault condition at operating temperature for single-phase connection of appliances other than those of class II




IEC

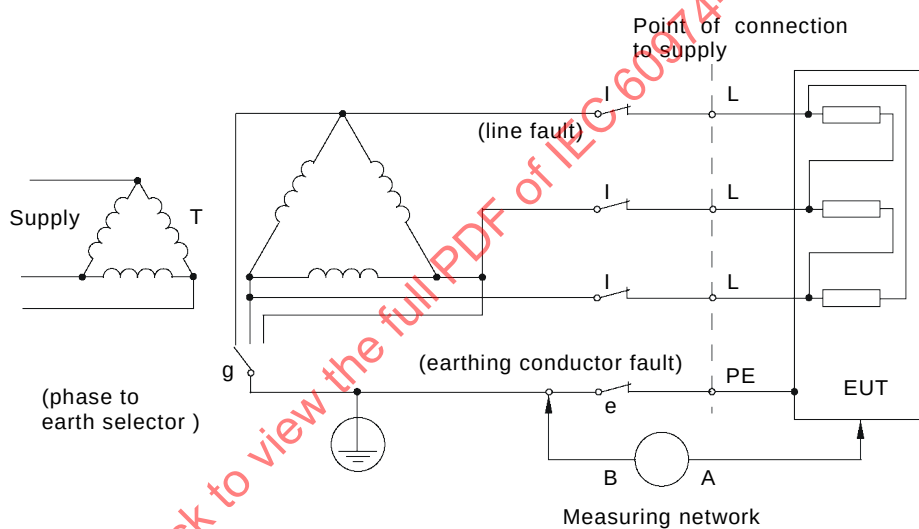a) Three-phase equipment on star TN or TT system




IEC

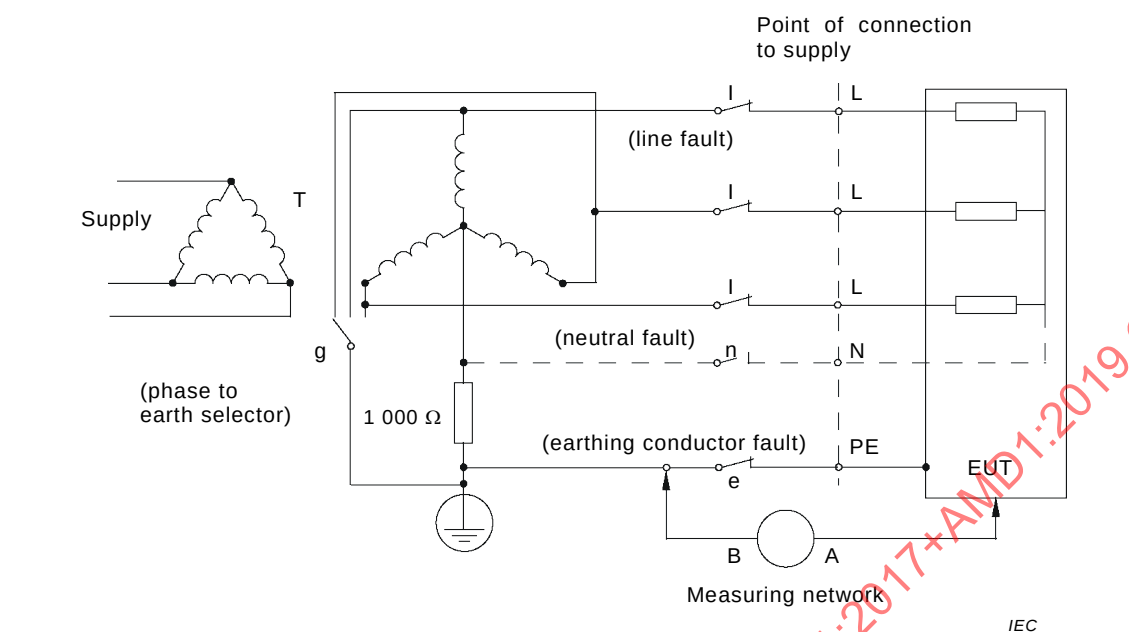b) Three-phase equipment on unearthed three-phase three-line system



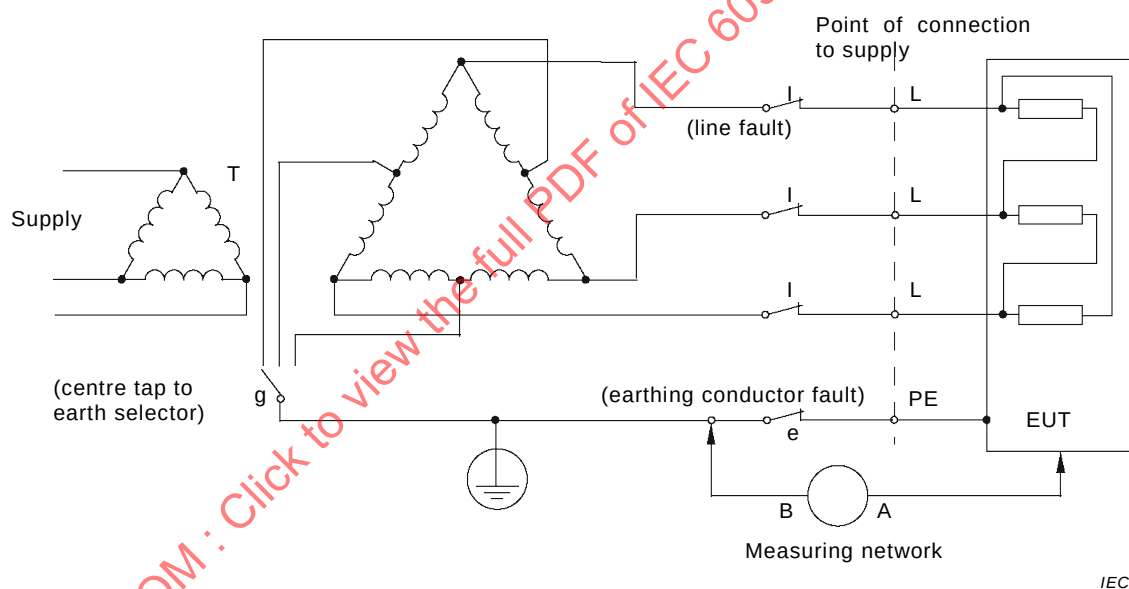c) Three-phase equipment on star IT system



d) Three-phase equipment on earthed centred three-phase three-line system

**Figure N.3 – Diagram for touch current measurement on fault condition for three-phase four-wire system connection of appliances other than those of class II**

## Annex O (normative)

### Battery-powered welding power sources

#### O.1 General

Annex O applies to rechargeable battery-powered welding power sources for arc welding and allied processes and the **battery** packs for such equipment.

**Battery-powered welding power sources** are welding power sources powered either by:

- **integral batteries**,
- **detachable battery packs**,
- **separable battery packs**.

All clauses of this document apply unless otherwise specified in Annex O. If a clause is included in Annex O, the numbered clauses of Annex O replace or add to the numbered clauses of the main body. Unless otherwise specified, the content of clauses and subclauses in Annex O replaces the content of the corresponding clauses and subclauses in the main body. Additional subclauses are numbered O.x.201, O.x.202, etc.

Battery-powered welding power sources and **battery** packs covered by Annex O can be operated:

- completely disconnected and isolated from the supply network;
- connected to the supply network with the **welding circuit** isolated from supply network.

Requirements for protection against risk of electric shock depend on specific electrical topology.

If the battery-powered welding power source can also be used during charging, the insulation requirements have to be considered when designing the charging unit.

Since **battery** packs for welding power sources are submitted to different use patterns (such as rough use, high charging and discharging currents), their safety can be evaluated only by Annex O and not by using other standards for **battery** packs, such as the IEC 62133 series, unless otherwise indicated in Annex O. All relevant requirements of IEC 62133-1:— and IEC 62133-2:— are addressed in Annex O.

When evaluating the risk of fire associated with **detachable battery packs**, consideration has been given to the fact that these **battery** packs are unattended energy sources and have been evaluated as such in this document. Requirements in other standards regarding the risk of fire due to the charging of these **detachable battery packs** are therefore considered to be fulfilled.

Annex O also addresses requirements covering the use of lithium-ion **cells** employed in **battery systems** in welding power sources. The following shall be considered within the context of these requirements.

- These requirements address the safety of batteries during storage and use including discharge and charge, and not any possible hazards associated with toxicity nor potential hazards associated with transportation or disposal.

NOTE 1 IEC 62281 covers the safety aspects of lithium-ion batteries during transport.

- **Battery systems** covered by these requirements are not intended to be serviced by the end user.
- These requirements are intended to provide comprehensive evaluation of a **battery** only if used in products covered by this document.
- These requirements address the safety of **battery systems** during storage and use including discharge and charge. These requirements are only considered to be supplementary requirements in regards to battery **charger** fire and electric shock.
- These requirements refer to and require parameters supplied in reference to the **cells** that establish conditions for safe use of those **cells**. Those parameters form the basis of acceptance criteria for a number of tests contained herein. This document does not independently evaluate the safety of **cells**. These parameters, taken as a set, constitute the “**specified operating region**” for a **cell**. There may be several sets of **specified operating region(s)**.

Annex O does not apply to the safety of battery **chargers** themselves. However, it covers the safe functioning of **battery systems**. The equipment including charging unit, **battery** pack and welding power source shall meet the separation requirements of this document.

NOTE 2 IEC 60335-2-29 covers a variety of **chargers**.

Annex O does not provide comprehensive safety information for manufacturing, maintenance and repair personnel.

## O.4 Environmental conditions

*Addition to Clause 4 of this document:*

Battery conditions shall not exceed the battery's **specified operating region**. Depending on the technology used, different environmental conditions can be necessary and the resulting welding power source and/or **battery** pack shall be marked accordingly (see 15.1).

NOTE See IEC 62133-2:—<sup>3</sup>, Figure A.1 for details.

## O.5 Tests

### O.5.1 Test conditions

Successive testing performed on a **battery** can result in cumulative stress which can cause permanent damage to the **battery** and should be avoided. Additional samples may be used as necessary, except for the **type tests** where only one sample shall be used.

Tests shall be carried out on new, dry and completely assembled welding power sources.

The heating test defined in O.7.1 and the **thermal protection** test defined in 8.5 shall be carried out at ambient temperature of 40 °C, see tolerances in 7.1.2 e).

Other tests shall be carried out at an ambient air temperature given in Clause 4 a).

*Unless otherwise specified, tests shall be performed starting with a **fully charged battery**.*

<sup>3</sup> Under preparation.

Some of the tests may result in fire or explosion. It is therefore recommended that personnel should be protected from the flying fragments, explosive force, sudden release of heat, chemical burns, intense light and noise that may result from such explosions. The test area should be well ventilated to protect personnel from possible harmful fumes or gases.

*Addition to 5.1 of this document:*

**O.5.1.201** When measuring voltage, the peak value of any superimposed ripple exceeding 10 % of the average value shall be included. Transient voltages are ignored, such as a temporary increase of voltage, for example after the **battery** pack is removed from the charger.

**O.5.1.202** Measurements of **cell** voltages during the tests of lithium-ion systems shall be made using a single pole resistive-capacitive low pass filter with a cut-off frequency of 5 kHz  $\pm$  500 Hz. If charging voltage limits have been exceeded, the peak value of the voltage measured after this network shall be used. The measurement shall have measurement tolerance within  $\pm 1$  % for the combined filter circuit and voltmeter.

**O.5.1.203** Unless otherwise specified, all batteries shall be fully conditioned as follows: **batteries** shall be **fully discharged** and after a rest of two hours charged in accordance with the manufacturer's instructions.

**O.5.1.204** The location of thermocouples for **cell** temperature measurements shall be on the outer surface, half way along the longest dimension, of the **cell** that results in the highest temperature.

**O.5.1.205** Currents measured during **battery** charging shall be average currents with an averaging period of 1 s to 5 s. Current limits set by the battery manufacturer's specification shall not be exceeded.

**O.5.1.206** If not otherwise specified, a **fully charged battery** shall be used.

**O.5.1.207** When a **battery** comprised of a single **cell** is employed, instructions in this document referring to special preparations of a **cell** in a series configuration do not apply.

**O.5.1.208** For **battery** designs where there is a series arrangement of parallel clusters of cells, the cluster shall be treated as a single **cell** for those tests that require altering the amount of charge on a single **cell** prior to conducting the test.

**O.5.1.209** Unless the manufacturer specifies a different voltage, the end-of-discharge voltages for common **cell** chemistries are:

- 0,9 V per cell for nickel cadmium or nickel metal-hydride **batteries**;
- 1,75 V per cell for lead-acid **batteries**;
- 2,5 V per cell for lithium-ion **batteries**.

### **O.5.3 Conformity of components**

*Addition to 5.3 of this document:*

**Cells** employed in welding power sources or **cells** employed in **battery** packs shall comply with IEC 62133-1:— or IEC 62133-2:—, except for lead-acid **batteries**.

NOTE The above requirement for testing according to IEC 62133-1:— or IEC 62133-2:— does not include the **battery** pack itself.

## O.6 Protection against electric shock

### O.6.1 Insulation

#### O.6.1.1 General

*Addition to 6.1.1 of this document:*

Protection against electric shock from **battery voltage class B** circuits shall be composed of;

- **basic protection** measures against direct contact with live parts;
- measures for protection under **single-fault conditions**.

The protection measures shall meet the requirements as described in a) and b) or a) and c).

##### a) **Basic protection** measures

Persons shall be protected against direct contact with the live parts of the **battery voltage class B** electric circuits. The protection measures against direct contact shall be provided by one of the following:

- **basic insulation** of the live parts;
- enclosures, preventing access to the live parts.

The enclosures may be electrically conductive or non-conductive.

##### b) Protection under **single-fault conditions**

- Equipotential bonding

Exposed conductive parts of **battery voltage class B** electric equipment, including exposed conductive enclosures, shall be bonded together for potential equalization in accordance with the requirements in O.10.5.201.

- Insulation resistance

The **battery voltage class B** electric circuits intended to be not conductively connected to the supply network shall have sufficient insulation resistance in accordance with the requirements in O.6.1.4.

Requirements on insulation resistance for **battery voltage class B** electric circuits intended to be conductively connected to the supply network shall comply with 6.1.4.

##### c) Alternative approach for protection against electric shock

As an alternative to b), the equipment manufacturer shall conduct an appropriate risk assessment and establish a set of measures which give sufficient protection against electric shock under **single-fault conditions**.

#### O.6.1.4 Insulation resistance

*Addition to 6.1.4 of this document:*

The minimum insulation resistance from **battery voltage class B** circuits to accessible surfaces shall be at least 100  $\Omega/V$ . The reference shall be the maximum **working voltage**.

NOTE Hazard of electric shock occurs when electric currents depending on value and duration pass through the human body. Harmful effects can be avoided if the current is within zone DC-2 for DC or zone AC-2 for AC as shown in IEC TS 60479-1:2005, Figure 20 and Figure 22, respectively. The relation of harmful body currents and other wave forms and frequencies is described in IEC TS 60479-2. The insulation resistance requirements of 100  $\Omega/V$  for DC allow body currents of 10 mA.

To meet the above requirement for the entire circuit, it is necessary to have a higher insulation resistance for each component, depending on the number of the components and the structure of the circuit to which they belong.

*Conformity shall be checked by the following procedure*



a) Preconditioning and conditioning

Prior to the measurement, the device under test (DUT) shall be subjected to a preconditioning period of at least 8 h at  $(5 \pm 2) ^\circ\text{C}$ , followed by a conditioning period of 8 h at a temperature of  $(23 \pm 5) ^\circ\text{C}$ , a humidity of  $90^{+10}_{-5} \%$ , and an atmospheric pressure of between 86 kPa and 106 kPa.

Alternative preconditioning and conditioning parameters may be selected provided transition across the dew point occurs shortly after the beginning of the conditioning period.

The insulation resistance shall be measured during the conditioning period at a rate from which the lowest value can be determined.

b) Insulation resistance measurements

The insulation resistance of entire conductively connected **battery voltage class B** electric circuits may be measured using the test procedure for the measurement of the rechargeable energy storage system (RESS) given in ISO 6469-1:2009, 6.1.3.

If the system has several voltage ranges (e.g. because of boost converter) in a conductively connected circuit and some of the components cannot withstand the maximum **working voltage** of the entire circuit, the insulation resistances of components can be measured separately by applying their own maximum **working voltages** after those components are disconnected.

The measurements shall be performed using suitable instruments that can apply DC voltage (e.g. megohmmeter, provided they deliver the required test voltage).

#### O.6.1.5 Dielectric strength

*Addition to 6.1.5 of this document:*

a) **battery voltage class B** circuits not conductively connected to the supply network

For **battery voltage class B** circuits the test voltage, AC or DC, shall be greater than the highest voltage that can actually occur to the component. The test voltage shall be derived from the relevant over-voltages of the electric circuit to which the component is connected. Transient over-voltages that can be expected, including influences from other connections to the supply network, if any, shall be considered. The test voltage and its duration shall be specified, considering the applicable parts and sections of IEC 60664 by the manufacturer.

This test is intended to demonstrate the adequacy of the protection measures to isolate live parts of **battery voltage class B** electric circuits.

b) **battery voltage class B** circuits conductively connected to the supply network

These shall comply with 6.1.5.

*Addition to 6.1 of this document:*

**O.6.1.201 Creepage distances** (6.1.2) and **clearances** (6.1.3) do not apply to the construction of **battery cells** or the interconnections between **cells** in a **battery pack**.

**O.6.1.202** When evaluating a **battery pack** for protection against electric shock, **creepage distances, clearances** and distances through insulation, the **battery pack** shall be connected to the **charger**.

#### O.6.2 Protection against electric shock in normal service

*Addition to 6.2 of this document:*

**O.6.2.201** Battery-powered welding power sources and **battery packs** shall be so constructed and enclosed that there is adequate protection against electric shock.

*Conformity shall be checked by inspection, and by the tests of O.6.2.202 to O.6.2.205, as applicable.*

**O.6.2.202** For detachable and **separable battery packs** it shall not be possible to have two conductive, simultaneously **accessible parts** where the voltage between them exceeds 60 V DC.

**O.6.2.203** A **battery system** shall be short-circuit protected by an over-current interruption device. The over-current interruption device shall be suitable for this application.

**O.6.2.204** Batteries exceeding a voltage of 113 V DC shall be insulated in accordance with 6.2.4 (Isolation of the **welding circuit**).

**O.6.2.205** **Battery voltage class B** circuits up to a voltage of 113 V DC may be conductively connected to the welding circuit provided the **no-load voltage** does not exceed 60 V DC in a **single-fault condition**.

NOTE A switch-disconnector element in accordance with IEC 60947-3 having an appropriate rating is considered to meet the single-fault requirement.

## **O.7 Thermal requirements**

### **O.7.1 Heating test**

#### **O.7.1.1 Test conditions**

When placing the measuring devices, the only access permitted shall be through openings with cover plates, inspection doors or easily removable panels provided by the manufacturer. The ventilation in the test area and the measuring devices used shall not interfere with the normal ventilation of the welding power source or cause abnormal transfer of heat to or from it.

The welding power source is operated at constant current starting with a **fully charged battery**:

- a) with the **rated maximum welding current** ( $I_{2max}$ ) with **consecutive operating cycles**;
- b) with the **rated welding current** ( $I_2$ ) which allows continuous operation;

until the welding power source no longer operates due to the **battery** being discharged.

For welding power sources with **detachable battery packs** or **separable battery packs** the test is performed three times on one welding power source in immediate succession with **fully charged battery packs**.

If it is known that neither a) nor b) gives maximum heating, then a test shall be made at the setting within the rated range which gives the maximum heating.

Additionally for welding power sources where continuous charging during welding is possible a heating test as specified in 7.1 shall be conducted where the charge of the **battery** is the same at the end of the test as it was at the beginning.

The ambient temperature condition of O.5.1 shall be fulfilled before starting the test and the batteries shall be conditioned as specified in O.5.1.203.

NOTE 1 This maximum heating is possible at the no-load condition.

NOTE 2 Operation time of welding equipment changes with **battery** temperature, which could lead to higher component temperatures at different ambient temperatures (e.g. 20 °C).

### O.7.1.3 Duration of test

The heating test for the continuous operation shall be carried out at the highest welding current and **conventional load voltage** that fully discharges the **battery** without interruption (e.g. thermal protection or automatic means).

### O.7.2 Temperature measurement

#### O.7.2.1 Measurement conditions

The temperature shall be determined as follows:

- a) for windings, by measurement of the resistance, or by surface or embedded temperature sensors;

NOTE 1 The surface temperature sensor method is not preferred.

NOTE 2 In the case of windings of low resistance having switch contacts in series with them, the resistance measurement can give misleading results.

- b) for other parts, by surface temperature sensors.

#### O.7.4 Loading test

Welding power sources shall withstand repeated load cycles without damage or functional failure. This test may be conducted on any welding power source that functions correctly.

*Conformity shall be checked by the following tests and by establishing that no damage or functional failure to the welding power source occur during the tests.*

Starting from the cold state, the welding power source is loaded at the **rated maximum welding current** until one of the following occurs:

- a) the **thermal protection** is actuated;
- b) the maximum temperature limit of the windings is reached;
- c) the **battery** is fully discharged.

Immediately after reset of the **thermal protection** in a), or after b) or c), the following test is carried out.

Immediately, while equipment is still hot, the equipment shall be checked in accordance with 6.1.5 and O.6.1.5 if applicable.

*Addition to Clause 7 of this document:*

#### O.7.201 Normal charging of lithium-ion systems

Charging a lithium-ion **battery** under normal conditions shall not exceed the **specified operating region for charging** of the **cell**.

*Conformity shall be checked by the following tests.*

*The **battery** is charged in accordance with the **charging system** instructions starting with a **fully discharged battery**. Testing is carried out at an ambient temperature of  $(40 \pm 5) ^\circ\text{C}$  and*

- *if the welding power source is recommended to be operated at a minimum temperature lower than  $4 ^\circ\text{C}$ , the test is also conducted at that minimum temperature  $-5 ^\circ\text{C}$ ;*

- if the welding power source is recommended to be operated at a maximum temperature greater than 40 °C, the test is also conducted at that maximum temperature  $^{+5}_{0}$  °C.

For individual **cells**, the voltage, the temperature measured in accordance with O.5.1.20 and the charging current are monitored to ensure that the hotspot of the **battery** pack is within limits. In the case of parallel configurations, analysis may be used to avoid measuring the individual branch currents. The result shall not exceed their **specified operating region for charging** (e.g. limits of voltage and current dependent on the temperature).

NOTE 1 The following is an example result of such analysis: the charging current for each branch of a parallel connection would not need to be monitored, if the maximum deliverable current of the **charger** did not exceed the **maximum charging current** of a single **cell**.

For **batteries** employing series configurations, the test is repeated with a deliberately imbalanced **battery**. The imbalance is introduced into a **fully discharged battery** by charging one **cell** to approximately 50 % of full charge.

If it can be demonstrated through testing and/or design evaluation that an imbalance less than 50 % would actually occur in **normal use**, then this lower imbalance may be used.

NOTE 2 Examples are those designs that employ circuitry intended for maintaining balance between **cells** in the **battery** pack. Systems with a small number of **cells** in series may be shown to exhibit limited imbalance in practice, if the product ceases to operate with a **battery** prepared with a smaller initial imbalance.

NOTE 3 An example for a testing is repeated charging and discharging of a **battery** in accordance with the manufacturer's instructions until its capacity has decreased to 80 % of the rated capacity, using the imbalance at the end of the test.

## O.8 Thermal protection

### O.8.1 General requirements

A battery-powered welding power source shall be fitted with **thermal protection**. This **thermal protection** shall meet the requirements of 8.2, 8.3, O.8.4 and 8.5 to 8.7.

Conformity shall be checked by **visual inspection**.

### O.8.4 Operating capacity

The **thermal protection** shall be able to operate 200 times, when the welding power source delivers its **rated maximum welding current**.

Conformity shall be checked with a suitable overload of a circuit having the same electrical characteristics, especially current and reactance, as the circuit in which the **thermal protection** is used.

## O.9 Abnormal operation

### O.9.1 General requirements

All welding power sources and their battery packs shall not break down and increase the risk of electric shock or fire under the conditions of operations O.9.2 to O.9.207.

Conformity shall be checked by the following tests.

### O.9.2 Stalled fan test

A welding power source, which relies on motor-driven fan(s) for conformity with the tests of Clause 7, is operated with a **fully charged battery** while the fan motor(s) is(are) mechanically stalled and the welding power source is operated at the output condition of O.7.1.

### O.9.3 Short circuit test

The battery-powered welding power source is short circuited with the torch and the welding cables normally supplied by the manufacturer, or, if none are supplied, by a conductor 1,2 m in length and of the cross-section given in Table 8.

NOTE Cross sections for non-SI system are given in Table F.1

The battery-powered welding power source at the maximum output setting with a **fully charged battery** shall not clear fuses or circuit-breakers when short circuited:

- a) for 15 s in the case of a **drooping characteristic**;
- b) three times for 1 s, within a period of 1 min, in the case of a **flat characteristic**.

The short circuit is then applied for 2 min or until a protection device operates.

### O.9.4 Overload test

This subclause is not applicable.

*Addition to Clause 9 of this document:*

#### O.9.201 Welding power source – abnormal conditions

The battery-powered welding power source, **battery** pack and the cables of b) and c), as appropriate, are placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm. The test is conducted until failure or until the test sample returns to within 5 K of the ambient temperature or, if neither of these occurs, until at least 3 h has elapsed. A new sample may be used for each fault listed below. No **explosion** shall occur during or after the test. There shall be adequate protection against electric shock as defined in O.6.2. No **charring** or burning of the cotton shall result. **Venting** of the **cells** is permitted.

The resistance for the short in items a), b) and c) shall not exceed 10 mΩ. **Charring** or igniting of the cotton from the shorting means is not considered a failure.

Fuses, **thermal cut-outs**, **thermal links**, **temperature limiters**, electronic devices or any component(s) or conductors(s) that interrupt the discharge current may operate during the above tests. If these devices are relied upon to pass the test, the test is to be repeated two more times, using two additional sample devices, and shall open the circuit in the same manner, unless the test is otherwise satisfactorily completed. Alternatively, the test may be repeated with the open-circuited device bridged.

- a) Combinations of exposed terminals of a **detachable battery pack** are shorted so as to produce the worst result. **Battery** pack terminals that can be contacted using either test probe B of IEC 61032:1997 or test probe 13 of IEC 61032:1997 are considered exposed. The means of shorting shall be selected or positioned such that **charring** or ignition of the cotton is not influenced.
- b) Any cable provided between the **separable battery pack** and the battery-powered welding power source shall be shorted at the point likely to produce the most adverse effects.
- c) Any cable provided between the **battery** pack or the battery-powered welding power source and the **charger** shall be shorted at the point likely to produce the most adverse effects.

**O.9.202 Welding circuit components – abnormal conditions**

The following fault conditions are considered for the power circuit path of the welding power source and, if necessary, applied one at a time, consequential faults being taken into consideration:

- a) open-circuit at the terminal of any component;
- b) short-circuit of capacitors, unless they comply with IEC 60384-14;
- c) short-circuit of any two terminals of an **electronic component**, other than a monolithic integrated circuit. This fault is not applied between the two circuits of an optocoupler;
- d) failure of triacs in the diode mode;
- e) failure of a monolithic integrated circuit or other circuits that cannot be assessed by the fault conditions a) to d). In this case the possible hazardous situations of the welding power source are assessed to ensure that safety does not rely on the correct functioning of such a component. All possible output signals are considered under fault conditions within the integrated circuit. If it can be shown that a particular output signal is unlikely to occur, then the relevant fault is not considered.

Components such as thyristors and triacs are not subjected to fault condition e).

Positive temperature coefficient resistors (PTCs) are not short-circuited if they are used within their manufacturer's declared specification.

For simulation of the conditions, the welding power source is operated at no-load condition adjusted to maximum output setting.

The test is conducted until failure or until one of the following occurs:

- thermal equilibrium is achieved; or
- the test samples return to within 5 K of the ambient temperature; or
- a test period of 3 h has elapsed.

NOTE Examination of the welding power source and its circuit diagram will reveal the fault conditions which have to be simulated through circuit analysis, so that testing can be limited to those cases which may be expected to give the most unfavourable result.

**O.9.203 Lithium-ion charging systems – abnormal conditions**

This subclause applies only to lithium-ion **batteries**.

The **charging system** and **battery** of a lithium-ion system shall be so designed that the risk of fire and **explosion** as a result of abnormal operation during charging is obviated as far as is practical.

*Conformity shall be checked by the following test.*

*A sample containing the **battery** and the associated assemblies of the **charging system** are placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm. The **battery system** is operated as specified in O.17.1 t) 1) with all of the categories of abnormal conditions listed below in a) to d).*

- a) Components in the **charging system** are faulted as in O.9.202 a) to e), one at a time, if the outcome of such a fault is uncertain based upon analysis. For each fault condition introduced, the state of the battery before charging is as follows:
  - a series configured **battery** shall have a deliberate imbalance. The imbalance is introduced into a **fully discharged battery** by charging one **cell** to approximately 50 % of full charge; or



- if the test of O.7.201 is conducted with an imbalance of less than 50 %, a series configured **battery** shall have a deliberate imbalance as established in O.7.201; or
  - a single **cell** or parallel only configuration **battery** shall be **fully discharged**.
- b) If the test of O.7.201 is conducted with an imbalance of less than 50 % due to the function of circuit(s), and if a single fault of any component within that circuit(s) is shown to result in the loss of that function, then a series configured **battery** shall be charged with a deliberate imbalance. The imbalance is introduced into a **fully discharged battery** by charging one **cell** to approximately 50 % of full charge.
- c) For a **battery** with a series configuration, all cells are at approximately 50 % charge, except for one which is shorted. The battery is then charged.
- d) With a **fully charged battery** connected to the **charger**, a short is introduced to the **charging system** across a component or between adjacent PCB tracks at a location expected to produce the most unfavourable results to evaluate the effect of back-feed from the **battery**. For a **charger** with a cable that connects to the **battery**, the short shall be introduced at the point likely to produce the most adverse effects. The resistance of the short shall not exceed 10 mΩ.

During the tests, each **cell** voltage is continuously monitored to determine if it has exceeded the limit condition. **Venting** of the **cells** is permitted.

The test is conducted until the sample under test experiences a failure, returns to within 5 K of the ambient temperature or, if neither of these, until at least 7 h or twice the normal charge period has elapsed, whichever is longer.

Tests are considered passed if all of the following are true:

- *There has been no **explosion** during the test.*
- *No **charring** or burning of the cotton has resulted. **Charring** or igniting of the cotton from the shorting means is not considered a failure.*
- *The **cells** shall not have exceeded the **upper limit charging voltage** by more than 150 mV or, if they have, then the **charging system** shall be permanently disabled from recharging the **battery**. To determine if recharging is disabled, the **battery** shall be discharged by using the welding power source tested (in the case of an integral system) or by using a new sample of the welding power source (in the case of a detachable **battery system**) to approximately 50 % charge, followed by an attempt to recharge the **battery** normally. There shall be no charging current after 10 min or after 25 % of the nominal capacity has been delivered, whichever occurs first.*
- *There shall be no evidence of damage to the **cell** vent to impair compliance with O.14.204.*

#### O.9.204 Lithium-ion battery short circuit

This subclause applies only to lithium-ion **batteries**.

There shall be no risk of fire or **explosion** when the main discharge connections of a series configured **integral battery**, **detachable battery pack** or **separable battery pack** are shorted under conditions of extreme imbalance.

*Conformity shall be checked by the following test.*

*The test is conducted with all the **cells** of the **battery** fully charged and one **cell** fully discharged.*

*A **detachable battery pack** or **separable battery pack** is placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm.*

A welding power source containing an **integral battery** is placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm.

The main discharge connections of the **battery** are shorted with a resistance not to exceed 10 m $\Omega$ . The test is conducted until the test sample experiences a failure or until the test sample returns to within 5 K of the ambient temperature. There shall be no **explosion** during or after the test. As a result of the test, there shall be no **charring** or burning of the cotton. **Venting of cells** is acceptable.

**Charring** or igniting of the cotton from the shorting means is not considered a failure.

Fuses, **thermal cut-outs**, **thermal links**, **temperature limiters**, electronic devices or any component(s) or conductor(s) that interrupt the discharge current may operate during the above tests. If these devices are relied upon to pass the test, the test is to be repeated two more times, using two additional samples, and shall open the circuit in the same manner, unless the test is otherwise satisfactorily completed. Alternatively, the test may be repeated with the open-circuited device bridged.

#### O.9.205 Batteries other than lithium-ion – overcharging

**Batteries** comprised of **cells** other than the lithium-ion type shall withstand abusive overcharging without risk of fire or **explosion**.

Conformity shall be checked by the following test.

The **battery** is placed on a layer of dry absorbent surgical type cotton, extending beyond each side for a distance of 150 mm and charged at a rate of 10 times the **C<sub>5</sub> rate** for the **battery** for 85 min. There shall be no **explosion** and no **charring** or burning of the cotton. **Venting** of the **cells** is acceptable.

#### O.9.206 Battery pack disconnection

Plugs, connectors and switches in the electrical current path of **battery** packs shall be suitable for this application and shall be able to disconnect the **battery** pack from battery-powered welding power sources without risk of fire and without risk of electrical shock.

This clause does not apply to a welding power source with an **integral battery**.

Conformity shall be checked by **visual inspection** according to O.6.1.202 after the following tests.

The **fully charged battery** pack operating the battery-powered welding power source the output of which is connected to a **conventional load** and adjusted to produce the **rated maximum welding current** is disconnected 10 times.

#### O.9.207 General purpose batteries

For **general purpose** batteries replaceable by the user additional risk analysis should be performed by the manufacturer.

### O.10 Connection to the supply network

Clause 10 is applicable only for **battery voltage class B** circuits conductively connected to the supply network, except as follows:



### O.10.5 Protective circuit

*Addition to 10.5 of this document:*

#### O.10.5.201 Continuity test for equipotential bonding of battery voltage class B circuits

All components forming the equipotential bonding current path (conductors, connections) shall withstand the maximum current in a single-fault situation.

The resistance of the equipotential bonding path between any two exposed conductive parts of the **battery voltage class B** electric circuit that can be touched simultaneously by a person shall not exceed 0,1  $\Omega$ .

The equipotential bonding resistances shall be tested by injecting a current of at least 10 A at 50 Hz or 60 Hz derived from a SELV source, which shall be passed through the potential current path between any two exposed conductive parts for at least 5 s. This path shall be isolated from other unintended potential paths for measurement. These conducting parts shall include **battery voltage class B** component housings, connections to battery-powered welding power source and the enclosures.

The voltage drop between any two reachable exposed conductive parts in a distance up to 2,5 m shall be measured and the resistance calculated from the current and this voltage drop.

NOTE 2,5 m is the usual distance which a person can reach.

### O.10.8 Supply circuit on/off switching device

*Addition to 10.8 of this document:*

Where a built-in **battery** circuit on/off switching device (for example switch, contactor or circuit-breaker) is provided, this shall:

- a) plainly indicate whether the circuit is open or closed, and
- b) be rated as follows:
  - voltage: not less than the rated **battery** voltage,
  - current: not less than the **battery** current at conventional welding condition with rated maximum welding current,or
- c) be suitable for this application.

*Conformity shall be checked by **visual inspection** for b) in accordance with other relevant standards, and for c) by the following tests.*

**Overload:** The output of the **fully charged** battery-powered welding power source is short-circuited in accordance with O.9.3. The switching device is operated for 100 cycles at the rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

**Endurance:** The output is connected to a **conventional load** and adjusted to produce the **rated maximum welding current**. The switching device is operated for 1 000 cycles at a rate of 6 to 10 cycles per minute with a minimum on-time of 1 s.

*Addition to Clause 10 of this document:*

**O.10.201** For battery-powered welding power sources with **separable battery packs**, the external flexible cable shall have anchorages such that the conductors are relieved from strain, including twisting, where they are connected within the welding power source, and protected from abrasion.

Conformity shall be checked by test in accordance with 10.6.

## O.14 Mechanical provisions

### O.14.1 General requirements

Addition to 14.1 of this document:

Following the test, the battery-powered welding power source and **battery** pack shall not catch fire or explode.

In addition, the following applies for lithium-ion **batteries** after the test of O.14.2.2 and O.14.4:

- the open circuit voltage of the **battery** shall not be less than 90 % of the voltage measured immediately prior to the test;
- the **battery** shall demonstrate normal discharging and recharging after the test;
- there shall be no damage to the **cell** vent that impairs compliance with O.14.204.

### O.14.2 Enclosure

#### O.14.2.2 Enclosure strength

Addition to 14.2.2 of this document:

**Detachable battery packs** shall be fitted during enclosure strength test.

For **detachable battery packs** or **separable battery packs** with a mass greater than or equal to 3 kg the test is repeated on the **battery** packs separately.

### O.14.4 Drop withstand

Equipment with any **detachable battery pack** attached shall be capable of withstanding a drop test. For this test, the equipment shall be equipped with all the associated attachments, cooling liquid and filler wire (excluding gas cylinders, separate trailers, carts and wheel undercarriages, unless these items are standard equipment and permanently affixed) that are recommended to be installed.

The heights for the drop test shall be as follows:

- a) equipment with a mass of up to 25 kg shall withstand a drop of 250 mm;
- b) equipment with a mass of greater than 25 kg shall withstand a drop of 100 mm.

NOTE 1 Mass of equipment includes mass of associated attachments, cooling liquid and filler wire.

Conformity shall be checked by dropping the equipment three times on a hard and rigid surface. This test is so arranged that a different bottom edge of the equipment is struck each time it drops.

NOTE 2 In practice, one corner will touch the impact surface first.

In addition, for **detachable battery packs** or **separable battery packs** with a mass less than 3 kg, the test is repeated on the **battery** packs separately three times from a height of 1 m. The sample shall be positioned to vary the point of impact.

Addition to Clause 14 of this document:

**O.14.201** It shall not be possible to install a **detachable battery pack** or a **separable battery pack** in reverse polarity.

*Conformity shall be checked by inspection.*

#### **O.14.202** Lithium-ion **battery** enclosure pressure test

This subclause applies only to lithium-ion **batteries**.

An enclosure for lithium-ion **batteries** shall be designed such that it will safely release gasses that may be generated as a result of **venting**.

*Conformity shall be checked by measurement in the case of a) or by the test of b):*

- a) *the total area of the openings in the enclosure allowing gasses to pass without obstruction shall be equal to or greater than 20 mm<sup>2</sup>; or*
- b) *the enclosure shall be tested as follows.*

*A total of (21 ± 2,1) ml of air shall be delivered at an initial pressure of (2 070 ± 207) kPa through a (2,87 ± 0,05) mm diameter orifice to the enclosure of a welding power source with **integral battery** or the enclosure of a **detachable battery pack** or **separable battery pack**. The pressure within the enclosure shall drop below 70 kPa in 30 s. There shall be no rupturing that would cause the enclosure to fail to meet the requirements of this document. An additional volume, not to exceed 3 ml, is allowed to be added to the enclosure volume as may be required for test fittings.*

**O.14.203** The manufacturer shall instruct the user that only **general purpose batteries** specified by the manufacturer shall be used as the primary energy source for battery-powered welding power sources.

*Conformity shall be checked by inspection.*

**O.14.204** Vents of battery **cells** shall not be obstructed in such a way as to defeat their operation if **venting** is relied upon for safety.

*Conformity shall be checked by inspection or, if in doubt, by inspecting the **cells** after conclusion of the abnormal tests of O.9.201 a), b) and c) to ensure that **cells** have not vented by any means other than through the **cell vent**.*

**O.14.205** User accessible interfaces between elements of a **battery system** shall not employ connectors of the following types:

- standard mains inlet connectors, except for mains supply connections;
- barrel connectors with outside diameters of 6,5 mm or less;
- phone plugs with a diameter of 3,5 mm or less.

*Conformity shall be checked by inspection.*

### **O.15** Rating plate

#### **O.15.3** Contents

##### a) Identification

Box 4      Welding power source symbol if applicable (optional) and type of **integral battery** for example:

|        |                                       |
|--------|---------------------------------------|
| NiCd   | nickel cadmium <b>batteries</b>       |
| NiMH   | nickel metal-hydride <b>batteries</b> |
| Li-ion | lithium-ion <b>batteries</b>          |

b) Welding output

|        |                               |                                                    |
|--------|-------------------------------|----------------------------------------------------|
| Box 12 | $I_{2\max} = \dots \text{ A}$ | Symbol and value of rated maximum welding current. |
| Box 13 | $U_2 = \dots \text{ V}$       | Symbol and value of the conventional load voltage. |
| Boxes  | 11a, 11b, 11c                 | Not applicable.                                    |
|        | 12a, 12b, 12c                 | Not applicable.                                    |
|        | 13a, 13b, 13c                 | Not applicable.                                    |

Alternatively for welding power sources where continuous charging during welding is possible in accordance with O.7.1.1, the **duty cycle** as specified in 15.3 b) may be used.

c) Energy supply

|              |                                    |
|--------------|------------------------------------|
| Box 14       | Energy supply symbol, for example: |
| $\text{---}$ | Direct current                     |

| Box                                                    | Welding power sources with integral battery |                                                                            | Box | Welding power sources with detachable or separable battery |                                       |
|--------------------------------------------------------|---------------------------------------------|----------------------------------------------------------------------------|-----|------------------------------------------------------------|---------------------------------------|
| 15                                                     | $U_b \dots \text{ V}$                       | Rated battery voltage                                                      | 15  | $U_b \dots \text{ V}$                                      | Rated battery voltage                 |
| 16                                                     | $E \dots \text{ W}\cdot\text{h}$            | Rated battery capacity based on the rated capacity of the cells determined | 19  | battery                                                    | Battery specified by the manufacturer |
| 17                                                     | $I_b \dots \text{ A}$                       | Rated charging current                                                     |     |                                                            |                                       |
| 19                                                     | charger                                     | Charger specified by the manufacturer                                      |     |                                                            |                                       |
| Boxes 15 to 17 form a table with corresponding values. |                                             |                                                                            |     |                                                            |                                       |

Addition to 15.3 of this document:

d) Separable and detachable battery packs shall also be marked with additional information as follows:

- type (identification) as given by the manufacturer;
- the year of manufacture and a date code identifying at least the month of manufacture;
- rated **battery** voltage;
- the capacity assigned by the manufacturer in  $\text{W}\cdot\text{h}$ , based on the rated capacity of the **cells** determined;
- for alkaline or other non-acid electrolyte **batteries**, the type of **battery** such as Li-Ion, NiCd and NiMH.

NOTE In Canada and the United States of America, the following additional requirements apply.

A battery-powered welding power source provided with a **detachable battery pack** or a **separable battery pack** shall be marked: "For use only with      battery", or the equivalent, where the underlined space is completed with the manufacturer's name or trademark, a catalogue number, a series identification, or the equivalent, of the **battery** pack. Alternatively, the statement "See instruction manual for additional battery packs" or the equivalent may be employed in addition to at least one **battery** pack referenced by catalogue number.

A **detachable battery pack**, a **separable battery pack**, or a battery-powered welding power source provided with an **integral battery** shall be marked "For use only with      charger", or the equivalent, where the underlined space is completed with the manufacturer's name or trademark, a catalogue number, a series identification, or the equivalent, of the **charger**. Alternatively, the statement "See instruction manual for additional chargers," or the equivalent may be employed in addition to at least one **charger** referenced by catalogue number.

## O.17 Instructions and markings

### O.17.1 Instructions

*Addition to 17.1 of this document:*

t) For battery-powered welding power sources:

- 1) Instructions regarding **battery** charging, information regarding ambient temperature range for welding power source and **battery** use and storage, and the recommended ambient temperature range for the **charging system** during charging;
- 2) For a battery-powered welding power source intended for use with a **detachable battery pack** or a **separable battery pack**: instructions indicating the appropriate **battery** packs for use, such as by a catalogue number, series identification or the equivalent;
- 3) Instructions indicating the appropriate **charger** for use, such as by a catalogue number, series identification or the equivalent;
- 4) Information regarding durability and lifetime of battery, typical welding range for a **fully charged battery** and typical charging times;
- 5) Warnings concerning battery-powered welding power sources:
  - Recharge only with the charger specified by the manufacturer. A charger that is suitable for one type of battery pack may create a risk of fire when used with another battery pack.
  - Use welding power sources only with specifically designated battery packs. Use of any other battery packs may create a risk of injury and fire.
  - When battery pack is not in use, keep it away from other metal objects, like paper clips, coins, keys, nails, screws or other small metal objects that can make a connection from one terminal to another. Shorting the battery terminals together may cause burns or a fire.
  - Under abusive conditions, liquid may be ejected from the battery; avoid contact. If contact accidentally occurs, flush with water. If liquid contacts eyes, additionally seek medical help. Liquid ejected from the battery may cause irritation or burns.
  - Do not use a battery pack or welding power source that is damaged or modified. Damaged or modified batteries may exhibit unpredictable behaviour resulting in fire, explosion or risk of injury.
  - Do not expose a battery pack or welding power source to fire or excessive temperature. Exposure to fire or temperature above 130 °C may cause explosion.

NOTE 1 The temperature "130 °C" can be replaced by the temperature "265 °F".

- Follow all charging instructions and do not charge the battery pack or welding power source outside the temperature range specified in the instructions. Charging improperly or at temperatures outside the specified range may damage the battery and increase the risk of fire.

NOTE 2 In Europe (EN 62841-1), the following additional requirement applies:

For battery-powered welding power sources with **integral battery**: instruction, how the **integral battery** can be removed safely from the welding power source after the welding power source's end of life, and information about the type of **battery** such as Li-Ion, NiCd and NiMH.

### O.17.2 Markings

*Addition to 17.2 of this document:*

Marking of **battery voltage Class B** electric components:

The symbol W012 in accordance with ISO 7010:2011 shown in Figure O.1 shall appear on (preferably) or near **battery voltage class B** electric power sources.

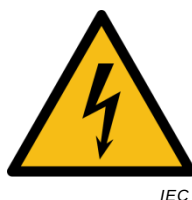


**Figure O.1 – Marking of battery voltage class B electric components**

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## **Annex P** **(normative)**

### **Conformity of components**

Components and subassemblies which, due to failure, can create a hazard, such as power supplies and built-in information technology equipment, shall be used in accordance with their specified ratings unless a specific exception is made. They shall conform to one of the following:

- a) applicable safety requirements of a relevant IEC standard. Conformity with other requirements of the component standard is not required. If necessary for the application, components shall be subjected to the tests of this document, except when those tests are identical or equivalent to the tests required to check conformity with the relevant component standard;


For example, if components meet the safety requirements of IEC 60950-1 but are rated for a less severe environment than the applicable environment of Clause 4 and 6.1.1, they shall also meet relevant additional requirements of this document.

- b) the requirements of this standard and, where necessary for the application, any additional applicable safety requirements of the relevant IEC component standard;
- c) if there is no relevant IEC standard, the requirements of this document;
- d) applicable safety requirements of a non-IEC standard which are at least as high as those of the relevant IEC standard, provided that the component has been approved to the non-IEC standard by a recognized testing authority.

NOTE Tests performed by a recognized testing authority which confirm conformity with applicable safety requirements need not be repeated, even if the tests were performed using a non-IEC standard.

Figure P.1 is a flow chart showing methods of conformity verification.

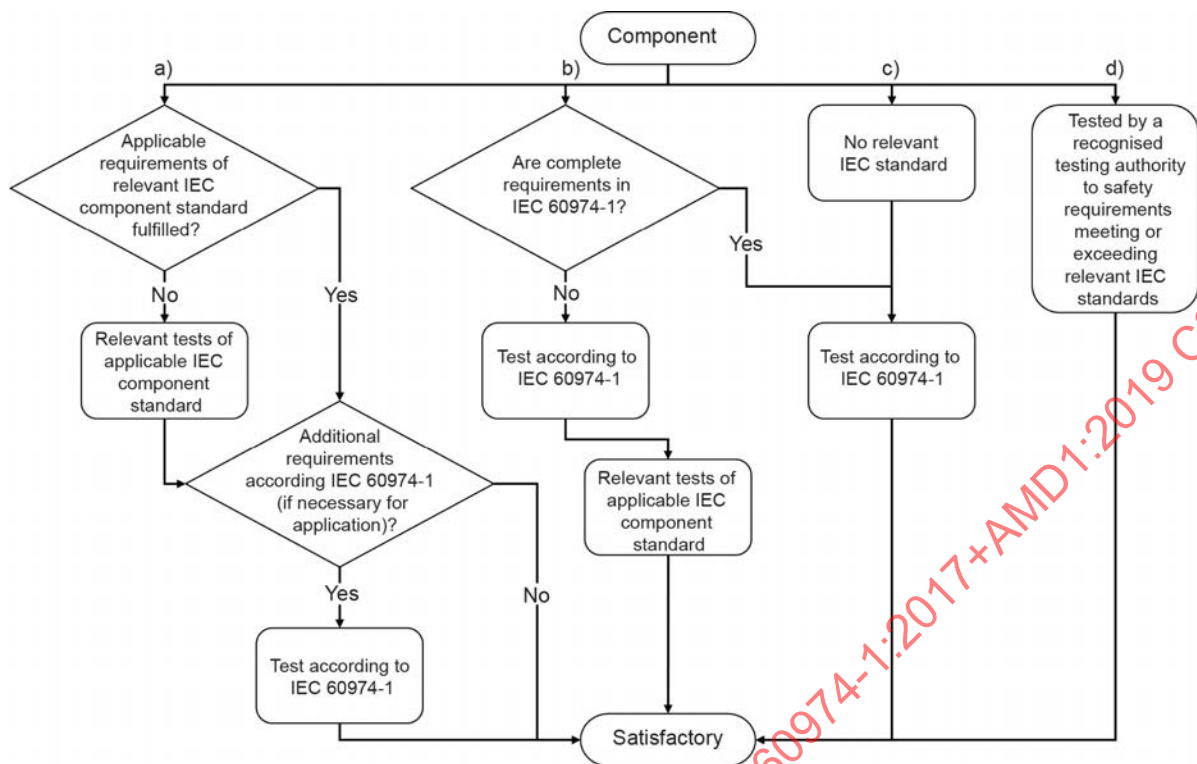*Conformity is checked by inspection and, if necessary, by test.*



IEC

Figure P.1 – Flow chart for conformity methods of Annex P



## Bibliography

IEC 60038:2009, *IEC standard voltages*

IEC 60050-195:1998, *International Electrotechnical Vocabulary – Part 195: Earthing and protection against electric shock*  
IEC 60050-195:1998/AMD1:2001

IEC 60050-811:1991, *International Electrotechnical Vocabulary – Chapter 811: Electric traction*

IEC 60050-826:2004, *International Electrotechnical Vocabulary – Part 826: Electrical installations*

IEC 60076-12, *Power transformers – Part 12: Loading guide for dry-type power transformers*

IEC 60085, *Electrical insulation – Thermal evaluation and designation*

IEC 60204-1, *Safety of machinery – Electrical equipment of machines – Part 1: General requirements*

IEC 60309-1, *Plugs, socket-outlets and couplers for industrial purposes – Part 1: General requirements*

IEC 60335-2-29, *Household and similar electrical appliances – Safety – Part 2-29: Particular requirements for battery chargers*

IEC 60384-14, *Fixed capacitors for use in electronic equipment – Part 14: Sectional specification – Fixed capacitors for electromagnetic interference suppression and connection to the supply mains*

IEC TS 60479-1:2005, *Effects of current on human beings and livestock – Part 1: General aspects*

IEC TS 60479-2, *Effects of current on human beings and livestock – Part 2: Special aspects*

IEC TR 60755:2008, *General requirements for residual current operated protective devices*

IEC 60950-1, *Information technology equipment – Safety – Part 1: General requirements*

IEC 60974-3, *Arc welding equipment – Part 3: Arc striking and stabilizing devices*

IEC 60974-4, *Arc welding equipment – Part 4: Periodic inspection and testing*

IEC 60974-6, *Arc welding equipment – Part 6: Limited duty equipment*

IEC 60974-9, *Arc welding equipment – Part 9: Installation and use*

IEC 60974-10, *Arc welding equipment – Part 10: Electromagnetic compatibility (EMC) requirements*

IEC 60974-12, *Arc welding equipment – Part 12: Coupling devices for welding cables*

IEC 61032:1997, *Protection of persons and equipment by enclosures – Probes for verification*

IEC 61558-1, *Safety of power transformers, power supplies, reactors and similar products – Part 1: General requirements and tests*

IEC 62281, *Safety of primary and secondary lithium cells and batteries during transport*

ISO 3864-1, *Graphical symbols – Safety colours and safety signs – Part 1: Design principles for safety signs and safety markings*

ISO 6469-1:2009, *Electrically propelled road vehicles – Safety specifications – Part 1: On-board rechargeable energy storage system (RESS)*

ISO 6469-3, *Electrically propelled road vehicles – Safety specifications – Part 3: Protection of persons against electric shock*

ISO 7000, *Graphical symbols for use on equipment* (available at: <http://www.graphical-symbols.info/equipment>)

ISO 13732-1, *Ergonomics of the thermal environment – Methods for the assessment of human responses to contact with surfaces – Part 1: Hot surfaces*

ISO 17846, *Welding and allied processes – Health and safety – Wordless precautionary labels for equipment and consumables used in arc welding and cutting*

CSA C22.1, *Canadian electrical code*

EN 50525-1, *Electric cables – Low voltage energy cables of rated voltages up to and including 450/750 V ( $U_0/U$ ) – Part 1: General requirements*

EN 50525-2-21, *Electric cables – Low voltage energy cables of rated voltages up to and including 450/750 V ( $U_0/U$ ) – Part 2-21: Cables for general applications – Flexible cables with crosslinked elastomeric insulation*

EN 50525-2-81, *Electric cables – Low voltage energy cables of rated voltages up to and including 450/750 V ( $U_0/U$ ) – Part 2-81: Cables for general applications – Cables with crosslinked elastomeric covering for arc welding*

EN 62841-1, *Electric motor-operated hand-held tools, transportable tools and lawn and garden machinery – Safety – Part 1: General requirements*

NFPA 70, *National Electrical code*

US Code of Federal Regulations, Title 16: Commercial Practices – Parts 1407: Portable Generators: Requirements to provide performance and technical data by labelling

---

IECNORM.COM : Click to view the full PDF of IEC 60974-1:2017+AMD1:2019 CSV

## SOMMAIRE

|                                                                                                 |     |
|-------------------------------------------------------------------------------------------------|-----|
| AVANT-PROPOS .....                                                                              | 157 |
| 1 Domaine d'application .....                                                                   | 159 |
| 2 Références normatives .....                                                                   | 159 |
| 3 Termes et définitions .....                                                                   | 160 |
| 3.1 Termes généraux .....                                                                       | 161 |
| 3.2 Termes relatifs aux systèmes de batterie .....                                              | 170 |
| 4 Conditions ambiantes .....                                                                    | 173 |
| 5 Essais .....                                                                                  | 173 |
| 5.1 Conditions d'essai .....                                                                    | 173 |
| 5.2 Instruments de mesure .....                                                                 | 174 |
| 5.3 Conformité des composants .....                                                             | 174 |
| 5.4 Essais de type .....                                                                        | 174 |
| 5.5 Essais individuels de série .....                                                           | 174 |
| 6 Protection contre les chocs électriques .....                                                 | 175 |
| 6.1 Isolement .....                                                                             | 175 |
| 6.1.1 Généralités .....                                                                         | 175 |
| 6.1.2 Distances d'isolement dans l'air .....                                                    | 176 |
| 6.1.3 Lignes de fuite .....                                                                     | 178 |
| 6.1.4 Résistance d'isolement .....                                                              | 180 |
| 6.1.5 Rigidité diélectrique .....                                                               | 180 |
| 6.2 Protection contre les chocs électriques en service normal (contact direct) .....            | 182 |
| 6.2.1 Degré de protection procuré par l'enveloppe .....                                         | 182 |
| 6.2.2 Condensateurs .....                                                                       | 182 |
| 6.2.3 Décharge automatique des condensateurs sur le circuit d'alimentation .....                | 183 |
| 6.2.4 Isolation du circuit de soudage .....                                                     | 183 |
| 6.2.5 Courant de contact d'un circuit de soudage .....                                          | 184 |
| 6.2.6 Courant de contact en condition normale .....                                             | 184 |
| 6.3 Protection contre les chocs électriques en cas de défaut (contacts indirects) .....         | 185 |
| 6.3.1 Mesures de protection .....                                                               | 185 |
| 6.3.2 Isolation entre les enroulements du circuit d'alimentation et le circuit de soudage ..... | 185 |
| 6.3.3 Conducteurs et connexions internes .....                                                  | 186 |
| 6.3.4 Exigences supplémentaires pour les systèmes de coupage par plasma .....                   | 186 |
| 6.3.5 Noyaux et bobines mobiles .....                                                           | 187 |
| 6.3.6 Courant de contact en cas de défaut .....                                                 | 187 |
| 7 Exigences thermiques .....                                                                    | 187 |
| 7.1 Essai d'échauffement .....                                                                  | 187 |
| 7.1.1 Conditions d'essai .....                                                                  | 187 |
| 7.1.2 Tolérances des paramètres d'essai .....                                                   | 188 |
| 7.1.3 Durée de l'essai .....                                                                    | 188 |
| 7.2 Mesurage des températures .....                                                             | 188 |
| 7.2.1 Conditions de mesure .....                                                                | 188 |
| 7.2.2 Capteur de température en surface .....                                                   | 188 |
| 7.2.3 Résistance .....                                                                          | 189 |
| 7.2.4 Capteur de température incorporé .....                                                    | 189 |

|        |                                                                                                                        |     |
|--------|------------------------------------------------------------------------------------------------------------------------|-----|
| 7.2.5  | Détermination de la température de l'air ambiant .....                                                                 | 189 |
| 7.2.6  | Enregistrement des températures .....                                                                                  | 190 |
| 7.3    | Limites d'échauffement .....                                                                                           | 190 |
| 7.3.1  | Enroulements, collecteurs et bagues collectrices .....                                                                 | 190 |
| 7.3.2  | Surfaces externes.....                                                                                                 | 191 |
| 7.3.3  | Autres composants .....                                                                                                | 191 |
| 7.4    | Essai en charge .....                                                                                                  | 191 |
| 7.5    | Collecteurs et bagues collectrices.....                                                                                | 192 |
| 8      | Protection thermique .....                                                                                             | 192 |
| 8.1    | Exigences générales.....                                                                                               | 192 |
| 8.2    | Construction .....                                                                                                     | 193 |
| 8.3    | Emplacement.....                                                                                                       | 193 |
| 8.4    | Capacité de fonctionnement.....                                                                                        | 193 |
| 8.5    | Fonctionnement .....                                                                                                   | 193 |
| 8.6    | Réenclenchement .....                                                                                                  | 193 |
| 8.7    | Indication .....                                                                                                       | 194 |
| 9      | Fonctionnement anormal .....                                                                                           | 194 |
| 9.1    | Exigences générales.....                                                                                               | 194 |
| 9.2    | Essai de ventilateur bloqué .....                                                                                      | 194 |
| 9.3    | Essai de courant de court-circuit.....                                                                                 | 194 |
| 9.4    | Essai de surcharge .....                                                                                               | 195 |
| 10     | Raccordement au réseau d'alimentation .....                                                                            | 195 |
| 10.1   | Tension d'alimentation .....                                                                                           | 195 |
| 10.2   | Tension d'alimentation multiple .....                                                                                  | 196 |
| 10.3   | Moyens de raccordement au circuit d'alimentation .....                                                                 | 196 |
| 10.4   | Marquage des bornes .....                                                                                              | 196 |
| 10.5   | Circuit de protection.....                                                                                             | 197 |
| 10.5.1 | Exigence de continuité du circuit de protection .....                                                                  | 197 |
| 10.5.2 | Essai de type.....                                                                                                     | 197 |
| 10.5.3 | Essai individuel de série .....                                                                                        | 198 |
| 10.6   | Serre-câble.....                                                                                                       | 198 |
| 10.7   | Entrées de câbles .....                                                                                                | 200 |
| 10.8   | Dispositif de commutation marche/arrêt sur le circuit d'alimentation.....                                              | 200 |
| 10.9   | Câbles d'alimentation.....                                                                                             | 201 |
| 10.10  | Dispositif de connexion à l'alimentation (fiche de prise de courant montée) .....                                      | 201 |
| 11     | Sortie .....                                                                                                           | 201 |
| 11.1   | Tension à vide assignée .....                                                                                          | 201 |
| 11.1.1 | Tension à vide assignée dans le cas d'environnements avec risque<br>accru de choc électrique .....                     | 201 |
| 11.1.2 | Tension à vide assignée dans le cas d'environnements sans risque<br>accru de choc électrique .....                     | 202 |
| 11.1.3 | Tension à vide assignée dans le cas de torches tenues mécaniquement<br>avec une protection accrue de l'opérateur ..... | 202 |
| 11.1.4 | Tension à vide assignée pour les procédés spéciaux, par exemple le<br>coupage par plasma .....                         | 202 |
| 11.1.5 | Exigences supplémentaires .....                                                                                        | 203 |
| 11.1.6 | Circuits de mesure.....                                                                                                | 203 |
| 11.2   | Valeurs d'essais de type de la tension conventionnelle en charge.....                                                  | 205 |
| 11.2.1 | Soudage manuel électrique à l'arc avec électrodes enrobées .....                                                       | 205 |

|        |                                                                                        |     |
|--------|----------------------------------------------------------------------------------------|-----|
| 11.2.2 | Soudage à l'arc en atmosphère inerte avec électrode de tungstène .....                 | 205 |
| 11.2.3 | Soudage à l'arc sous protection de gaz inerte / actif et avec fil fourré dans gaz..... | 205 |
| 11.2.4 | Soudage à l'arc sous flux en poudre .....                                              | 205 |
| 11.2.5 | Coupage par plasma.....                                                                | 205 |
| 11.2.6 | Soudage plasma.....                                                                    | 205 |
| 11.2.7 | Gougeage par plasma .....                                                              | 205 |
| 11.2.8 | Exigences supplémentaires .....                                                        | 205 |
| 11.3   | Dispositifs de commutation mécaniques utilisés pour ajuster la sortie .....            | 206 |
| 11.4   | Raccordement au circuit de soudage .....                                               | 206 |
| 11.4.1 | Protection contre les contacts involontaires .....                                     | 206 |
| 11.4.2 | Emplacement des dispositifs de connexion .....                                         | 206 |
| 11.4.3 | Ouvertures de sortie .....                                                             | 206 |
| 11.4.4 | Transformateur de soudage multiopérateur triphasé .....                                | 206 |
| 11.4.5 | Marquage .....                                                                         | 207 |
| 11.4.6 | Connexions pour les torches de coupage par plasma .....                                | 207 |
| 11.5   | Alimentation de dispositifs extérieurs raccordés au circuit de soudage.....            | 207 |
| 11.6   | Sortie d'alimentation auxiliaire .....                                                 | 208 |
| 11.7   | Câbles de soudage .....                                                                | 208 |
| 12     | Circuits de commande .....                                                             | 208 |
| 12.1   | Exigence générale .....                                                                | 208 |
| 12.2   | Isolation des circuits de commande .....                                               | 208 |
| 12.3   | Tensions locales des circuits de commande à distance.....                              | 209 |
| 13     | Dispositif réducteur de risques .....                                                  | 209 |
| 13.1   | Exigences générales.....                                                               | 209 |
| 13.2   | Types de dispositifs réducteurs de risques.....                                        | 209 |
| 13.2.1 | Dispositif réducteur de tension.....                                                   | 209 |
| 13.2.2 | Dispositif de commutation de courant alternatif à courant continu .....                | 210 |
| 13.3   | Exigences pour les dispositifs réducteurs de risques .....                             | 210 |
| 13.3.1 | Mise hors service d'un dispositif réducteur de risques .....                           | 210 |
| 13.3.2 | Interférences avec le fonctionnement d'un dispositif réducteur de risques .....        | 210 |
| 13.3.3 | Indicateur de fonctionnement satisfaisant .....                                        | 210 |
| 13.3.4 | Non-danger en cas de défaillance.....                                                  | 210 |
| 14     | Dispositions mécaniques .....                                                          | 210 |
| 14.1   | Exigences générales.....                                                               | 210 |
| 14.2   | Enveloppe.....                                                                         | 211 |
| 14.2.1 | Matériaux de l'enveloppe .....                                                         | 211 |
| 14.2.2 | Résistance de l'enveloppe .....                                                        | 211 |
| 14.3   | Moyens de manutention .....                                                            | 211 |
| 14.3.1 | Moyens de manutention mécanisés .....                                                  | 211 |
| 14.3.2 | Moyens de manutention manuels.....                                                     | 212 |
| 14.4   | Essai de chute .....                                                                   | 212 |
| 14.5   | Essai de stabilité.....                                                                | 213 |
| 15     | Plaque signalétique .....                                                              | 213 |
| 15.1   | Exigences générales.....                                                               | 213 |
| 15.2   | Description .....                                                                      | 213 |
| 15.3   | Contenu .....                                                                          | 214 |

|                                                                                                                                                                                   |                                                                     |     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------|-----|
| 15.4                                                                                                                                                                              | Tolérances .....                                                    | 217 |
| 15.5                                                                                                                                                                              | Direction de la rotation .....                                      | 218 |
| 16                                                                                                                                                                                | Réglage de la sortie .....                                          | 218 |
| 16.1                                                                                                                                                                              | Type de réglage .....                                               | 218 |
| 16.2                                                                                                                                                                              | Marquage du dispositif de réglage .....                             | 218 |
| 16.3                                                                                                                                                                              | Indication du dispositif de commande de courant ou de tension ..... | 219 |
| 17                                                                                                                                                                                | Instructions et marquages .....                                     | 219 |
| 17.1                                                                                                                                                                              | Instructions .....                                                  | 219 |
| 17.2                                                                                                                                                                              | Marquages .....                                                     | 220 |
| Annexe A (informative) Tensions nominales des réseaux d'alimentation .....                                                                                                        |                                                                     | 222 |
| Annexe B (informative) Exemple d'un essai diélectrique combiné .....                                                                                                              |                                                                     | 223 |
| Annexe C (normative) Charge déséquilibrée dans le cas de sources de courant de soudage à l'arc en atmosphère inerte avec électrode de tungstène (TIG) en courant alternatif ..... |                                                                     | 224 |
| C.1                                                                                                                                                                               | Généralités .....                                                   | 224 |
| C.2                                                                                                                                                                               | Charge déséquilibrée .....                                          | 225 |
| C.3                                                                                                                                                                               | Exemple d'une charge déséquilibrée .....                            | 225 |
| Annexe D (informative) Extrapolation de température par rapport au temps de coupure.....                                                                                          |                                                                     | 227 |
| Annexe E (normative) Construction des bornes de raccordement du circuit d'alimentation .....                                                                                      |                                                                     | 228 |
| E.1                                                                                                                                                                               | Dimensions des bornes .....                                         | 228 |
| E.2                                                                                                                                                                               | Raccordement aux bornes .....                                       | 228 |
| E.3                                                                                                                                                                               | Construction des bornes .....                                       | 229 |
| E.4                                                                                                                                                                               | Fixation des bornes .....                                           | 229 |
| Annexe F (informative) Correspondance avec les unités non SI .....                                                                                                                |                                                                     | 230 |
| Annexe G (informative) Adaptation du réseau d'alimentation pour le mesurage de la valeur efficace vraie du courant d'alimentation.....                                            |                                                                     | 231 |
| Annexe H (informative) Traçage des caractéristiques statiques .....                                                                                                               |                                                                     | 233 |
| H.1                                                                                                                                                                               | Généralités .....                                                   | 233 |
| H.2                                                                                                                                                                               | Méthode.....                                                        | 233 |
| H.3                                                                                                                                                                               | Analyse des résultats.....                                          | 233 |
| Annexe I (normative) Méthodes d'essai pour un choc de 10 Nm .....                                                                                                                 |                                                                     | 234 |
| I.1                                                                                                                                                                               | Marteau pendulaire de choc .....                                    | 234 |
| I.2                                                                                                                                                                               | Corps de chute sphérique en acier.....                              | 235 |
| Annexe J (normative) Épaisseur des tôles métalliques pour enveloppes .....                                                                                                        |                                                                     | 236 |
| Annexe K (informative) Exemples de plaques signalétiques .....                                                                                                                    |                                                                     | 239 |
| Annexe L (informative) Symboles graphiques pour le matériel de soudage électrique à l'arc .....                                                                                   |                                                                     | 246 |
| L.1                                                                                                                                                                               | Généralités .....                                                   | 246 |
| L.2                                                                                                                                                                               | Utilisation des symboles .....                                      | 246 |
| L.2.1                                                                                                                                                                             | Généralités .....                                                   | 246 |
| L.2.2                                                                                                                                                                             | Sélection des symboles .....                                        | 246 |
| L.2.3                                                                                                                                                                             | Dimension des symboles .....                                        | 246 |
| L.2.4                                                                                                                                                                             | Utilisation de la couleur .....                                     | 247 |
| L.3                                                                                                                                                                               | Symboles .....                                                      | 247 |
| L.3.1                                                                                                                                                                             | Généralités .....                                                   | 247 |
| L.3.2                                                                                                                                                                             | Symboles littéraux .....                                            | 247 |
| L.3.3                                                                                                                                                                             | Symboles graphiques .....                                           | 248 |

|                                                                                                      |                                                                           |     |
|------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------|-----|
| L.4                                                                                                  | Exemples de combinaisons de symboles .....                                | 268 |
| L.5                                                                                                  | Exemples de panneaux de commande .....                                    | 270 |
| Annexe M (informative) Mesurage du rendement énergétique et de la puissance en état au ralenti ..... |                                                                           | 273 |
| M.1                                                                                                  | Mesurage du rendement .....                                               | 273 |
| M.2                                                                                                  | Mesurage de la puissance en état au ralenti .....                         | 273 |
| Annexe N (normative) Mesurage du courant de contact en condition de défaut .....                     |                                                                           | 275 |
| Annexe O (normative) Sources de courant de soudage alimentées par batterie .....                     |                                                                           | 280 |
| O.1                                                                                                  | Généralités .....                                                         | 280 |
| O.4                                                                                                  | Conditions ambiantes.....                                                 | 281 |
| O.5                                                                                                  | Essais.....                                                               | 281 |
| O.5.1                                                                                                | Conditions d'essai .....                                                  | 281 |
| O.5.3                                                                                                | Conformité des composants.....                                            | 283 |
| O.6                                                                                                  | Protection contre les chocs électriques .....                             | 283 |
| O.6.1                                                                                                | Isolation.....                                                            | 283 |
| O.6.2                                                                                                | Protection contre les chocs électriques en service normal .....           | 285 |
| O.7                                                                                                  | Exigences thermiques.....                                                 | 285 |
| O.7.1                                                                                                | Essai d'échauffement .....                                                | 285 |
| O.7.2                                                                                                | Mesurage des températures .....                                           | 286 |
| O.7.4                                                                                                | Essai en charge.....                                                      | 286 |
| O.7.201                                                                                              | Chargement normal des systèmes ion-lithium .....                          | 287 |
| O.8                                                                                                  | Protection thermique.....                                                 | 288 |
| O.8.1                                                                                                | Exigences générales .....                                                 | 288 |
| O.8.4                                                                                                | Capacité de fonctionnement .....                                          | 288 |
| O.9                                                                                                  | Fonctionnement anormal.....                                               | 288 |
| O.9.1                                                                                                | Exigences générales .....                                                 | 288 |
| O.9.2                                                                                                | Essai de ventilateur bloqué.....                                          | 288 |
| O.9.3                                                                                                | Essai de courant de court-circuit.....                                    | 288 |
| O.9.4                                                                                                | Essai de surcharge .....                                                  | 289 |
| O.9.201                                                                                              | Source de courant de soudage – conditions anormales .....                 | 289 |
| O.9.202                                                                                              | Composants du circuit de soudage – conditions anormales .....             | 289 |
| O.9.203                                                                                              | Systèmes de charge ion-lithium – conditions anormales .....               | 290 |
| O.9.204                                                                                              | Court-circuit des batteries ion-lithium.....                              | 291 |
| O.9.205                                                                                              | Batteries autres que les batteries ion-lithium – surcharge .....          | 292 |
| O.9.206                                                                                              | Déconnexion du bloc de batteries .....                                    | 292 |
| O.9.207                                                                                              | Batteries à usage général .....                                           | 293 |
| O.10                                                                                                 | Raccordement au réseau d'alimentation.....                                | 293 |
| O.10.5                                                                                               | Circuit de protection .....                                               | 293 |
| O.10.8                                                                                               | Dispositif de commutation marche/arrêt sur le circuit d'alimentation..... | 293 |
| O.14                                                                                                 | Dispositions mécaniques.....                                              | 294 |
| O.14.1                                                                                               | Exigences générales .....                                                 | 294 |
| O.14.2                                                                                               | Enveloppe .....                                                           | 294 |
| O.14.4                                                                                               | Essai de chute .....                                                      | 294 |
| O.15                                                                                                 | Plaque signalétique .....                                                 | 296 |
| O.15.3                                                                                               | Contenu.....                                                              | 296 |
| O.17                                                                                                 | Instructions et marquages.....                                            | 297 |
| O.17.1                                                                                               | Instructions.....                                                         | 297 |
| O.17.2                                                                                               | Marquages .....                                                           | 298 |



|                                                      |     |
|------------------------------------------------------|-----|
| Annexe P (normative) Conformité des composants ..... | 299 |
| Bibliographie.....                                   | 301 |

|                                                                                                                                                                                                            |     |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----|
| Figure 1 – Exemple de configuration d'isolation pour le matériel de classe I .....                                                                                                                         | 176 |
| Figure 2 – Mesurage du courant de contact d'un circuit de soudage .....                                                                                                                                    | 184 |
| Figure 3 – Mesurage du courant de contact en condition normale .....                                                                                                                                       | 185 |
| Figure 4 – Mesurage des valeurs efficaces .....                                                                                                                                                            | 204 |
| Figure 5 – Mesurage des valeurs de crête .....                                                                                                                                                             | 204 |
| Figure 6 – Principe de la plaque signalétique.....                                                                                                                                                         | 214 |
| Figure B.1 – Transformateurs haute tension combinés.....                                                                                                                                                   | 223 |
| Figure C.1 – Tension et courant au cours du soudage TIG en courant alternatif.....                                                                                                                         | 224 |
| Figure C.2 – Tension déséquilibrée au cours du soudage TIG en courant alternatif .....                                                                                                                     | 225 |
| Figure C.3 – Source de courant alternatif de soudage avec charge déséquilibrée .....                                                                                                                       | 226 |
| Figure I.1 – Montage d'essai.....                                                                                                                                                                          | 234 |
| Figure K.1 – Transformateur monophasé .....                                                                                                                                                                | 239 |
| Figure K.2 – Convertisseur de fréquence rotatif triphasé.....                                                                                                                                              | 240 |
| Figure K.3 – Plaque signalétique subdivisée: transformateur redresseur mono-/triphasé ....                                                                                                                 | 241 |
| Figure K.4 – Moteur thermique-générateur-redresseur .....                                                                                                                                                  | 242 |
| Figure K.5 – Type d'onduleur mono-/triphasé.....                                                                                                                                                           | 243 |
| Figure K.6 – Source de courant de soudage alimentée par batterie incorporée .....                                                                                                                          | 244 |
| Figure K.7 – Source de courant de soudage alimentée par batterie<br>amovible/démontable .....                                                                                                              | 245 |
| Figure L.1 – Bouton d'amenée de tension.....                                                                                                                                                               | 271 |
| Figure L.2 – Potentiomètre de commande de la force de l'arc .....                                                                                                                                          | 271 |
| Figure L.3 – Prises de commande à distance et boutons de sélection .....                                                                                                                                   | 271 |
| Figure L.4 – Bornes avec sélecteurs d'inductance pour le soudage MIG/MAG .....                                                                                                                             | 271 |
| Figure L.5 – Bouton de choix de procédé (MMA, TIG, MIG) .....                                                                                                                                              | 272 |
| Figure L.6 – Bouton de sélection sur matériel à courant alternatif/continu .....                                                                                                                           | 272 |
| Figure L.7 – Voyants lumineux du panneau (surchauffe, défaut, amorçage d'arc,<br>tension de sortie) .....                                                                                                  | 272 |
| Figure L.8 – Réglage des paramètres de pulsation par affichage numérique .....                                                                                                                             | 272 |
| Figure N.1 – Réseau de mesure du courant de contact pondéré .....                                                                                                                                          | 275 |
| Figure N.2 – Diagramme pour le mesurage du courant de contact en condition de<br>défaut à la température de fonctionnement pour une connexion monophasée<br>d'appareils autres que ceux de classe II ..... | 277 |
| Figure N.3 – Diagramme pour le mesurage du courant de contact en condition de<br>défaut pour une connexion triphasée à quatre fils d'appareils autres que ceux de<br>classe II .....                       | 279 |
| Figure O.1 – Marquage des composants électriques de la classe de tension de<br>batterie B.....                                                                                                             | 298 |
| Figure P.1 – Diagramme pour les méthodes de conformité de l'Annexe P .....                                                                                                                                 | 300 |

|                                                                                                    |     |
|----------------------------------------------------------------------------------------------------|-----|
| Tableau 1 – Distances d'isolement dans l'air minimales pour la catégorie de<br>surtension III..... | 177 |
| Tableau 2 – Lignes de fuite minimales .....                                                        | 179 |

|                                                                                                                |     |
|----------------------------------------------------------------------------------------------------------------|-----|
| Tableau 3 – Résistance d'isolement.....                                                                        | 180 |
| Tableau 4 – Tensions d'essai diélectrique.....                                                                 | 181 |
| Tableau 5 – Distance minimale à travers l'isolation.....                                                       | 185 |
| Tableau 6 – Limites de température pour les enroulements, collecteurs et bagues collectrices .....             | 190 |
| Tableau 7 – Limites de température des surfaces externes .....                                                 | 191 |
| Tableau 8 – Section du conducteur de court-circuit de sortie .....                                             | 195 |
| Tableau 9 – Exigences de courant et de temps pour les circuits de protection .....                             | 198 |
| Tableau 10 – Section minimale du conducteur de protection externe en cuivre .....                              | 198 |
| Tableau 11 – Vérification de la continuité du circuit de protection .....                                      | 198 |
| Tableau 12 – Traction .....                                                                                    | 199 |
| Tableau 13 – Résumé des tensions à vide assignées admissibles .....                                            | 203 |
| Tableau 14 – Exigences pour le dispositif réducteur de risques .....                                           | 209 |
| Tableau E.1 – Plage de dimensions des conducteurs à introduire dans les bornes du circuit d'alimentation ..... | 228 |
| Tableau F.1 – Correspondance entre les mm <sup>2</sup> et les dimensions américaines (AWG).....                | 230 |
| Tableau I.1 – Angle de rotation $\theta$ pour obtenir un choc de 10 Nm.....                                    | 234 |
| Tableau I.2 – Masse du corps de chute et hauteur de chute.....                                                 | 235 |
| Tableau J.1 – Épaisseur minimale des tôles pour les enveloppes en acier .....                                  | 237 |
| Tableau J.2 – Épaisseur minimale des tôles pour enveloppes d'aluminium, de laiton ou de cuivre.....            | 238 |
| Tableau L.1 – Lettres utilisées comme symboles .....                                                           | 247 |

## COMMISSION ÉLECTROTECHNIQUE INTERNATIONALE

### MATÉRIEL DE SOUDAGE À L'ARC –

#### Partie 1: Sources de courant de soudage

##### AVANT-PROPOS

- 1) La Commission Électrotechnique Internationale (IEC) est une organisation mondiale de normalisation composée de l'ensemble des comités électrotechniques nationaux (Comités nationaux de l'IEC). L'IEC a pour objet de favoriser la coopération internationale pour toutes les questions de normalisation dans les domaines de l'électricité et de l'électronique. À cet effet, l'IEC – entre autres activités – publie des Normes Internationales, des Spécifications techniques, des Rapports techniques, des Spécifications accessibles au public (PAS) et des Guides (ci-après dénommés "Publication(s) de l'IEC"). Leur élaboration est confiée à des comités d'études, aux travaux desquels tout Comité national intéressé par le sujet traité peut participer. Les organisations internationales, gouvernementales et non gouvernementales, en liaison avec l'IEC, participent également aux travaux. L'IEC collabore étroitement avec l'Organisation Internationale de Normalisation (ISO), selon des conditions fixées par accord entre les deux organisations.
- 2) Les décisions ou accords officiels de l'IEC concernant les questions techniques représentent, dans la mesure du possible, un accord international sur les sujets étudiés, étant donné que les Comités nationaux de l'IEC intéressés sont représentés dans chaque comité d'études.
- 3) Les Publications de l'IEC se présentent sous la forme de recommandations internationales et sont agréées comme telles par les Comités nationaux de l'IEC. Tous les efforts raisonnables sont entrepris afin que l'IEC s'assure de l'exactitude du contenu technique de ses publications; l'IEC ne peut pas être tenue responsable de l'éventuelle mauvaise utilisation ou interprétation qui en est faite par un quelconque utilisateur final.
- 4) Dans le but d'encourager l'uniformité internationale, les Comités nationaux de l'IEC s'engagent, dans toute la mesure possible, à appliquer de façon transparente les Publications de l'IEC dans leurs publications nationales et régionales. Toutes divergences entre toutes Publications de l'IEC et toutes publications nationales ou régionales correspondantes doivent être indiquées en termes clairs dans ces dernières.
- 5) L'IEC elle-même ne fournit aucune attestation de conformité. Des organismes de certification indépendants fournissent des services d'évaluation de conformité et, dans certains secteurs, accèdent aux marques de conformité de l'IEC. L'IEC n'est responsable d'aucun des services effectués par les organismes de certification indépendants.
- 6) Tous les utilisateurs doivent s'assurer qu'ils sont en possession de la dernière édition de cette publication.
- 7) Aucune responsabilité ne doit être imputée à l'IEC, à ses administrateurs, employés, auxiliaires ou mandataires, y compris ses experts particuliers et les membres de ses comités d'études et des Comités nationaux de l'IEC, pour tout préjudice causé en cas de dommages corporels et matériels, ou de tout autre dommage de quelque nature que ce soit, directe ou indirecte, ou pour supporter les coûts (y compris les frais de justice) et les dépenses découlant de la publication ou de l'utilisation de cette Publication de l'IEC ou de toute autre Publication de l'IEC, ou au crédit qui lui est accordé.
- 8) L'attention est attirée sur les références normatives citées dans cette publication. L'utilisation de publications référencées est obligatoire pour une application correcte de la présente publication.
- 9) L'attention est attirée sur le fait que certains des éléments de la présente Publication de l'IEC peuvent faire l'objet de droits de brevet. L'IEC ne saurait être tenue pour responsable de ne pas avoir identifié de tels droits de brevets et de ne pas avoir signalé leur existence.

**Cette version consolidée de la Norme IEC officielle et de son amendement a été préparée pour la commodité de l'utilisateur.**

**L'IEC 60974-1 édition 5.1 contient la cinquième édition (2017-02) [documents 26/610/FDIS et 26/613/RVD] et son amendement 1 (2019-01) [documents 26/653/CDV et 26/669/RVC].**

**Cette version Finale ne montre pas les modifications apportées au contenu technique par l'amendement 1. Une version Redline montrant toutes les modifications est disponible dans cette publication.**

La Norme internationale IEC 60974-1 a été établie par le comité d'études 26 de l'IEC: Soudage électrique.

Cette cinquième édition constitue une révision technique.

Les modifications majeures par rapport à l'édition précédente sont les suivantes:

- amélioration de la Figure 1 (6.1.1);
- modification du Tableau 3 (6.1.4);
- description des mesurages du rendement énergétique dans l'Annexe M;
- introduction des sources de courant de soudage alimentées par batterie dans le domaine d'application. Les exigences sont donc décrites dans l'Annexe O.

Cette publication a été rédigée selon les Directives ISO/IEC, Partie 2.

Dans la présente norme, les caractères d'imprimerie suivants sont utilisés:

- critères de conformité: caractères *italiques*.
- termes définis à l'Article 3: caractères **gras**.

Une liste de toutes les parties de la série IEC 60974, publiées sous le titre général *Matériel de soudage à l'arc*, peut être consultée sur le site web de l'IEC.

Le comité a décidé que le contenu de la publication de base et de son amendement ne sera pas modifié avant la date de stabilité indiquée sur le site web de l'IEC sous "<http://webstore.iec.ch>" dans les données relatives à la publication recherchée. A cette date, la publication sera

- reconduite,
- supprimée,
- remplacée par une édition révisée, ou
- amendée.

**IMPORTANT – Le logo "colour inside" qui se trouve sur la page de couverture de cette publication indique qu'elle contient des couleurs qui sont considérées comme utiles à une bonne compréhension de son contenu. Les utilisateurs devraient, par conséquent, imprimer cette publication en utilisant une imprimante couleur.**

## MATÉRIEL DE SOUDAGE À L'ARC –

### Partie 1: Sources de courant de soudage

#### 1 Domaine d'application

La présente partie de l'IEC 60974 s'applique aux sources de courant de soudage à l'arc et aux procédés connexes conçus pour un **usage industriel et professionnel** qui sont alimentés sous une tension ne dépassant pas 1000 V, alimentés par batterie ou entraînés par des moyens mécaniques.

Le présent document spécifie les exigences de sécurité et de fonctionnement des sources de courant de soudage et des **systèmes de coupage par plasma**.

Le présent document ne s'applique pas aux sources de courant de soudage et de coupage à l'arc à service limité qui sont utilisées essentiellement par des non professionnels et qui sont conçues selon l'IEC 60974-6.

Le présent document inclut les exigences relatives aux sources de courant de soudage alimentées par batterie et aux blocs de batteries qui sont donnés à l'Annexe O.

Le présent document ne s'applique pas aux essais des sources de courant pendant l'entretien périodique ou après réparation.

NOTE 1 Des procédés connexes typiques sont le coupage à l'arc électrique et la projection à l'arc électrique.

NOTE 2 Des systèmes en courant alternatif possédant une tension nominale comprise entre 100 V et 1000 V sont présentés dans le Tableau 1 de l'IEC 60038:2009.

NOTE 3 Le présent document ne contient pas les exigences de compatibilité électromagnétique (CEM).

#### 2 Références normatives

Les documents suivants cités dans le texte constituent, pour tout ou partie de leur contenu, des exigences du présent document. Pour les références datées, seule l'édition citée s'applique. Pour les références non datées, la dernière édition du document de référence s'applique (y compris les éventuels amendements).

IEC 60050-151, *Vocabulaire Électrotechnique International – Partie 151: Dispositifs électriques et magnétiques* (disponible sous: <http://www.electropedia.org>)

IEC 60050-851, *Vocabulaire Électrotechnique International – Partie 851: Soudage électrique* (disponible sous: <http://www.electropedia.org>)

IEC 60245-6, *Conducteurs et câbles isolés au caoutchouc – Tension assignée au plus égale à 450/750 V – Partie 6: Câbles souples pour électrodes de soudage à l'arc*

IEC 60417, *Symboles graphiques utilisables sur le matériel* (disponible sous: <http://www.graphical-symbols.info/equipment>)

IEC 60445, *Principes fondamentaux et de sécurité pour les interfaces homme-machines, le marquage et l'identification – Identification des bornes de matériels, des extrémités de conducteurs et des conducteurs*

IEC 60529, *Degrés de protection procurés par les enveloppes (Code IP)*

IEC 60664-1:2007, *Coordination de l'isolement des matériels dans les systèmes (réseaux) à basse tension – Partie 1: Principes, exigences et essais*

IEC 60664-3, *Coordination de l'isolement des matériels dans les systèmes (réseaux) à basse tension – Partie 3: Utilisation de revêtement, d'empotage ou de moulage pour la protection contre la pollution*

IEC 60695-11-10, *Essais relatifs aux risques du feu – Partie 11-10: Flammes d'essai – Méthodes d'essai horizontal et vertical à la flamme de 50 W*

IEC 60974-7, *Matériel de soudage à l'arc – Partie 7: Torches*

IEC 61140, *Protection contre les chocs électriques – Aspects communs aux installations et aux matériels*

IEC 61558-2-4, *Sécurité des transformateurs, bobines d'inductance, blocs d'alimentation et produits analogues pour des tensions d'alimentation jusqu'à 1 100 V – Partie 2-4: Règles particulières et essais pour les transformateurs de séparation des circuits et les blocs d'alimentation incorporant des transformateurs de séparation des circuits*

IEC 61558-2-6, *Sécurité des transformateurs, bobines d'inductance, blocs d'alimentation et produits analogues pour des tensions d'alimentation jusqu'à 1 100 V – Partie 2-6: Règles particulières et essais pour les transformateurs de sécurité et les blocs d'alimentation incorporant des transformateurs de sécurité*

IEC 62133-1:— 1, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary cells, and for batteries made from them, for use in portable applications – Part 1: Nickel systems* (disponible en anglais seulement)

IEC 62133-2:— 2, *Secondary cells and batteries containing alkaline or other non-acid electrolytes – Safety requirements for portable sealed secondary lithium cells, and for batteries made from them, for use in portable applications – Part 2: Lithium systems* (disponible en anglais seulement)

ISO 7010:2011, *Symboles graphiques – Couleurs de sécurité et signaux de sécurité – Signaux de sécurité enregistrés*

### 3 Termes et définitions

Pour les besoins du présent document, les termes et définitions donnés dans l'IEC 60050-151, l'IEC 60050-851 et l'IEC 60664-1 ainsi que les suivants s'appliquent.

L'ISO et l'IEC tiennent à jour des bases de données terminologiques destinées à être utilisées en normalisation, consultables aux adresses suivantes:

- IEC Electropedia: disponible à l'adresse <http://www.electropedia.org/>
- ISO Online browsing platform: disponible à l'adresse <http://www.iso.org/obp>

<sup>1</sup> En préparation. Stade au moment de la publication: IEC CDV 62133-1:2015.

<sup>2</sup> En préparation. Stade au moment de la publication: IEC CDV 62133-2:2015.

### 3.1 Termes généraux

#### 3.1.1

##### **source de courant de soudage**

##### **source de courant de soudage à l'arc**

équipement destiné à fournir un courant électrique et une tension et ayant des caractéristiques appropriées au soudage à l'arc et à des procédés connexes

Note 1 à l'article: Une **source de courant de soudage** peut également alimenter d'autres équipements et accessoires, par exemple des tensions auxiliaires, liquide de refroidissement, électrode fusible pour soudage à l'arc et gaz pour la protection de l'arc et de la zone de soudage.

Note 2 à l'article: Cet article révisé l'IEV 851-13-01, qui sera mis à jour.

#### 3.1.2

##### **usage industriel et professionnel**

usage prévu uniquement par des **experts** ou des **personnes averties**

[SOURCE: IEC 60050-851:2008, 851-11-12]

#### 3.1.3

##### **expert**

##### **personne compétente**

##### **personne qualifiée**

personne qui peut juger le travail assigné et reconnaître les dangers possibles sur la base de sa formation, ses connaissances, son expérience et sa connaissance du matériel concerné

Note 1 à l'article: Plusieurs années de pratique dans le domaine technique concerné peuvent être prises en considération pour l'estimation de la formation professionnelle.

[SOURCE: IEC 60050-851:2008, 851-11-10]

#### 3.1.4

##### **personne avertie**

personne informée des tâches assignées et des dangers possibles dus à des négligences

Note 1 à l'article: Si nécessaire, la personne a subi une formation.

[SOURCE: IEC 60050-851:2008, 851-11-13]

#### 3.1.5

##### **essai de type**

essai effectué sur un ou plusieurs dispositifs réalisés selon une conception donnée, afin de vérifier si ces dispositifs satisfont aux exigences de la norme concernée

[SOURCE: IEC 60050-851:2008, 851-12-05]

#### 3.1.6

##### **essai individuel de série**

essai effectué sur chaque dispositif en cours ou en fin de fabrication pour vérifier qu'il satisfait aux exigences de la norme concernée ou à des critères spécifiés

[SOURCE: IEC 60050-851:2008, 851-12-06]

#### 3.1.7

##### **examen visuel**

examen à l'œil nu destiné à vérifier qu'il n'y a pas de désaccord apparent par rapport aux dispositions de la norme concernée

[SOURCE: IEC 60050-851:2008, 851-11-11]

### 3.1.8

#### **caractéristique tombante**

**caractéristique** externe **statique** d'une source de courant de soudage qui, dans la zone normale de soudage, est telle que la pente négative est supérieure ou égale à 7 V/100 A

Note 1 à l'article: Cet article révisé l'IEV 851-12-34, qui sera mis à jour.

### 3.1.9

#### **caractéristique plate**

**caractéristique** externe **statique** d'une source de courant de soudage qui, dans la zone normale de soudage, est telle que lorsque le courant croît, la tension décroît de moins de 7 V/100 A ou croît de moins de 10 V/100 A

[SOURCE: IEC 60050-851:2008, 851-12-35]

### 3.1.10

#### **caractéristique statique**

relation entre la tension et le courant aux bornes de sortie d'une source de courant de soudage quand elle est connectée à une **charge conventionnelle**

Note 1 à l'article: Cet article révisé l'IEV 851-12-32, qui sera mis à jour.

### 3.1.11

#### **circuit de soudage**

tous les éléments conducteurs à travers lesquels le passage du **courant de soudage** est prévu

Note 1 à l'article: En soudage à l'arc, l'arc fait partie du **circuit de soudage**.

Note 2 à l'article: Dans certains procédés de soudage à l'arc, l'arc peut être établi entre deux électrodes. Dans un tel cas, la pièce mise en œuvre ne fait pas nécessairement partie du **circuit de soudage**.

[SOURCE: IEC 60050-851:2008, 851-14-10]

### 3.1.12

#### **circuit de commande**

circuit interne ou externe servant à commander le fonctionnement du matériel et/ou la protection des circuits de puissance

EXEMPLE 1 **Circuits de commande** destinés à réaliser l'interface entre la source de courant de soudage et un matériel externe conçu par le constructeur.

EXEMPLE 2 **Circuits de commande** destinés à réaliser l'interface entre la source de courant de soudage et d'autres types de matériels accessoires.

Note 1 à l'article: Cet article révisé l'IEV 851-14-11, qui sera mis à jour.

### 3.1.13

#### **courant de soudage**

courant fourni par une source de courant de soudage pendant le soudage

### 3.1.14

#### **tension en charge**

tension entre les bornes de sortie lorsque la source de courant de soudage débite un **courant de soudage**

[SOURCE: IEC 60050-851:2008, 851-12-04]



### 3.1.15

#### **tension à vide**

tension, à l'exclusion de toute tension d'amorçage ou de stabilisation, se trouvant entre les bornes de sortie accessibles d'une source de courant de soudage lorsque le **circuit de soudage** est ouvert, mais sous tension

Note 1 à l'article: Cet article révisé l'IEV 851-12-24, qui sera mis à jour.

### 3.1.16

#### **valeur conventionnelle**

valeur normalisée utilisée pour la mesure d'un paramètre en vue de comparaison, étalonnage, essai, etc.

Note 1 à l'article: Les **valeurs conventionnelles** ne s'appliquent pas nécessairement au cours d'une opération de soudage.

[SOURCE: IEC 60050-851:2008, 851-12-07]

### 3.1.17

#### **condition conventionnelle de soudage**

condition de la source de courant de soudage sous tension et à l'état thermiquement stabilisé définie par un **courant de soudage conventionnel** établi sous la **tension conventionnelle en charge** correspondante dans une **charge conventionnelle** pour la **tension d'alimentation**, la fréquence ou la vitesse de rotation assignées

[SOURCE: IEC 60050-851:2008, 851-12-26]

### 3.1.18

#### **charge conventionnelle**

charge résistive constante pratiquement non inductive ayant un facteur de puissance non inférieur à 0,99

[SOURCE: IEC 60050-851:2008, 851-12-27]

### 3.1.19

#### **courant de soudage conventionnel**

$I_2$

courant débité par une source de courant de soudage dans une **charge conventionnelle** sous la **tension conventionnelle en charge** correspondante

Note 1 à l'article: Les valeurs de  $I_2$  sont données en valeurs efficaces pour le courant alternatif et en valeurs arithmétiques moyennes pour le courant continu.

### 3.1.20

#### **tension conventionnelle en charge**

$U_2$

**tension en charge** d'une source de courant de soudage, liée au **courant conventionnel de soudage** par une relation linéaire spécifiée

Note 1 à l'article: Les valeurs de  $U_2$  sont données en valeurs efficaces pour le courant alternatif et en valeurs moyennes arithmétiques pour le courant continu.

Note 2 à l'article: La relation linéaire spécifiée varie suivant le procédé de soudage (voir 11.2).

Note 1 à l'article: Cet article révisé l'IEV 851-12-30, qui sera mis à jour.

### 3.1.21

#### **valeur assignée**

valeur, assignée généralement par le constructeur, pour une condition de fonctionnement spécifiée d'un composant, d'un dispositif ou d'un matériel

### 3.1.22

#### **plaque signalétique**

plaque, fixée de façon permanente sur un dispositif électrique, où sont inscrites de façon indélébile les caractéristiques assignées et d'autres informations, selon les exigences de la norme applicable

[SOURCE: IEC 60050-151:2001, 151-16-12]

### 3.1.23

#### **puissance assignée**

**valeurs assignées** de la puissance de l'équipement

Note 1 à l'article: Cet article révisé l'IEV 851-12-17, qui sera mis à jour.

### 3.1.24

#### **courant de soudage assigné maximal**

$I_{2max}$

valeur maximale du **courant conventionnel de soudage** pouvant être fournie par la source de courant de soudage à son réglage maximal dans la **condition conventionnelle de soudage**

[SOURCE: IEC 60050-851:2008, 851-12-14]

### 3.1.25

#### **courant de soudage assigné minimal**

$I_{2min}$

valeur minimale du **courant conventionnel de soudage** qui peut être fournie par la source de courant de soudage à son réglage minimal dans les **conditions conventionnelles de soudage**

[SOURCE: IEC 60050-851:2008, 851-12-15]

### 3.1.26

#### **tension à vide assignée**

$U_0$

**tension à vide** dans les conditions assignées de tension d'alimentation et de fréquence ou de **vitesse de rotation assignée à vide**

Note 1 à l'article: Si une source de courant de soudage est équipée d'un **dispositif réducteur de risques**, il s'agit de la tension mesurée avant que le **dispositif réducteur de risques** n'ait rempli sa fonction.

### 3.1.27

#### **tension à vide assignée réduite**

$U_r$

**tension à vide** d'une source de courant de soudage équipée d'un dispositif réducteur de tension immédiatement après l'action du dispositif pour diminuer la tension

### 3.1.28

#### **tension à vide assignée commutée**

$U_s$

**tension continue à vide** d'une source de courant de soudage équipée d'un dispositif de commutation courant alternatif à courant continu

### 3.1.29

#### **tension assignée d'alimentation**

$U_1$

valeur efficace d'une tension d'alimentation pour laquelle le matériel est conçu

**3.1.30**  
**courant assigné d'alimentation**

$I_1$   
valeur efficace d'un courant d'alimentation absorbé par la source de courant de soudage dans une **condition conventionnelle de soudage** assignée

**3.1.31**  
**courant d'alimentation assigné à vide**

$I_0$   
valeur efficace d'un courant d'alimentation absorbé par la source de courant de soudage à **tension à vide assignée**

**3.1.32**  
**courant d'alimentation assigné maximal**

$I_{1\max}$   
valeur maximale du **courant d'alimentation assigné**

Note 1 à l'article: Cet article révisé l'IEV 851-12-13, qui sera mis à jour.

**3.1.33**  
**courant d'alimentation effectif maximal**

$I_{1\text{eff}}$   
valeur maximale du courant effectif d'alimentation, calculée à partir du **courant d'alimentation assigné** ( $I_1$ ), du **facteur de marche** ( $X$ ) correspondant et du courant d'alimentation à vide ( $I_0$ ), par la formule:

$$I_{1\text{eff}} = \sqrt{I_1^2 \times X + I_0^2 \times (1 - X)}$$

Note 1 à l'article: Le courant d'alimentation effectif maximal n'est pas toujours calculé au facteur de marche correspondant au courant d'alimentation assigné maximal.

[SOURCE: IEC 60050-851:2008, 851-12-39]

**3.1.34**  
**vitesse assignée en charge**

$n$   
vitesse de rotation d'un groupe électrogène de soudage lorsqu'il fonctionne au **courant de soudage assigné maximal**

Note 1 à l'article: Cet article révisé l'IEV 851-12-12, qui sera mis à jour.

**3.1.35**  
**vitesse de rotation assignée à vide**

$n_0$   
vitesse de rotation d'un groupe électrogène de soudage lorsque le **circuit de soudage** extérieur est ouvert

Note 1 à l'article: Si un moteur thermique est équipé d'un dispositif réducteur de vitesse en l'absence de soudage,  $n_0$  sera mesurée avant fonctionnement de ce dispositif.

Note 2 à l'article: Cet article révisé l'IEV 851-12-16, qui sera mis à jour.

**3.1.36**  
**vitesse de rotation assignée au ralenti**

$n_i$   
vitesse à vide réduite d'une source de courant de soudage pilotée par un moteur

[SOURCE: IEC 60050-851:2008, 851-12-18]

### 3.1.37 facteur de marche

X

REPLACÉ: cycle de marche  
rapport, sur un intervalle de temps donné, de la durée en charge non interrompue à la durée totale

Note 1 à l'article: Ce rapport, compris entre 0 et 1, est exprimé en pourcentage.

Note 2 à l'article: Pour les besoins du présent document, la durée complète d'un cycle est de 10 min. Par exemple, dans le cas d'un **facteur de marche** de 60 %, une période de charge continue de 6 min est suivie d'une période de marche à vide de 4 min.

### 3.1.38 distance d'isolement dans l'air distance d'isolement distance la plus courte dans l'air entre deux parties conductrices

[SOURCE: IEC 60664-1:2007, 3.2]

### 3.1.39 ligne de fuite distance la plus courte, le long de la surface d'un isolant solide, entre deux parties conductrices

[SOURCE: IEC 60664-1:2007, 3.3]

### 3.1.40 degré de pollution nombre caractérisant la pollution prévue du **micro-environnement**

Note 1 à l'article: Afin d'évaluer les **lignes de fuite** et les **distances d'isolement dans l'air**, les quatre **degrés de pollution** suivants sont définis au 4.6.2 de l'IEC 60664-1:2007 pour le **micro-environnement**.

- a) **Degré de pollution 1:** Il n'existe pas de pollution ou il se produit seulement une pollution sèche, non conductrice. La pollution n'a pas d'influence.
- b) **Degré de pollution 2:** Il ne se produit qu'une pollution non conductrice. Cependant, dans certains cas, une conductivité temporaire provoquée par la condensation doit être envisagée.
- c) **Degré de pollution 3:** Présence d'une pollution conductrice ou d'une pollution sèche, non conductrice, qui devient conductrice par suite de la condensation qui peut se produire.
- d) **Degré de pollution 4:** Une conductivité persistante apparaît, due à la poussière conductrice, à la pluie ou à la neige.

[SOURCE: IEC 60664-1:2007, 3.13, modifiée – Modification de la Note à l'article.]

### 3.1.41 micro-environnement environnement immédiat de l'isolation qui influence en particulier le dimensionnement des **lignes de fuite**

[SOURCE: IEC 60664-1:2007, 3.12.2]

### 3.1.42 groupe de matériau matériaux classés en quatre groupes selon les valeurs de leur indice de résistance au cheminement (IRC) conformément à l'IEC 60664-1

Note 1 à l'article: Les quatre groupes suivants sont définis dans l'IEC 60664-1:

- Groupe de matériau I  $600 \leq \text{IRC}$

- Groupe de matériau II  $400 \leq IRC < 600$
- Groupe de matériau IIIa  $175 \leq IRC < 400$
- Groupe de matériau IIIb  $100 \leq IRC < 175$

### 3.1.43

#### **échauffement**

différence entre la température d'une partie du matériel et celle de l'air ambiant

### 3.1.44

#### **équilibre thermique**

état atteint lorsque l'**échauffement** constaté d'une partie quelconque du matériel ne dépasse pas 2 K/h

### 3.1.45

#### **protection thermique**

système destiné à assurer la protection d'une partie, et donc l'ensemble de l'équipement contre les températures excessives résultant de certaines conditions de surcharge thermique

Note 1 à l'article: Elle peut être réarmée (soit manuellement, soit automatiquement) lorsque la température redescend à la valeur de réencenchement.

Note 2 à l'article: Cet article révisé l'IEV 851-15-03, qui sera mis à jour.

### 3.1.46

#### **environnement avec risque accru de choc électrique**

environnement dans lequel la probabilité de choc électrique due au soudage à l'arc est accrue par rapport aux conditions normales du soudage à l'arc

Note 1 à l'article: De tels environnements se trouvent, par exemple:

- a) dans des emplacements où la liberté de mouvement restreinte oblige l'opérateur à souder dans une position inconfortable (à genoux, assis, allongé, par exemple), en contact physique avec des parties conductrices;
- b) dans des emplacements totalement ou partiellement limités par des éléments conducteurs, présentant une probabilité élevée de contact involontaire ou accidentel par l'opérateur;
- c) dans des emplacements mouillés, humides ou chauds lorsque l'humidité ou la transpiration réduit considérablement la résistance de la peau du corps humain et les propriétés isolantes des accessoires.

### 3.1.47

#### **dispositif réducteur de risques**

dispositif conçu pour réduire le danger de choc électrique pouvant résulter de la **tension à vide**

[SOURCE: IEC 60050-851:2008, 851-15-01]

### 3.1.48

#### **matériel de classe I**

matériel dont l'**isolation principale** est la disposition de protection principale et dont l'équipotentialité de protection assure la protection contre les défauts

[SOURCE: IEC 60050-851:2008, 851-15-10]

### 3.1.49

#### **matériel de classe II**

matériel dont l'**isolation principale** est la mesure de protection principale, et l'**isolation supplémentaire** est la mesure de protection en cas de défaut, ou dont les protections principales et protections en cas de défaut sont assurées par une **isolation renforcée**

[SOURCE: IEC 60050-851:2008, 851-15-11]

### 3.1.50

#### **isolation principale**

isolation des parties actives dangereuses qui assure la protection principale

[SOURCE: IEC 60050-851:2008, 851-15-04]

### 3.1.51

#### **isolation supplémentaire**

isolation indépendante prévue, en plus de l'**isolation principale**, en tant que protection en cas de défaut

[SOURCE: IEC 60050-851:2008, 851-15-05]

### 3.1.52

#### **double isolation**

isolation comprenant à la fois une **isolation principale** et une **isolation supplémentaire**

[SOURCE: IEC 60050-851:2008, 851-15-06]

### 3.1.53

#### **isolation renforcée**

isolation des parties actives dangereuses assurant un degré de protection contre les chocs électriques équivalant à celui d'une **double isolation**

Note 1 à l'article: L'**isolation renforcée** peut comporter plusieurs couches qui ne peuvent pas être essayées séparément en tant qu'**isolation principale** ou **isolation supplémentaire**.

[SOURCE: IEC 60050-851:2008, 851-15-07]

### 3.1.54

#### **système de coupage par plasma**

combinaison de source de courant électrique, torche et dispositifs de sécurité associés pour le coupage et le gougeage par plasma

[SOURCE: IEC 60050-851:2008, 851-13-03]

### 3.1.55

#### **source de courant électrique de coupage par plasma**

équipement destiné à fournir un courant électrique et une tension, ayant des caractéristiques appropriées pour le coupage et le gougeage par plasma et pouvant fournir du gaz et du liquide de refroidissement

Note 1 à l'article: Une **source de courant électrique de coupage plasma** peut également fournir des services à d'autres équipements et accessoires, par exemple tensions auxiliaires, liquide de refroidissement et gaz.

[SOURCE: IEC 60050-851:2008, 851-13-04]

### 3.1.56

#### **très basse tension de sécurité**

##### **TBTS**

tension n'excédant pas 50 V en courant alternatif ou 120 V en courant continu lissé entre conducteurs ou entre un conducteur quelconque et la terre dans un circuit dont la séparation du réseau d'alimentation est assurée par des moyens tels qu'un transformateur de sécurité

Note 1 à l'article: Une tension maximale inférieure à 50 V en courant alternatif ou 120 V en courant continu lissé peut être spécifiée dans des règles particulières, plus spécialement lorsque le contact direct avec des parties actives est possible.

Note 2 à l'article: Lorsque la source est un transformateur de sécurité, il convient que la limite de tension ne soit pas dépassée à toute charge comprise entre la pleine charge et à vide.

Note 3 à l'article: «Lissé» se dit par convention d'une tension en courant continu lorsque le rapport de la valeur efficace de l'ondulation à la composante continue ne dépasse pas 10 %. La valeur crête maximale ne dépasse pas 140 V pour un système en courant continu lissé de tension nominale 120 V, et 70 V pour un système en courant continu lissé de tension nominale 60 V.

Note 4 à l'article: Cet article révisé l'IEV 851-15-08, qui sera mis à jour.

### 3.1.57

#### **circuit d'alimentation**

circuit d'entrée

matériau conducteur dans le matériel, à travers lequel le passage du courant d'alimentation est prévu

### 3.1.58

#### **tension locale**

valeur efficace la plus élevée de la tension en courant alternatif ou continu qui peut apparaître à travers n'importe quelle isolation lorsqu'un matériel est alimenté sous la tension assignée

Note 1 à l'article: Les surtensions transitoires sont négligées.

Note 2 à l'article: Il est tenu compte à la fois des conditions à vide et des conditions normales de fonctionnement.

[SOURCE: IEC 60050-851:2008, 851-12-31]

### 3.1.59

#### **courant de contact**

courant électrique passant dans le corps humain ou dans le corps d'un animal lorsque ce corps est en contact avec une ou plusieurs parties accessibles d'une installation ou de matériels

Note 1 à l'article: Le **courant de contact** est mesuré à l'aide d'un réseau de mesure simulant l'impédance du corps humain.

[SOURCE: IEC 60050-195:1998/AMD1:2001, 195-05-21, modifiée – Ajout d'une note à l'article.]

### 3.1.60

#### **commande à distance**

dispositif ou circuit extérieur au matériel, utilisé pour la surveillance ou la commande du fonctionnement

### 3.1.61

#### **condition de défaut simple**

condition dans laquelle un seul moyen de protection contre les dangers est défectueux

Note 1 à l'article: Lorsqu'une **condition de défaut simple** résulte dans une autre **condition de défaut simple**, les deux défauts sont considérés comme une **condition de défaut simple**.

### 3.1.62

#### **installation fixe**

combinaison particulière de plusieurs types d'appareils et, le cas échéant, d'autres dispositifs, qui sont assemblés, installés et destinés à être utilisés de façon permanente sur un emplacement prédéfini

### 3.1.63

#### **circuit de protection**

circuit destiné à être relié à la terre de protection pour la protection contre les chocs électriques

### 3.1.64

#### **classe d'isolation**

repère dans une nomenclature appliquée à un matériau d'isolation utilisé dans les machines ou appareils électriques et spécifiant la nature des matériaux et la limite de température recommandée

[SOURCE: IEC 60050-811:1991, 811-13-33]

### 3.1.65

#### **isolation fonctionnelle**

isolation entre parties conductrices, nécessaire pour le bon fonctionnement du matériel

[SOURCE: IEC 60050-195:1998, 195-02-41]

### 3.1.66

#### **état au ralenti**

état de fonctionnement dans lequel l'alimentation est activée mais le **circuit de soudage** n'est pas mis sous tension

Note 1 à l'article: Pour certains types de matériels, il n'y a pas d'**état au ralenti**, mais un état de soudage précédant l'amorçage de l'arc.

Note 2 à l'article: Pour une source de courant dans un système mécanisé, la configuration réalisant l'**état au ralenti** est définie par le constructeur.

Note 3 à l'article: Un **état au ralenti** peut inclure un état énergétique faible dans lequel un procédé de soudage ne peut être initié sans une réactivation automatique ou manuelle.

## 3.2 Termes relatifs aux systèmes de batterie

### 3.2.1

#### **batterie**

assemblage d'un ou de plusieurs **éléments** destinés à fournir du courant électrique à la source de courant de soudage

### 3.2.2

#### **batterie incorporée**

**batterie** qui est placée à l'intérieur de la source de courant de soudage alimentée par batterie et qui n'est pas retirée de cette source pour le chargement

Note 1 à l'article: Une **batterie** qui doit être retirée de la source de courant de soudage alimentée par batterie uniquement pour sa mise au rebut ou son recyclage est considérée comme une **batterie incorporée**.

### 3.2.3

#### **bloc de batteries amovibles**

**batterie** qui est à l'intérieur d'une enveloppe séparée de la source de courant de soudage alimentée par batterie et qui est destinée à être retirée de cette source pour le chargement

### 3.2.4

#### **bloc de batteries démontables**

**batterie** qui est à l'intérieur d'une enveloppe séparée de la source de courant de soudage alimentée par batterie et qui est raccordée à cette source par un câble

### 3.2.5

#### **système de batterie**

combinaison d'une **batterie**, du **système de charge**, de la source de courant de soudage et des interfaces entre eux tels qu'ils existent pendant le fonctionnement de la source de courant de soudage ou pendant le chargement



### 3.2.6

#### **régime C<sub>5</sub>**

courant, en ampères, auquel un **élément** ou une **batterie** peut être déchargé(e) pendant 5 h au point de coupure de la tension spécifié par le constructeur d'**éléments**

### 3.2.7

#### **élément**

unité fonctionnelle de base, consistant en un assemblage d'électrodes, d'électrolyte, de conteneur, de bornes et généralement de séparateurs, qui est une source d'énergie électrique obtenue par transformation directe d'énergie chimique

[SOURCE: IEC 60050-482:2004, 482-01-01]

### 3.2.8

#### **chargeur**

tout ou partie du **système de charge** contenu dans une enveloppe séparée

Note 1 à l'article: Au minimum, le **chargeur** comprend certains des circuits de conversion du courant. Tous les **systèmes de charge** ne possèdent pas un **chargeur** séparé comme dans le cas où une source de courant de soudage peut être chargée en utilisant un câble d'alimentation secteur ou peut incorporer une fiche de prise de courant pour sa fixation à une prise secteur.

### 3.2.9

#### **système de charge**

combinaison de circuits destinés à charger, équilibrer et/ou maintenir l'état de charge de la **batterie**

### 3.2.10

#### **batterie complètement chargé**

#### **élément complètement chargé**

**batterie** ou **élément** chargé(e) à l'état maximal de charge permis par le **système de charge de batterie** destiné(e) à être utilisé(e) avec la source de courant de soudage

### 3.2.11

#### **batterie complètement déchargé**

#### **élément complètement déchargé**

**batterie** ou **élément** qui a été déchargé(e) jusqu'à ce qu'une des conditions suivantes se produise: la décharge prend fin du fait de l'intervention d'un circuit de protection ou la **batterie** (ou **élément**) atteint une tension totale avec une tension moyenne par **élément** égale à la tension de fin de décharge pour la chimie des **éléments** utilisés sauf si une autre tension de fin de décharge est spécifiée par le constructeur de **batteries/d'éléments**

Note 1 à l'article: Les tensions de fin de décharge pour les chimies courantes de l'**élément** sont fournies en O.5.210.

### 3.2.12

#### **batteries à usage general**

#### **éléments à usage general**

**batteries** et **éléments** disponibles chez plusieurs constructeurs, au niveau d'une variété de points de vente des produits de différents constructeurs

Note 1 à l'article: Les **batteries** de 12 V pour automobiles et les **éléments** alcalins AA, C et D sont des exemples d'**usage général**.

### 3.2.13

#### **courant de charge maximal**

courant le plus élevé qu'un **élément** est autorisé à recevoir pendant le chargement pour une plage spécifique de températures, tel que spécifié par le constructeur d'**éléments** et évalué conformément à l'IEC 62133-1:— ou à l'IEC 62133-2:—

### 3.2.14

#### **région de fonctionnement spécifiée**

plage de fonctionnement admissible pour les **éléments**, exprimée par les limites des paramètres des **éléments**

#### 3.2.14.1

##### **région de fonctionnement spécifiée pour le chargement**

conditions relatives à la tension et au courant pendant le chargement dans lesquelles l'**élément** est autorisé à fonctionner, telles que spécifiées par le constructeur d'**éléments** et évaluées conformément à l'IEC 62133-1:— ou à l'IEC 62133-2:—

### 3.2.15

#### **tension en charge maximale**

tension la plus élevée qu'un **élément** est autorisé à atteindre pendant le chargement normal pour une plage spécifique de températures, telle que spécifiée par le constructeur d'**éléments** et évaluée conformément à l'IEC 62133-1:— ou à l'IEC 62133-2:—

### 3.2.16

#### **échappement de gaz**

condition dans laquelle un **élément** libère une pression interne excessive prévue par conception, de manière à prévenir l'**explosion**

### 3.2.17

#### **composant électronique**

pièce dans laquelle la conduction est obtenue principalement par des électrons qui se déplacent à travers un vide, un gaz ou un semiconducteur, à l'exclusion des indicateurs en néon

Note 1 à l'article: Des exemples de **composants électroniques** incluent les diodes, transistors, triacs et les circuits intégrés monolithiques. Les résistances, condensateurs et inductances ne sont pas considérés comme des **composants électroniques**.

### 3.2.18

#### **protection principale**

protection contre les chocs électriques en l'absence de défaut

[SOURCE: IEC 60050-195:1998, 195-06-01]

### 3.2.19

#### **classe de tension de batterie A**

classification d'un composant électrique ou d'un circuit électrique ayant une **tension de service** pour batterie maximale de 60 V en courant continu

### 3.2.20

#### **classe de tension de batterie B**

classification d'un composant électrique ou d'un circuit électrique ayant une **tension de service** pour batterie maximale comprise entre 60 V en courant continu et 1 500 V en courant continu

### 3.2.21

#### **carbonisation**

noircissement du coton causé par une combustion

Note 1 à l'article: La décoloration du coton causée par la fumée est acceptable.

### 3.2.22

#### **cycle de fonctionnement consécutif**

mise en cycle immédiate après réenclenchement du dispositif de commande thermique

### 3.2.23

#### **explosion**

<d'une atmosphère explosive> augmentation soudaine de la pression et de la température due à une oxydation ou une autre réaction exothermique

[SOURCE: IEC 60050-426:2008, 426-02-13]

## 4 Conditions ambiantes

Les sources de courant de soudage doivent être capables de fournir leurs **puissances assignées** pour les **facteurs de marche** assignés dans les conditions ambiantes suivantes:

- a) plage de températures de l'air ambiant:  
pendant le soudage:  $-10\text{ °C}$  à  $+40\text{ °C}$ ;
- b) humidité relative de l'air:  
inférieure ou égale à 50 % à  $40\text{ °C}$ ;  
inférieure ou égale à 90 % à  $20\text{ °C}$ ;
- c) air ambiant exempt de quantités anormales de poussières, d'acides, de gaz corrosifs ou substances corrosives, etc. autres que celles créées au cours de l'opération de soudage;
- d) altitude au-dessus du niveau de la mer inférieure ou égale à 1 000 m;
- e) base de la source de courant de soudage inclinée jusqu'à  $10^\circ$ .

Les sources de courant de soudage doivent résister au stockage et au transport à une température de l'air ambiant comprise entre  $-20\text{ °C}$  et  $+55\text{ °C}$  sans subir aucune dégradation de leur fonctionnement ni de leurs performances.

NOTE Des conditions ambiantes différentes peuvent faire l'objet d'un accord entre le constructeur et l'acheteur et la source de courant de soudage est marquée en conséquence (voir 15.1). Parmi ces conditions, il est possible de citer: humidité élevée, fumées corrosives inhabituelles, vapeur d'eau, excès de vapeur d'huile, vibration ou choc anormal(e), excès de poussières, conditions climatiques sévères, conditions inhabituelles au bord de la mer ou à bord d'un navire, infestation de vermine et conditions favorisant la croissance de moisissures.

## 5 Essais

### 5.1 Conditions d'essai

Les essais doivent être effectués sur des sources de courant de soudage neuves, sèches et complètement assemblées.

L'essai d'échauffement défini au 7.1 et l'essai de **protection thermique** défini au 8.5 doivent être effectués à une température ambiante de  $40\text{ °C}$ , voir les tolérances au 7.1.2 e), à l'exception des groupes électrogènes de soudage et des matériels d'**installations fixes**, qui doivent être soumis à des essais conformément aux spécifications du constructeur.

D'autres essais doivent être effectués à une température de l'air ambiant indiquée à l'Article 4 a).

Les sources de courant de soudage refroidies par liquide doivent être soumises à l'essai en présence de liquide comme cela est spécifié par le constructeur.

Sauf spécification contraire, le matériel doit être alimenté sous une **tension assignée d'alimentation** avec une tolérance de  $\pm 5\%$ .

## 5.2 Instruments de mesure

L'exactitude des instruments de mesure doit être:

- a) instruments de mesure électriques: classe I ( $\pm 1\%$  de la lecture à pleine échelle), à l'exception du mesurage de la résistance d'isolement et de la rigidité diélectrique, pour lequel l'exactitude des instruments de mesure n'est pas spécifiée, mais doit être prise en compte pour le mesurage;
- b) thermomètre:  $\pm 2\text{ K}$ ;
- c) tachymètre:  $\pm 1\%$  de la lecture à pleine échelle.

## 5.3 Conformité des composants

Se reporter à l'Annexe P pour la conformité des composants.

## 5.4 Essais de type

Sauf spécification contraire, les essais du présent document sont des **essais de type**.

La source de courant de soudage à l'essai doit comprendre tous les matériels accessoires qui pourraient affecter les résultats des essais.

Tous les **essais de type** doivent être effectués sur la même source de courant de soudage, sauf s'il est spécifié qu'un essai peut être effectué sur une autre source de courant de soudage.

Pour vérifier la conformité, les **essais de type** indiqués ci-après doivent être effectués dans l'ordre suivant sans temps de séchage entre f), g) et h):

- a) **examen visuel** général, voir 3.1.7;
- b) résistance d'isolement, voir 6.1.4 (contrôle préliminaire);
- c) enveloppe, voir 14.2;
- d) moyens de manutention, voir 14.3;
- e) essai de résistance à la chute, voir 14.4;
- f) protection procurée par l'enveloppe, voir 6.2.1;
- g) résistance d'isolement, voir 6.1.4;
- h) rigidité diélectrique, voir 6.1.5;
- i) **examen visuel** général, voir 3.1.7.

Les autres essais prévus par le présent document qui ne sont pas mentionnés ici doivent être effectués, mais peuvent être effectués dans l'ordre le plus pratique.

## 5.5 Essais individuels de série

Tous les **essais individuels de série** doivent être effectués sur chaque source de courant de soudage. L'ordre suivant est recommandé:

- a) **examen visuel** conforme à la spécification du constructeur;
- b) continuité du **circuit de protection**, voir 10.5.1;
- c) rigidité diélectrique, voir 6.1.5;
- d) **tension à vide**:
  - 1) **tension à vide assignée**, voir 11.1 par mesurage uniquement; ou
  - 2) si applicable, **tension à vide assignée réduite**, voir 13.2; ou
  - 3) si applicable, **tension à vide assignée commutée**, voir 13.3;

- e) essai pour garantir les valeurs de sortie minimales et maximales assignées selon 15.4 b) et 15.4 c). Le constructeur peut choisir des essais sur **charge conventionnelle**, en court-circuit ou sous d'autres conditions d'essai.

NOTE 1 En court-circuit et sous d'autres conditions d'essai, les valeurs de sortie peuvent différer des valeurs obtenues sur **charge conventionnelle**.

NOTE 2 Lorsque la conception le justifie, les valeurs mesurées peuvent être compensées en raison des variations du réseau d'alimentation.

## 6 Protection contre les chocs électriques

### 6.1 Isolement

#### 6.1.1 Généralités

La majorité des sources de courant de soudage appartiennent à la catégorie de surtension III, conformément à l'IEC 60664-1; les sources de courant de soudage à moteur thermique appartiennent à la catégorie de surtension II. Toutes les sources de courant de soudage doivent être conçues pour une utilisation dans les conditions d'environnement présentant au moins un **degré de pollution 3**.

Les composants ou sous-ensembles présentant des **distances d'isolement dans l'air** ou des **lignes de fuite** correspondant au **degré de pollution 2** sont permis, si le **micro-environnement** du composant ou du sous-ensemble est amélioré (par des moyens tels que le filtrage, le revêtement, l'empotage ou le moulage) de sorte que seule la pollution non conductrice ou la conductivité occasionnelle temporaire due à la condensation se produise.

Les composants ou sous-ensembles présentant des **distances d'isolement dans l'air** ou des **lignes de fuite** correspondant au **degré de pollution 1** sont permis s'ils sont totalement revêtus, empotés ou moulés conformément à l'IEC 60664-3.

Voir le Tableau 2 pour les **lignes de fuite** des cartes imprimées.

Le **matériel de classe I** destiné à être connecté à un système triphasé à trois fils relié à la terre doit être conçu avec une isolation basée sur les valeurs de la tension entre phases. Le **matériel de classe I** conçu avec une isolation basée sur les valeurs de la tension phase-neutre doit comporter un avertissement indiquant qu'un tel matériel ne doit être utilisé que sur un réseau d'alimentation qui est soit triphasé à quatre fils avec un neutre relié à la terre soit monophasé à trois fils avec un neutre relié à la terre.

L'application de l'isolation dans plusieurs configurations est représentée à la Figure 1, mais d'autres configurations et solutions sont possibles. Si une configuration particulière n'est pas représentée à la Figure 1, l'isolation exigée doit être déterminée en examinant l'effet d'un défaut simple.

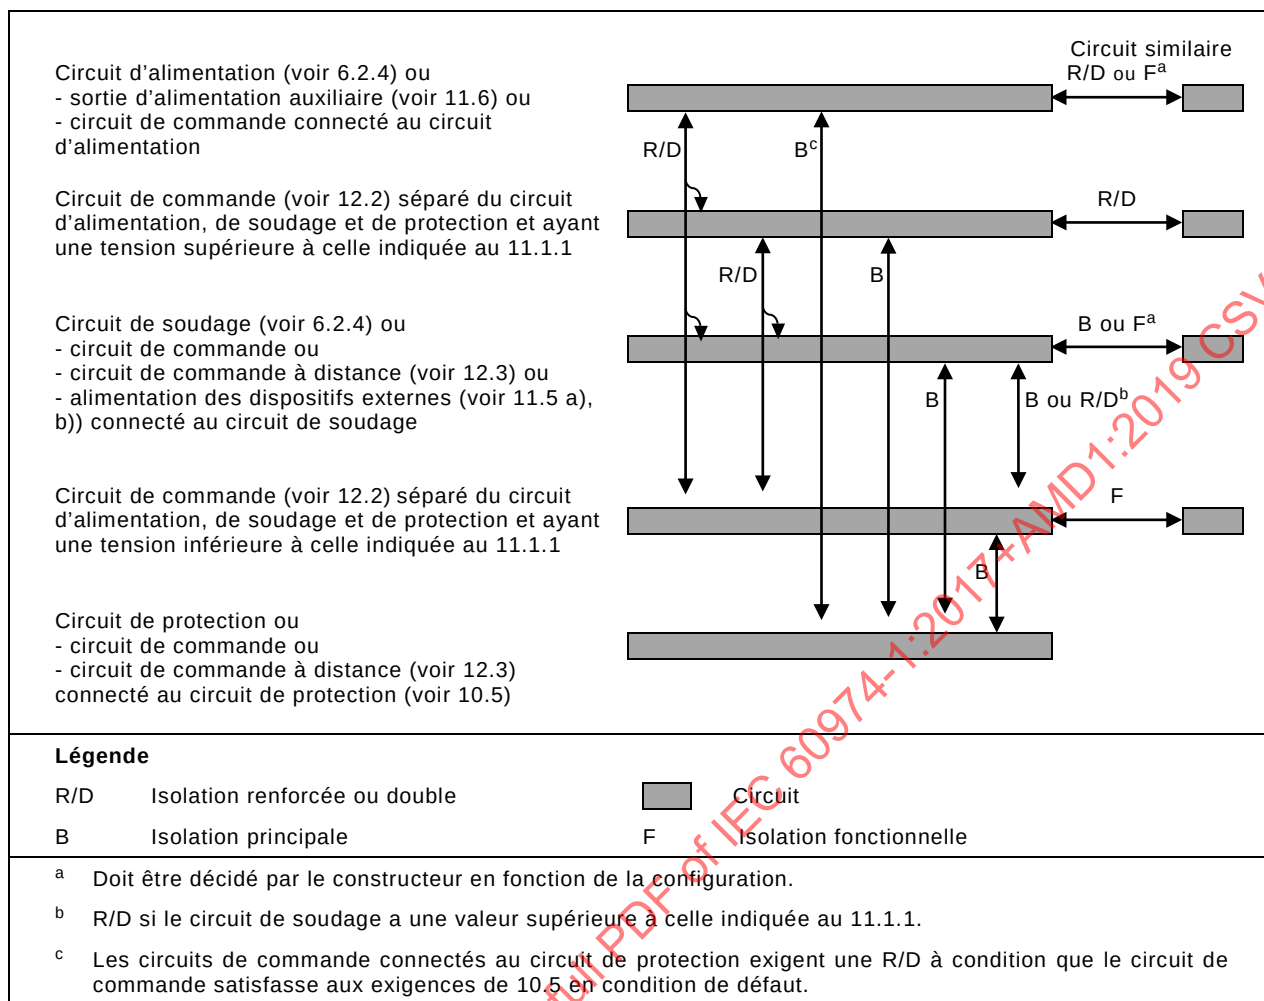


**Figure 1 – Exemple de configuration d'isolation pour le matériel de classe I**

### 6.1.2 Distances d'isolement dans l'air

Pour l'**isolation principale** ou **supplémentaire** et pour l'**isolation renforcée**, les **distances d'isolement dans l'air** minimales doivent être conformes au Tableau 1 pour la catégorie de surtension III. Pour d'autres catégories de surtension, les **distances d'isolement dans l'air** minimales doivent être conformes à l'IEC 60664-1.

**Tableau 1 – Distances d'isolement dans l'air minimales pour la catégorie de surtension III**

| Tension phase-neutre dérivée des tensions nominales en courant alternatif ou en courant continu jusqu'à et y compris <sup>a</sup><br><br>V eff.                                                                   | Isolation principale ou supplémentaire               |                                                     |                                           |     |     | Isolation renforcée                                  |                                                     |                                           |     |     |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------|-----------------------------------------------------|-------------------------------------------|-----|-----|------------------------------------------------------|-----------------------------------------------------|-------------------------------------------|-----|-----|
|                                                                                                                                                                                                                   | Tension assignée d'essai en impulsion<br><br>V crête | Tension d'essai en courant alternatif<br><br>V eff. | Degré de pollution                        |     |     | Tension assignée d'essai en impulsion<br><br>V crête | Tension d'essai en courant alternatif<br><br>V eff. | Degré de pollution                        |     |     |
|                                                                                                                                                                                                                   |                                                      |                                                     | 2                                         | 3   | 4   |                                                      |                                                     | 2                                         | 3   | 4   |
|                                                                                                                                                                                                                   |                                                      |                                                     | Distance d'isolement dans l'air<br><br>mm |     |     |                                                      |                                                     | Distance d'isolement dans l'air<br><br>mm |     |     |
| 50                                                                                                                                                                                                                | 800                                                  | 566                                                 | 0,2                                       | 0,8 | 1,6 | 1 500                                                | 1 061                                               | 0,5                                       | 0,8 | 1,6 |
| 100                                                                                                                                                                                                               | 1 500                                                | 1 061                                               | 0,5                                       |     |     | 2 500                                                | 1 768                                               | 1,5                                       |     |     |
| 150                                                                                                                                                                                                               | 2 500                                                | 1 768                                               | 1,5                                       |     |     | 4 000                                                | 2 828                                               | 3                                         |     |     |
| 300                                                                                                                                                                                                               | 4 000                                                | 2 828                                               | 3                                         |     |     | 6 000                                                | 4 243                                               | 5,5                                       |     |     |
| 600                                                                                                                                                                                                               | 6 000                                                | 4 243                                               | 5,5                                       |     |     | 8 000                                                | 5 657                                               | 8                                         |     |     |
| 1 000                                                                                                                                                                                                             | 8 000                                                | 5 657                                               | 8                                         |     |     | 12 000                                               | 8 485                                               | 14                                        |     |     |
| NOTE 1 Valeurs basées sur les Tableaux F.1 et F.2 de l'IEC 60664-1:2007.                                                                                                                                          |                                                      |                                                     |                                           |     |     |                                                      |                                                     |                                           |     |     |
| NOTE 2 Pour les autres degrés de pollution et catégories de surtension, voir l'IEC 60664-1.                                                                                                                       |                                                      |                                                     |                                           |     |     |                                                      |                                                     |                                           |     |     |
| NOTE 3 Si un autotransformateur est raccordé au circuit d'alimentation et fourni en tant qu'élément d'une source de courant de soudage, la tension d'alimentation détermine les distances d'isolement dans l'air. |                                                      |                                                     |                                           |     |     |                                                      |                                                     |                                           |     |     |
| <sup>a</sup> Voir l'Annexe A.                                                                                                                                                                                     |                                                      |                                                     |                                           |     |     |                                                      |                                                     |                                           |     |     |

Afin de déterminer les **distances d'isolement dans l'air** par rapport aux surfaces accessibles non conductrices, de telles surfaces doivent être considérées comme étant recouvertes d'une feuille métallique à tout endroit où elles peuvent être touchées par le doigt d'essai normalisé conforme à l'IEC 60529.

Les **distances d'isolement dans l'air** ne doivent pas être interpolées.

Pour les bornes du **circuit d'alimentation**, voir E.2.

Les **distances d'isolement dans l'air** entre des éléments de la source de courant de soudage (par exemple circuits ou composants électroniques) qui sont protégés par un dispositif limiteur des surtensions (par exemple varistance métal-oxyde) peuvent être définies conformément à la catégorie de surtension I (voir IEC 60664-1).

Les valeurs du Tableau 1 doivent également s'appliquer au **circuit de soudage** à l'intérieur de la source de courant de soudage et aux **circuits de commande** lorsqu'ils sont séparés du **circuit d'alimentation**, par exemple par un transformateur.

Si le **circuit de commande** est directement raccordé au **circuit d'alimentation**, les valeurs correspondant à la tension d'alimentation doivent s'appliquer.

*La conformité doit être vérifiée par mesurage, conformément au 6.2 de l'IEC 60664-1:2007 ou, si cela n'est pas possible, en soumettant la source de courant de soudage à un essai par impulsion avec les tensions indiquées au Tableau 1.*

Pour l'essai par impulsion, un minimum de trois impulsions espacées d'au moins 1 s pour chaque polarité est appliqué avec la tension indiquée au Tableau 1, en utilisant un générateur

d'impulsions ayant une forme d'onde de sortie de 1,2/50  $\mu$ s et une impédance de sortie inférieure à 500  $\Omega$ .

En variante, une tension d'essai en courant alternatif comme indiquée au Tableau 1 peut être appliquée pendant trois cycles ou une tension en courant continu sans ondulation dont la valeur est égale à la tension d'impulsion peut être appliquée trois fois pendant 10 ms, dans chaque polarité.

### 6.1.3 Lignes de fuite

Pour l'**isolation** principale ou **supplémentaire**, les **lignes de fuite** doivent être conformes au Tableau 2.

Les **lignes de fuite** pour la **double isolation** doivent être la somme des valeurs pour l'isolation principale et l'**isolation supplémentaire** qui forment la **double isolation**.

Les **lignes de fuite** pour l'**isolation renforcée** doivent être deux fois celles déterminées pour l'**isolation principale**.

Afin de déterminer les **lignes de fuite** par rapport aux surfaces accessibles non conductrices, de telles surfaces doivent être considérées comme étant recouvertes d'une feuille métallique à tout endroit où elles peuvent être touchées par le doigt d'essai normalisé conforme à l'IEC 60529.

Les **lignes de fuite** sont données pour la tension assignée la plus élevée de chaque ligne du Tableau 2. Dans le cas d'une tension assignée plus faible, l'interpolation est autorisée.

Pour les bornes du **circuit d'alimentation**, voir E.2.

Les valeurs du Tableau 2 doivent s'appliquer également au **circuit de soudage** à l'intérieur de la source de courant de soudage et aux **circuits de commande** lorsqu'ils sont séparés du **circuit d'alimentation**, par exemple par un transformateur.

Une **ligne de fuite** ne peut pas être inférieure à la **distance d'isolement dans l'air** associée, la **ligne de fuite** la plus courte possible est donc égale à la **distance d'isolement dans l'air** exigée.

Si le **circuit de commande** est directement raccordé au **circuit d'alimentation**, les valeurs correspondant à la tension d'alimentation doivent s'appliquer.

La conformité doit être vérifiée par mesurage linéaire, conformément au 6.2 de l'IEC 60664-1:2007.



**Tableau 2 – Lignes de fuite minimales**

| Tension locale | Lignes de fuite en millimètres         |       |                    |                    |          |           |                    |          |           |
|----------------|----------------------------------------|-------|--------------------|--------------------|----------|-----------|--------------------|----------|-----------|
|                | Isolation principale ou supplémentaire |       |                    |                    |          |           |                    |          |           |
|                | Matériau des cartes imprimées          |       | Degré de pollution |                    |          |           |                    |          |           |
|                | Degré de pollution                     |       |                    |                    |          |           |                    |          |           |
| V.eff.         | 1                                      | 2     | 1                  | 2                  |          |           | 3                  |          |           |
|                | a                                      | b     | a                  | Groupe de matériau |          |           | Groupe de matériau |          |           |
|                | mm                                     | mm    | mm                 | I<br>mm            | II<br>mm | III<br>mm | I<br>mm            | II<br>Mm | III<br>mm |
| 10             | 0,025                                  | 0,04  | 0,08               | 0,4                | 0,4      | 0,4       | 1                  | 1        | 1         |
| 12,5           | 0,025                                  | 0,04  | 0,09               | 0,42               | 0,42     | 0,42      | 1,05               | 1,05     | 1,05      |
| 16             | 0,025                                  | 0,04  | 0,1                | 0,45               | 0,45     | 0,45      | 1,1                | 1,1      | 1,1       |
| 20             | 0,025                                  | 0,04  | 0,11               | 0,48               | 0,48     | 0,48      | 1,2                | 1,2      | 1,2       |
| 25             | 0,025                                  | 0,04  | 0,125              | 0,5                | 0,5      | 0,5       | 1,25               | 1,25     | 1,25      |
| 32             | 0,025                                  | 0,04  | 0,14               | 0,53               | 0,53     | 0,53      | 1,3                | 1,3      | 1,3       |
| 40             | 0,025                                  | 0,04  | 0,16               | 0,56               | 0,8      | 1,1       | 1,4                | 1,6      | 1,8       |
| 50             | 0,025                                  | 0,04  | 0,18               | 0,6                | 0,85     | 1,2       | 1,5                | 1,7      | 1,9       |
| 63             | 0,04                                   | 0,063 | 0,2                | 0,63               | 0,9      | 1,25      | 1,6                | 1,8      | 2         |
| 80             | 0,063                                  | 0,1   | 0,22               | 0,67               | 0,95     | 1,3       | 1,7                | 1,9      | 2,1       |
| 100            | 0,1                                    | 0,16  | 0,25               | 0,71               | 1        | 1,4       | 1,8                | 2        | 2,2       |
| 125            | 0,16                                   | 0,25  | 0,28               | 0,75               | 1,05     | 1,5       | 1,9                | 2,1      | 2,4       |
| 160            | 0,25                                   | 0,4   | 0,32               | 0,8                | 1,1      | 1,6       | 2                  | 2,2      | 2,5       |
| 200            | 0,4                                    | 0,63  | 0,42               | 1                  | 1,4      | 2         | 2,5                | 2,8      | 3,2       |
| 250            | 0,56                                   | 1     | 0,56               | 1,25               | 1,8      | 2,5       | 3,2                | 3,6      | 4         |
| 320            | 0,75                                   | 1,6   | 0,75               | 1,6                | 2,2      | 3,2       | 4                  | 4,5      | 5         |
| 400            | 1                                      | 2     | 1                  | 2                  | 2,8      | 4         | 5                  | 5,6      | 6,3       |
| 500            | 1,3                                    | 2,5   | 1,3                | 2,5                | 3,6      | 5         | 6,3                | 7,1      | 8         |
| 630            | 1,8                                    | 3,2   | 1,8                | 3,2                | 4,5      | 6,3       | 8                  | 9        | 10        |
| 800            | 2,4                                    | 4     | 2,4                | 4                  | 5,6      | 8         | 10                 | 11       | 12,5      |
| 1 000          | 3,2                                    | 5     | 3,2                | 5                  | 7,1      | 10        | 12,5               | 14       | 16        |
| 1 250          |                                        |       | 4,2                | 6,3                | 9        | 12,5      | 16                 | 18       | 20        |
| 1 600          |                                        |       | 5,6                | 8                  | 11       | 16        | 20                 | 22       | 25        |
| 2 000          |                                        |       | 7,5                | 10                 | 14       | 20        | 25                 | 28       | 32        |
| 2 500          |                                        |       | 10                 | 12,5               | 18       | 25        | 32                 | 36       | 40        |
| 3 200          |                                        |       | 12,5               | 16                 | 22       | 32        | 40                 | 45       | 50        |
| 4 000          |                                        |       | 16                 | 20                 | 28       | 40        | 50                 | 56       | 63        |
| 5 000          |                                        |       | 20                 | 25                 | 36       | 50        | 63                 | 71       | 80        |
| 6 300          |                                        |       | 25                 | 32                 | 45       | 63        | 80                 | 90       | 100       |
| 8 000          |                                        |       | 32                 | 40                 | 56       | 80        | 100                | 110      | 125       |
| 10 000         |                                        |       | 40                 | 50                 | 71       | 100       | 125                | 140      | 160       |

a Groupes de matériaux I, II, IIIa et IIIb.

b Groupes de matériaux I, II et IIIa.

NOTE Conformément à l'IEC 60664-1, les dimensions de la ligne de fuite ne peuvent pas être spécifiées en présence d'une pollution conductrice en permanence (Degré de pollution 4).

#### 6.1.4 Résistance d'isolement

La résistance d'isolement ne doit pas être inférieure aux valeurs indiquées au Tableau 3.

**Tableau 3 – Résistance d'isolement**

| Mesurage <sup>a</sup>                                                                                                                                                                                                                                            |                 |                                   | Résistance | Isolation           |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|-----------------------------------|------------|---------------------|
| Circuit d'alimentation                                                                                                                                                                                                                                           | par rapport au  | circuit de soudage                | 5,0 MΩ     | Double ou renforcée |
| Circuit de soudage                                                                                                                                                                                                                                               | par rapport au  | circuit de protection             | 2,5 MΩ     | Principale          |
| Circuit d'alimentation                                                                                                                                                                                                                                           | par rapport au  | circuit de protection             | 2,5 MΩ     | Principale          |
| Circuit d'alimentation du matériel de Classe II                                                                                                                                                                                                                  | par rapport aux | surfaces accessibles <sup>b</sup> | 5,0 MΩ     | Double ou renforcée |
| <sup>a</sup> Les circuits de commande sont soumis à l'essai avec le circuit auquel ils sont reliés de façon galvanique. Les circuits de commande accessibles séparés de tous les autres circuits sont soumis à l'essai selon les spécifications du constructeur. |                 |                                   |            |                     |
| <sup>b</sup> Pour le mesurage par rapport aux surfaces accessibles non conductrices, ces surfaces doivent être considérées comme étant recouvertes d'une feuille métallique.                                                                                     |                 |                                   |            |                     |

Tout circuit de commande ou circuit auxiliaire relié à la borne du conducteur de protection doit, pour cet essai, être considéré comme une partie conductrice accessible.

*La conformité doit être vérifiée par mesurage stabilisé de la résistance d'isolement par application d'une tension continue égale à 500 V, à la température ambiante.*

Pendant le mesurage, les torches doivent être déconnectées, les composants électroniques à semiconducteurs et leurs dispositifs de protection peuvent être court-circuités et les unités de refroidissement par liquide doivent être soumises aux essais sans liquide.

#### 6.1.5 Rigidité diélectrique

L'isolation doit supporter les tensions d'essai suivantes sans contournement ni claquage:

- premier essai d'une source de courant de soudage: tensions d'essai indiquées au Tableau 4;
- répétition de l'essai sur la même source de courant de soudage: tension d'essai égale à 80 % des valeurs indiquées au Tableau 4.

**Tableau 4 – Tensions d'essai diélectrique**

| Tension assignée maximale <sup>a</sup><br>V eff.                                                                                                                                                                                                                                                                       | Tension alternative d'essai diélectrique<br>V eff.                                                                                                      |                       |                                                                                        |                                                          |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------|----------------------------------------------------------------------------------------|----------------------------------------------------------|
|                                                                                                                                                                                                                                                                                                                        | Entre tous les circuits et les parties conductrices accessibles, entre le circuit d'alimentation et tous les autres circuits sauf le circuit de soudage |                       | Entre tous les circuits, sauf entre le circuit d'alimentation et le circuit de soudage | Entre le circuit d'alimentation et le circuit de soudage |
|                                                                                                                                                                                                                                                                                                                        | Matériel de classe I                                                                                                                                    | Matériel de classe II |                                                                                        |                                                          |
| Jusqu'à 50                                                                                                                                                                                                                                                                                                             | 500                                                                                                                                                     | 1 000                 | 500                                                                                    | 1 000                                                    |
| 220                                                                                                                                                                                                                                                                                                                    | 1 100                                                                                                                                                   | 2 200                 | 1 100                                                                                  | 2 200                                                    |
| 450                                                                                                                                                                                                                                                                                                                    | 1 875                                                                                                                                                   | 3 750                 | 1 875                                                                                  | 3 750                                                    |
| 700                                                                                                                                                                                                                                                                                                                    | 2 500                                                                                                                                                   | 5 000                 | 2 500                                                                                  | 5 000                                                    |
| 1 000                                                                                                                                                                                                                                                                                                                  | 2 750                                                                                                                                                   | 5 500                 | 2 750                                                                                  | 5 500                                                    |
| NOTE 1 La tension assignée maximale est valable pour les systèmes mis à la terre ou non.                                                                                                                                                                                                                               |                                                                                                                                                         |                       |                                                                                        |                                                          |
| NOTE 2 L'essai de rigidité diélectrique des circuits de commande est limité dans le présent document à tous les circuits qui entrent ou sortent de l'enveloppe, autres que le circuit d'alimentation et le circuit de soudage.                                                                                         |                                                                                                                                                         |                       |                                                                                        |                                                          |
| <sup>a</sup> Pour les valeurs intermédiaires, l'interpolation est permise sur tous les réseaux d'alimentation (circuit d'alimentation) fonctionnant en dehors de la plage comprise entre 220 V et 450 V et sur tous les systèmes triphasés à trois fils reliés à la terre sans exemption de tension (voir l'Annexe A). |                                                                                                                                                         |                       |                                                                                        |                                                          |
| <sup>b</sup> Pour les valeurs intermédiaires, l'interpolation est permise sur les circuits de soudage et de commande.                                                                                                                                                                                                  |                                                                                                                                                         |                       |                                                                                        |                                                          |

La tension d'essai en courant alternatif doit être de forme sensiblement sinusoïdale avec une valeur de crête ne dépassant pas 1,45 fois la valeur efficace, et d'une fréquence d'environ 50 Hz ou 60 Hz.

Le réglage maximal admissible du courant de déclenchement doit être 100 mA. Le transformateur haute tension doit délivrer la tension spécifiée jusqu'au courant de déclenchement. Un déclenchement est considéré comme un contournement ou un claquage.

NOTE Pour la sécurité de l'opérateur, le réglage le plus faible possible du courant de déclenchement (inférieur ou égal à 10 mA) est généralement utilisé.

**Essai en variante:** Une tension d'essai en courant continu égale à 1,4 fois la tension d'essai efficace peut être utilisée.

Les composants ou sous-ensembles ne doivent pas être déconnectés ou court-circuités sauf si les conditions de a), b) ou c) ci-dessous sont remplies:

- Les composants ou sous-ensembles sont conçus et soumis à l'essai conformément aux normes appropriées qui spécifient une tension plus faible que le niveau de tension d'essai du présent document. Ces composants ou sous-ensembles ne sont pas connectés entre le circuit d'alimentation et le **circuit de soudage** et leur déconnexion ou mise en court-circuit n'empêche pas de soumettre à l'essai une partie du circuit. Exemples: moteurs de ventilateurs et moteurs de pompes.
- Les composants ou sous-ensembles sont complètement incorporés soit dans le circuit d'alimentation soit dans le **circuit de soudage** et leur déconnexion n'empêche pas de soumettre à l'essai une partie du circuit. Exemple: circuits électroniques.
- Les circuits destinés à éliminer les parasites ou les condensateurs destinés à la protection entre le circuit d'alimentation ou le **circuit de soudage** et toutes les parties conductrices accessibles qui sont conformes aux normes appropriées.

Les **circuits de commande** connectés à une borne conductrice de protection ne doivent pas être déconnectés pendant l'essai et ils sont alors soumis à l'essai comme des parties conductrices accessibles.