

---

---

**Reactor technology — Power reactor  
analyses and measurements —  
Determination of heavy water isotopic  
purity by Fourier transform infrared  
spectroscopy**

*Technologie du réacteur — Analyses et mesurages relatifs aux  
réacteurs de puissance — Détermination de la pureté isotopique de  
l'eau lourde par spectroscopie infrarouge à transformée de Fourier*



STANDARDSISO.COM : Click to view the full PDF of ISO 23468:2021



**COPYRIGHT PROTECTED DOCUMENT**

© ISO 2021

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
CP 401 • Ch. de Blandonnet 8  
CH-1214 Vernier, Geneva  
Phone: +41 22 749 01 11  
Email: [copyright@iso.org](mailto:copyright@iso.org)  
Website: [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

Page

|                                                                                                                 |           |
|-----------------------------------------------------------------------------------------------------------------|-----------|
| Foreword                                                                                                        | iv        |
| <b>1 Scope</b>                                                                                                  | <b>1</b>  |
| <b>2 Normative references</b>                                                                                   | <b>1</b>  |
| <b>3 Terms and definitions</b>                                                                                  | <b>1</b>  |
| <b>4 Principle</b>                                                                                              | <b>2</b>  |
| <b>5 Reagents and materials</b>                                                                                 | <b>3</b>  |
| <b>6 Apparatus</b>                                                                                              | <b>3</b>  |
| <b>7 Heavy water reference standard preparation</b>                                                             | <b>4</b>  |
| 7.1 General requirements                                                                                        | 4         |
| 7.2 Storage of high isotopic purity heavy water reference standard                                              | 4         |
| 7.2.1 Ampoule bottle                                                                                            | 4         |
| 7.2.2 Specially designed stainless steel container                                                              | 4         |
| 7.3 Lower D <sub>2</sub> O concentration reference standard preparation                                         | 4         |
| <b>8 Sampling</b>                                                                                               | <b>5</b>  |
| 8.1 General requirements                                                                                        | 5         |
| 8.2 Sampling with syringes                                                                                      | 5         |
| 8.3 Sampling with bottles                                                                                       | 5         |
| <b>9 Preparation of calibration curves of the method</b>                                                        | <b>5</b>  |
| 9.1 General                                                                                                     | 5         |
| 9.2 Preparation of the apparatus                                                                                | 6         |
| 9.2.1 FTIR spectrometer                                                                                         | 6         |
| 9.2.2 Infrared liquid cell                                                                                      | 7         |
| 9.3 Editing of the method                                                                                       | 7         |
| 9.4 Background spectrum                                                                                         | 7         |
| 9.5 Heavy water reference standard spectra                                                                      | 7         |
| 9.6 Draw the calibration curves for different D <sub>2</sub> O concentration ranges                             | 7         |
| <b>10 Procedure</b>                                                                                             | <b>8</b>  |
| 10.1 Sample preparation                                                                                         | 8         |
| 10.1.1 Sample temperature adjustment                                                                            | 8         |
| 10.1.2 Sample filtration                                                                                        | 8         |
| 10.1.3 Sample source check                                                                                      | 8         |
| 10.2 Sample load and scan                                                                                       | 8         |
| 10.3 After measurement                                                                                          | 8         |
| <b>11 Expression of results</b>                                                                                 | <b>9</b>  |
| 11.1 Calculation method                                                                                         | 9         |
| 11.2 Precision                                                                                                  | 9         |
| 11.3 Uncertainty                                                                                                | 10        |
| <b>12 Interferences</b>                                                                                         | <b>10</b> |
| 12.1 Contaminated samples                                                                                       | 10        |
| 12.2 Air bubbles                                                                                                | 10        |
| 12.3 Foreign materials on the outside of the cell window                                                        | 11        |
| <b>13 Test report</b>                                                                                           | <b>11</b> |
| <b>Annex A (informative) Specially designed stainless steel container for D<sub>2</sub>O reference standard</b> | <b>12</b> |
| <b>Annex B (informative) Interested region suggested for typical curves</b>                                     | <b>14</b> |
| <b>Bibliography</b>                                                                                             | <b>19</b> |

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see [www.iso.org/directives](http://www.iso.org/directives)).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see [www.iso.org/patents](http://www.iso.org/patents)).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation on the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT) see the following URL: [www.iso.org/iso/foreword.html](http://www.iso.org/iso/foreword.html).

This document was prepared by Technical Committee ISO/TC 85, *Nuclear energy, nuclear technologies, and radiological protection*, Subcommittee SC 6, *Reactor technology*.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at [www.iso.org/members.html](http://www.iso.org/members.html).

# Reactor technology — Power reactor analyses and measurements — Determination of heavy water isotopic purity by Fourier transform infrared spectroscopy

## 1 Scope

This document specifies an analytical method for determining heavy water isotopic purity by Fourier transform infrared spectroscopy (FTIR). It is applicable to the determination of the whole range of heavy water concentration. The method is devoted to process controls at the different steps of the process systems in heavy water reactor power plant or any other related areas.

The method can be applied for heavy water isotopic purity measurements in a heavy water reactor power plant or research reactor, heavy water production factory and heavy water related areas.

## 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 3696, *Water for analytical laboratory use — Specification and test methods*

## 3 Terms and definitions

For the purposes of this document, the following terms and definitions are applied.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <https://www.iso.org/obp>
- IEC Electropedia: available at <https://www.electropedia.org/>

### 3.1

#### **heavy water**

water which contains a higher than normal proportion of the heavy isotopes of hydrogen in combination with oxygen

Note 1 to entry: HDO exists whenever there is water with hydrogen-1 and deuterium in the mix. HDO is formed when hydrogen and deuterium atoms are rapidly exchanged between light water and heavy water molecules.

Note 2 to entry: Heavy water here does not mean “heavy water” which is enriched in the heavier oxygen isotopes  $^{17}\text{O}$  and  $^{18}\text{O}$ .

Note 3 to entry: The ice point of heavy water is as high as 3,8 °C, care should be taken to avoid heavy water from freezing.

[SOURCE: ISO 6107:2021, 3.272, modified — Notes 1 to 3 to entry were added.]

### 3.2

#### **light water**

water that contains natural abundance of protium and deuterium

### 3.3

#### Fourier transform infrared spectroscopy

##### FTIR

method in which a sample is subjected to excitation of molecular bonds by pulsed, broad-band infra-red radiation and the Fourier transform mathematical method is used to obtain an absorption spectrum

[SOURCE: ISO/TS 80004-6:2021, 5.8]

### 3.4

#### D<sub>2</sub>O

molecular formula of deuterium oxide

### 3.5

#### heavy water isotopic purity

$c_{\text{atom}}$

percentage of deuterium atoms in the total number of all hydrogen atoms including deuterium, protium and tritium atoms

Note 1 to entry: Expressed as atom%.

### 3.6

#### D<sub>2</sub>O concentration

$c_{\text{mass}}$

percentage of the mass of D<sub>2</sub>O in total water mass, assuming that all of the deuterium exist in the form of D<sub>2</sub>O

Note 1 to entry: Expressed as mass fraction.

Note 2 to entry: The mass percentage of D<sub>2</sub>O is deduced from heavy water isotopic purity which does not precisely mean the mass percentage of D<sub>2</sub>O in water because deuterium exists both in the form of HDO and D<sub>2</sub>O.

### 3.7

#### precision

closeness of agreement between independent test results/measurement results obtained under stipulated conditions

[SOURCE: ISO 3534-2:2006, 3.3.4]

## 4 Principle

HDO, D<sub>2</sub>O and H<sub>2</sub>O co-exist in heavy water, with [Formula \(1\)](#):



The O-H bond and the O-D bond have each different infrared spectroscopy. Heavy water isotopic purity is proportional to the absorption strength of characteristic region in infrared spectrum within certain range of heavy water concentration.

Almost all protium in high isotopic purity heavy water, like a mass fraction from 98,500 to 100,000 in %, exists in the form of HDO, in which O-H has the biggest absorption at infrared wave number about 3 400 cm<sup>-1</sup> ( $\lambda$  is 2,94  $\mu\text{m}$ ). The absorption strength of this specified infrared wave number is proportional to protium isotopic purity and proportional inversely to the deuterium isotopic purity in heavy water. Almost all deuterium in low concentration of heavy water, like a mass fraction from 0,05 to 2,00 in %, exists in the form of HDO, in which O-D has the biggest absorption at infrared wave number about 2 500 cm<sup>-1</sup> ( $\lambda$  is 4,00  $\mu\text{m}$ ). The absorption strength of this specified infrared wave number is proportional to deuterium isotopic purity and proportional to heavy water concentration.

For heavy water concentration in the range of a mass fraction from 2,00 to 98,50 in %, different ranges could be subdivided according to different interested regions of the spectra respectively.

## 5 Reagents and materials

Use only reagents of recognized analytical grade, unless otherwise specified.

**5.1 Demineralised light water**, in accordance with the requirements of grade 1 as defined in ISO 3696.

**5.2 High isotopic purity heavy water reference standards**, a series of heavy water standards with precisely characterized D<sub>2</sub>O concentration, acquired from a certified laboratory and are free from impurities and organic matters. Their conductivity should be less than 2 µS/cm.

**5.3 Acetone or absolute ethyl alcohol.**

**5.4 Helium**, with a purity of 99,999 % in volume.

**5.5 Dry nitrogen or compressed air**, with a dew point less than –30 °C.

## 6 Apparatus

The usual laboratory apparatus and, in particular, the following:

**6.1 FTIR spectrometer**, with a resolution of 4 cm<sup>-1</sup> and a spectral range of 1 000 cm<sup>-1</sup> to 6 000 cm<sup>-1</sup>.

**6.2 Infrared liquid cell**, super-sealed liquid cells with Luer-Lock fittings for syringe filling of the samples and shall have precise and reproducible path length. Two plugs are attached with each cell. Different path lengths of cells like 0,5 mm, 0,3 mm, 0,2 mm, 0,1 mm, 0,05 mm may be prepared for the method.

NOTE Liquid cells without temperature control are used in this standard method. A temperature controlled liquid cell can be used for this method if necessary.

**6.3 Hypodermic glass syringes**, with Luer-Lock tips, clean and dry, always kept in a desiccator (6.9).

**6.4 Disposable syringes.**

**6.5 Needles**, with slip tips and suitable outer diameter.

**6.6 Polyethylene or Polypropylene bottles**, clean and dry, with tight caps.

**6.7 Fume hood**, with the inlet air flow in the range of (0,3 to 0,6) m/s.

**6.8 Oven**, with a temperature control model; the oven can heat up to 120 °C.

**6.9 Desiccator.**

**6.10 Electrical analytical balance**, which can be read to the nearest 0,1 mg.

**6.11 Syringe filter**, with the pore size of 0,45 µm.

**6.12 Tissue paper**, lint-free tissue paper for cleaning the cell window.

## 7 Heavy water reference standard preparation

### 7.1 General requirements

High isotopic purity heavy water reference standards (5.2) should be procured from a certified laboratory. Heavy water reference standards of lower concentration may be prepared by mixing a high isotopic purity heavy water standard and demineralized light water (5.1) in the laboratory according to 7.3.

### 7.2 Storage of high isotopic purity heavy water reference standard

#### 7.2.1 Ampoule bottle

High isotopic purity heavy water degrades easily. The reference standards shall be enclosed in sealed ampoule bottles and each shall be used only once.

#### 7.2.2 Specially designed stainless steel container

Specially designed stainless steel container is recommended for the storage of high purity heavy water reference standard, which is able to hold a relatively big amount of heavy water and prevent the heavy water from degradation for a long time by covering the heavy water surface with pure helium (5.4). The heavy water in the container can be extracted through a sampling port with rubber diaphragm. See Annex A for reference.

If a container has not been sampled for several weeks, successive samples should be withdrawn and analysed until two consecutive samples deviate within a mass fraction of 0,005 in %.

### 7.3 Lower D<sub>2</sub>O concentration reference standard preparation

The relative humidity should be controlled under 40 %, preferably as low as possible, in the standard preparation area of the laboratory. The bottles, pipettes or any other apparatus which will be used for the standard preparation should be dry and of constant weight before the standard preparation.

Lower D<sub>2</sub>O concentration of heavy water reference standards can be prepared in a clean and dry bottle by mixing appropriate volume of a high purity heavy water reference standard with appropriate volume of demineralized light water (5.1). The masses of the heavy water reference standard and the light water need to be accurate to 0,1 mg weighted by the electrical analytical balance (6.10). D<sub>2</sub>O concentration of the prepared heavy water reference standard can be referred to Formula (2):

$$c_r = \frac{c_D \times w_D + w_H \times c_H}{w_D + w_H} \quad (2)$$

where

$c_r$  is the target D<sub>2</sub>O concentration of the lower reference standard, expressed as mass fraction in %;

$c_D$  is the D<sub>2</sub>O concentration of the high purity heavy water reference standard expressed as mass fraction in %;

$w_D$  is the mass of the high purity heavy water reference standard, expressed in grams;

$w_H$  is the mass of the light water (5.1) added, expressed in grams;

$c_H$  is the D<sub>2</sub>O concentration of the light water (5.1), expressed as mass fraction in %;

NOTE  $c_H$ , the D<sub>2</sub>O concentration of light water (5.1) which is approximately a mass fraction of 0,0173 in %, while it varies in different areas around the world. This value can be measured through mass spectrometers by a qualified institute.

The maximum duration is 3 weeks when the lower D<sub>2</sub>O concentration heavy water reference standards stored in a polyethylene or polypropylene bottle with a tight cap. The reference standards should be re-prepared once introduction of light water is suspected.

## 8 Sampling

### 8.1 General requirements

**WARNING** — Heavy water is not radioactive. However, heavy water in nuclear power plant may contain a large amount of tritium and other radionuclides. Proper protection measures shall be taken when sampling and analysing heavy water samples in nuclear facilities. All syringes and cell filling of the test should be carried out in a fume hood (6.7).

Heavy water degrades easily when open to atmosphere. It is very important to keep the sample sealed after sampling.

### 8.2 Sampling with syringes

Hypodermic glass syringes (6.3) with Luer-Lock tips and matched needles (6.5) are widely used for heavy water sampling in industry. Specially designed syringe sampling station is provided in heavy water reactor power plants. The sampling station is a stainless steel pot with the diaphragm of a polychloroprene disc, and the connections are welded to the sample tubing. A small isolation valve is provided on each side of the sample pot for normal isolation and for diaphragm changing. A bypass is provided to permit continuous flow during isolation of the hypodermic pots.

To take a heavy water sample from the station, a flow through the station shall be established. Dry syringe (6.3) and dry needle (6.5) are used to extract the sample through the rubber diaphragm after the flow has been established for more than 2 min.

### 8.3 Sampling with bottles

Once syringe sampling is not applicable, clean and dry bottles (6.6) should be used for sampling. Immediately tighten the bottle cap after sampling.

## 9 Preparation of calibration curves of the method

### 9.1 General

Table 1 gives 5 typical calibration curves of different D<sub>2</sub>O concentration ranges of heavy water with different test conditions based on the test of a CaF<sub>2</sub> infrared liquid cell (6.2) with a same path length of 0,2 mm. The spectra with regions of interest of different D<sub>2</sub>O concentration ranges are given in Annex B.

**Table 1 — Calibration curves for different D<sub>2</sub>O concentration range**

| Curve number | D <sub>2</sub> O concentration range <sup>a</sup><br>mass fraction in % | Cell material <sup>b</sup> | Background                          | Region of interest suggested<br>cm <sup>-1</sup> | Baseline suggested <sup>c</sup><br>cm <sup>-1</sup> | Linear coefficient |
|--------------|-------------------------------------------------------------------------|----------------------------|-------------------------------------|--------------------------------------------------|-----------------------------------------------------|--------------------|
| 1            | 98,500 to 100,000                                                       | CaF <sub>2</sub>           | Air                                 | 3 200 to 3 600                                   | around 3 100                                        | ≥99,99 %           |
| 2            | 80,0 to 98,5                                                            | CaF <sub>2</sub>           | Air                                 | 2 850 to 3 050                                   | around 3 850<br>or 4 500                            | ≥99,9 %            |
| 3            | 20,0 to 80,0                                                            | CaF <sub>2</sub>           | Air                                 | 2 000 to 2 100                                   | around 3 850<br>or 4 500                            | ≥99 %              |
| 4            | 2,0 to 20,0                                                             | CaF <sub>2</sub>           | Air                                 | 5 050 to 5 300                                   | around 5 500                                        | ≥99,9 %            |
| 5            | 0,05 to 2,00                                                            | CaF <sub>2</sub>           | demineralized light water (5.1)/Air | 2 530 to 2 600                                   | around 2 800                                        | ≥99,99 %           |

<sup>a</sup> D<sub>2</sub>O concentration range can be changed according to the choice of different path lengths of cells.

<sup>b</sup> The window material of the cell could be ZnSe for all the curves. SiO<sub>2</sub> could be used for curve 1 only.

<sup>c</sup> A baseline shall be specified to draw the curves. For curve 1, 4 and 5 which are plotted by peak area integration, a one-point baseline is suggested, which means a horizontal baseline will be drawn through the specified point of each spectrum where all spectra have a minimum absorbance. A two-point baseline may be selected for curve 1, 4 and 5, in which case the baseline will be drawn through both points. For curve 2 and 3, which are plotted by peak height integration, a fixed x-axis location where all spectra have a minimum absorbance shall be selected for the baseline integration.

Both curve 1 and curve 5 have a linear coefficient above 99,99 % and show good repeatability and reproducibility.

Curve 2, curve 3, and curve 4 for mid-range concentration heavy water (mass fraction from 2,0 to 98,5 in %) measurement do not have as good repeatability as curve 1 or curve 5, although their linear coefficient can reach above 99 %. There are maybe some other acceptable regions of interest that could be used for D<sub>2</sub>O concentration analysis of the mid-range concentration heavy water. These 3 curves are suitable for rapid and routine analysis and meet the process control requirements of the heavy water reactor power plant. For more precise results, subdivide the curves into several narrower ranges to get better results or dilute the samples to the range of curve 1 or curve 5 according to the preliminary test results of curve 2, curve 3 and curve 4.

Different optical path length of the infrared cell like 0,5 mm, 0,3 mm, 0,1 mm or less can also be used for the method; in which case the D<sub>2</sub>O concentration range of each curve will be changed according to the difference of the absorption strength of the spectra.

**EXAMPLE** To measure D<sub>2</sub>O concentration of the high isotopic purity heavy water more precisely, curve 1 can be further split into 2 curves with one using a 0,3 mm cell (6.2) for higher part of this range (e.g. higher than a mass fraction of 99,200 in %) and one with a 0,1 mm cell (6.2) for lower part of this range (from a mass fraction of 98,100 to 99,200 in %). Curve 5 can be further split into 2 curves in a similar way.

## 9.2 Preparation of the apparatus

### 9.2.1 FTIR spectrometer

The temperature of the laboratory should be in the range of 18 °C to 25 °C and maintained at a constant operating room temperature within ±1 °C. For example, the temperature is kept at (22 ± 1) °C.

The non-condensing relative humidity of the laboratory should be in the range of 30 % to 60 %, preferably as low as possible.

Make sure the humidity indication of the instrument is in normal status.

Turn on the instrument and wait for the instrument stabilization according to the instrument instructions.

### 9.2.2 Infrared liquid cell

The cell should be clean and dry. If the cell is kept filled with heavy water sample, make sure to rinse the cell thoroughly with the next sample.

Once the cell is contaminated with oil or any other solvents, use acetone or absolute ethyl alcohol (5.3) to clean the cell (6.2) in the fume hood (6.7), and flush the cell with demineralised light water (5.1). Then purge with dry nitrogen or compressed air (5.5) and keep it dry.

### 9.3 Editing of the method

According to Table 1, edit the parameters of the curves through the instrument software.

Choose the integration region and the baseline point in the suggested baseline region according to Table 1. Integrate the interested region by area for curve 1, curve 4 and curve 5 and integrate by height for curve 2 and curve 3. Normally 16 scan times are set for one spectrum.

NOTE Integration by area has the priority for the test method. If the interested region is only the absorbance strength of a characteristic wavelength, integrate the height of the characteristic wavelength with a selected baseline point in the suggested area which is recommended in Table 1.

### 9.4 Background spectrum

Scan air or demineralised light water (5.1) for background spectrum according to Table 1.

### 9.5 Heavy water reference standard spectra

Make sure the temperature of the heavy water reference standards reach the constant operating room temperature.

Extract heavy water reference standard using clean and dry syringe (6.3). Inject the reference standard into the infrared liquid cell (6.2) in an amount at least 5 times that of the cell volume to make sure that the cell is thoroughly rinsed, and insert the cell outlet with a plug and remove the syringe (6.3), then insert another plug into the cell inlet. Make sure there are no air bubbles or suspended dirt in the cell and the outside of the cell window is free of lint.

Place the cell (6.2) in the sample chamber of the Fourier transform infrared spectrometer (6.1). Scan the reference standard immediately after it has been put into the instrument chamber and get the spectrum. Repeat the above steps and get all the spectra of the reference standards.

Each curve should have 5 or more spectra.

### 9.6 Draw the calibration curves for different D<sub>2</sub>O concentration ranges

Choose the spectra of the standards, draw the curves respectively.

The linear coefficient of the curves shall meet the requirements in Table 1.

## 10 Procedure

### 10.1 Sample preparation

#### 10.1.1 Sample temperature adjustment

The sample temperature should be consistent with the temperature of the reference standards with which the curves are plotted. Wait until the temperature of the sample reaches the constant room temperature before performing the test.

#### 10.1.2 Sample filtration

If the sample is not clear or there is oil or any organic solvents or lint in the sample, the results will be affected. Always filter the sample with the syringe filter (6.11).

#### 10.1.3 Sample source check

Check the sample source and understand the approximate D<sub>2</sub>O concentration of the heavy water. Select the curve according to the D<sub>2</sub>O concentration range specified in Table 1.

If there is no information about the D<sub>2</sub>O concentration of the sample, scan the sample and determine the spectrum first, then choose the proper curve according to the region of interest in the spectrum.

### 10.2 Sample load and scan

- a) Choose the proper liquid cell (6.2). When performing the test of a series of samples with the same cell, inject the samples from high D<sub>2</sub>O concentration to low D<sub>2</sub>O concentration.
- b) Extract the sample using the hypodermic glass syringe (6.3) or disposable syringe (6.4) and inject the sample into the cell (6.2) at least 5 times of the cell volume to make sure that the cell is thoroughly rinsed, and insert the cell outlet with a plug and remove the syringe (6.3) or disposable syringe (6.4), then insert another plug into the cell inlet. Make sure there are no air bubbles or suspended dirt in the cell and the outside of the cell window is free of lint.
- c) Place the cell (6.2) in the sample chamber of the FTIR (6.1). Scan the sample immediately after it has been put in the instrument chamber and obtain the sample spectrum.
- d) Read the D<sub>2</sub>O concentration result of the sample from the curve. If the result is not in the range of the selected curve, choose another curve and repeat the test.

### 10.3 After measurement

- a) The sample left should be collected in a suitable container for later purification and up-grade or other disposal.
- b) Wash the glass syringe with demineralized light water (5.1) and dry it in an oven (6.8), take the syringe out after it was dried and put it in a desiccator (6.9).
- c) Used needles (6.5) and disposable syringe (6.4) should be flushed with demineralized light water (5.1) and collected and treated in a suitable way.
- d) The cell (6.2) could stay filled with the heavy water sample. If the infrared cell (6.2) is not to be used for some time, it shall be blown dry with dry nitrogen or compressed air (5.5) and store in a dry place.

## 11 Expression of results

### 11.1 Calculation method

D<sub>2</sub>O concentration and the integral value of the interested region of the sample can be fitted linearly by the least square method for all the 5 typical curves. The D<sub>2</sub>O concentration can be determined with [Formula \(3\)](#).

$$c_{\text{mass}} = aX + b \quad (3)$$

where

$X$  is the integral value of the interested region of the sample spectra;

$a$  is the slope of the curve;

$b$  is the intercept of the curve.

D<sub>2</sub>O isotopic purity can be converted from D<sub>2</sub>O concentration by [Formula \(4\)](#):

$$c_{\text{atom}} = \left( \frac{0,9 \times c_{\text{mass}}}{1 - 0,1 \times c_{\text{mass}}} \right) \times 100 \% \quad (4)$$

where  $c_{\text{mass}}$  is in fraction i.e. 10 % is 0,1;

Report the result in form of  $c_{\text{atom}}$  or  $c_{\text{mass}}$  according to the client's requirements.

### 11.2 Precision

A planned trial of this method was carried out by 6 laboratories. Five parallel samples in different range of D<sub>2</sub>O concentration were prepared by one laboratory and sent to all 6 laboratories. The six sets of data were produced by different operators, using different apparatus under the identical operation conditions and in a minimum period of time.

The results obtained were statistically treated in accordance with ISO 5725-1 and ISO 5725-2, which are listed in [Table 2](#).

**Table 2 — Standard deviation of the test results from 6 laboratories**

| Curves | Test results of 6 laboratories<br>(mass fraction in %) | Average D <sub>2</sub> O concentration<br>(mass fraction in %) | Absolute standard deviation<br>(mass fraction in %) |
|--------|--------------------------------------------------------|----------------------------------------------------------------|-----------------------------------------------------|
| 1      | 99,797                                                 | 99,800                                                         | 0,002 43                                            |
|        | 99,799                                                 |                                                                |                                                     |
|        | 99,798                                                 |                                                                |                                                     |
|        | 99,803                                                 |                                                                |                                                     |
|        | 99,802                                                 |                                                                |                                                     |
|        | 99,798                                                 |                                                                |                                                     |
| 2      | 88,258                                                 | 88,297                                                         | 0,045 3                                             |
|        | 88,360                                                 |                                                                |                                                     |
|        | 88,335                                                 |                                                                |                                                     |
|        | 88,240                                                 |                                                                |                                                     |
|        | 88,300                                                 |                                                                |                                                     |
|        | 88,290                                                 |                                                                |                                                     |

Table 2 (continued)

| Curves | Test results of 6 laboratories<br>(mass fraction in %) | Average D <sub>2</sub> O concentration<br>(mass fraction in %) | Absolute standard deviation<br>(mass fraction in %) |
|--------|--------------------------------------------------------|----------------------------------------------------------------|-----------------------------------------------------|
| 3      | 30,571                                                 | 30,594                                                         | 0,296                                               |
|        | 30,683                                                 |                                                                |                                                     |
|        | 30,489                                                 |                                                                |                                                     |
|        | 30,090                                                 |                                                                |                                                     |
|        | 30,770                                                 |                                                                |                                                     |
|        | 30,960                                                 |                                                                |                                                     |
| 4      | 15,108                                                 | 15,107                                                         | 0,071 8                                             |
|        | 15,080                                                 |                                                                |                                                     |
|        | 15,066                                                 |                                                                |                                                     |
|        | 15,010                                                 |                                                                |                                                     |
|        | 15,180                                                 |                                                                |                                                     |
|        | 15,200                                                 |                                                                |                                                     |
| 5      | 1,006                                                  | 1,003                                                          | 0,004 08                                            |
|        | 1,004                                                  |                                                                |                                                     |
|        | 1,008                                                  |                                                                |                                                     |
|        | 1,001                                                  |                                                                |                                                     |
|        | 1,000                                                  |                                                                |                                                     |
|        | 0,997                                                  |                                                                |                                                     |

### 11.3 Uncertainty

The uncertainty of this method mainly includes the following factors:

- The sample temperature: The reference standard and the sample should reach the constant temperature within  $\pm 1$  °C before being scanned to reduce the uncertainty brought by the temperature variation.
- Laboratory humidity: The laboratory relative humidity should be kept in the range of 30 % to 60 %, preferably as low as possible for the high isotopic purity sample analysis.
- The preparation of heavy water reference standards: Diluting process and the isotopic purity of the local light water (5.1) can introduce uncertainty.
- The stability of the FTIR (6.1).

## 12 Interferences

### 12.1 Contaminated samples

Contaminated samples with colour, oil or solvents could lead to erroneous results by extraneous absorption at the chosen wavelength in the infrared method or by altering the light transmittance in the method. Always filter the sample with syringe filter (6.11) before performing the test.

### 12.2 Air bubbles

Air bubbles in the cell will disturb the analysis results. Care should be taken not to introduce air bubbles into the cell.

### 12.3 Foreign materials on the outside of the cell window

Foreign materials like water, dirt on the outside of the cell window could lead to erroneous results. Use lint-free tissue paper (6.12) to make the cell window dry and clean before sample scanning.

## 13 Test report

The test report shall specify the followings:

- a) a reference to this document, i.e. ISO 23468:2021;
- b) the sample identification;
- c) the sample appearance;
- d) the client and contact information;
- e) the method used by reference to this document;
- f) any operation not specified in this document or any optional operation which might influenced the results;
- g) the test result(s) obtained;
- h) any unusual features (anomalies) observed during the determination;
- i) signature of the responsible;
- j) the date of the determination.


## **Annex A** **(informative)**

### **Specially designed stainless steel container for D<sub>2</sub>O reference standard**

The specially designed stainless steel container ([7.2.2](#)) is illustrated in [Figure A.1](#).

The heavy water standard is stored in a stainless steel container, under a blanket of helium gas. The standard can be sampled through a rubber diaphragm by means of hypodermic syringes. The container is pressurized to about 34,5 kPa with helium gas to prevent introduction of moist air and to facilitate sampling. The sampling rubber diaphragm could be changed immediately once there is leakage and the folded outlet tube provides a long diffusion path barrier if a trace of H<sub>2</sub>O should enter the diaphragm.

STANDARDSISO.COM : Click to view the full PDF of ISO 23468:2021

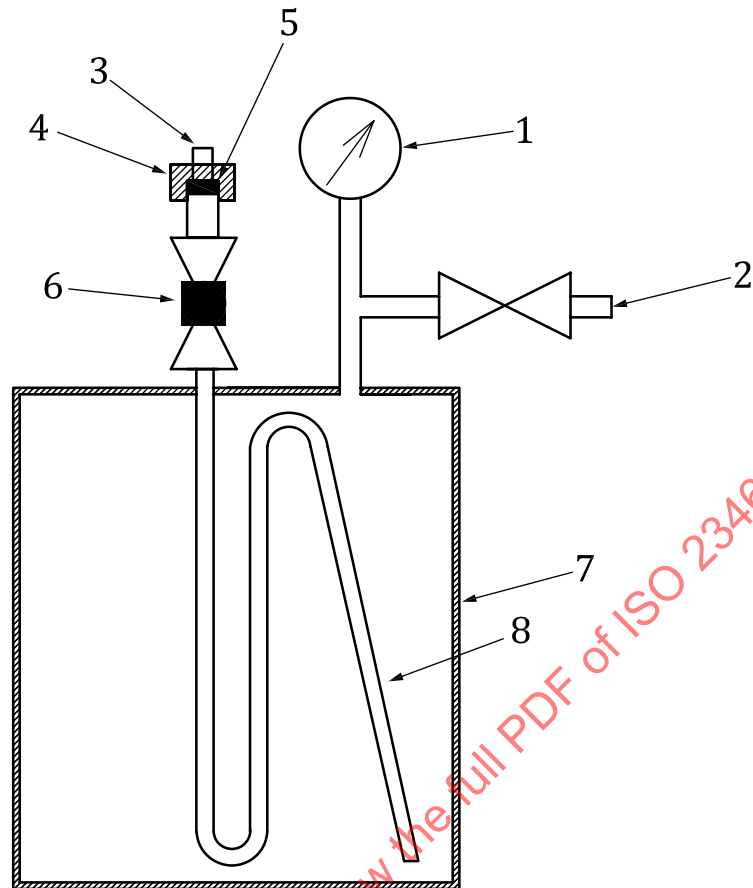

**Key**

- 1 pressure gauge
- 2 helium inlet
- 3 sample port
- 4 binding bolt
- 5 rubber diaphragm
- 6 ball valve
- 7 stainless steel container
- 8 folded outlet tube

**Figure A.1 — Specially designed stainless steel container**

## Annex B (informative)

### Interested region suggested for typical curves

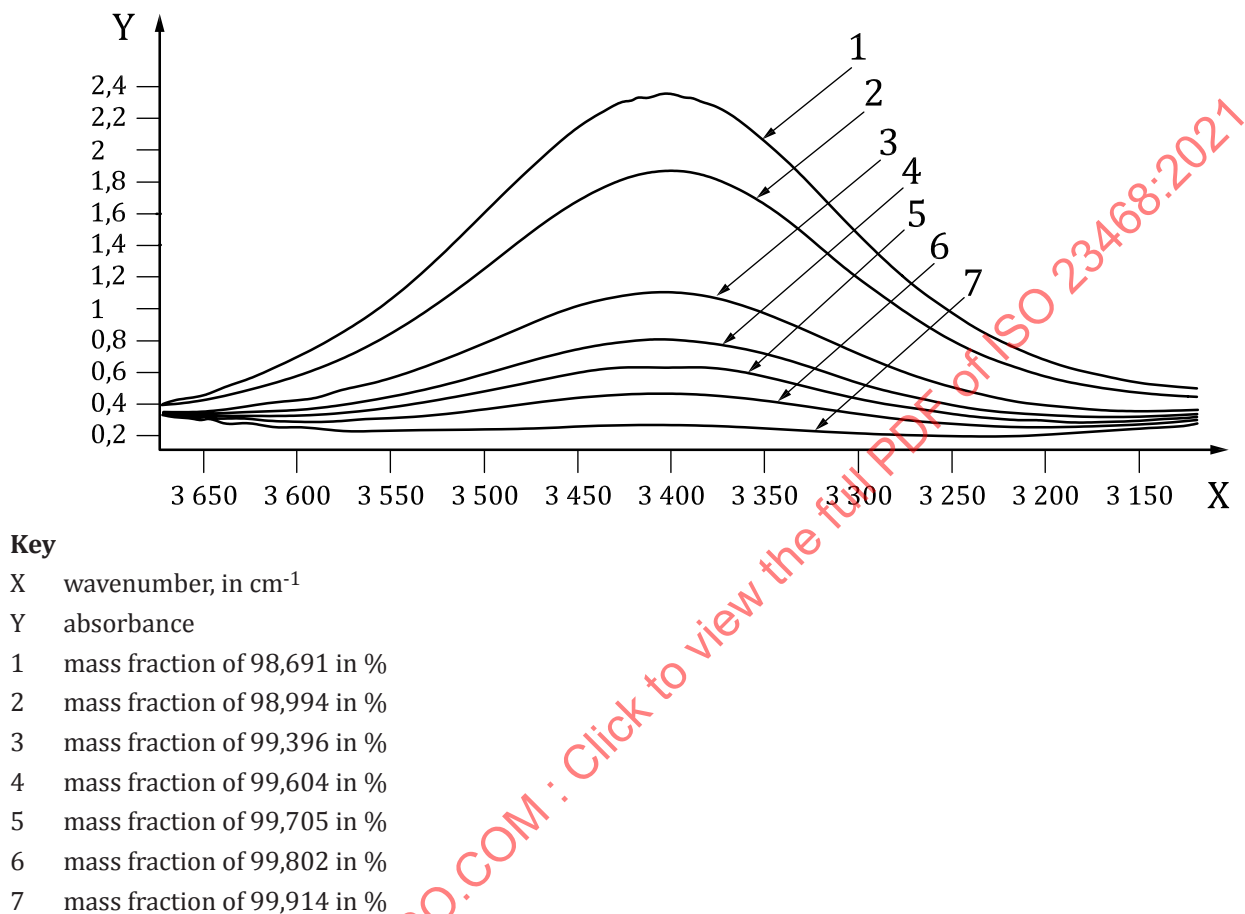
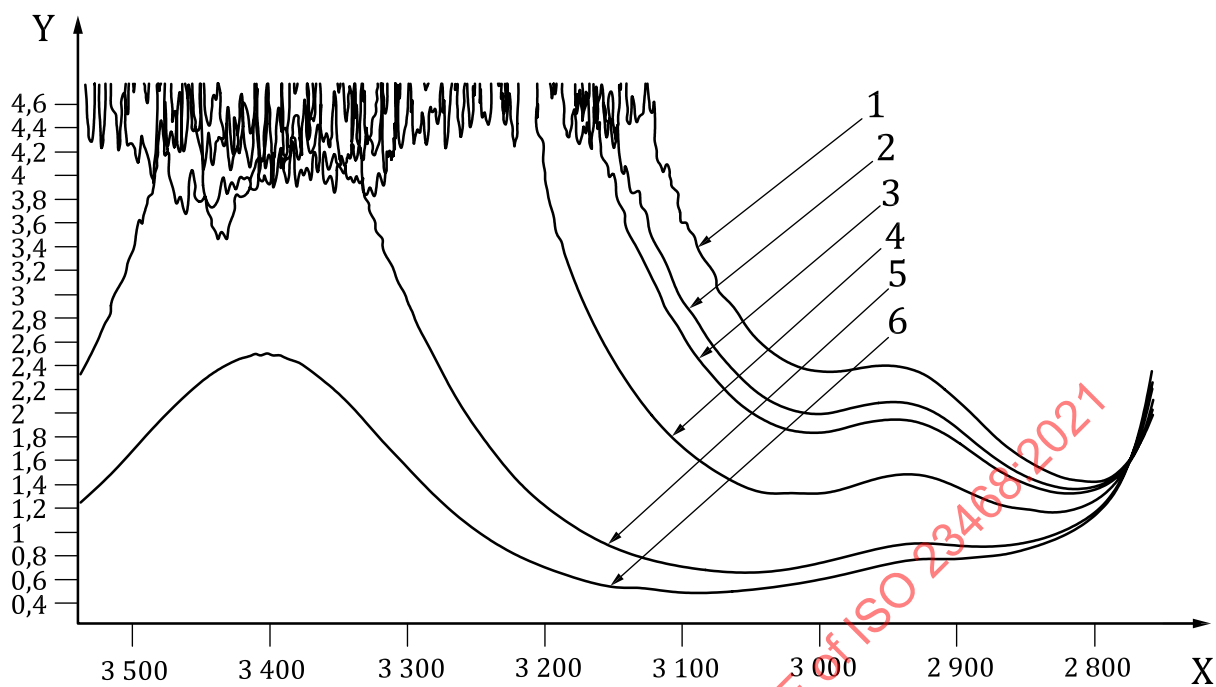


**Figure B.1 — Interested region of curve 1 (mass fraction from 98,500 to 100,000 in %)**

**Key**X wavenumber, in  $\text{cm}^{-1}$ 

Y absorbance

1 mass fraction of 79,5 in %

2 mass fraction of 83,4 in %

3 mass fraction of 84,8 in %

4 mass fraction of 90,6 in %

5 mass fraction of 97,1 in %

6 mass fraction of 98,5 in %

**Figure B.2 — Interested region of curve 2 (mass fraction from 80,0 to 98,5 in %)**