
**Rubber, vulcanized or
thermoplastic — Abrasion testing —
Guidance**

*Caoutchouc vulcanisé ou thermoplastique — Essais d'abrasion —
Lignes directrices*

STANDARDSISO.COM : Click to view the full PDF of ISO 23794:2023



STANDARDSISO.COM : Click to view the full PDF of ISO 23794:2023



COPYRIGHT PROTECTED DOCUMENT

© ISO 2023

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
CP 401 • Ch. de Blandonnet 8
CH-1214 Vernier, Geneva
Phone: +41 22 749 01 11
Email: copyright@iso.org
Website: www.iso.org

Published in Switzerland

Contents

	Page
Foreword.....	iv
1 Scope.....	1
2 Normative references.....	1
3 Terms and definitions.....	1
4 Wear mechanisms.....	2
5 Types of abrasion test.....	3
6 Abradants.....	8
7 Test conditions.....	9
7.1 Temperature.....	9
7.2 Degree and rate of slip.....	9
7.3 Contact pressure.....	9
7.4 Continuous/intermittent contact.....	9
7.5 Lubricants and contamination.....	9
8 Abrasion test apparatus.....	10
9 Reference materials.....	12
10 Test procedure.....	12
11 Expression of results.....	13
Bibliography.....	15

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see www.iso.org/directives).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see www.iso.org/patents).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT), see www.iso.org/iso/foreword.html.

This document was prepared by Technical Committee ISO/TC 45, *Rubber and rubber products*, Subcommittee SC 2, *Testing and analysis*.

This fourth edition cancels and replaces the third edition (ISO 23794:2015), which has been technically revised.

The main changes are as follows:

- some terms (abradant and abrasion pattern) have been added in [Clause 3](#);
- [Figures 1](#) to [9](#) have been transferred from [Clause 10](#) to [Clause 5](#);
- some captions for the figures have been changed to proper description;
- in [Clause 8](#), the order of the description has been changed;
- in addition, the text has been editorially revised to improve clarity.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at www.iso.org/members.html.

Rubber, vulcanized or thermoplastic — Abrasion testing — Guidance

WARNING 1 — Persons using this document should be familiar with normal laboratory practice. This document does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user to establish appropriate safety and health practices and to determine the applicability of any other restrictions.

WARNING 2 — Certain procedures specified in this document can involve the use or generation of substances, or the generation of waste, that can constitute a local environmental hazard. Reference should be made to appropriate documentation on safe handling and disposal after use.

1 Scope

This document provides guidance on the determination of the abrasion resistance of vulcanized and thermoplastic rubbers. It covers both solid and loose abrasives.

The guidelines given are intended to assist in the selection of an appropriate test method and appropriate test conditions for evaluating a material and assessing its suitability for a product subject to abrasion. Factors influencing the correlation between laboratory abrasion testing and product performance are considered, but, for example this document is not concerned with wear tests developed for specific finished rubber products, for example, trailer tests for tyres.

2 Normative references

There are no normative references in this document.

3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

ISO and IEC maintain terminology databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <https://www.iso.org/obp>
- IEC Electropedia: available at <https://www.electropedia.org/>

3.1

abrasion

loss of material from a surface due to frictional forces

[SOURCE: ISO 1382:2020^[1], 3.1]

3.2

abrasion resistance

resistance to wear resulting from mechanical action upon a surface

Note 1 to entry: Abrasion resistance is expressed by the abrasion resistance index.

[SOURCE: ISO 1382:2020^[1], 3.2]

3.3

abrasion resistance index

ratio of the loss in volume of a standard rubber to the loss in volume of a test rubber, measured under the same specified conditions and expressed as a percentage

Note 1 to entry: ISO 4649 contains a method for the determination of *abrasion resistance* (3.2) using a rotating drum device.

[SOURCE: ISO 1382:2020^[1], 3.3]

3.4

relative volume loss

loss in volume of a test rubber due to abrasion by a specified abradant which causes a reference rubber to lose a defined mass under the same conditions

3.5

abradant

material or means used for grinding, rasping rubber to cause abrasion

3.6

abrasion pattern

patterns on a surface formed by friction

4 Wear mechanisms

The mechanisms by which wear of rubber occurs when it is in moving contact with another material are complex, but the principal factors involved are cutting and abrasion. It is possible to categorize wear mechanisms in various ways and commonly distinction is made between

- abrasive wear,
- fatigue wear, and
- adhesive wear.

Additionally, wear by roll formation is sometimes considered as a separate mechanism.

Abrasive wear is caused by sharp asperities cutting the rubber.

Fatigue wear is caused by particles of rubber being detached as a result of dynamic stressing on a localized scale.

Adhesive wear is the transfer of rubber to another surface as a result of adhesive forces between the two surfaces.

Wear by roll formation is where there is progressive tearing of a layer of rubber which forms a roll.

There can also be corrosive wear due to direct chemical attack on the surface.

The term erosive wear is sometimes used for the action of particles in a liquid stream.

In any particular wear situation, more than one mechanism is usually involved, but one can predominate. Abrasive wear requires hard, sharp cutting edges, and high friction. Fatigue wear occurs with smooth or rough but blunt surfaces and does not need high friction. Adhesive wear is much less common, but can occur on smooth surfaces. Roll formation requires high friction and relatively poor tear strength. Roll formation results in a characteristic abrasion pattern of ridges and grooves at right angles to the direction of movement.

Abrasive wear or roll formation results in much more rapid wear than fatigue processes. The mechanism and hence the rate of wear can change, perhaps quite suddenly, with the conditions, such as contact pressure, speed, and temperature. In any practical circumstances, the mechanisms can be complex and critically dependent on the conditions. Consequently, the critical factor as regards testing

is that the test conditions should essentially reproduce the service conditions if a good correlation is to be obtained. Even a comparison between two rubbers can be invalid if the dominant mechanism is different in testing and in service. The range of conditions encountered in applications such as tyres is so complex, that they cannot be matched by a single test.

It follows that there cannot be a universal standard abrasion test method for rubber, and the test method and test conditions have to be chosen to suit the end application. Also, great care has to be taken if the test is intended to provide a significant degree of acceleration.

5 Types of abrasion test

Many abrasion testing machines have been devised and standardized at national level for use with rubber. The majority of rubber tests involve a relatively sharp abradant and were devised for use with tyre tread materials.

Abrasion tests can be divided into two main types: those using a loose abradant and those using a solid abradant.

A loose abrasive powder can be used rather in the manner of a shot-blasting machine as a logical way of simulating the action of sand or similar abradants impinging on the rubber in service. A loose abradant can also be used between two sliding surfaces. Conveyor belts or tank linings are examples of products subject to abrasion by loose materials. A car tyre is an example of the situation where there is a combination of abrasion against a solid rough abradant, the road, and abrasion against a free-flowing abradant in the form of grit particles. This situation can also occur in testing as a result of the generation of wear debris from a solid abradant.

Solid abradants can consist of almost anything, but the most common are: abrasive wheels (vitreous or resilient), abrasive papers or cloths, and metal “knives”. The majority of wear situations involve the rubber moving in contact with another solid material.

Distinctions can be made on the basis of the geometry by which the test piece and abradant are rubbed together. Many geometries are possible, and some common configurations are shown in [Figure 1](#) to [Figure 9](#):

[Figure 1](#): The test piece reciprocates linearly against a sheet of abradant (or alternatively a strip of abradant can be moved past a stationary test piece).

[Figure 2](#): The abradant is a rotating disc with the test piece held against it (or vice versa).

[Figure 3](#): Both abradant and test piece are in the form of a wheel, either of which can be the driven member.

[Figure 4](#): The rotating disc test piece is driving, or driven by, the abradant wheel(s). The relative position of test piece and abradant is as the figure and vice versa.

[Figure 5](#): Both the test piece and the abradant are rotating.


[Figure 6](#): The test piece is held against a rotating drum and traverses the drum. The test piece may also be rotated.

[Figure 7](#): The test piece revolves in contact with metal knives.

[Figure 8](#): Test pieces are tumbled together with abrasive particles inside a hollow rotating drum.

[Figure 9](#): Single metal knife is held against a rotating tube test piece.

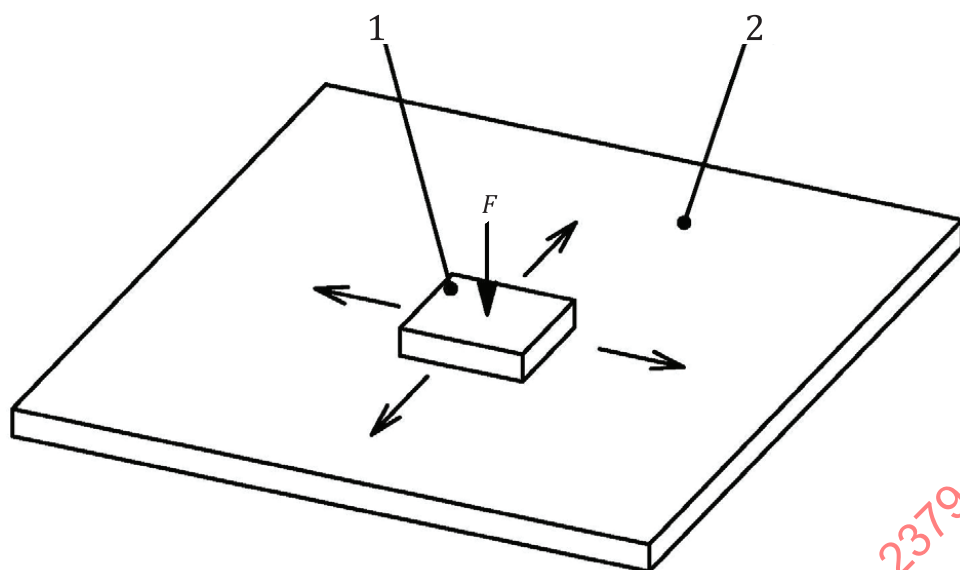
If the abrasion is unidirectional, abrasion patterns will develop which can markedly affect abrasion loss.



Key

- 1 test piece
- 2 abrasant
- F load

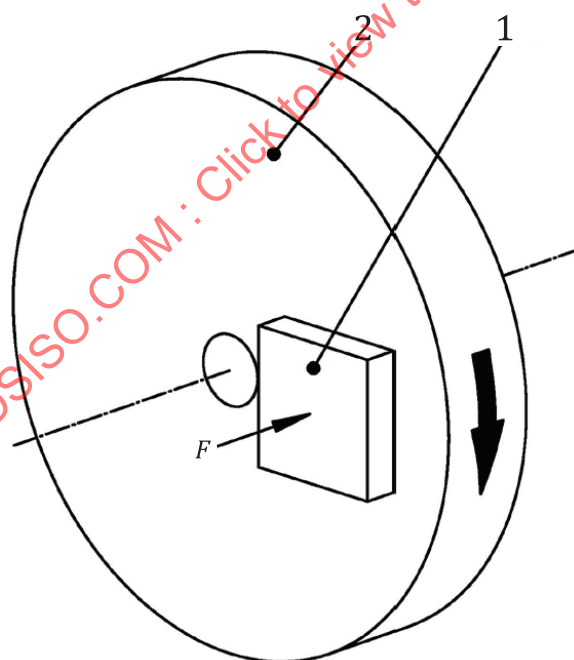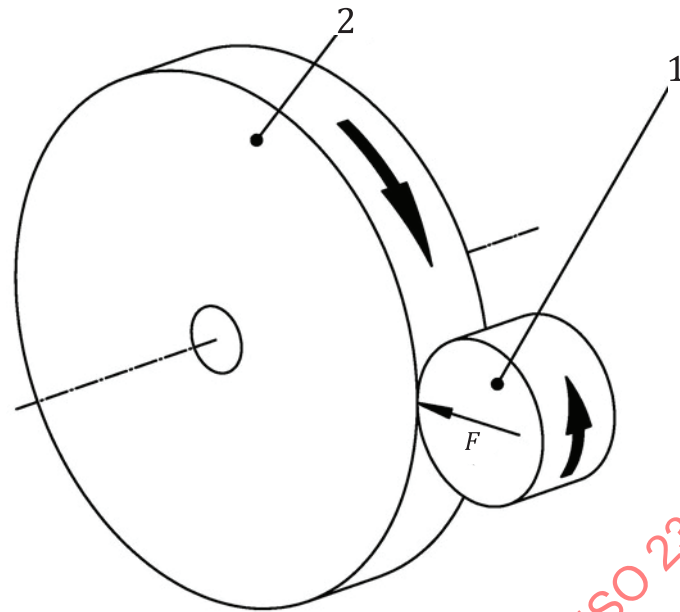
Figure 1 — Test piece reciprocating linearly against a sheet of abrasant



Key

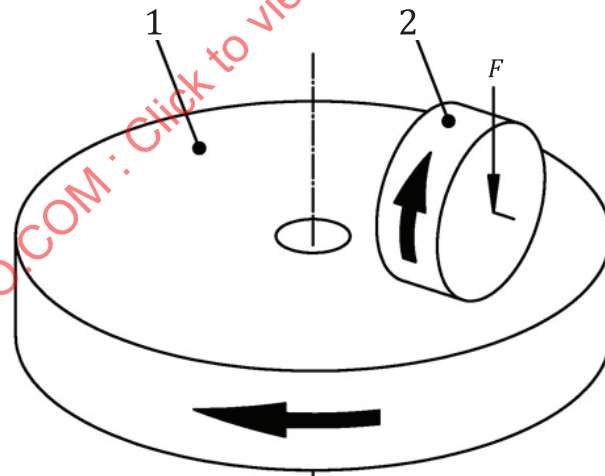
- 1 test piece
- 2 abrasant
- F load

Figure 2 — Test piece held against a rotating disc of abrasant

**Key**

- 1 test piece
- 2 abradant
- F load


Figure 3 — Test piece and abradant in the form of wheels either of which can be driven

**Key**

- 1 test piece
- 2 abradant
- F load

NOTE The relative position of test piece and abradant is as the figure and vice versa.

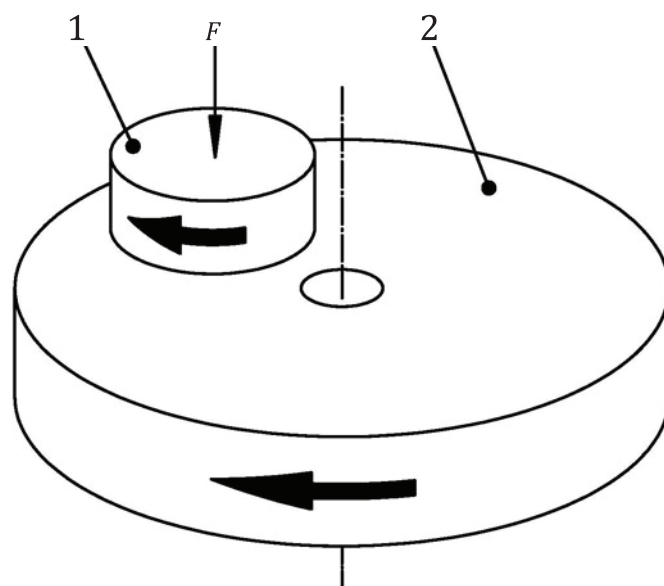
Figure 4 — Rotating disc test piece driving, or driven by, the abradant wheel(s)



Key

- 1 test piece
- 2 abrasant
- F load

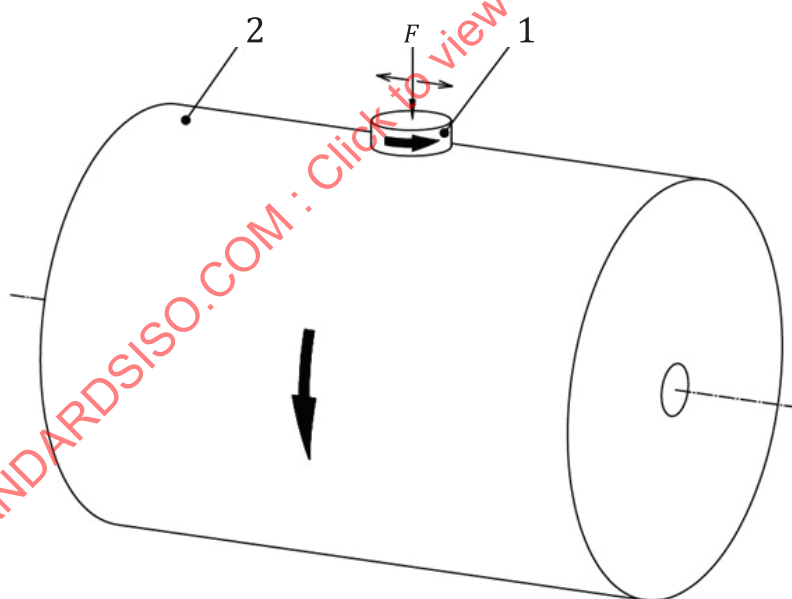Figure 5 — Rotating test piece held against a rotating abrasant disc




Key

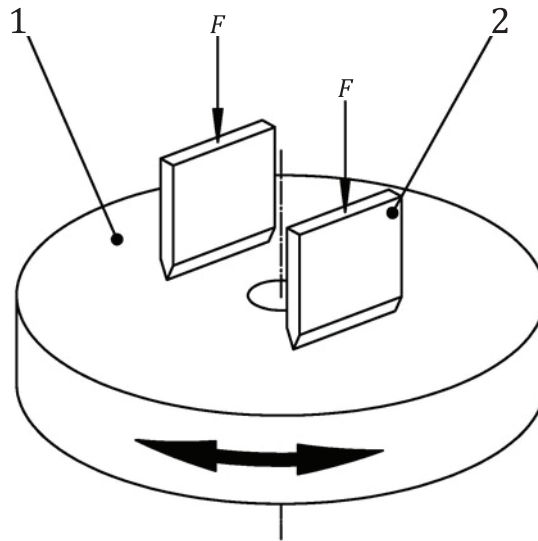- 1 test piece
- 2 abrasant
- F load

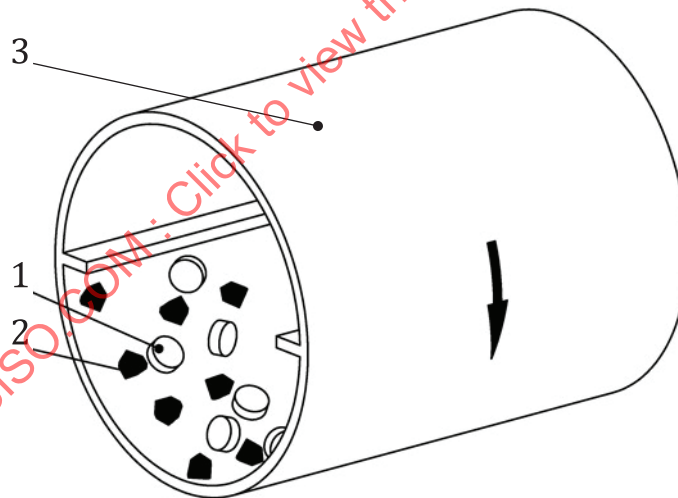
NOTE The test piece can also be rotated.

Figure 6 — Test piece held against a rotating drum and traverses the drum

**Key**

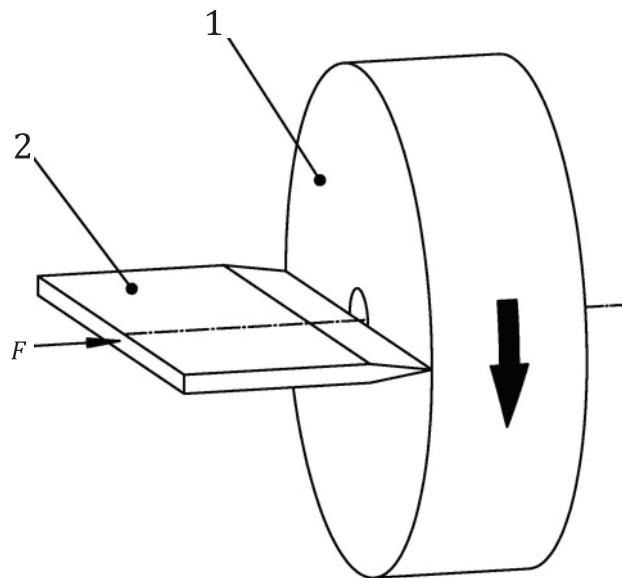
- 1 test piece
- 2 abrasant
- F load

Figure 7 — Knife-type abrasant held against test piece in the form of a rotating disc

**Key**

- 1 test piece
- 2 abrasant
- 3 rotating drum (mill)

Figure 8 — Test pieces and abrasants inside a rotating drum

**Key**

- 1 test piece
- 2 abrasant
- F load

Figure 9 — Knife-type abrasant held against a rotating cylindrical tube test piece

6 Abradants

Abradants can be classified into the following types:

- abrasive wheels;
- abrasive papers and cloths attached to discs;
- metal knives;
- smooth surfaces;
- loose abrasants.

The abrasive wheel is probably the most convenient abrasant because of its low cost and mechanical stability, and also, by simple refacing, a consistent surface can be maintained. Wheels are characterized by the nature of the abrading particles, their size and sharpness, the structure of the wheel, and the manner in which the abrasive is bonded (either resilient or vitreous). It follows that a very wide range of abrasive properties is possible.

Abrasive papers and cloths are inexpensive and easy to use, but deteriorate in cutting power rather quickly. They are characterized by the nature of the abrading particles and their size and sharpness.

Metal “knives” can have various geometries, including the form of a mesh and a raised pattern on a wheel. The main characteristic is the sharpness (radius) of the edges in contact with the rubber, and there can be some difficulty maintaining a reproducible sharpness.

Smooth surfaces are characterized by their degree of smoothness and the material, which defines the level of friction.

Loose abrasants are commonly particles of the same material as is used to form abrasive wheels or papers, and are characterized by their size and sharpness.

The choice of abradant should be made primarily to give the best correlation with service conditions, but it is also necessary for the abradant to be available in a convenient form and for its production to be reproducible.

As a consequence of these considerations, abrasive wheels and papers or cloths predominate where cutting by sharp asperities is to be simulated. It is still necessary to select an appropriate asperity size and sharpness. Materials such as textiles and metal plates are more appropriate for other applications. Smoother materials generally abrade relatively slowly and, if conditions are accelerated, give rise to an excessive temperature rise at the sliding surfaces. Because of these difficulties, abrasive wheels and papers are frequently used for convenience in situations where they are inappropriate for assessment of in-service performance.

7 Test conditions

7.1 Temperature

Although temperature has a large effect on wear rate and is one of the important factors in obtaining correlation between laboratory and service conditions, it is extremely difficult to control the temperature during testing. Abrasion tests are normally carried out at standard laboratory temperature. However, it is the temperature of the contact surfaces which is of importance rather than the ambient temperature, and the surface temperature reached is dependent on several experimental factors as outlined in 7.2 to 7.5.

7.2 Degree and rate of slip

With any geometry involving a fixed abradant, there is relative movement or slip between the abradant and the test piece, and the degree of slip is a critical factor in determining the wear rate. In [Figure 1](#) and [Figure 6](#), there is 100 % slip, and the rate of slip is the same as the rate of movement between abradant and test piece, whereas in [Figure 3](#), the degree of slip can be varied by changing the angle between the wheels. In [Figure 2](#), [Figure 4](#), [Figure 5](#) and [Figure 7](#), the rate of slip will depend on the distance of the test piece from the centreline. In [Figure 9](#), the degree of slip is 100 % but the rate of slip varies across the test piece. In all cases, the rate will depend on the speed of the driven member. An increase in the rate of slip will also increase the amount of heat generated and hence the temperature.

7.3 Contact pressure

The contact pressure between the test piece and abradant is another critical factor in determining the wear rate. Under some conditions, the wear rate is approximately proportional to the pressure, but abrupt changes will occur if, with changing pressure, the abrasion mechanism changes. Such a change can be because of a large rise in temperature.

Rather than consider contact pressure and degree of slip separately, it has been proposed that the power consumed in moving the rubber over the abradant should be used as a measure of the severity of an abrasion test. The power used will depend on the friction between the surfaces and will determine the rate of temperature rise.

7.4 Continuous/intermittent contact

An important difference between the types of apparatus shown in, for example, [Figure 1](#) and [Figure 4](#) is that, in the first case, the test piece is continuously and totally in contact with the abradant and there is no chance of the heat generated at the contact surfaces being dissipated.

7.5 Lubricants and contamination

Any change in the nature of the contact surfaces will affect the rate of wear, and this includes changes in the abradant and the test piece as the wear process proceeds. Additionally, there can be deliberate

addition of another material between the contact surfaces, accidental contamination, debris from the abrasant, and debris from the test piece.

Introduction of a particulate material between the contact surfaces can be made to simulate service conditions, such as a car tyre running on a dusty road. Similarly, a lubricant such as water can be introduced. Relatively few types of apparatus are capable of operating under these conditions.

It is common practice to remove wear debris by continuously brushing the test piece or by the use of air jets. In the latter case, care has to be taken to ensure that the air supply is not contaminated with oil or water from the compressor. Clogging or smearing of the abrasant is a common problem with abrasive wheels and papers, and its occurrence will invalidate the test. It is normally caused by a high temperature at the contact surfaces and, although the problem can sometimes be reduced by introducing a powder between the surfaces, it should be treated as an indication that the test conditions are not suitable. If high temperatures are experienced in service, a test method in which new abrasant is continually used should be chosen.

If correlation between laboratory tests and service conditions is required, the test conditions should be chosen extremely carefully to match those found in the application concerned.

8 Abrasion test apparatus

A large number of abrasion testers have been developed, and the following list is not exhaustive, but covers those of greatest significance in the rubber and plastics industries (the main features of each are presented in [Table 1](#)).

- Akron: Wheel-on-wheel geometry, notable for the ability to vary the degree of slip by changing the relative angle of the wheels.

NOTE 1 An example of the use of this method can be found in BS 903-A9^[2].

- Blade abrader: Single knife blade under a constant normal load is in contact with the flat surface of a rotating cylindrical tube test piece.
- DuPont (Grasselli)¹⁾: Pair of small, flat-faced moulded test pieces on a rotating abrasive paper disc.
- Laboratory Abrasion Tester 100 (LAT 100)¹⁾ (System Dr Grosch^[24]): Sophisticated computer-controlled apparatus, allowing variation of several parameters. Wheel-on-disc geometry.
- Lambourn (Dunlop)¹⁾: Both test piece and abrasive wheel are driven but at different speeds.
- Improved Lambourn: Significantly improved design. Test piece and abrasive wheel driven independently.
- Martindale¹⁾: Disc test piece on cloth abrasive disc. The pattern of relative movement forms a Lissajous figure giving multidirectional abrasion. A standard method for coated fabrics.

NOTE 2 An example of the use of this method for coated fabrics can be found in ISO 5470-2^[4].

- NBS (Footwear abrader): Small square test piece in contact with a revolving drum covered with abrasive paper. Used particularly for footwear compounds.

NOTE 3 An example of the use of this method, primarily for shoe soles and heels, can be found in ASTM D1630^[5].

- Pico: Disc test piece rotated in contact with a pair of tungsten knives supplied with a uniform flow of dusting powder.

NOTE 4 An example of the use of this method can be found in ASTM D2228^[6].

1) These abrasion testers are examples of a suitable products available commercially. This information is given for the convenience of users of this document and does not constitute an endorsement by ISO of these products.

- Rotating cylindrical drum (DIN, Conti): Small disc test piece traverses rotating cylinder covered with abrasive paper which gives large abradant/test piece area.

NOTE 5 An example of the use of this method can be found in ISO 4649[7].

- Rotating cylindrical mill: A number of designs involving test pieces (usually discs) and particulate abrasive being tumbled together inside a rotating hollow drum. The motion simulates the action of free-flowing abrasive materials.
- Schiefer (WIRA): The test piece and abradant are two discs arranged as shown in [Figure 5](#). The movement produces multidirectional abrasion. Various abradants be used, including serrated metal surfaces.
- Taber¹⁾: A pair of abrasive wheels is in contact with a driven flat-disc test piece. The force on the wheels and the nature of the abradant can easily be varied and the test can be carried out in the presence of liquids.

NOTE 6 An example of the use of this method for coated fabrics can be found in ISO 5470-1[8].

- Frick Taber¹⁾: Abrasive wheels on disc test piece with additional flow of abrasive powder. Noted for simulating wear of flooring.

NOTE 7 An example of the use of this method can be found in EN 660-2[3].

NOTE 8 Frick Taber is basically a Taber test with leather covered rollers and the use of special abrasive grit particles.

Table 1 — Summary of types of abrasion apparatus

	Test piece	Abradant	Motion	Slip	Speed	Contact	Reference
Akron	Wheel	Abrasive wheel	Test piece driven	Variable	0,2 m/s to 0,35 m/s	Intermittent	Figure 3
Blade abrader	Cylindrical tube	Knife	Test piece rotates	100 %	Variable	Continuous	Figure 9
DuPont	Moulded or cut from sheet	Abrasive paper	Abrasive paper rotates	100 %	0,19 m/s to 0,3 m/s	Continuous	Figure 2
LAT 100	Wheel	Abrasive disc	Disc rotates	Variable	Variable	Intermittent	Figure 4
Lambourne	Wheel	Abrasive disc	Test piece/ abradant driven	Variable	0,21 m/s	Intermittent	Figure 4
Improved Lambourne	Wheel	Abrasive wheel	Test piece/ abradant driven	Variable	0,15 m/s to 3,6 m/s	Intermittent	Figure 3
Martindale	Disc	Various	Test piece driven in pattern	100 %	Varies	Continuous	Modification of Figure 1
NBS	Square cut from sheet	Abrasive paper	Drum rotates	100 %	0,3 m/s to 0,4 m/s	Continuous	Figure 6
Pico	Disc	Tungsten knives	Test piece rotates	100 %	1,7 m/s to 5,3 m/s	Continuous	Figure 7
DIN	Disc	Abrasive paper	Test piece, which can or not rotate, traverses a rotating drum	100 %	0,31 m/s	Continuous	Figure 6
Mill	Disc	Abrasive particles	Tumbled in drum	NA	NA	Continuous	Figure 8

Table 1 (continued)

	Test piece	Abradant	Motion	Slip	Speed	Contact	Reference
Schiefer	Disc	Various	Test piece/ abrasant driven	100 %	Varies	Continuous	Figure 5
Taber	Flat disc	Various wheels	Disc rotates	100 %	0,045 m/s	Intermittent	Figure 4
Frick Taber	Flat disc	Wheel + powder	Test piece rotates	100 %	0,25 m/s	Intermittent	Figure 4

9 Reference materials

Because of the difficulty in ensuring reproducibility of the abrasant and/or test conditions, it is common practice to use a reference material against which results on the test material can be normalized.

Some workers prefer to use a standard rubber to normalize or certify the abrasant. This is most useful when the abrasant is certified by one source only, but does not enable corrections to be made for machine variations and ageing of the abrasant.

The alternative, or additional, approach is to refer results on the test material to results obtained at the same time on a reference rubber, with the objective of eliminating variability due to differences between nominally identical machines and abrasants.

The drawback to either approach is the difficulty in producing an accurately reproducible reference rubber. It can be difficult to decide whether it is the abrasant or the reference rubber that is the most stable and reproducible.

A reference rubber can be produced and certified by one source, be produced locally to a given formulation or specification, or be an in-house or user-defined standard representative of the type of compound being evaluated.

The most common type of reference rubber is based on a tyre tread compound, but shoe-sole type material is also widely used. Reference rubbers are specified in some specific abrasion test method standards, but no generally applicable reference materials have been established.

A material other than rubber can be used as a reference material and can be more suitable in terms of reproducibility. A very soft metal and a plastic have been suggested, but no such material is in common use.

10 Test procedure

The main objective in selecting the test method and test conditions for a particular application is to achieve correlation with service conditions. Good correlation is only possible if the abrasant and test conditions reproduce the essential conditions and, particularly, the abrasion mechanisms of service. Where service conditions are not well defined, it is advisable to carry out tests with a range of abrasants and test conditions.

In practice, good correlation is often extremely difficult or impossible to achieve because of the complexity of the wear mechanisms and the multiple climatic conditions in service.

Even for purely quality control purposes, it is necessary for the abrasant and conditions to be chosen so as to be similar to those in service, although it is generally sufficient to test with one abrasant and one set of defined test conditions.

The abrasion pattern is a good, although not fool proof, indication of the wear mechanism, and examination of the worn surfaces of both the product and test pieces can show how well the service conditions have been matched in the laboratory.

Even if there is no quantitative correlation, valuable results can be obtained if the test produces the same ranking of materials as in service. For example, if the wear resistance depends on the hardness, resilience or coefficient of friction, the test should show a similar dependence. Fatigue wear can sometimes be changed by the type of anti-degradant present in the rubber under both test and service conditions.

In seeking correlation, consideration should be given to factors other than the test conditions and wear mechanism. These include the effect of product bulk, the role of inflation where applicable, differences in the state of cure between the product and test pieces, and the effect of ageing of the product. Thus, it is sometimes appropriate to examine the effect of cure or ageing on test performance for closer correlations.

In some cases, it is advisable to make preliminary runs in order to remove any surface effects.

The general test procedure should follow a particular test method standard or the apparatus manufacturer's instructions. Attention is drawn to ISO 23529^[26] for conditioning of test pieces, determination of dimensions and preparation of test pieces, which should be followed as appropriate.

It is necessary to resurface or renew the abrasant and to plan the order in which materials are tested to minimize the effects of changes in the abrasant with time. Ideally, a new abrasant would be used for each test, but the frequency at which resurfacing or renewal is necessary will depend on the particular abrasant and the nature of the materials tested. A common practice is to test a reference material at intervals between the testing of the materials under study and to run repeat test pieces of a series of materials in reverse order.

Most methods are based on determining the difference in mass of the test piece before and after abrasion. Care will have to be taken that erroneous results are not obtained where microscopic examination shows that material has been scraped from the surface but remains attached to the test piece.

11 Expression of results

In standard abrasion tests, it is usually mass loss which is the parameter measured, although in certain cases, the change in test piece thickness is more convenient. Because it is the amount of material lost which matters, it is usual to convert the mass loss to a volume loss by dividing by the density. The volume loss can be expressed as the loss per unit distance travelled over the abrasant, loss per 1 000 revolutions of the apparatus, or loss per some other measure of length or time. A less usual practice is to express the result as the loss in volume per unit of energy consumed in causing abrasion, which is sometimes referred to as *abradability* and can be linked to the relative sliding speed through the Williams Landel Ferry (WLF) relationship. The loss in volume can also be calculated per unit surface area to give a specific wear rate.

Whatever measure is used to represent the loss, the rate of wear is not always constant because of inhomogeneity of the test piece, changes in the test piece surface or gradual changes in the nature of the abrasant. To investigate the test piece effects, wear rate can be plotted against the number of cycles or the distance travelled. Abrasant effects can be compensated for as discussed in [Clause 10](#).

The abrasion resistance can be calculated as the reciprocal of the loss in volume.

If a reference material has been used to normalize the abrasant, the relative volume loss, V_{RVL} , is calculated from:

$$V_{RVL} = \frac{V_{\text{test}} \times V_{\text{const}}}{V_{\text{ref}}} \quad (1)$$

where

V_{test} is the loss in volume of the test rubber;