

ISO

INTERNATIONAL ORGANIZATION FOR STANDARDIZATION

ISO RECOMMENDATION R 1099

AXIAL LOAD FATIGUE TESTING

1st EDITION

July 1969

COPYRIGHT RESERVED

The copyright of ISO Recommendations and ISO Standards belongs to ISO Member Bodies. Reproduction of these documents, in any country, may be authorized therefore only by the national standards organization of that country, being a member of ISO.

For each individual country the only valid standard is the national standard of that country.

Printed in Switzerland

Also issued in French and Russian. Copies to be obtained through the national standards organizations.

STANDARDSISO.COM : Click to view the full PDF of ISO/R 1099:1969

BRIEF HISTORY

The ISO Recommendation R 1099, *Axial load fatigue testing*, was drawn up by Technical Committee ISO/TC 17, *Steel*, the Secretariat of which is held by the British Standards Institution (BSI).

Work on this question led to the adoption of a Draft ISO Recommendation.

In June 1968, this Draft ISO Recommendation (No. 1351) was circulated to all the ISO Member Bodies for enquiry. It was approved, subject to a few modifications of an editorial nature, by the following Member Bodies :

Australia	India	Romania
Brazil	Israel	South Africa, Rep. of
Canada	Italy	Spain
Colombia	Japan	Switzerland
Czechoslovakia	Korea, Rep. of	Thailand
Denmark	Netherlands	Turkey
Finland	Norway	United Kingdom
Germany	Peru	U.S.A.
Hungary	Poland	U.S.S.R.

Four Member Bodies opposed the approval of the Draft :

Belgium
France
New Zealand
Sweden

The Draft ISO Recommendation was then submitted by correspondence to the ISO Council, which decided, in July 1969, to accept it as an ISO RECOMMENDATION.

STANDARDSISO.COM : Click to view the full PDF of ISO/R 1099:1969

AXIAL LOAD FATIGUE TESTING

1. SCOPE

This ISO Recommendation gives the conditions for carrying out axial load fatigue tests on test pieces without deliberately introduced stress concentrations. The tests are carried out at room temperature, in air, the loading applied to the test piece being along the longitudinal axis passing through the centroid of each cross-section.

Whilst the form, preparation and testing of test pieces of circular and rectangular cross-section are described, component testing and other specialised forms of test are not included in this ISO Recommendation. Tests on very thin test pieces of rectangular cross-section are not covered by this ISO Recommendation.

Results of fatigue tests may be affected by atmospheric conditions, and where controlled conditions are required, clause 2.1 of ISO Recommendation R 554, *Standard atmospheres for conditioning and/or testing – Standard reference atmosphere – Specifications*, applies.

2. OBJECT OF TEST

Tests are made to determine fatigue properties such as the S/N curve described in ISO Recommendation R 373, *General principles for fatigue testing of metals*.

3. PRINCIPLE OF TEST

Nominally identical test pieces are mounted in an axial load type fatigue testing machine and subjected to the required loading conditions, which introduce any one of the types of cyclic stress illustrated in Figure 3 in ISO Recommendation R 373. The test is continued until the test piece fails or until a pre-determined number of stress cycles has been exceeded. (See section 10.)

NOTE. – For definitions of failure see ISO Recommendation R 373.

4. SYMBOLS AND DEFINITIONS

In this ISO Recommendation the following symbols (see Figures 1 and 2) are used :

Symbols	Definitions
D	Diameter of the gripped ends of the test piece if plain, or overall diameter of the threaded ends
d	Diameter of the test piece where the stress is a maximum
L_c	Parallel length
r	Radius* at the ends of the test section which starts the transition from the test diameter d or test width b to the diameter D or width B of the gripped ends; or the continuous radius between the gripped ends of the test piece
a	Thickness of test section of test pieces of rectangular cross-section
b	Width of test pieces of rectangular cross-section where the stress is a maximum
B	Width of test pieces of rectangular cross-section at the gripped ends

Further symbols and definitions relating to fatigue testing are given in ISO Recommendation R 373.

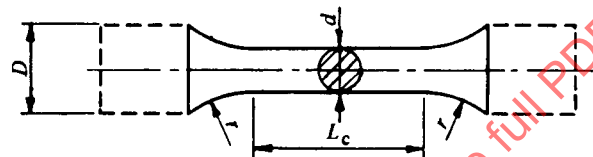


FIG. 1a

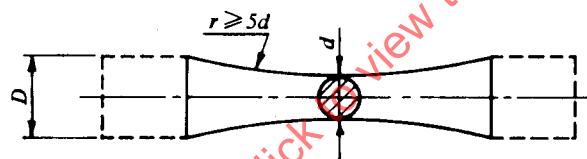


FIG. 1b

FIG. 1 Test pieces of circular cross-section

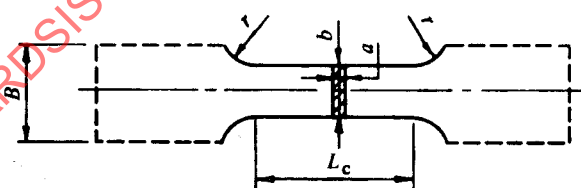


FIG. 2a

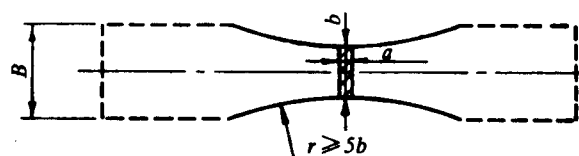


FIG. 2b

FIG. 2 - Test pieces of rectangular cross-section

- * This curve need not be a true arc of a circle over the whole of the distance between the end of the test section and the start of the enlarged end for test pieces of the types shown in Figures 1a and 2a.

5. SHAPE AND SIZE OF TEST PIECE

5.1 Form of test piece

The test piece may be of

- (a) circular cross-section, with tangentially blending fillets between the test section and the ends (Fig. 1a), or with a continuous radius between the ends (Fig. 1b);
- (b) rectangular cross-section of uniform thickness over the test section with tangentially blending fillets* between the test section and the gripped ends (Fig. 2a), or with a continuous radius between the ends (Fig. 2b).

The ends of the test piece should be of a form to suit the type of machine used and the material being tested.

The gripped ends of the test piece should be symmetrical about the axis or axes of the reduced test section. With certain types of axial load fatigue testing machines, it is important that the ends of the test pieces should be machined truly square to the axis or axes of the test section.

For either form of test piece where the test section is formed by a continuous radius, this radius should be not less than $5d$ or $5b$.

The type of test piece employed will depend on the information required from the test and the form in which the material is available. If basic fatigue properties of a material are to be determined, it is preferable, where practicable, to use test pieces of circular cross-section. For materials in round bar form, test pieces of circular cross-section are an obvious choice. Test pieces of rectangular cross-section are always used for testing materials in the form of sheet or thin plate. For production material in large sections, e.g. forgings, either form of test piece may be employed, but it should be noted that the form of the cross-section of the test piece may affect the value of the results obtained from the test.

5.2 Dimensions of test pieces

All the test pieces employed for a fatigue determination should have the same nominal dimensions.

When fundamental characteristics of a metal from a fatigue point of view are required, the following dimensions and tolerances apply :

- (a) *Circular cross-section.* The nominal value of the diameter d , where the stress is at a maximum, should be between 6 mm (0.25 in) and 12.5 mm (0.5 in). Where possible, the tolerance on shape of the cylindrical portion should be parallel within 0.02 mm (0.001 in).

In the case of test pieces taken from very short samples, a diameter of less than 6 mm may be used to obtain a standard test piece.

For the purpose of calculating the load to be applied to obtain the required stress, the actual minimum diameter of each test piece should be measured to an accuracy of 0.01 mm (0.0005 in). Care should be taken during the measurement of the test piece prior to testing that the surface is not damaged.

NOTE. — In tests where the stress cycle runs into compression the ratio L_0/d should not be greater than 4. It may be necessary to reduce this ratio considerably, to avoid high stresses due to buckling.

* With test pieces of rectangular cross-section, it may be required to reduce the test section in both width and thickness. If this is necessary, then blending fillets will be required in both the width and thickness directions.

- (b) *Rectangular cross-section.* Nominal values of the thickness, a , and the width, b , should be such that the area of the cross-section where the stress is at a maximum is between 32.2 mm^2 (0.05 in^2) and 645 mm^2 (1.0 in^2). Where possible, the shape of the rectangular section should be parallel within 0.02 mm (0.001 in).

For the purpose of calculating the load to be applied to obtain the required stress, the cross-sectional area should be calculated from measurement of the appropriate dimensions with a tolerance of not more than $\pm 0.5 \%$ in each dimension. Care should be taken during the measurement of the test piece prior to testing that the surface is not damaged.

NOTES

1. A larger range of cross-sectional area is permitted for test pieces of rectangular cross-section than for test pieces of circular cross-section, as the rectangular form is frequently used for obtaining data on sheet and plate of widely varying thicknesses.
2. The tolerance on the measurement permitted for test pieces of rectangular cross-section takes into account the possibility that such test pieces may be tested with their surfaces in the "as received" condition.
3. In tests where the stress cycle runs into compression the ratio L_c/b should not be greater than 4. It may be necessary to reduce this ratio considerably to avoid high stresses due to buckling. It may be necessary, also, to consider the ratio of the thickness to the width in relation to buckling stresses.

6. PREPARATION OF TEST PIECE

6.1 Method of machining

It is necessary to ensure that any cutting (e.g. contour profiling by flame cutting) or machining operation required, either to rough the test piece out from the blank or to machine it to size, does not alter the metallurgical structure or properties of the test piece. All cuts taken in machining should be such as to minimize work-hardening of the surface of the test piece. Grinding may be used, particularly in finishing to size test pieces of the harder steels, but an adequate supply of coolant should be ensured so as to avoid undue heating of the surface. (See clause 4.2 of ISO Recommendation R 373.)

Throughout any machining or grinding procedures, the tool or cutter sharpness and setting, the conditions of the wheel and the grinding machine and speeds and feeds should conform to good workshop practice for the material commensurate with the requirements of clauses 6.2, 6.3, 6.4 and 6.5.

6.2 Turning

It is recommended that the following procedure should be adopted :

- 6.2.1** In rough turning the test piece from a diameter of $x + 5 \text{ mm}$ ($x + 0.2 \text{ in}$) (x will generally be the diameter, d , plus a suitable allowance for surface finishing) to $x + 0.5 \text{ mm}$ ($x + 0.02 \text{ in}$), a succession of cuts of decreasing depth should be made, the recommended depths of cut being as follows :

1.25 mm (0.05 in)
0.75 mm (0.03 in)
0.25 mm (0.01 in)

- 6.2.2** From a diameter of $x + 0.5 \text{ mm}$ ($x + 0.02 \text{ in}$) to x , a further succession of cuts of decreasing depth should be made, the recommended depths of cut being as follows :

0.125 mm (0.005 in)
0.075 mm (0.003 in)
0.05 mm (0.002 in)

For these finishing cuts a feed not exceeding 0.06 mm (0.0025 in) per revolution should be used.

6.3 Milling

This process may be applied in the extraction of test piece blanks from billets or plates and, in the case of test pieces of rectangular cross-section, for machining such blanks to the finished test piece size.

In selecting cutting speeds and feed rates, due regard should be paid to the test piece material and, for finishing cuts, to the quality of the surface finish required.

NOTE. — It is not practicable to recommend a set procedure for milling. Cutting speeds and depths of cut differ from plain milling and face milling, whilst material composition and conditions also influence these values.

6.4 Grinding

For test pieces in material which cannot be readily turned, it is recommended that the finishing operations are carried out by grinding.

The test piece should then be ground to size. A succession of cuts of decreasing depth should be made, the recommended values being as follows :

- 0.030 mm (0.0012 in) depth of cut to 0.1 mm (0.004 in) oversize;
- 0.005 mm (0.0002 in) depth of cut to 0.025 mm (0.001 in) oversize;
- 0.0025 mm (0.0001 in) depth of cut to size.

6.5 Surface finishing

When the test section has been machined or ground to nominal dimensions, it should be polished either by hand or by machine, using successively finer grades of abrasive papers or cloths. The polishing should generally be in a longitudinal direction, although intermediate stages may be done in any direction to ensure that longitudinal scratches made by the coarser grades of abrasive papers or cloths are removed. The direction of polishing at the final stage should be mainly longitudinal.

The polishing sequences employed should be such that the finished test section has a surface texture of not rougher than 0.025 microns (centreline average).

6.6 Storage prior to testing

If there is an interval between final preparation and testing of the test pieces they should be examined by appropriate means to ensure that no deterioration of the surface has taken place during the storage period. If there is any deterioration the test piece should be re-polished to remove any surface defects, e.g. corrosion pits.

With rectangular test pieces it is recommended that burrs and sharp corners be removed. This can normally be done by hand with a fine grade of abrasive paper.

NOTE. — The procedures described in clauses 6.2, 6.4 and 6.5 represent standard practice for a wide range of materials. It should not be inferred that they are wholly applicable to all materials and to all heat-treated conditions of these materials. For example, the allowance of 0.5 mm (0.02 in) on diameter x , for heat treatment prior to final grinding to size, may not be adequate. The purpose of this allowance is to permit the removal of material affected by surface phenomena associated with the heat treatment procedure, such as decarburization, distortion, etc.; the allowance used in practice should be sufficient to ensure the complete removal of any features associated with such effects.

Some fatigue investigations may be undertaken to study the behaviour of material with particular surface finishes (e.g. rough machined, fine machined or in the "as received" condition) in which case special conditions would apply.