

ISO

INTERNATIONAL ORGANIZATION FOR STANDARDIZATION

ISO RECOMMENDATION R 184

BRINELL HARDNESS TEST FOR GREY CAST IRON

1st EDITION

February 1961

COPYRIGHT RESERVED

The copyright of ISO Recommendations and ISO Standards belongs to ISO Member Bodies. Reproduction of these documents, in any country, may be authorized therefore only by the national standards organization of that country, being a member of ISO.

For each individual country the only valid standard is the national standard of that country.

Printed in Switzerland

Also issued in French and Russian. Copies to be obtained through the national standards organizations.

STANDARDSISO.COM : Click to view the full PDF of ISO/R 184:1961

BRIEF HISTORY

The ISO Recommendation R 184, *Brinell Hardness Test for Grey Cast Iron*, was drawn up by Technical Committee ISO/TC 25, *Cast Iron*, the Secretariat of which is held by the British Standards Institution (B.S.I.).

Work on this matter which the Technical Committee had already begun in 1955, came to an end in 1959, with the adoption of a proposal as a Draft ISO Recommendation.

On 12 June 1959, the Draft ISO Recommendation (No. 286) was distributed to all the ISO Member Bodies and was approved by the following Member Bodies:

Belgium	Greece	Romania
Burma	Hungary	Spain
Chile	India	Sweden
Czechoslovakia	Italy	Switzerland
Denmark	Netherlands	United Kingdom
Finland	New Zealand	U.S.A.
France	Norway	
Germany	Portugal	

No Member Body opposed the approval of the Draft.

The Draft ISO Recommendation was then submitted by correspondence to the ISO Council, which decided, in February 1961, to accept it as an ISO RECOMMENDATION.

STANDARDSISO.COM : Click to view the full PDF of ISO/R 184:1961

BRINELL HARDNESS TEST FOR GREY CAST IRON

1. SCOPE

This ISO Recommendation refers exclusively to the determination of Brinell hardness of grey cast iron, and not to the determination of hardness of chilled cast iron or of grey cast iron which has been surface-hardened, since these properties only concern specialized foundries.


2. PRINCIPLE OF TEST

The test consists in forcing a steel ball of diameter D , under a load F , into the test piece and measuring the diameter d of the indentation left in the surface after removal of the load.

The Brinell hardness HB is the quotient of the test load F (expressed in kilogrammes-force) by the curved surface area of the indentation (expressed in square millimetres) which is assumed to be spherical and of diameter D .

3. SYMBOLS AND DESIGNATIONS

Number	Symbol	Designation
1	D	Diameter of the ball, in millimetres
2	F	Test load, in kilogrammes-force
3	d	Diameter of indentation, in millimetres
4	HB	Brinell hardness
		$= \frac{\text{test load}}{\text{surface area of indentation (considered as a portion of a sphere)}}$ $= \frac{2F}{\pi D (D - \sqrt{D^2 - d^2})}$

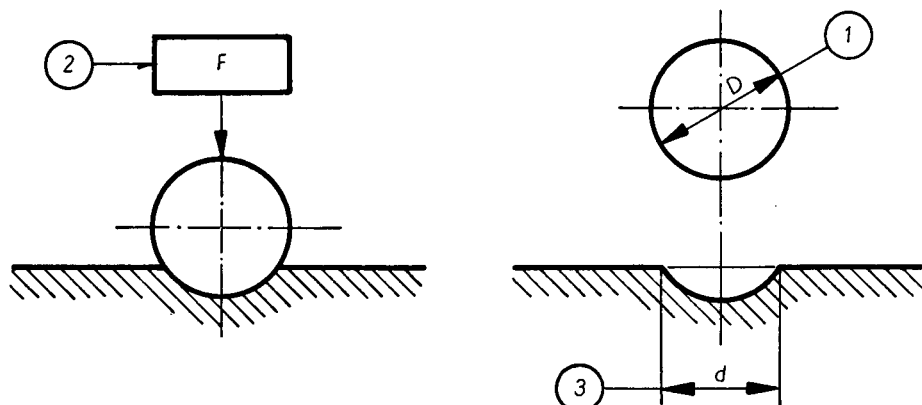

NOTE

The Brinell hardness is denoted by the symbol HB for standard test conditions, i.e.:

ball diameter	10	mm
load	3 000	kgf
duration of loading	15	s

For other conditions, the symbol HB is supplemented by an index indicating the test conditions in the following order:

diameter of ball,
load,
duration of loading.

Example: HB 5/750/15 = Brinell hardness
measured with a ball of 5 mm diameter and
with a load of 750 kgf applied for 15 s.

4. TESTING EQUIPMENT

The ball diameter should be chosen as a function of the thickness of the test piece, namely:

Thickness of the test piece millimetres	Ball diameter millimetres
less than 5	2 ± 0.003 5 or 2.5 ± 0.003 5
from 5 to 15	5 ± 0.004
more than 15	10 ± 0.004 5

5. TEST REQUIREMENTS

- 5.1 The test is carried out at ambient temperature, unless otherwise specified.
- 5.2 The ball is placed against the surface of the test piece. Pressure is gradually applied to the ball normal to the surface without sudden shocks until the test load is attained. The test load is maintained for 15 ± 1 s.
- 5.3 The test should be carried out on a surface which is sufficiently smooth and even to permit the accurate determination of the diameter of the indentation. It should be free from oxide scale and foreign matter. Care should be taken in preparing the surface to avoid any change in condition, e.g. due to heating or cold working.
- 5.4 The test piece should be placed on a rigid support. The contact surfaces should be clean and free from foreign matter (scale, oil, dirt, etc.). It is important that the test piece lies firmly on the support so that displacement cannot occur during the test.