

Photometry Laboratory Accuracy Guidelines— SAE J1330 AUG82

SAE Information Report
Approved August 1982

S. A. E.
LIBRARY

THIS IS A PREPRINT WHICH IS
SUBJECT TO REVISIONS AND
CORRECTIONS. THE FINAL
VERSION WILL APPEAR IN THE
1984 EDITION OF THE SAE
HANDBOOK.

SAE *The Engineering
Resource For
Advancing Mobility*

PREPRINT

SAENORM.COM : Click to view the full PDF of J1330_198208

PHOTOMETRY LABORATORY ACCURACY GUIDELINES—SAE J1330 AUG82

SAE Information Report

Report of the Lighting Committee, approved August 1982. Rationale statement available.

1. Scope—The purpose of this information report is to list and explain major equipment, instrumentation, and procedure variables which can affect inter-laboratory differences and repeatability of photometric measurements of various lighting devices listed in SAE Standards and Recommended Practices. The accuracy guidelines listed in the report are for the purpose of controlling variables that are not a direct function of the lighting device being measured. The control of these individual variables is necessary to control the overall accuracy of photometric measurements. These accuracy guidelines apply to the measurement of the luminous intensities and reflected intensities of devices at the specified geometrically distributed test points and areas. These guidelines do not apply to photometric equipment used to measure license plate lamps.

2. Use of Guidelines—The accuracy limit guidelines suggested in this report are intended as a reference guide to photometric laboratories of various accuracy parameters to help maintain correlation of photometric measurements between laboratories. The guidelines are not intended as specifications to be applied to all photometric equipment, test fixtures, and measurements. Actual photometric performance of various functions and the designs of lighting devices and test fixtures may vary considerably. The use of the guideline information in this report as rigid specifications applied to all types of photometric measurements would be impractical and in some cases would result in equipment with unnecessary accuracy restrictions. These guidelines should be used to aid the photometric laboratory in the awareness of the major variables and to provide information on equipment, instrumentation, and procedure accuracies which may affect overall laboratory differences and repeatability.

3. Accuracy Guidelines

3.1 Test Fixtures

3.1.1 DEVICE POSITIONING—The lighting device to be photometered should be mounted on a rigid test fixture in a position corresponding to the designed nominal operating position of the device on the vehicle. For devices designed for a specific vehicle, the designed nominal position should be determined from the vehicle manufacturer's specifications. For devices designed for multiple vehicle use, the designed nominal position should be determined from the device manufacturer's specifications or instructions. Multiple use devices should be tested in each position in which they are designed for use, or the equivalent, by mathematically translating axis angles and test points.

One of the factors which can significantly affect the device mounting attitude is the torque used to fasten the device to the test stand. This is particularly important when the device floats on a compression type gasket. Mounting torques should be specified for all devices, and these torques should be sufficient to compress the specified gaskets so that "floating" of parts does not occur, unless certain parts are so designed as a means of absorbing shock and vibration.

3.1.2 TEST FIXTURE POSITIONING—Numerous factors affect the ability of the test fixture to position the test device in its designed nominal position. Some of these accuracy factors are the rigidity and flatness of the base, the rigidity of the test fixture structure, and the length of the machined alignment edge or the spacing between alignment pins. Each test fixture should be built from a manufacturer's test fixture design standard to minimize these errors. One suggested example of a test fixture design guide is shown in Appendix A. Other test fixture designs may be equally satisfactory (for example, specialized fixtures for sealed beam units) if they provide proper positioning accuracy.

3.1.3 POSITIONING TOLERANCE—Tolerance guidelines for positioning the test device are listed below.

3.1.3.1 Lighting Devices Except Headlamp Units—The tolerance for positioning the device in the test fixture should be ± 0.1 deg in each axis.

3.1.3.2 Headlamp Units—The positioning of headlamp units is generally more critical than other lighting devices. The tolerance for positioning of headlamp units in the test fixture should be ± 0.05 deg in each axis.

3.2 Measurement of Spatial Distributions of Luminous Intensity—The photometric test point patterns specified in the SAE technical reports are based on measurement of luminous intensity as a function of angle when using a Type A goniometer (as shown in Appendix B and recommended in SAE J575) to position the device with the configuration of horizontal rotation over elevation. The other goniometer configuration is elevation over horizontal rotation (Type B). The use of a Type B goniometer configuration may require the use of a conversion table as given in Appendix B. Methods other than a two axis goniometer, as described

above, may be used. For example, a fixed test device with fixed photometer sensors mounted at every specified test point at some suitable distance, or other configurations of fixed and/or moveable sensors may be used. It should be noted that specified luminous intensity maximums or values between test points cannot be measured using sensors at fixed test points.

3.2.1 POSITIONER ACCURACY DETERMINATION—The accuracy of positioners or goniometers used to measure spatial distributions of luminous intensities can be determined by using a checking procedure such as outlined in Appendix C.

3.2.2 POSITIONER TOLERANCES—The repeatability of photometric measurements stated as a percent difference between laboratories when measuring the same device cannot be solely determined as a function of the accuracy of the positioner system or goniometer. For example, a difference of 0.1 deg due to mounting/positioner accuracy will result in no difference between measurements (other factors being equal) if the light distribution is uniform and does not vary significantly with angle in the area of interest. On the other hand, if the area of interest is in a high gradient (rate of change of luminous intensity with angle), one system may, for example, measure 500 cd and another system with a difference of 0.1 deg may measure 550–600 cd. The percent difference between the two measurements could then be 10–20% even with the small orientation difference. This example demonstrates that it is not possible to state a specific accuracy for a photometric measurement system as a function of angle accuracy alone, as both the positioner angular accuracy and the luminous intensity gradient are involved.

Two axis goniometers are available with accuracies of ± 0.05 deg and with a resolution of ± 0.01 deg. However, in most photometric measurements, a positioner system accuracy deviation of ± 0.1 deg with a resolution of ± 0.03 deg is considered adequate. (See paragraph 3.1.3.2 above.)

3.3 Power Supplies—Unless otherwise specified, a regulated DC power supply should be used for all photometric measurements. The following are suggested specifications for the DC power supply:

3.3.1 LINE REGULATION— $\pm 0.1\%$

3.3.2 RIPPLE AND NOISE—0.4% maximum

3.3.3 STABILITY—Any power supply that remains stable within $\pm 0.1\%$ during the photometric measurement period is satisfactory.

3.4 Voltage Measurements—A $4\frac{1}{2}$ digit digital voltmeter (DC) with a 10 meg ohm minimum impedance and with an accuracy of 0.05% of the reading is recommended for measurements up to at least 20 V. Voltage measurements should be taken as close to the device input terminations as practicable.

3.5 Current Measurements—A $4\frac{1}{2}$ digit digital voltmeter reading the output of a precision current shunt is recommended for measurements up to 100 W. The size of the shunt should be sufficient to prevent error due to excessive heat loading. The minimum accuracy of this system should be 0.09% of the value of the current being measured.

3.6 Accurate Rated Bulbs—Unless otherwise specified, accurate rated bulbs should be used for all photometric measurements. When applicable ratings are available, these bulbs should be rated at the current to produce the designed luminous flux (lumens) or mean spherical intensity (candela) in the attitude in which they are intended to be used with respect to gravity (any attitude for vacuum bulbs). Yellow glass bulbs should also be rated for current to produce their designed luminous flux. Because there are several filament parameters in addition to those controlled in accurate rated bulbs such as coil length, pitch, diameter, and color temperature, some lighting devices may produce significantly different luminous intensity measurements with two different accurate rated bulbs, particularly lighting devices with exceptionally short focal lengths. The light source should be allowed sufficient warmup period for the luminous flux to stabilize. Yellow glass bulbs should also have a sufficient warmup period for any color change to stabilize.

3.7 Sensor/Photometer System

3.7.1 COLOR RESPONSE—The spectral response of the photometer sensor system should be such that color corrections in the yellow color being tested are less than 2% between the yellow-green limit and the yellow-red limit. Likewise, the red correction should not exceed 3% from the red-yellow limit to medium red. One method to determine this color response requires a 2856°K (C.I.E. Illuminant A) standard lamp and a set of at least four glass color filters calibrated for transmittance at 2856°K. Suggested filters are:

Color Region	Chromaticity Coordinates	
	x	y
SAE Yellow-Green Limit Area	0.56	0.44
SAE Yellow-Red Limit Area	0.61	0.39
SAE Red-Yellow Limit Area	0.67	0.33
Medium Red Area	0.69	0.31

In addition, blue filters can be used to check the blue response such as ones with 2856°K chromaticity coordinates of approximately $x = 0.16$, $y = 0.13$; and approximately $x = 0.12$, $y = 0.30$.

Other methods for determinations of color response are acceptable. For example, a calibrated filter may be used whose color matches the color of the light emitted by the device(s) being measured.

3.7.2 RANGE LINEARITY—The linearity of the sensor/photometer system should be verified at least over the range of luminous intensities used for the specific type of device being measured. A deviation from linear response over the range from the calibration level to the extreme luminous intensity value measured should not exceed 2.5%. Measurements made over a narrow range of intensities should have a smaller deviation from linear response.

3.7.3 PHOTOMETER SENSOR APERTURE SIZE—Since photometric measurements are allowed at various distances with different lighting device functions, the area of the photosensor aperture determines the intercepted solid angle of the light flux at the measured test point. Use of large diameter photodetectors should be avoided at shorter measurement distances. Unless otherwise specified, the actual effective area of the sensor used for making the photometric measurements should fit within a circle whose diameter is approximately 0.009 times the distance from the measured light source to the sensor. A 0.009 ratio is equivalent to a solid angle formed by a radius of 0.26 deg. At test distances greater than 5 or 10 m it is common practice for sensor areas to be considerably smaller than the 0.009 maximum. Unless otherwise required, a minimum size is not specified for a sensor; however, some differences in measurements due to large differences in sensor sizes may be experienced, particularly in areas of high luminous intensity gradients.

3.7.4 PHOTOMETER SYSTEM CALIBRATION—The preferred method of photometric calibration is with a calibrated photometric standard lamp. When a calibrating lamp is used for the procedure, it should be calibrated using standard lamps of a high order of accuracy and be traceable to the National Bureau of Standards or other qualified laboratories, through no more than four steps. A minimum of three photometric standard lamps or calibrating lamps should be maintained by the testing laboratory. These lamps should be intercompared periodically and records of the results maintained by the laboratory.

3.8 Instrumentation Calibration—Maintenance of instrumentation accuracy is necessary for the photometric laboratory to make measurements with consistent precision. The following are recommendations of calibration intervals on various instrumentation and standards:

3.8.1 GENERAL INSTRUMENTATION—All instrumentation including voltmeters, current shunts, standard lamps, and accurate rated bulbs should be recalibrated at least annually by comparison with standards of a higher order of accuracy whose calibration is traceable to the National Bureau

of Standards or other national laboratories, or by comparison to other like calibrated instrumentation. Records of these checks should be maintained by the laboratory.

3.8.2 SENSOR/PHOTOMETER SYSTEM—The system should be checked for color response and linearity (see paragraphs 3.7.1 and 3.7.2) at least annually. Records of these checks should be maintained by the laboratory.

3.8.3 STANDARD LAMPS AND BULBS—In addition to the annual recalibration, operating time records should be kept on standard lamps, calibrating lamps, and accurate rated bulbs. Secondary and working calibrating lamps should be recalibrated or replaced at the interval recommended by the calibrating laboratory.

3.9 Environmental Variables—The following environmental variables should be controlled so that their effect on photometric measurement accuracy is minimal.

3.9.1 TEMPERATURE AND HUMIDITY—Temperature and humidity can have a significant influence on electrical and photometric measuring instrumentation. Unless special steps have been taken to negate the effects of these factors, such as temperature control (or compensation) and humidity protection on the sensors and amplifiers, the photometry test area should be maintained at a calibrated room temperature within a sufficient temperature and humidity range so as not to have a significant effect on the instrumentation. Typical acceptable tolerances are $\pm 5^\circ\text{C}$ and a maximum of 80% relative humidity. Large temperature gradients and turbulent air can cause fluctuations in luminous intensity measurements over long test distances of 20 m or more. Uniform temperatures should be maintained in long, enclosed photometric tubes or tunnels. Likewise, high concentrations of smoke or dust in the atmosphere may also influence results.

3.9.2 CONDITIONING PERIODS—Injection molded plastic optical components may tend to change dimensionally after molding. Final critical photometric measurements should be made after the parts have stabilized. Similar precautions should be taken with devices which have been exposed to extreme temperatures or humidities in shipping or storage. For maximum accuracy and repeatability, parts should be conditioned in the laboratory environment for a minimum of 24 h, immediately prior to testing.


4. References

- SAE J387—Terminology—Motor Vehicle Lighting.
- SAE J573—Lamp Bulbs and Sealed Beam Headlamp Units.
- I.E.S. Lighting Handbook, Sixth Edition, 1981, Illuminating Engineering Society.
- Journal of I.E.S., October 1971—Practical Guide to Photometry.
- Illuminating Engineering, March and April 1955—I.E.S. General Guide to Photometry.

APPENDIX A TEST FIXTURE DESIGN GUIDE

To assist the photometric laboratory in using test fixtures which control the main factors influencing the overall positioning accuracy (see paragraph 3.2.1), an example of a test fixture design is shown in Fig. A-1. Other designs, suitable for specific devices such as sealed beam units, or for multipurpose use, and sufficient to provide proper positioning accuracy, may be equally satisfactory.

INDEXING HOLES ARE NOT SHOWN IN TOP DRAWINGS.

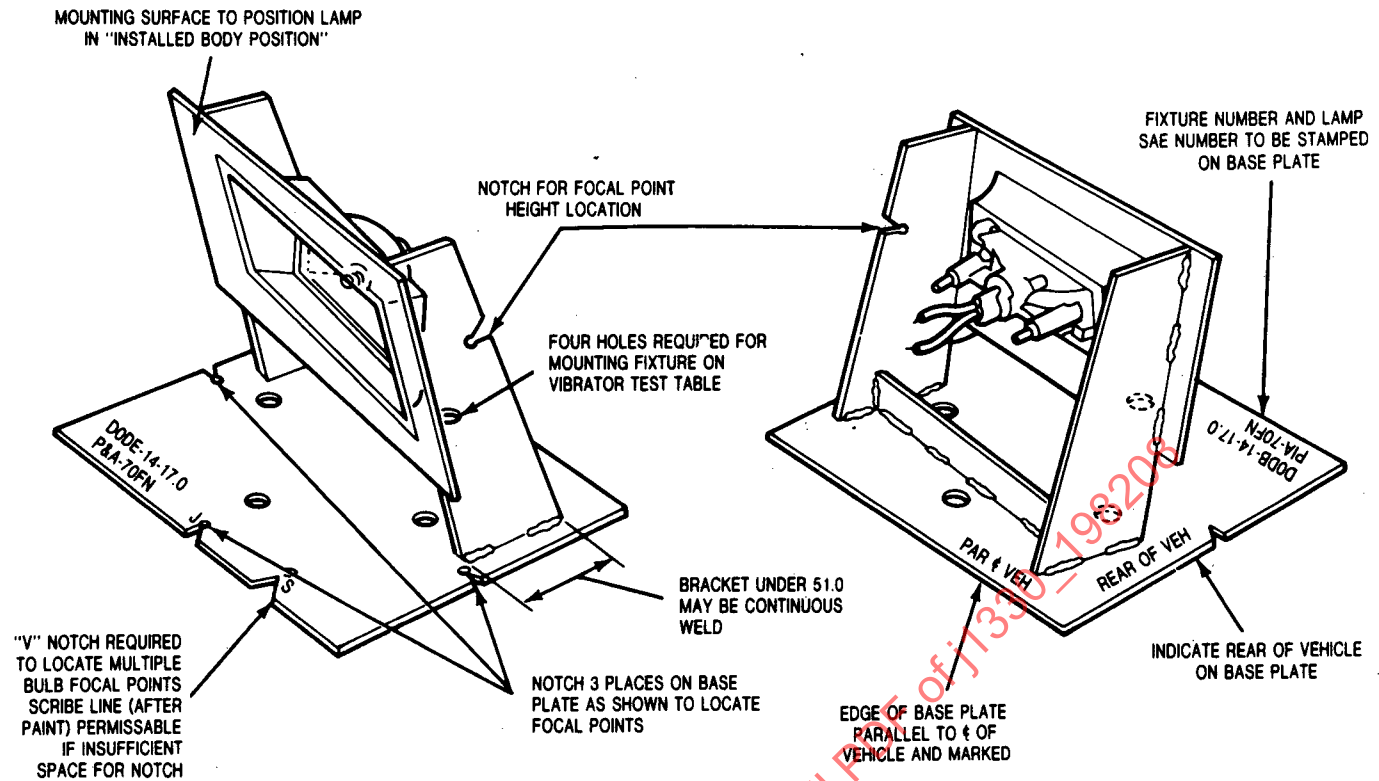

DIMENSIONS SHOWN IN mm
TOLERANCE ON DIMENSIONS TO BE 0.5 mm.

TOLERANCE BETWEEN ALL HOLES WITHIN A GROUP TO BE ± 0.25 mm.

WELD LENGTHS AND SPACINGS SHOULD BE SUFFICIENT TO PROVIDE RIGIDITY AND NOT RESULT IN WARPAGE.

MATERIAL THICKNESS: BASE 3.0 mm FOR HEAD LAMP ONLY, STRUCTURE 2.5 mm

FIXTURE TO BE SUFFICIENTLY RIGID TO PREVENT DISTORTION DURING VIBRATION.

NOTE: INCLUDE OTHER LEGENDS AND DIMENSIONS AS SHOWN.

NOTE: C/L = ϕ OR CENTERLINE

VIBRATOR MOUNTING HOLES ARE NOT SHOWN IN THE BOTTOM DRAWINGS.

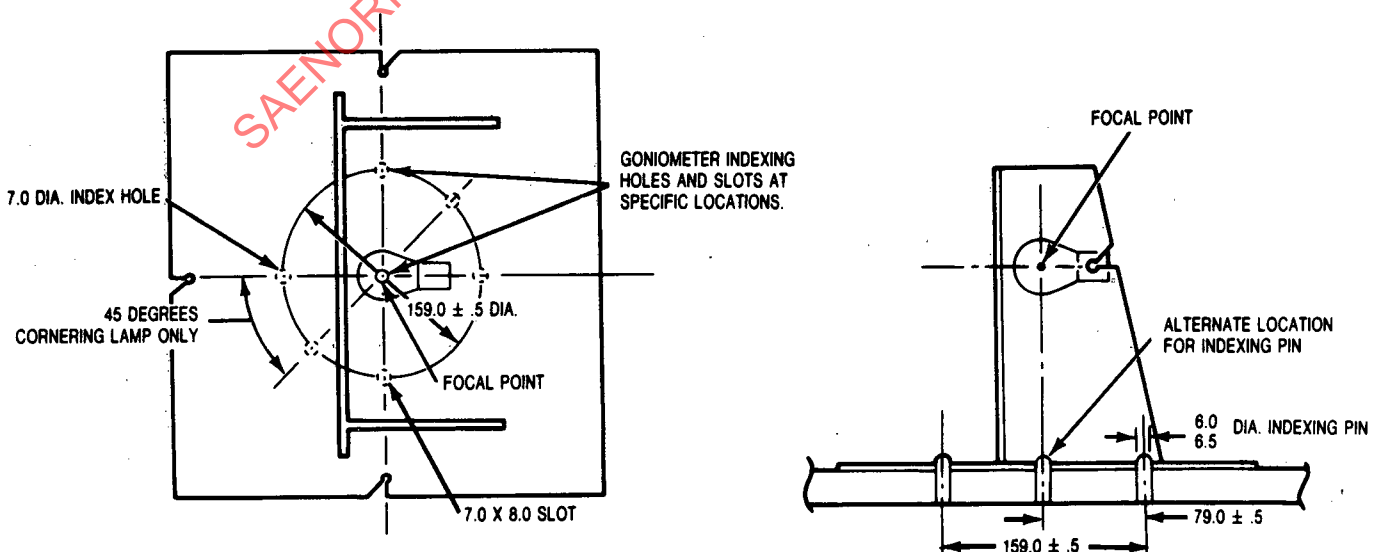


FIG. A-1—LAMP TEST FIXTURE DESIGN