

---

---

**Rubber compounding ingredients —  
Carbon black — Determination of loss  
on heating**

*Ingrédients de mélange du caoutchouc — Noir de carbone —  
Détermination de la perte à la chaleur*

STANDARDSISO.COM : Click to view the full PDF of ISO 1126:2006



**PDF disclaimer**

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 1126:2006

© ISO 2006

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
Case postale 56 • CH-1211 Geneva 20  
Tel. + 41 22 749 01 11  
Fax + 41 22 749 09 47  
E-mail [copyright@iso.org](mailto:copyright@iso.org)  
Web [www.iso.org](http://www.iso.org)

Published in Switzerland

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 1126 was prepared by Technical Committee ISO/TC 45, *Rubber and rubber products*, Subcommittee SC 3, *Raw materials (including latex) for use in the rubber industry*.

This fourth edition cancels and replaces the third (ISO 1126:1992). Two additional methods have been included: a moisture balance method and an infrared irradiation method.



# Rubber compounding ingredients — Carbon black — Determination of loss on heating

**WARNING** — Persons using this International Standard should be familiar with normal laboratory practice. This standard does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user to establish appropriate safety and health practices and to ensure compliance with any national regulatory conditions.

## 1 Scope

This International Standard specifies methods for determining the loss on heating of carbon black for use in the rubber industry. This loss on heating is due primarily to loss of moisture, but traces of other volatile materials may also be lost.

These methods are not applicable to treated carbon blacks which contain added volatile materials.

One of the following three methods is used:

- method 1: gravity-convection oven method;
- method 2: moisture balance method;
- method 3: infrared irradiation method (rapid method).

Note that method 1 is considered as the reference method. Apparatus equivalent to that specified may be used provided the same results are obtained.

## 2 Method 1: Gravity-convection oven method

### 2.1 Principle

A test portion of carbon black is heated for 1 h at a temperature 125 °C in a weighing bottle. The weighing bottle plus contents is allowed to cool in a desiccator to room temperature and weighed, and the percentage loss on heating calculated.

### 2.2 Apparatus

**2.2.1 Oven**, gravity-convection type, the temperature of which can be regulated to within  $\pm 1$  °C at 125 °C and the temperature uniformity of which is  $\pm 5$  °C or better.

**2.2.2 Weighing bottle**, squat-form, 30 mm in height and 60 mm in diameter, fitted with a ground-glass stopper.

When larger samples are required for other tests, use an open vessel of dimensions such that the depth of the black is not greater than 10 mm during conditioning.

**2.2.3 Analytical balance**, accurate to  $\pm 0,1$  mg.

#### 2.2.4 Desiccator.

### 2.3 Procedure

#### 2.3.1 Precautions

**2.3.1.1** Take the sample of carbon black in a tightly stoppered glass bottle or friction-top can. Allow the closed container to reach ambient temperature before starting the test.

**2.3.1.2** To prevent loss of carbon black due to air currents, keep the weighing bottle stoppered when transferring to and from the desiccator.

#### 2.3.2 Determination

**2.3.2.1** Dry the weighing bottle (2.2.2) and the stopper, with the stopper removed, for 30 min in the oven (2.2.1) set at 125 °C. Then place the bottle and the stopper in the desiccator (2.2.4) and allow to cool to room temperature. Weigh the bottle with stopper to the nearest 0,1 mg.

**2.3.2.2** Weigh about 2 g of carbon black to the nearest 0,1 mg into the weighing bottle.

**2.3.2.3** Place the weighing bottle, test portion and stopper in the oven (2.2.1) for 1 h at 125 °C, with the stopper removed.

**2.3.2.4** Insert the stopper and transfer the bottle and contents to the desiccator. Remove the stopper and allow to cool to ambient temperature. Re-insert the stopper in the weighing bottle and reweigh to the nearest 0,1 mg.

### 2.4 Expression of results

Calculate the loss on heating, expressed as a percentage by mass, to the nearest 0,1 % using the equation

$$H = \frac{m_1 - m_2}{m_1 - m_0} \times 100$$

where

$H$  is the loss on heating, in %;

$m_0$  is the mass, in grams, of the weighing bottle and stopper;

$m_1$  is the mass, in grams, of the weighing bottle, stopper and test portion before heating;

$m_2$  is the mass, in grams, of the weighing bottle, stopper and test portion after heating.

## 3 Method 2: Moisture balance method

### 3.1 Principle

A test portion of carbon black is heated at a temperature of not more than 125 °C and the decrease in mass measured using a moisture balance.

### 3.2 Apparatus

**3.2.1 Moisture balance**, having a sensitivity of 0,1 mg and fitted with an indirect heating source.

### 3.3 Procedure

**3.3.1** Set up the moisture balance in accordance with the manufacturer's instructions. The temperature shall not exceed 125 °C.

**3.3.2** Place approximately 2 g of carbon black into the moisture balance and determine its mass to the nearest 0,1 mg.

**3.3.3** Close the lid and start the machine.

**3.3.4** Once the mass loss, under these drying conditions, is less than 1 mg over 30 s, the test portion is considered dry and the percent mass loss shall be recorded to the nearest 0,1 %.

### 3.4 Calculation

If the test result is not displayed automatically by the instrument, calculate the percent loss on heating as follows:

$$H = \frac{A - B}{A} \times 100$$

where

$H$  is the loss on heating, in %;

$A$  is the mass, in grams, of the test portion before heating;

$B$  is the mass, in grams, of the test portion after heating.

## 4 Method 3: Infrared irradiation method (rapid method)

### 4.1 Principle

A test portion of carbon black is heated by infrared irradiation from an infrared lamp and the loss on heating measured as the decrease in mass using an infrared moisture meter.

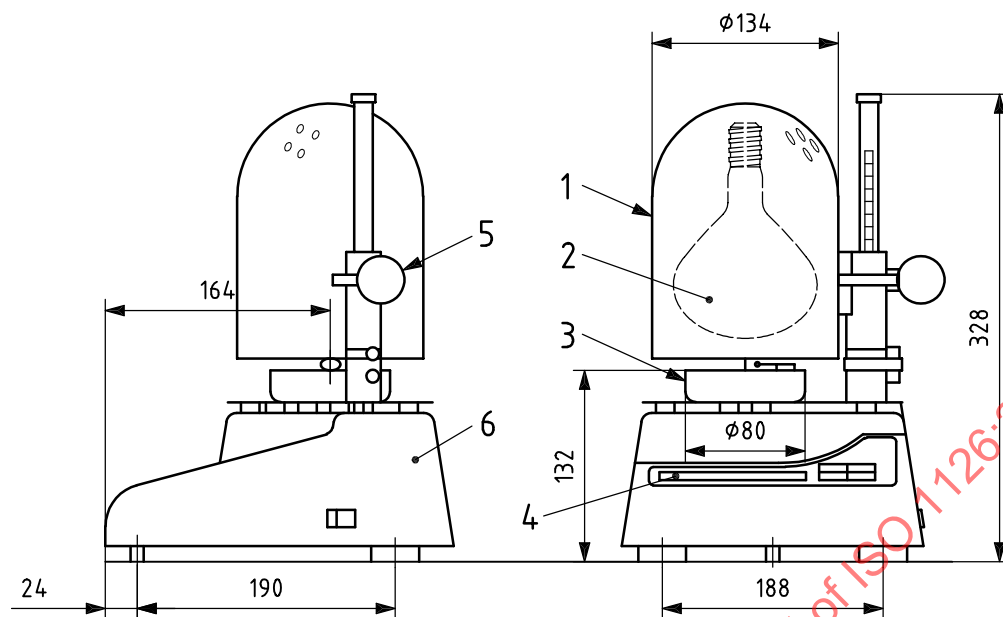
### 4.2 Apparatus

**4.2.1 Infrared moisture meter**, having a sensitivity of 1 mg.

The moisture meter shall be either a distance-adjusting-type meter using a 185 W infrared lamp or a voltage-adjusting-type meter using a 250 W infrared lamp. In either case, the meter shall be equipped with an analytical balance. Figure 1 shows an example of an infrared moisture meter.

In principle, the meter used shall have a capacity of 5 g, regardless of whether it is a distance- or voltage-adjusting-type meter. A meter of different capacity may be used provided that it offers the same accuracy as a 5 g capacity meter. When using a newly purchased meter, the calibrated scale of the meter shall be checked, either after a specific period of time or as deemed necessary.

Dimensions in millimetres

**Key**

- 1 infrared lamp hood
- 2 infrared lamp ( $\varnothing$  100 mm  $\times$  137 mm height)
- 3 sample dish
- 4 digital display
- 5 grip
- 6 moisture meter

**Figure 1 — An example of an infrared moisture meter****4.3 Procedure**

**4.3.1** Set up the moisture meter in accordance with the manufacturer's instructions.

**4.3.2** Weigh 5 g of the sample to the nearest  $\pm 0,01$  g and spread it evenly over the sample dish of the infrared moisture meter.

**4.3.3** Start the machine.

**4.3.4** The upper rim of the sample dish is set at a distance of  $75 \text{ mm} \pm 2 \text{ mm}$  from the central surface of the infrared lamp of the moisture meter. Infrared irradiation is then delivered to the sample.

**4.3.5** When the change in the meter reading falls to 0,05 % or below per minute of irradiation, record the value given after a further 2 min have elapsed. This value is taken as the loss on heating. It is expressed as a percentage.



## 5 Differences between method 2 and method 3

Table 1 — Comparison of methods 2 and 3

|                                 | Method 2                                                                                                                                                                       | Method 3                                                                                                                                                                        |
|---------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Apparatus                       | Moisture balance                                                                                                                                                               | Infrared moisture meter                                                                                                                                                         |
| Sensitivity                     | 0,1 mg                                                                                                                                                                         | 1,0 mg                                                                                                                                                                          |
| Measurement method              | Indirect heating source                                                                                                                                                        | Direct heating source<br>Distance-adjusting-type<br>Voltage-adjusting-type                                                                                                      |
| Measurement temperature         | Not to exceed 125 °C                                                                                                                                                           | —                                                                                                                                                                               |
| Mass of test portion            | About 2 g                                                                                                                                                                      | About 5 g                                                                                                                                                                       |
| Point at which reading is taken | Once the mass loss, under these drying conditions, is less than 1 mg over 30 s, the test portion is considered dry and the percent mass loss is recorded to the nearest 0,1 %. | When the change in the meter reading (loss on heating) falls to 0,05 % or below per minute of irradiation, then the value given after a further 2 min have elapsed is recorded. |
| Calculation of result           | $H = \frac{A - B}{A} \times 100$                                                                                                                                               | Automatic readout                                                                                                                                                               |

## 6 Precision

### 6.1 General

Method 1 and method 3 were compared in various laboratories using several different samples. The precision data are reported in Table 2 and Table 3.

### 6.2 Precision data for method 1 using the gravity-convection oven method (drying for 1 h at 125 °C)

Table 2 — Precision data — Loss on heating (%) by method 1

| Sample                                                                                                                                                                                                                                                                              | Mean level | Within lab |       |         | Between labs |       |         |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------|-------|---------|--------------|-------|---------|
|                                                                                                                                                                                                                                                                                     |            | $s_r$      | $r$   | ( $r$ ) | $s_R$        | $R$   | ( $R$ ) |
| A                                                                                                                                                                                                                                                                                   | 0,39       | 0,034      | 0,097 | 25,10   | 0,037        | 0,105 | 27,24   |
| B                                                                                                                                                                                                                                                                                   | 0,78       | 0,052      | 0,146 | 18,73   | 0,052        | 0,148 | 19,02   |
| C                                                                                                                                                                                                                                                                                   | 1,36       | 0,065      | 0,183 | 13,47   | 0,065        | 0,183 | 13,47   |
| D                                                                                                                                                                                                                                                                                   | 2,40       | 0,091      | 0,258 | 10,76   | 0,105        | 0,296 | 12,33   |
| E                                                                                                                                                                                                                                                                                   | 4,49       | 0,142      | 0,402 | 8,96    | 0,143        | 0,403 | 8,99    |
| Pooled                                                                                                                                                                                                                                                                              | 1,88       | 0,085      | 0,242 | 12,85   | 0,087        | 0,252 | 13,37   |
| $s_r$ = within-laboratory standard deviation;<br>$r$ = repeatability (in measurement units);<br>( $r$ ) = repeatability (in percent);<br>$s_R$ = between-laboratory standard deviation;<br>$R$ = reproducibility (in measurement units);<br>( $R$ ) = reproducibility (in percent). |            |            |       |         |              |       |         |