
**Carbon-fibre-reinforced plastics —
Determination of the size and aspect
ratio of crushed objects**

*Plastiques renforcés de fibres de carbone — Détermination des
dimensions et du rapport d'apparence d'objets broyés*

STANDARDSISO.COM : Click to view the full PDF of ISO 30012:2016



STANDARDSISO.COM : Click to view the full PDF of ISO 30012:2016



COPYRIGHT PROTECTED DOCUMENT

© ISO 2016, Published in Switzerland

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Ch. de Blandonnet 8 • CP 401
CH-1214 Vernier, Geneva, Switzerland
Tel. +41 22 749 01 11
Fax +41 22 749 09 47
copyright@iso.org
www.iso.org

Contents

	Page
Foreword	iv
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Symbols	1
5 Principle	2
6 Apparatus	2
7 Sampling	2
8 Measurement	3
8.1 General	3
8.2 Method A: Manual method (stereomicroscope)	3
8.3 Method B: Projection microscope	3
8.4 Method C: Automatic shape and size measurement apparatus	4
9 Calculation and expression of results	5
10 Precision	6
11 Test report	7

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see www.iso.org/directives).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see www.iso.org/patents).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation on the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the WTO principles in the Technical Barriers to Trade (TBT) see the following URL: [Foreword - Supplementary information](#)

The committee responsible for this document is ISO/TC 61, *Plastics*, Subcommittee SC 13, *Composites and reinforcement fibres*.

Carbon-fibre-reinforced plastics — Determination of the size and aspect ratio of crushed objects

1 Scope

This International Standard specifies test methods for measurement of the size and aspect ratio of crushed carbon-fibre-reinforced plastics (CFRP), especially for recycling purpose. In this International Standard the shape of crushed CFRP, the fragment, is treated as a rectangular shape, and the measurement of the long and short sides of the shape is described. It applies to fragments of the following average dimensions:

- length of the long side: 5 mm to 50 mm;
- width of the short side: 1 mm to 10 mm.

This International Standard provides three measuring methods, two methods are manual methods using microscope and scale and the third method is an automatic method using a measuring apparatus.

Crushed CFRP obtained from thermosetting or thermoplastic resin matrices are covered by this International Standard.

NOTE If the crushed CFRP contain a lot of small fragments and fine particle, it is intended to screen out by a sieve of 1 mm size before the measurement.

2 Normative references

The following documents, in whole or in part, are normatively referenced in this document and are indispensable for its application. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 472, *Plastics — Vocabulary*

3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 472 apply.

4 Symbols

W	width of a CFRP fragment represented by the short side of a rectangular shape
L	length of a CFRP fragment represented by the long side of a rectangular shape
$\overline{W}$	average width of CFRP fragments
$\overline{L}$	average length of CFRP fragments
R_A	aspect ratio of CFRP fragments, calculated as the ratio of the length to the width of CFRP fragment
$\sigma(L)$	standard deviation of length of CFRP fragments

$\sigma(W)$ standard deviation of width of CFRP fragments

5 Principle

The fragments obtained from crushing CFRP laminates are impartially sampled and measured.

Most fragments of CFRP have a shape that can be approximate to a rectangle. Each fragment is observed with an optical microscope or equivalent equipment and the width and length of the rectangle are measured.

At least 100 fragments are measured. The size and aspect ratio of crushed CFRP fragments are reported as average and standard deviation of W , L , and average of aspect ratio R_A .

6 Apparatus

6.1 Stereomicroscope, comprised of a light source, scales and a stage which supports a glass plate carrying the fragment of CFRP. Magnification should be variable up to 10 $\times$. Scales shall be readable to 0,1 mm. (Method A).

6.2 Projection microscope, comprised of a projector, light source, scales, and a stage which supports a slide carrying the fragment of CFRP. Magnification should be variable up to 10 $\times$. Scales shall be readable to 0,1 mm. (Method B).

NOTE A personal computer, connected to the projection microscope and with a software for measuring the length and width of the fragments enables faster and easier measurements to be made (Method B).

6.3 Automatic size and shape measurement apparatus, such as an image analyser with magnification for carrying out semi-automatic measurement of the length and width of the CFRP fragments. (Method C).

6.4 Calibrated rule or scale, used to calibrate measurement scales on microscope and projection equipment.

7 Sampling

Unless otherwise specified, the following sampling procedure shall be followed.

7.1 Crushed CFRP is sampled from a pile into a bag of 20 l to 50 l volume.

CAUTION — Use caution when handling CFRP fragments. Handling them with unprotected hands can easily result in minor irritation/injury due to CFRP slivers. Protective gloves made of impervious material should be used.

7.2 Take three samples from one bag. Avoid samples of outer locations of around 20 % of the total volume. Take three samples from inner locations impartially, e.g. upper, centre and lower locations.

NOTE Distribution of size or shape of the CFRP fragments may not be identical among locations in the bag, due to sampling or transportation causes.


7.3 Mix the three samples impartially for the measurement. The total amount of the sample shall be at least 100 fragments to be measured.

8 Measurement

8.1 General

The shape of each fragment is approximated to a rectangle circumscribing the fragment as represented in [Figure 1](#). The shape of the rectangle is defined so as to minimize the value of W .

NOTE Short fragments with length of 2 mm or shorter can be omitted from the following measurements. Total amount of the non-measured fragments can be counted and recorded in percentage.

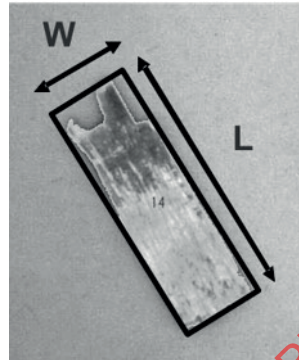

Key

L length of the fragment

W width of the fragment

Figure 1 — Length and width of the fragment of CFRP

8.2 Method A: Manual method (stereomicroscope)

8.2.1 Each fragment is arranged on the plate on the stereomicroscope. The magnification of the microscope is adjusted appropriately to the average size of the fragments.

[Figure 2 a\)](#) and [Figure 2 b\)](#) are examples of unidirectional fibre type (UD) CFRP and fabric type CFRP on the plate of microscope, respectively.

8.2.2 Calibrate the measurement scale with a calibrated ruler or scale

8.2.3 The fragment is aligned with the long side parallel to one of the scales.

8.2.4 The length of the long side of the fragment is measured as length L and the short side as width W . Measure the length and width to 0,1 mm.

8.2.5 Repeat the measurement for at least 100 fragments.

8.3 Method B: Projection microscope

8.3.1 Arrange an adequate number of fragments on the plate. Distribute fragments in order to avoid any contact or overlapping between them.


8.3.2 Set the glass plate on the stage of the microscope connected to the personal computer.

8.3.3 Calibrate the personal computer measurements using a calibrated ruler.


8.3.4 The magnification of the microscope is adjusted appropriately to the average size of the fragments.

8.3.5 The observed fragments are projected on the monitor. Measure the length L and the width W of the fragment to 0,1 mm.

8.3.6 Repeat the measurement for at least 100 fragments.

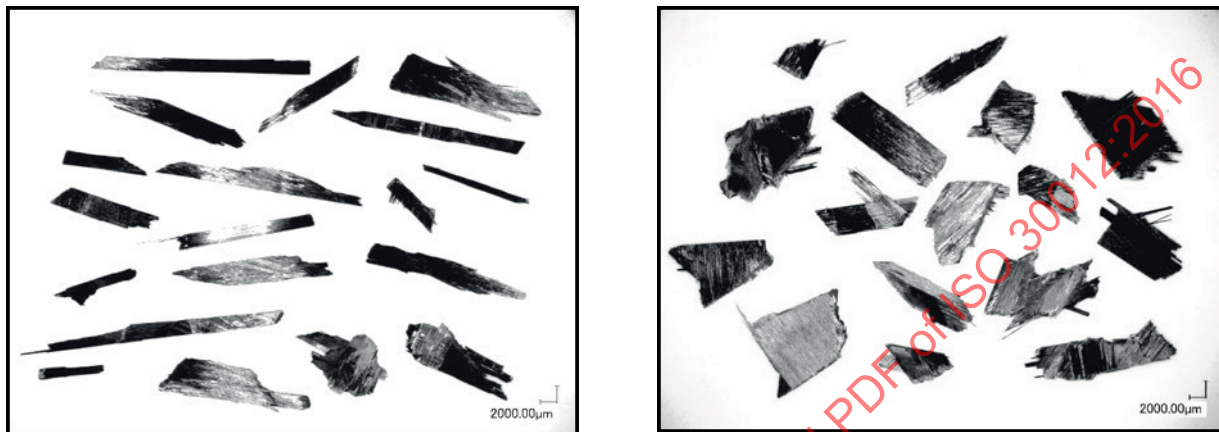

a) Examples of crushed UD type CFRP

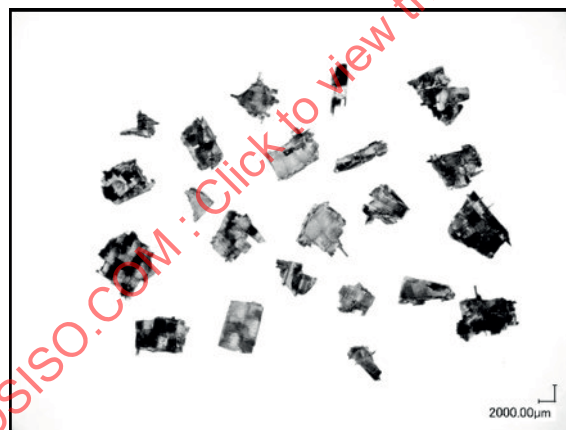

b) Example of crushed fabric type CFRP

Figure 2 — Examples of crushed CFRP fragments on the plate of the microscope

8.4 Method C: Automatic shape and size measurement apparatus

8.4.1 Arrange an adequate number of fragments on the stage of the apparatus. Distribute fragments in order to avoid any contact or overlapping between them.

8.4.2 The observed fragments are projected on the monitor.

8.4.3 All CFRP fragments are approximated as a rectangular shape by the construction lines shown in [Figure 3](#). The length L and width W of each fragment is measured to 0,1 mm, and recorded automatically.

8.4.4 Repeat the measurement for at least 100 fragments.

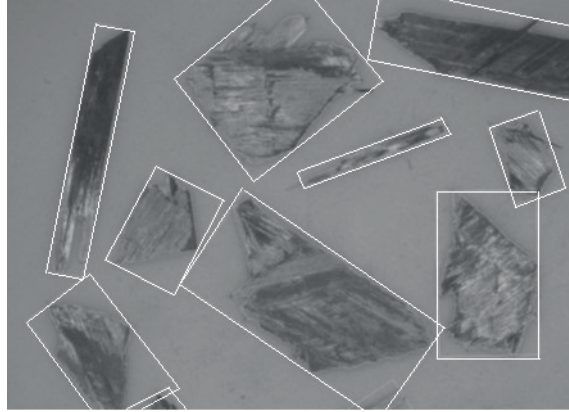


Figure 3 — Example of crushed CFRP fragments, approximated as rectangular shapes (shown by the lines) for method C

9 Calculation and expression of results

9.1 The average length, $\bar{L}$, and the average width, $\bar{W}$, of fragments are calculated using Formula (1) and Formula (2), respectively:

$$\bar{L} = \frac{\sum L_n}{N} \quad (n = 1 \text{ to } N) \quad (1)$$

$$\bar{W} = \frac{\sum W_n}{N} \quad (n = 1 \text{ to } N) \quad (2)$$

where

$\bar{L}$ is the average length of fragments;

$\bar{W}$ is the average width of fragments;

n is the measurement number;

N is the total number of fragments assessed;

L_n is the measurement length of the n -th fragment;

W_n is the measurement width of the n -th fragment.

NOTE Log or Log natural of $\bar{L}$ or $\bar{W}$ can be used instead of the measured data.

9.2 The standard deviation $\sigma(L)$ and $\sigma(W)$ of length L and width W of fragments are calculated using Formula (3) and Formula (4), respectively: