
**Rubber — Measurement of
vulcanization characteristics using
curemeters —**

**Part 3:
Rotorless curemeter**

*Caoutchouc — Mesure des caractéristiques de vulcanisation à l'aide
de rhéomètres —*

Partie 3: Rhéomètre sans rotor



STANDARDSISO.COM : Click to view the full PDF of ISO 6502-3:2018



COPYRIGHT PROTECTED DOCUMENT

© ISO 2018

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
CP 401 • Ch. de Blandonnet 8
CH-1214 Vernier, Geneva
Phone: +41 22 749 01 11
Fax: +41 22 749 09 47
Email: copyright@iso.org
Website: www.iso.org

Published in Switzerland

Contents

	Page
Foreword	iv
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Principle	1
5 Apparatus	2
5.1 General	2
5.2 Dies	6
5.2.1 Seal plate	7
5.2.2 Seal	7
5.3 Die closure	7
5.4 Oscillation system	8
5.5 Torque-measuring system	8
5.6 Protective films	8
5.7 Heating and temperature control	8
6 Calibration	9
7 Test piece	9
8 Vulcanization temperature	9
9 Conditioning	9
10 Procedure	9
10.1 Preparation for test	9
10.2 Loading the curemeter	10
11 Expression of results	10
11.1 General	10
11.2 Torque values	10
11.3 Scorch time	10
11.4 Time to a percentage of full cure	10
11.5 Cure rate index	11
12 Precision	11
13 Test report	11
Annex A (normative) Calibration schedule	12
Annex B (informative) Practical examples of calibration for the various curemeters	14
Annex C (informative) Precision	17
Bibliography	20

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see www.iso.org/directives).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see www.iso.org/patents).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT) see the following URL: www.iso.org/iso/foreword.html.

This document was prepared by Technical Committee ISO/TC 45, *Rubber and rubber products*, Subcommittee SC 2, *Testing and analysis*.

A list of all parts in the ISO 6502 series can be found on the ISO website.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at www.iso.org/members.html.

Rubber — Measurement of vulcanization characteristics using curemeters —

Part 3: Rotorless curemeter

WARNING 1 — Persons using this document should be familiar with normal laboratory practice. This document does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user to establish appropriate safety and health practices and to determine applicability of any other restrictions.

WARNING 2 — Certain procedures specified in this document might involve the use or generation of substances, or the generation of waste, that could constitute a local environmental hazard. Reference should be made to appropriate documentation on safe handling and disposal after use.

1 Scope

This document specifies a method for determining selected vulcanization characteristics of a rubber compound by means of a rotorless curemeter. The introduction to the use of curemeters is given in ISO 6502-1.

2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 6502-1:2018, *Rubber — Measurement of vulcanization characteristics using curemeters — Part 1: Introduction*

ISO 18899:2013, *Rubber — Guide to the calibration of test equipment*

3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 6502-1 apply.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <https://www.iso.org/obp>
- IEC Electropedia: available at <http://www.electropedia.org/>

4 Principle

A test piece of rubber is placed in a heated cavity formed by two dies, one of which is oscillated at a given frequency and amplitude. This action exerts a shear strain on the test piece and a shear torque which depends on the stiffness (shear modulus) of the rubber. The torque that increases as vulcanization proceeds is measured by a torque sensor incorporated in the other die member. The torque is recorded autographically as a function of time.

The stiffness of the rubber test piece increases as vulcanization proceeds. The curve is complete when the recorded torque rises either to an equilibrium value or to a maximum value (see ISO 6502-1). If the

torque continues to increase, vulcanization is considered to be complete after a given time. The time required to obtain a vulcanization curve is a function of the test temperature and the characteristics of the rubber compound.

The vulcanization characteristics are obtained from the recorded curve of torque as a function of time, in accordance with ISO 6502-1.

5 Apparatus

5.1 General

A rotorless curemeter consists of two dies that are heated and closed or almost closed, under a specified force, to form a test cavity that contains a test piece. One of the dies oscillates, and reaction torque on the stationary die, which is opposite to the moving die, can be measured at specified conditions of temperature, frequency and amplitude.

There are two types of assembly surrounding the test cavity formed by the upper and lower dies, one is unsealed or open type, and the other is sealed type. In the case of a sealed type die system, the die cavity is surrounded by seal plates and seal rings, and is completely closed. In the unsealed type the cavity is not completely closed.


Two kinds of cavity shape formed by the dies are used, namely, a biconical shape and a flat plate shape.

Three types of curemeter with different combination of sealing type and die cavity shape are available:

- a) biconical die cavity with unsealed system,
- b) biconical die cavity with sealed system, or
- c) flat plate die cavity (with sealed system).

The general arrangements for rotorless curemeters are shown in [Figure 1](#), [Figure 2](#) and [Figure 3](#), including typical machine dimensions.

Curemeters with different design might result in different torque responses and cure time (see ISO 6502-1:2018, A.2).

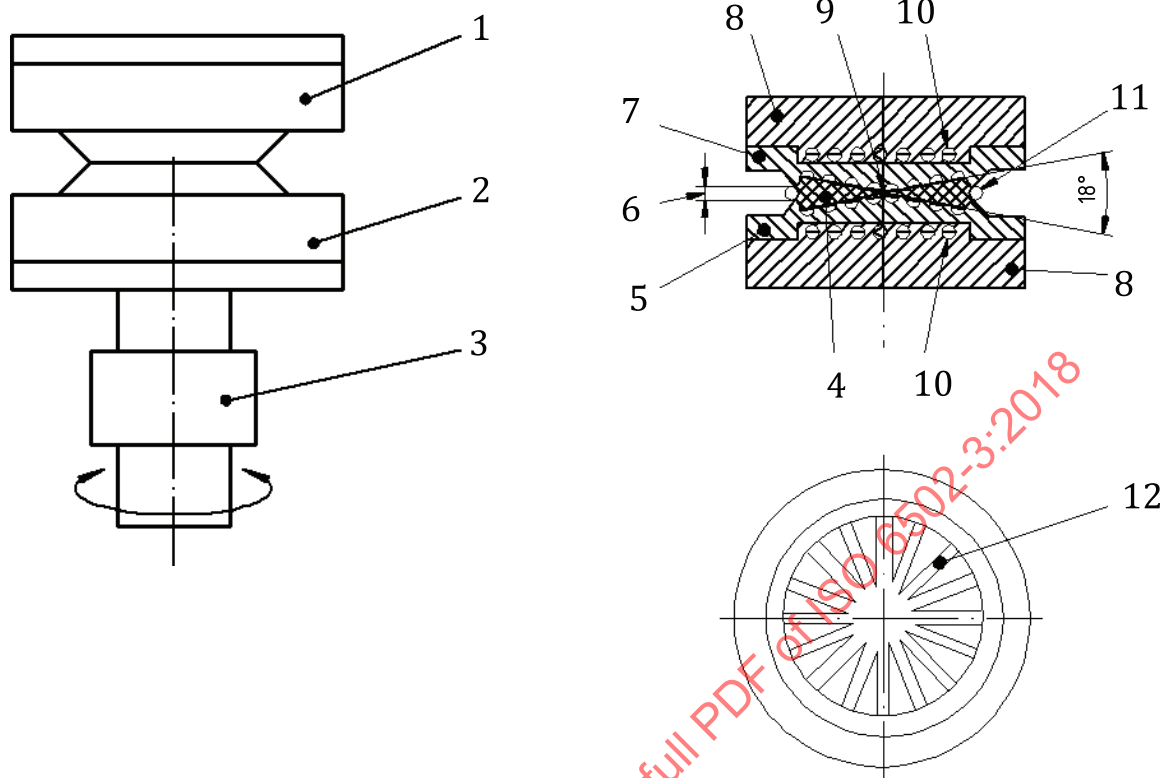


Key


- | | | | |
|---|-------------------------|----|--------------------|
| 1 | fixed die | 7 | upper die |
| 2 | oscillating die | 8 | temperature sensor |
| 3 | torque-measuring system | 9 | die gap |
| 4 | test piece | 10 | heater |
| 5 | lower die | 11 | spew |
| 6 | die gap | 12 | grooves |

Figure 1 — Typical unsealed torsion-shear rotorless curemeter with biconical-die cavity

Dimensions in millimetres

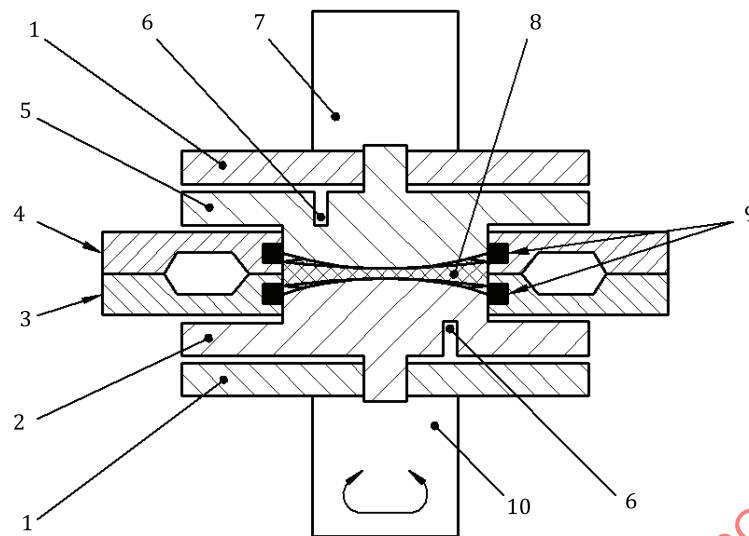

a) Measurement principle

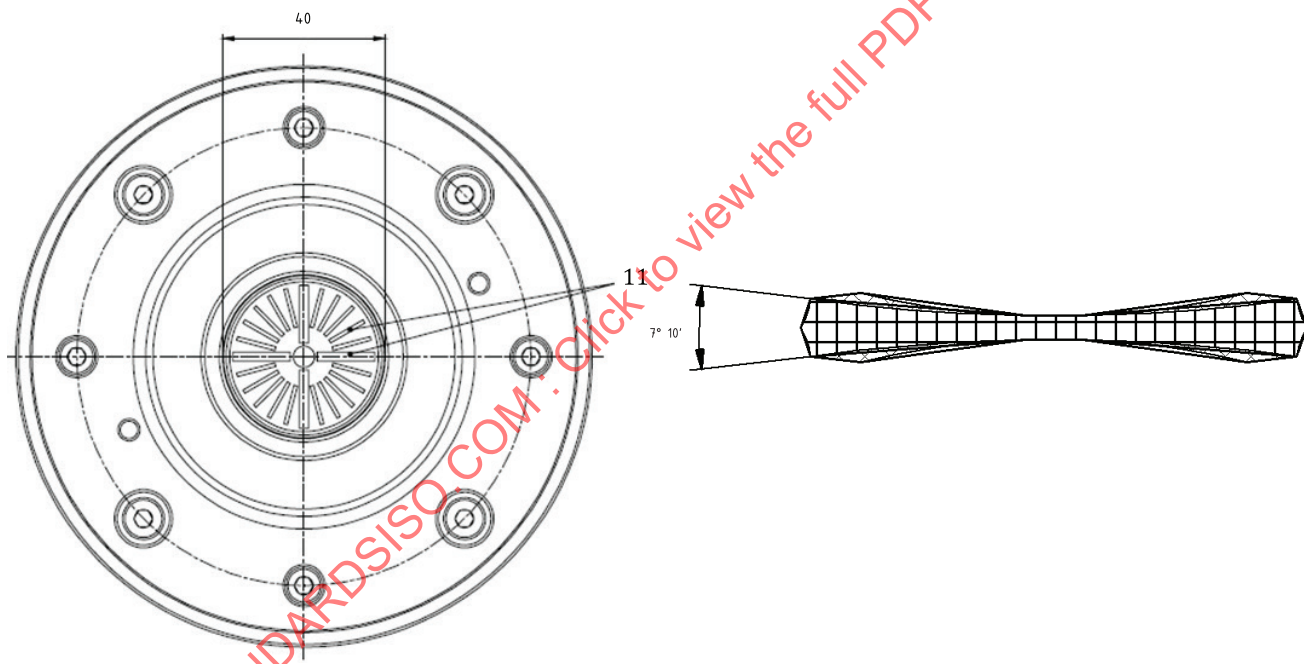

b) Die (upper and lower)


c) Test piece

Key

- | | | | |
|---|--------------------|----|--------------------------|
| 1 | heater | 7 | torque-measuring system |
| 2 | lower die | 8 | test piece |
| 3 | lower seal plate | 9 | seals |
| 4 | upper seal plate | 10 | oscillating-drive system |
| 5 | upper die | 11 | grooves |
| 6 | temperature sensor | | |

Figure 2 — Typical sealed torsion-shear rotorless curemeter with biconical-die cavity



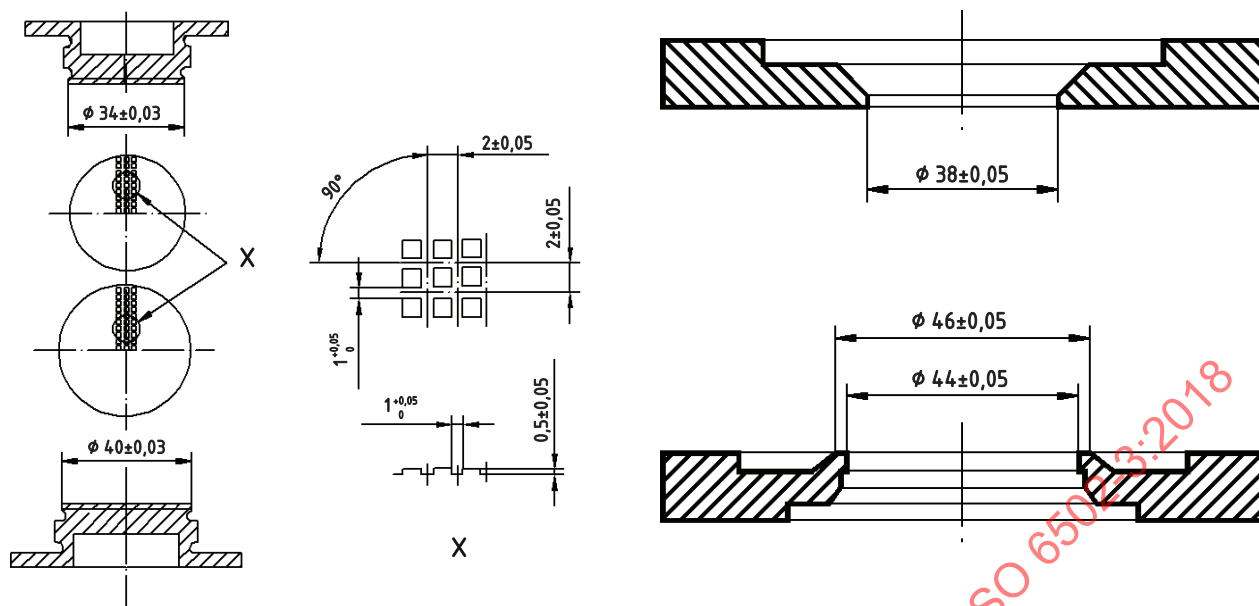

c) Shapes and dimensions of dies and seal plates

Key

- | | | | |
|---|---|----|------------------|
| 1 | shaft of torque-measuring system | 10 | lower die |
| 2 | temperature sensor | 11 | drive shaft |
| 3 | heater | 12 | upper seal plate |
| 4 | upper die | 13 | upper die |
| 5 | upper seal | 14 | upper seal |
| 6 | upper seal plate | 15 | lower seal |
| 7 | platen | 16 | lower die |
| 8 | lower seal plate | 17 | lower seal plate |
| 9 | lower seal | | |
| a | 0±0,1 means that the difference between the bottom level of both parts (right and left) shall be within 0,1 mm. | | |

Figure 3 — Typical sealed torsion-shear rotorless curemeter with flat-plate-die cavity**5.2 Dies**

The dies shall be manufactured from a non-deforming, high stiffness and low thermal expansion material to minimize system compliance and prevent gap changes with temperature. The surface of the dies shall be treated to minimize the effect of test piece contamination if protective or carrying film are not used and shall be hard enough to prevent wear. A minimum Rockwell hardness of 50 HRC, or equivalent, is recommended.

A die cavity is formed with a fixed lower die and a vertically-moving upper die, and the shape of the die cavity shall be biconical or flat-plate.

- A biconical die cavity is formed by two conically shaped dies with angle of separation ranging from 7° to 18°. The spacing between both dies facing each other differs by the distance on the periphery than the centre so as to be minimum at the central point, to increase toward the outer side from the central point.
- A flat plate die cavity is disc-shaped. It has same spacing all over the cavity.

Biconical dies are designed to provide a constant shear strain throughout the entire test piece, while flat plate dies give uniform temperature distribution in the test piece.

The top and bottom surfaces of the cavity shall have a pattern of grooves to prevent slippage of the rubber test piece. For the biconical type dies, radial grooves, for the flat plate type dies, checkered pattern grooves are recommended.

Suitable means shall be employed by design of dies or otherwise to apply pressure to the test piece.

The typical dimensions for the die cavity are shown in [Table 1](#). The tolerances necessary on the dimensions of the dies depend on the particular design.

The dimensions of the die cavity can be checked by measuring the dimensions of the vulcanized test piece. For biconical type dies, particular attention should be paid to the thin central portion, the thickness of which depends on the die gap.

Table 1 — Typical dimensions of die cavity

	Biconical cavity		Flat-plate cavity
Diameter	40 mm ± 2 mm		44,00 mm ± 0,05 mm
Height	Angle of separation ranging from 7° to 18° In the centre of the dies, a separation equal to 0,5 mm plus the die gap		2,00 mm ± 0,03 mm
Die gap ^a	Unsealed type	Sealed type	Level differences between die and seal plate ^b Upper : 0,0 mm ± 0,1 mm Lower : 2,0 mm ± 0,1 mm
	0,05 mm to 0,20 mm, preferably 0,1 mm	No gap	
Grooves	Radial grooves at 20° intervals	Radial grooves at 18° to 22,5° intervals	In a criss-cross pattern 16 grooves on the upper die 19 grooves on the lower die
^a The gap between the edges of the dies in the closed position.			
^b A level difference between the surfaces of the upper die and of the upper seal plate, or lower die and lower seal plate.			

5.2.1 Seal plate

For sealed type (biconical cavity or flat plate cavity) die systems, seal plates shall be provided around the upper and lower dies. The seal plates shall be fabricated from sufficiently rigid and abrasion resistant material. A minimum Rockwell hardness of 50 HRC, or equivalent, is recommended.

5.2.2 Seal

The sealed type (biconical cavity or flat plate cavity) curemeter shall have suitable low constant friction seals to prevent material leaking from the cavity. The material shall have adequate flexibility, high resistance to the test temperature and to wear. O-rings made from fluororubber, silicone rubber or tetrafluoroethylene resin are recommended.

The seals should be replaced periodically to prevent a lowering of the torque measuring accuracy or leakage of test piece by thermal degradation.

5.3 Die closure

The dies shall be held closed during the test by, for example, pneumatic cylinder.

The closing force shall be maintained at 7 kN to 8 kN for dies of a biconical cavity and 7,0 kN ± 0,5 kN for flat plate dies.

For sealed cavities, the contact of the die cavity edges shall be such as to form a perfectly sealed cavity.

NOTE For checking the sealing condition, place a piece of soft tissue paper not thicker than 0,04 mm between the mating surfaces and see if continuous pattern of uniform intensity is obtained when the dies are closed. A non-uniform pattern indicates incorrect adjustment of the die closure, worn or faulty mating surfaces, or distortion of the dies. Any of these conditions might result in leakage and erroneous results.

In unsealed rotorless instruments, the dies are not completely closed but a small clearance is left which shall be between 0,05 mm and 0,2 mm, preferably 0,1 mm.

5.4 Oscillation system

A torsional oscillating movement shall be applied to one of the dies (typically the lower one in the cavity).

The frequency of the rotary oscillation shall be $1,7 \text{ Hz} \pm 0,1 \text{ Hz}$ except for particular purposes when other frequencies in the range of 0,05 Hz to 2,00 Hz may be used.

The range of oscillation amplitude shall be between $\pm 0,1^\circ$ and $\pm 2,0^\circ$, for routine control purposes $\pm 0,5^\circ$ or $\pm 1,0^\circ$ are preferable. The tolerance on amplitude shall be $\pm 2 \%$, and the drive shall be sufficiently powerful and stiff to substantially maintain the amplitude under load.

NOTE Generally, greater sensitivity can be obtained with larger amplitudes, but the amplitude that can be used in practice is restricted by the possibility of slippage between the test piece and the die surface.

When a torque is applied between the upper and lower dies, the resulting angular amplitude of oscillation decreases with increasing torque. For a flat plate type machine, the decrement of amplitude shall be a linear function having a slope of less than $0,01^\circ/\text{N}\cdot\text{m}$.

5.5 Torque-measuring system

A suitable transducer which is capable of measuring the torque with an accuracy of $\pm 1 \%$ of the torque range shall be provided. This tolerance shall include any errors due to deformation of the measuring device and its coupling and of the output device.

A recorder shall be provided to continuously monitor the torque. It shall have a response time for full-scale deflection of 1 s or less. Automatic data acquisition and processing equipment is strongly recommended.

5.6 Protective films

One or more layers of protective film (approximately 0,025 mm thick) may be inserted between the test piece and the dies.

Film introduction can be useful to avoid frequent cavity cleaning, since material remaining in the die cavity can influence the test results.

The film shall not react with the test pieces. However, the presence of films might affect the test results, so if they are used, their specification (material, maximum temperature of use, thickness, stiffness) shall be reported.

NOTE Materials that have been found suitable include, for example, cellophane, polyester, nylon, high-density polyethylene (at 100°C only), plain, uncoated fabric, and similar materials.

5.7 Heating and temperature control

Both dies are mounted on, or formed part of platens equipped with a heating device capable of maintaining the temperature of the dies to an accuracy of $\pm 0,3^\circ\text{C}$ for the test duration.

The temperature-measuring system shall enable the temperature of the dies to be measured to a resolution of $0,1^\circ\text{C}$ over the range of 100°C to 200°C . Temperature sensors shall be provided in both the upper and lower dies and located for the best possible heat contact with the dies, i.e. heat gaps and other heat resistance shall be excluded.

After insertion of a test piece at $23^\circ\text{C} \pm 5^\circ\text{C}$, the temperature of the dies shall recover to within $0,3^\circ\text{C}$ of the test temperature within 3 min for biconical-die rotorless instruments.

For flat-plate-die rotorless instruments, the recovery range shall be ± 1 °C within 1,5 min at the test temperature of 150 °C.

6 Calibration

The test apparatus shall be calibrated in accordance with the schedule given in [Annex A](#).

Where available, the procedures for calibration shall be in accordance with the manufacturer's instructions. The torque shall be determined at several points over the range(s) used but, additionally, it can be useful to have provision to make in-use checks.

Some practical examples of the calibration methods for torque and oscillation amplitude are described in [Annex B](#).

Stable rubber reference compounds can also be tested periodically to check for consistent performance.

7 Test piece

Test pieces with appropriate thickness should be cut from a rubber sheet. The sheet shall be homogeneous and, as far as possible, free from trapped air.

The test piece should be circular with a diameter slightly smaller than the die cavity. The volume of test piece shall be slightly larger than the die cavity volume (typically 130 % to 150 % larger) so that a small amount of material is extruded between all edges of the dies when they are closed. Typical volume of test piece is between 3 cm³ and 6 cm³ for a biconical cavity, and approximately 5 cm³ for a flat plate cavity. The pertinent volume shall be determined by preliminary tests, and test pieces of equal volume should be used to obtain reproducible results. The use of an appropriate device which ensures the production of test pieces of constant volume is recommended.

NOTE Undersized test pieces can cause low cavity pressure and low torque readings. Oversize test pieces might cool the cavity excessively during the early part of the test cycle.

8 Vulcanization temperature

The vulcanization temperature is chosen as that appropriate for the rubber compound being tested and intended processing. The normal range is 100 °C to 200 °C.

The tolerances on the vulcanization temperature shall be $\pm 0,3$ °C.

9 Conditioning

The test piece shall be conditioned at $23 \text{ °C} \pm 5 \text{ °C}$, for a minimum of 3 h before testing. The test pieces cut from conditioned test samples may be tested immediately.

10 Procedure

10.1 Preparation for test

The temperature of both dies shall be brought to the test temperature with the cavity closed and allowed to stabilize. Bring the temperature of both dies to the curing temperature, with the cavity closed.

Adjust the recorder pen to the zero-torque line on the chart. Position the pen at the zero-time position on the chart. Calibrate the recorder.

10.2 Loading the curemeter

The loading of the test piece and the closure of the dies shall be carried out as quickly as possible. The dies shall be closed immediately after insertion of the test piece. The whole cycle, from opening to closure, shall not exceed 20 s.

The vulcanization time shall be counted from the instant the dies are fully closed. Oscillation of the movable die shall be started before or at the instant of die closure.

After removal of the cured tested piece, a further test piece may be inserted immediately if the temperature of the dies remains within $\pm 0,3$ °C of the set value. If not, the dies shall be closed and the temperature be allowed to recover to the set value.

For low viscosity or sticky materials, a piece of protective film may be inserted between the test piece and the die surface for prevention of contamination and easy removal after the test. For biconical-die roterless curemeters of the sealed-cavity type, the use of protective film is strongly recommended.

If film layers are not used, a deposit of material from the rubber compound can build up on the dies which might affect the final torque values. It is suggested that reference compounds be tested daily to detect this occurrence. If such contamination develops, it can be removed by very light blasting with a mild abrasive, ultrasonic cleaning or non-corrosive cleaning fluids. Great care should be taken with cleaning, and the manufacturer's advice followed. If fluids are used, the first two tests after cleaning shall be rejected. Running a natural rubber gum compound can be used to remove debris.

11 Expression of results

11.1 General

In accordance with ISO 6502-1, all or some of the cure characteristics indicated in 11.2 to 11.5 that are required for the purpose of the test shall be taken from the cure curve.

11.2 Torque values

- M_L : minimum torque, in N·m
- M_{HF} : plateau torque, in N·m
- M_{HR} : maximum torque (reverting curve), in N·m
- M_H : highest torque value attained, in N·m, in a curve where no plateau or maximum value is obtained after the specified time

11.3 Scorch time

The scorch time t_{sx} is the time required for the torque to increase by x units from M_L . A suitable value of x should be defined depending on the instrument used. A typical example for a biconical cavity curemeter is 0,1 N·m at $\pm 0,5^\circ$ of oscillation amplitude, or in the case of a flat-plate cavity type, 0,04 N·m at $\pm 1^\circ$ of amplitude.

11.4 Time to a percentage of full cure

The time to a percentage of full cure from minimum torque, $t'_c(y)$ is the time taken for the torque to reach from M_L to $M_L + 0,01y(M_H - M_L)$.

- $t'_c(10)$ is a measure of the early stages of cure.
- $t'_c(50)$ can be determined accurately provided that the slope of the curve is greatest at this point.

11.5 Cure rate index

The cure rate index is the average slope of the rising curve and is given by $100/[t_c(y) - t_{sx}]$.

12 Precision

See [Annex C](#).

13 Test report

The test report shall include the following information:

- a) sample details:
 - 1) full description of the sample and its origin;
 - 2) details of the compound tested;
- b) test method:
 - 1) a full reference to the test method used, i.e. the number of this document (ISO 6502-3:2018);
 - 2) details of the curemeter used;
- c) test details:
 - 1) the nominal amplitude of oscillation, reported as half the total displacement, i.e. 1° for a total displacement of 2°;
 - 2) the frequency of oscillation, in Hertz;
 - 3) the vulcanization temperature, in degrees Celsius;
 - 4) details of any film layers used;
- d) test results:
 - 1) the recorded vulcanization curve with torque and time scales indicated, if required;
 - 2) the values of the parameters obtained from the vulcanization curve, as required;
- e) date(s) of the test.

Annex A (normative)

Calibration schedule

A.1 Inspection

Before any calibration is undertaken, the condition of the items to be calibrated shall be ascertained by inspection and recorded on any calibration report or certificate. It shall be reported whether calibration is carried out in the “as-received” condition or after rectification of any abnormality or fault.

It shall be ascertained that the apparatus is generally fit for the intended purpose, including any parameters specified as approximate and for which the apparatus does not therefore need to be formally calibrated. If such parameters are liable to change, then the need for periodic checks shall be written into the detailed calibration procedures.

A.2 Schedule

Verification/calibration of the test apparatus is a mandatory part of this document. However, the frequency of calibration and the procedures used are, unless otherwise stated, at the discretion of the individual laboratory, using ISO 18899 for guidance.

The calibration schedule given in [Table A.1](#) has been compiled by listing all of the parameters specified in the test method, together with the specified requirement. A parameter and requirement can relate to the main test apparatus, to part of that apparatus or to an ancillary apparatus necessary for the test.

For each parameter, a calibration procedure is indicated by reference to ISO 18899, to another publication or to a procedure particular to the test method which is detailed (whenever a calibration procedure which is more specific or detailed than that in ISO 18899 is available, it shall be used in preference).

The verification frequency for each parameter is given by a code-letter. The code-letters used in the calibration schedule are:

- N initial verification only;
- S standard interval as advised in ISO 18899.

Table A.1 — Calibration frequency schedule

Parameter	Requirement	Subclause in ISO 18899: 2013	Verification frequency guide	Notes
Surface hardness of the dies	≥ 50 HRC or equivalent		N	See ISO 6508-1
Dimensions of the dies	± 2 %	15.2	S	
Die grooves	See Figures 1, 2 and 3		S	
Die gap	See Table 1		S	
Die closing force	Biconical cavity: 7 kN to 8 kN Flat-plate cavity: 7,0 kN $\pm$ 0,5 kN	21.3	S	
Tolerance on oscillation frequency	$\pm 0,1$ Hz	23.3	S	
Tolerance on oscillation amplitude	± 2 %		S	
Temperature resolution	$\pm 0,1$ °C	18	N	
Temperature accuracy	$\pm 0,3$ °C	18	S	
Temperature stability at steady-state	Within $\pm 0,3$ °C	18	S	
Torque transducer accuracy	± 1 %	21.4	S	

In addition to the items listed in [Table A.1](#), use of the following is implied, all of which shall be calibrated in accordance with ISO 18899:

- instruments for determining the dimensions of the dies;
- a load cell for checking the die-closing force;
- a thermometer for monitoring the conditioning.


Annex B (informative)

Practical examples of calibration for the various curemeters

B.1 Examples of calibration for torque

B.1.1 Wire-mass method


A calibration pulley is fitted instead of the upper die, a wire is fastened to the pulley and load is applied to the pulley by a weight attached to the other end of the wire. [Figure B.1](#) provides an example of calibration for biconical die, and [Figure B.2](#) provides an example for flat plate die.

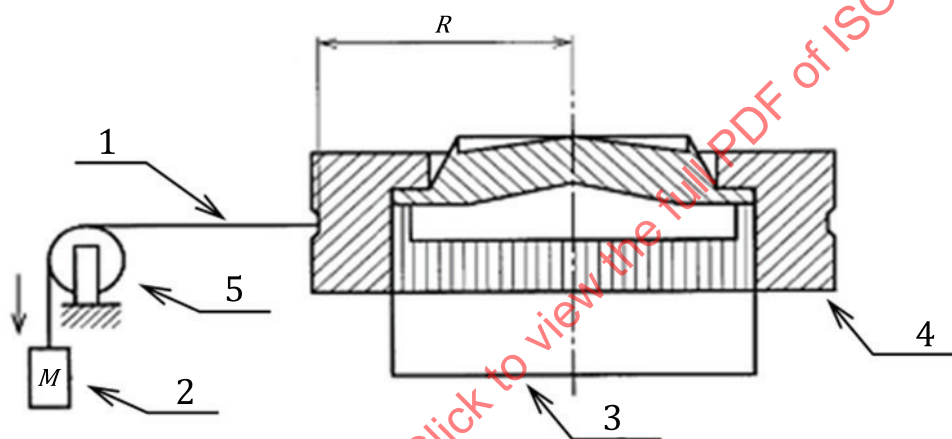

Key

- 1 wire
- 2 weight
- 3 torque measuring system
- 4 calibration pulley
- 5 pulley

Figure B.1 — Biconical die

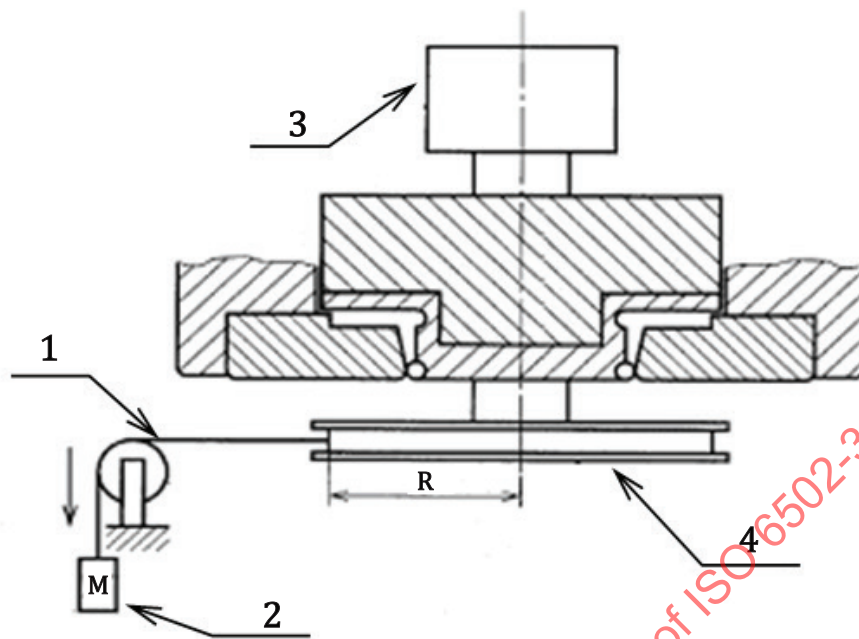

Key

- 1 wire
- 2 weight
- 3 torque measuring system
- 4 calibration pulley

Figure B.2 — Flat plate die

The torque T can be calculated using the following equation:

$$T = R \times M \times g$$

where


- R is effective radius of the pulley;
- M is mass of the weight;
- g is the gravitational acceleration.

B.1.2 Torsional spring rod method

A standard spring rod can be used to calibrate the torque measuring system. The standard spring rod is installed between the oscillating die and the torque measuring dies, and checks the torque measurement at the selected angular displacement.

B.2 Oscillation angle

A calibration rod is fixed to the oscillation driving unit, and a displacement transducer is coupled by a knife-edge bearing in contact with the rod. The calibration is carried out without inserting a test piece. Figure B.3 provides an example of calibration for oscillation angles.

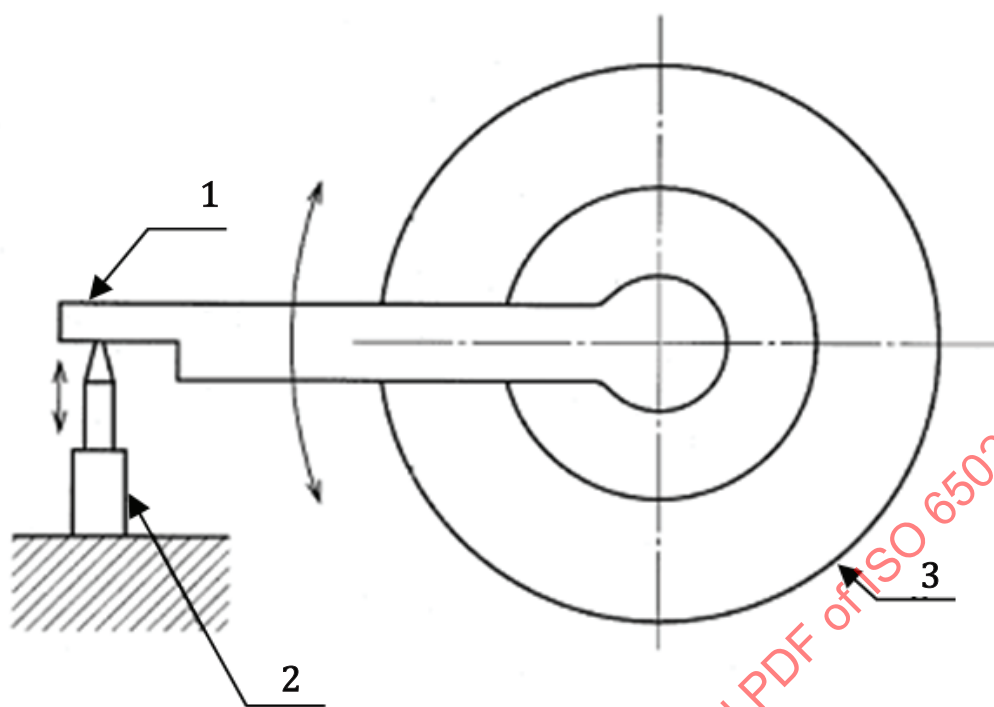

Key

- 1 calibration arm
- 2 displacement gauge
- 3 lower die

Figure B.3 — Example of calibration for oscillation angles